



Expertise

Protocol number: 46905288
Order No. / Reference: 26847842
Inspection date: 4 Aug 2026

Manufacturer: Ford

Model: Kuga 2.5 Duratec FHEV 4x4 TITANIUM X

VIN: WF0FXXWPMHPK45253



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Kuga 2.5 Duratec FHEV 4x4 TITANIUM X	
Vehicle Identification number	WF0FXXWPMHPK45253
Mileage (Read)	94,728 km
First registration	15 Jun 2023
Number of holders	1
Next periodical technical inspection	06/2028
(Report on hand)	
Fuel type	Hybrid Petrol / E
Engine displacement / Cylinder	2,488 ccm / 4
Power	112 kW
Gearbox / Number of gears	Automatic / 1
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Frozen White
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Anthracite-Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	18 %
Last service on / at	05/2025 at 58,966 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT876910
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BUR 00047		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,280 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/65 R17 106V	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	225/65 R17 106V	Summer tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/65 R17 102H	Winter tyres on Light alloy	Goodyear	4mm / 4mm
2)	225/65 R17 102H	Winter tyres on Light alloy	Goodyear	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Acoustic Vehicle Alerting System (AVAS)
- Ambient lighting at the front
- Electrically adjustable, heated and folding exterior mirrors (painted in body color - with integrated turn signals and ambient lighting)
- Tires: Tire repair kit (maximum speed 80 km/h when used)
- Fabric headliner
- Roof spoiler (painted in car color)
- Tachometer
- Selective driving mode switch (5 driving modes to choose from: Normal, Sport, Eco, Slippery and Unpaved Roads)
- Electric front and rear windows with all-around closing function
- Ford EcoCoach (shows the efficiency of current driving behavior)
- Ford Power Start function & Ford Key Free system (keyless locking/unlocking)
- FordPass Connect including eCall, Live Traffic information (information about the current status or location of the vehicle, as well as control of selected vehicle functions via a compatible smartphone with the FordPass app - Real-time traffic information)
- Illuminated glove compartment
- Heated rear window
- rear window wiper
- Intelligent Protection System (IPS) (front airbag for driver and front passenger - front and rear head and shoulder airbags - side airbag for driver and front passenger - seat belt tensioners and force limiters in the front and on the outer seats of the 2nd row - 3-point seat belts on all seats, height-adjustable in the front - warning system for unfastened seat belts in the front and in the 2nd row)
- LED taillights
- Steering column, adjustable in height and reach
- Illuminated makeup mirrors in the driver's and passenger's sun visors
- MyKey key system (individually programmable second key)
- Navigation system: Ford navigation system including Ford SYNC 3 (AppLink, Android Auto, Apple CarPlay - 8" touchscreen (20.3 cm screen diagonal) - DAB/DAB+ radio reception (Digital Audio Broadcasting) - 6 speakers - Steering wheel controls - Bluetooth hands-free system and audio streaming - USB port - Voice control for audio and telephone - Acoustic and visual route guidance - Dynamic navigation with enhanced traffic information system - Lane guidance - Road map for Europe)
- Tire Pressure Monitoring System (TPMS)
- Rear view camera
- Windscreen wipers with rain sensor
- Headlights with delayed shut-off
- Power steering (electro-mechanical, speed-dependent (EPAS - Electric Power Assisted Steering))
- Seats: Driver's seat electrically adjustable, 10-way including electrically adjustable lumbar support
- Seats: Backrest for front passenger, adjustable tilt
- Seats: Driver's backrest, electrically adjustable for tilt
- All-wheel drive
- Anti-lock braking system
- Passenger airbag deactivation
- Tires: 7 J x 17 alloy wheels (4) in 5x2-spoke design (with 225/65 R 17 tires)
- third brake light
- Roof rails, silver-colored
- 12.3-inch digital instrument panel
- Electronic Stability Program (ESP) (additionally with electronic brake booster)
- Lane keeping assist including lane keeping assist
- Electric parking brake with auto hold function
- Ford Easy Fuel (Ford Easy Fuel comfort refueling system (Eliminates the need for a separate internal fuel cap and prevents misfueling by detecting the size difference between petrol and diesel nozzles. The filler neck only opens when the correct fuel is used.)
- Luggage compartment cover, roller blind, removable
- Luggage compartment lighting
- Cruise control
- Transmission: continuously variable automatic transmission (CVT)
- Electric tailgate, sensor-controlled (opens via foot movement)
- Interior mirror, automatically dimming
- ISOFIX mounts including top tether attachment points on the outer seats of the 2nd row.
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Front and rear headrests (5) height adjustable
- Paint finish: Solid
- Steering wheel: Steering wheel, 3-spoke design, Sensico in leather look
- Rear center armrest with two cup holders
- Front center console with integrated armrest (2 front cup holders)
- Emergency brake light, pulsating illumination of the brake lights during hard braking
- Front and rear parking pilot system
- Upholstery: Premium Sensico upholstery in leather look/fabric (with Sensico seat bolsters in leather look)
- Post-Collision Assist
- Pre-Collision Assist (including Forward Alert system with pedestrian and bicycle detection)
- Radio accessories: B&O Sound System (575 Watt premium sound system with 10 speakers, including subwoofer - based on the renowned sound and design expertise of Bang & Olufsen)
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Seats: Passenger seat, 8-way manually adjustable (including adjustable lumbar support)



- Seats: Front sports seats with integrated headrests
- Static LED headlights (high beam assist - LED fog lights)
- Carpet floor mats front and rear, velour
- Variable radiator air intake
- Central locking with remote control and remote luggage compartment release

Extra equipment

- Detachable towbar (including ESP trailer stabilization)
- Inductive charging station for mobile devices (The inductive charging station allows you to charge your compatible smartphone while driving without the hassle of connecting it to a cable. The charging station is located in the vehicle's center console and is only activated when it comes into contact with a compatible device. If you place a wallet or other items on the charging station, it remains inactive.)
- Package: Technology (Adaptive LED headlights with glare-free high beam assist and dynamic cornering lights, automatic headlight range control and LED fog lights - Head-up display)
- Package: Winter II (Heated windscreen - Heated leather steering wheel - Heated outer rear seats)
- Safety partition net for attachment behind the 2nd row of seats (including attachment points behind the first and second rows of seats)

- Seats: Map pockets on the driver's and front passenger's seat backrests
- Seats: Rear bench seat, sliding, with split-folding backrest
- Seats: Front seats, individually and variably heated
- Power outlet: 12-volt connection in the luggage compartment
- Immobiliser

- Mounting points behind the first and second row of seats according to ISO 27955, (required for the installation of the safety partition available as an accessory from your participating Ford dealer)
- Paint finish: Solid color, special color
- Package: Driver Assistance Package (Automatic Transmission) (Intelligent Adaptive Cruise Control with Traffic Sign Recognition System - Traffic Jam Assist with Stop&Go Function and Lane Keeping Assist - Wrong-Way Driver Warning System - Evasive Steering Assist - Driver Drowsiness Detection - Pre-Collision Assist including Forward Collision Warning System with Cross Traffic Alert - Blind Spot Assist with Emergency Braking Function and Trailer Detection - Active Park Assist with Parking Assist and Semi-Autonomous Vehicle Steering - Front Camera with Split View - Door Edge Protectors - Intelligent Speed Limiter with Speed Limit Display)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Trailer hitch	Electrical connection socket (Pins Verformt) - Deformed - Replace
2	Door - front left side	Door edge - Scratch(es) - Smart repair
3	Door - rear right side	Brightware - lower - Scratched - Replace
4	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Smart repair
5	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
6	Body	Body (Flugrost) - Corrosion - Conditioning
7	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
8	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
9	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
10	Wheel / tyres	Alloy rim - front left side - Scratched - Loss in value
11	Door - front left side	Door (innen) - Dent / paintcoat damage - Smart repair
12	Trim / covers	Boot lid - interior trim (Halterung für Hutablage) - Scratched - Replace
13	Sill - right side	Trim - Scratched - Replace
14	Vehicle glazing	Windscreen (mit Heizung) - Stone chips - repair according to calculation

Wear and tear

No.	Component group	Description
1	2nd wheel set	2 tyres (Über 4mm Profiltiefe) - No deduction
2	Wing mirror - right side	Mirror housing - Scratch(es) - No deduction
3	Sill - left side	Sill - Scratch(es) - No deduction
4	Rear bumper	Spoiler - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 2 Oct 2024	1.262,87 €
2	Rear, Side right, Provided by user / customer, from 8 Sept 2023	3.582,79 €

Repainting

No.	Repainting
1	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
2	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
3	Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear right side	199 µm	Door - rear right side	221 µm
Door - front right side	203 µm		



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

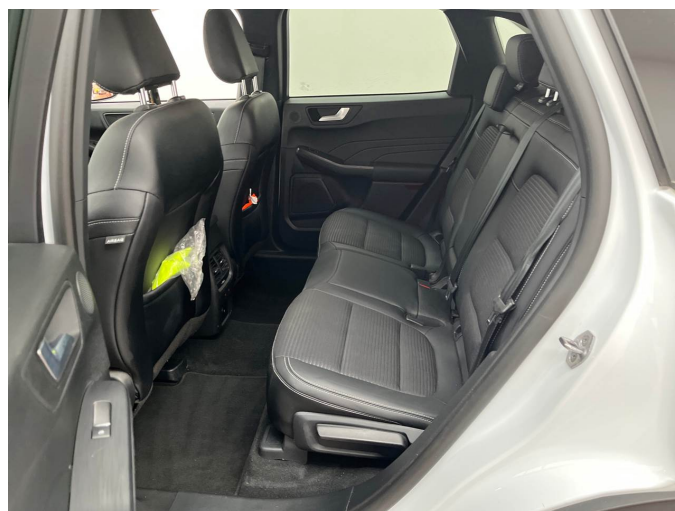


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents

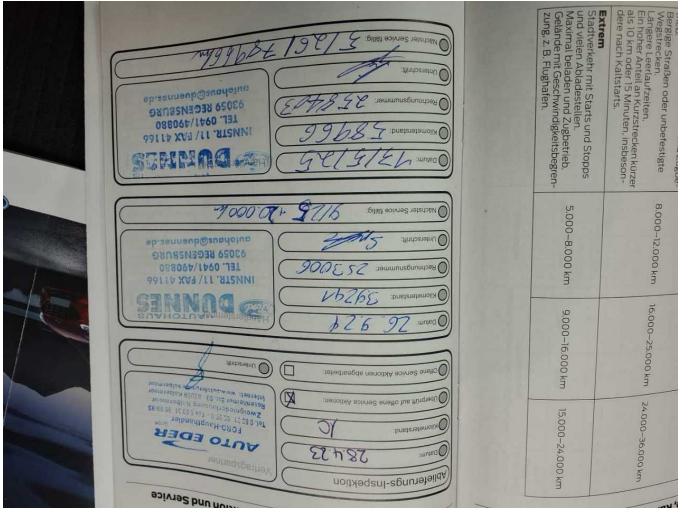


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.




Damage 1: Trailer hitch: Electrical connection socket (Pins Verformt) - Deformed - Replace



Damage 1: Trailer hitch: Electrical connection socket (Pins Verformt) - Deformed - Replace



Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair

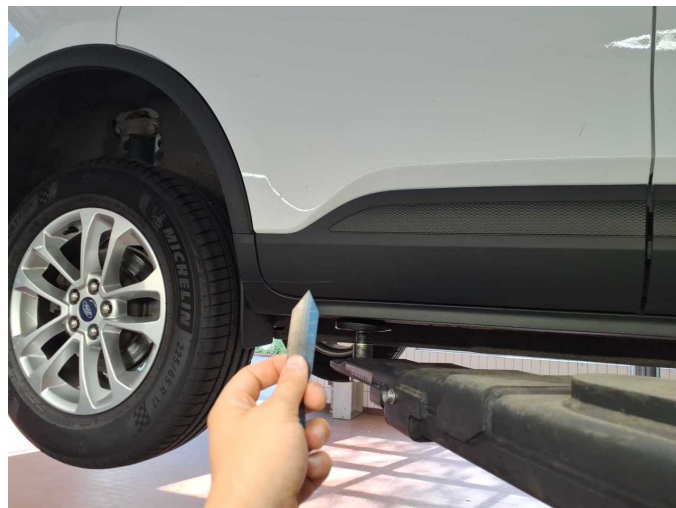

Damage 3: Door - rear right side: Brightware - lower - Scratched - Replace



Damage 3: Door - rear right side: Brightware - lower - Scratched - Replace



Damage 4: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair




Damage 5: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

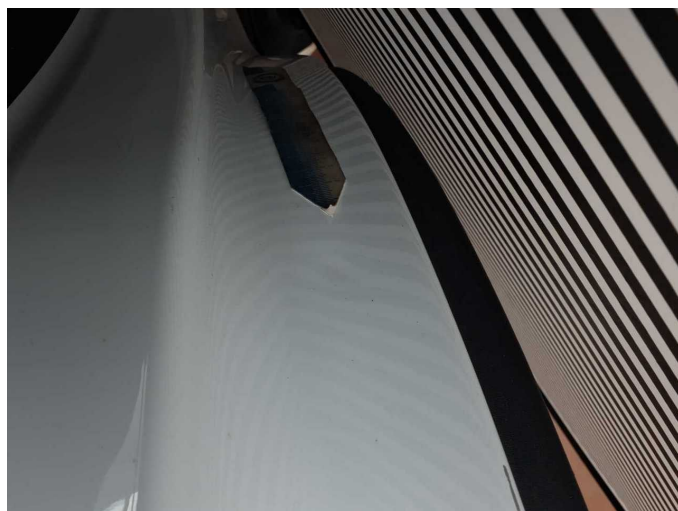

Damage 5: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Body: Body (Flugrost) - Corrosion - Conditioning



Damage 6: Body: Body (Flugrost) - Corrosion - Conditioning



Damage 6: Body: Body (Flugrost) - Corrosion - Conditioning



Damage 6: Body: Body (Flugrost) - Corrosion - Conditioning



Damage 6: Body: Body (Flugrost) - Corrosion - Conditioning



Damage 6: Body: Body (Flugrost) - Corrosion - Conditioning



Damage 6: Body: Body (Flugrost) - Corrosion - Conditioning



Damage 6: Body: Body (Flugrost) - Corrosion - Conditioning



Damage 6: Body: Body (Flugrost) - Corrosion - Conditioning



Damage 6: Body: Body (Flugrost) - Corrosion - Conditioning



Damage 6: Body: Body (Flugrost) - Corrosion - Conditioning



Damage 6: Body: Body (Flugrost) - Corrosion - Conditioning



Damage 6: Body: Body (Flugrost) - Corrosion - Conditioning



Damage 6: Body: Body (Flugrost) - Corrosion - Conditioning



Damage 7: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair




Damage 7: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 7: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 7: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

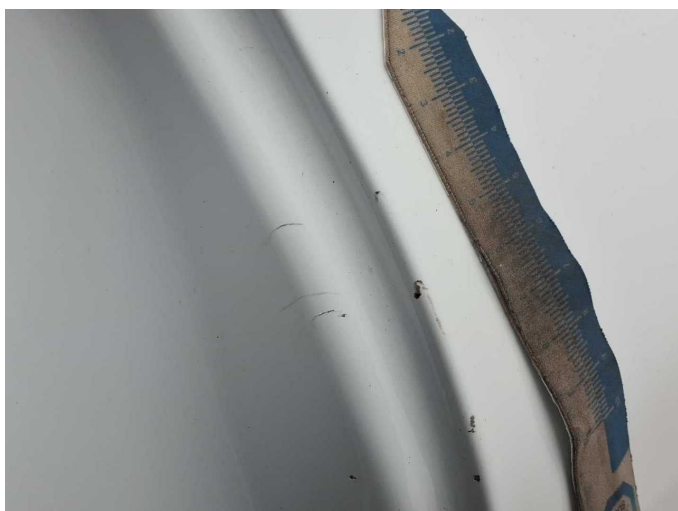

Damage 7: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair




Damage 8: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 8: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 9: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value

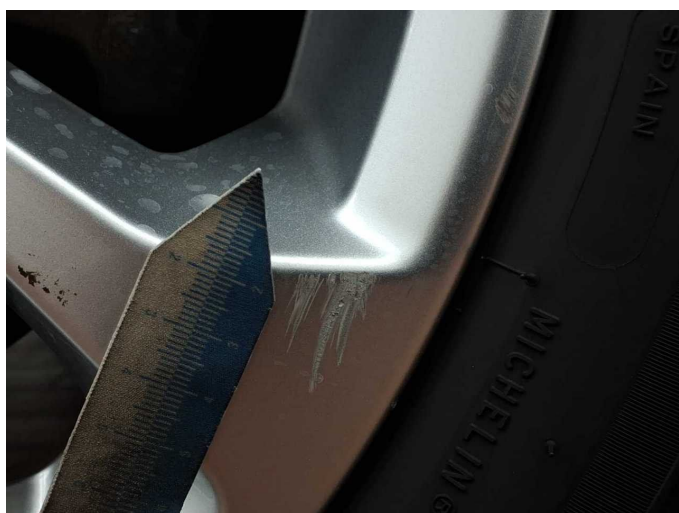


Damage 9: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 10: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 10: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value

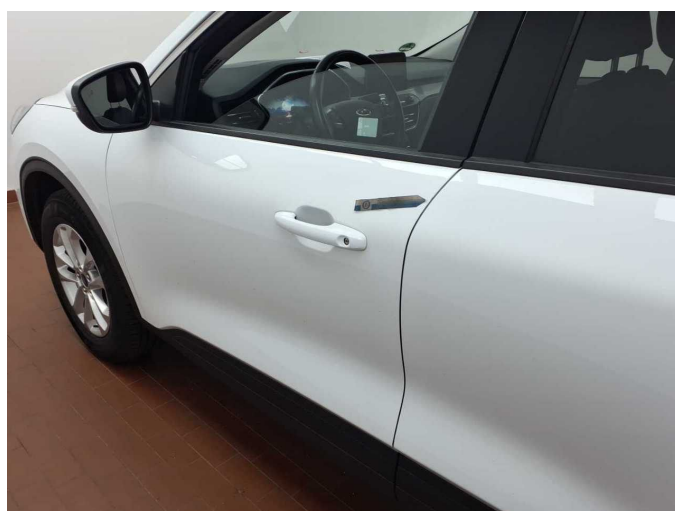

Damage 11: Door - front left side: Door (innen) - Dent / paintcoat damage - Smart repair




Damage 11: Door - front left side: Door (innen) - Dent / paintcoat damage
- Smart repair




Damage 11: Door - front left side: Door (innen) - Dent / paintcoat damage
- Smart repair



Damage 11: Door - front left side: Door (innen) - Dent / paintcoat damage
- Smart repair

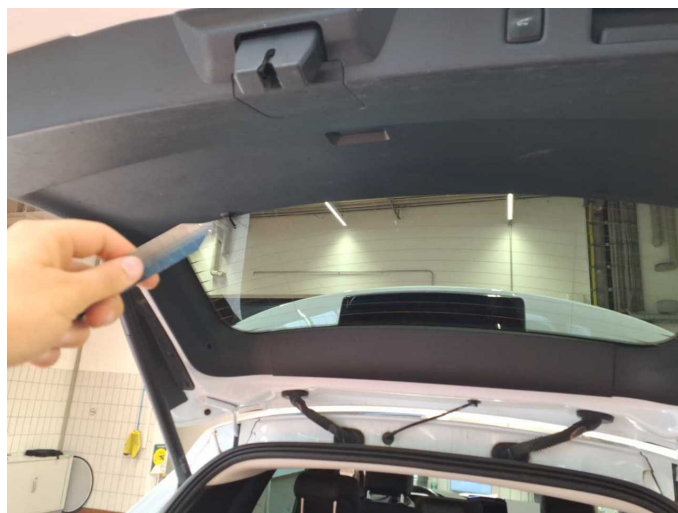

Damage 12: Trim / covers: Boot lid - interior trim (Halierung für
Hutablage) - Scratched - Replace

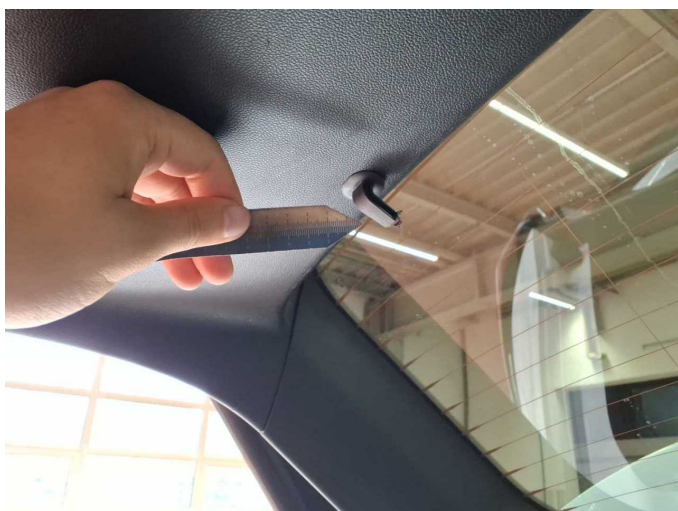

Damage 12: Trim / covers: Boot lid - interior trim (Halierung für
Hutablage) - Scratched - Replace




Damage 12: Trim / covers: Boot lid - interior trim (Halierung für
Hutablage) - Scratched - Replace




Damage 12: Trim / covers: Boot lid - interior trim (Halterung für Hutablage) - Scratched - Replace



Damage 12: Trim / covers: Boot lid - interior trim (Halterung für Hutablage) - Scratched - Replace

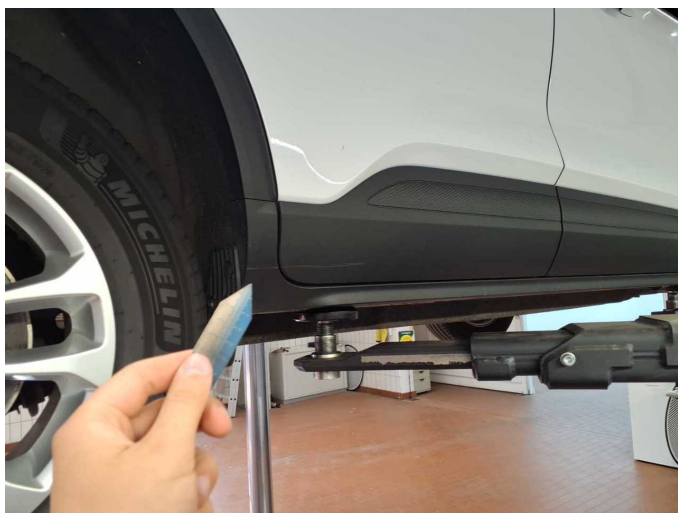


Damage 13: Sill - right side: Trim - Scratched - Replace

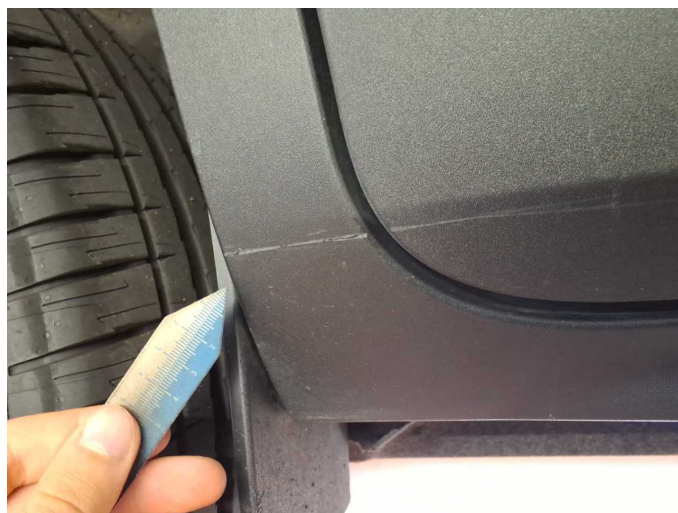


Damage 13: Sill - right side: Trim - Scratched - Replace



Damage 14: Vehicle glazing: Windscreen (mit Heizung) - Stone chips - repair according to calculation

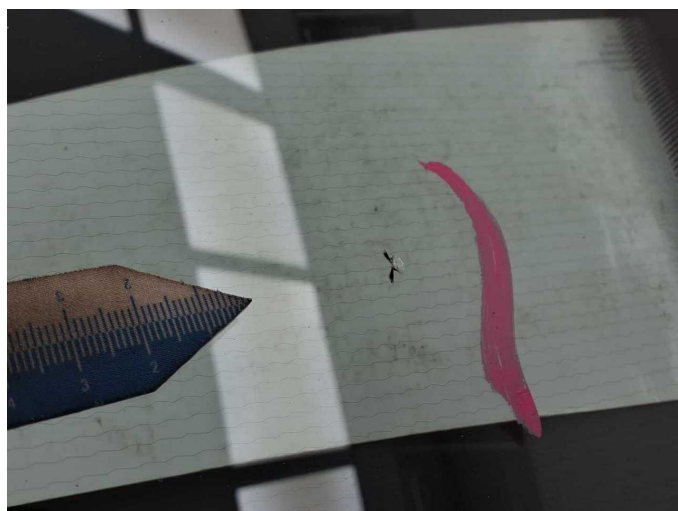

Damage 14: Vehicle glazing: Windscreen (mit Heizung) - Stone chips - repair according to calculation

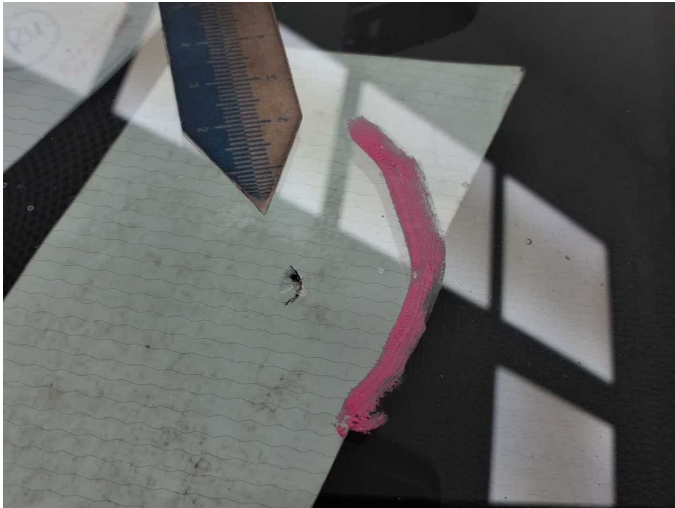

Damage 14: Vehicle glazing: Windscreen (mit Heizung) - Stone chips - repair according to calculation



Repainting 1: Side panel - rear right side



Repainting 2: Door - rear right side



Repainting 3: Door - front right side