



Expertise

Protocol number: 46545324
Order No. / Reference: 26517949
Inspection date: 8 Jul 2026

Manufacturer: Mercedes-Benz

Model: A 200 d 8G-DCT Progressive

VIN: W1K1771121J246202



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz A 200 d 8G-DCT Progressive	
Vehicle Identification number	W1K1771121J246202
Mileage (Read)	138,607 km
First registration	18 Aug 2020
Number of holders	1
Next periodical technical inspection	09/2027
(Report on hand)	
Power / Engine displacement	110 kw / 1,950 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Mojavesilber Metallic
Doors / Seats	4 / 5
Upholstery type	Leather
Colour of upholstery	Beige-Black



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	-5,241 km
Last service on / at	09/2025 at 108,363 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FT820796
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AJR 00021		
Emission standard	EURO6;WLTP;AM;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,010 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 91W	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/45 R18 91W	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS - Anti-lock Braking System
- Airbag: Automatic passenger airbag deactivation
- Airbag: Kneebag for driver
- Airbag: Windowbag for driver and front passenger
- Foldable armrest in the center console for driver and front passenger
- Outdoor temperature display
- Brake assist, active
- Double cup holder at the front
- DYNAMIC SELECT
- Door sills with the lettering "Mercedes-Benz"
- Driving light assistant
- Vehicle key with chrome decorative frame
- Luggage net on driver and passenger seatbacks
- Transmission: 8G-DCT automatic
- Black fabric headliner
- Mechanical child safety lock
- Communication module (LTE) for the use of Mercedes me connect services
- Radiator grille with diamond pins in black
- Mercedes-Benz emergency call system
- Net in the passenger footwell
- Package: Seating comfort
- Radio accessories: USB interface in the storage compartment & 2 USB interfaces in the rear center console
- Tire pressure monitoring system
- Windscreen wipers with rain sensor
- Power steering
- Seats: Rear seat backrests foldable 40/20/40 split
- Lane Keeping Assist, active
- Cruise control
- Pre-installation for vehicle monitoring
- High-visibility vest for drivers
- Heat-insulating glass, green all around
- Decorative elements with carbon look
- Adaptive brake light flashing
- Airbag: Driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Traction control (ASR)
- ATTENTION ASSIST
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Diesel particulate filter
- Third brake light
- ECO start/stop function
- Electronic Stability Program (ESP)
- Chassis: Comfort chassis
- Electric windows (4-way)
- Speed Limit Assistant
- Heated rear window
- KEYLESS-GO start function
- THERMATIC automatic climate control
- Rear headrests (3)
- Front headrests are height-adjustable
- Steering wheel: Multifunction sports steering wheel in leather
- Package: Light and Visibility Package
- Radio accessories: Digital radio (DAB)
- Radio: Extended MBUX functions
- Radio: MBUX multimedia system
- Gearshift lever with additional chrome elements
- Crosswind Assist
- Seat belts A-Class
- Seats: Comfort seats
- Power outlet: 12V connection
- Touchpad
- Pre-installation for vehicle setup
- Electronic immobilizer
- Central locking

Extra equipment

- Storage compartment in center console with roller blind
- Ambient lighting (The 64 colors of the ambient lighting create fascinating color worlds, for example in the illuminated air vents, doors or the instrument panel.)
- Head-up Display (projects important information directly into the field of vision on the windshield)
- Package: Business (Hard drive navigation - Smartphone integration - Traffic sign assistant - Pre-installation for car sharing - Connectivity package navigation - Seat heating for driver and front passenger - Active parking assistant with PARKTRONIC)
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC - Active Steering Assist - Active Speed Limit Assist - Active Brake Assist with Cross-Traffic Function - Evasive Steering Assist - Active Blind Spot Assist - Active Lane Change Assist - Active Emergency Stop Assist - Route-Based Speed Adaptation - PRE-SAFE PLUS)
- Package: MBUX Advanced Package (Hard drive navigation - Traffic sign assistant - Connectivity package Navigation: Hard drive navigation, Extended navigation services - Smartphone integration: Mobile phone via Apple CarPlay and Android Auto with the media system - Pre-installation for car sharing)
- Package: Parking package with 360° camera (including Active Parking Assist with PARKTRONIC and 360° camera)
- Package: Mirror package (interior and exterior mirrors on the driver's side automatically dimming - exterior mirrors left and right electrically folding)
- Radio accessories: Media Interface Cable Kit (The direct line to your data: With the practical cable kit, you can connect your devices with a USB or Lightning connector to your vehicle's multimedia system via a universal interface. This is located in the center console. Simply connect your smartphone or tablet via cable and access the desired content.)
- Heated windshield washer system
- Sunroof: Electric panoramic sunroof
- Seats: Electrically adjustable front passenger seat with memory function (The memory function remembers the ideal seating position for your passengers. Up to three people can thus find their perfect environment at the touch of a button – making changes uncomplicated and comfortable. Your passengers can then easily readjust the seat electrically and continuously.)
- Seats: Heated seats for driver and front passenger (The intensity can be selected in three levels. Intelligent and comfortable: The seat heating switches off automatically.)
- 230V power outlet in the rear
- Phone accessories: Smartphone integration (consisting of Apple CarPlay and Android Auto)
- Type designation removed from trunk lid
- Decorative elements in dark carbon look
- Airbag: Side airbags in the rear
- Rear armrest (with two integrated cupholders for drinks)
- Velour floor mats (black with decorative stitching in the respective interior color)
- Paint finish: Metallic
- MULTIBEAM LED (via controllable LEDs, the light can always be switched on exactly where it is needed - partial switching off of the LEDs of the high beam modules to avoid dazzling vehicles ahead or oncoming vehicles (partial high beam) - extends and perfects the functions known from the Intelligent Light System, especially with regard to high beam - active cornering light - automatically switching-on turning light - extended fog light)
- Package: KEYLESS-GO Comfort Package (KEYLESS-GO access and drive authorization system - HANDS-FREE ACCESS opens the trunk lid - Door handles with chrome inserts - Handle recess lighting)
- Package: Leather (high-quality leather with decorative stitching on the door sill and instrument panel)
- Package: Night (45.7 cm (18") 5-twin-spoke alloy wheels, black painted and polished, with 225/45 R 18 tires on 7.5 J x 18 ET49 rims; exterior mirror housings painted black; diamond grille with pins and louvre painted in high-gloss black; rear apron with trim element painted in high-gloss black; beltline trim strip and window line trim strip in high-gloss black; heat-insulating dark tinted glass from the B-pillar back)
- Upholstery: Leather macchiato beige/black
- Radio accessories: Burmester surround sound system (The high-performance speakers develop first-class surround sound. You can optimize this specifically for the front and rear seats and intensify the listening experience. A quality that is also visible thanks to the high-quality Burmester lettering.)
- Wheels: 45.7 cm (18") alloy wheels, 4-piece set in 5-twin-spoke design (black painted and polished with 225/45 R 18 tires on 7.5 J x 18 ET49 rims)
- Seats: 4-way lumbar support (Four settings are possible: higher, lower, weaker or stronger.)
- Seats: Electrically adjustable driver's seat with memory function (The memory function saves your ideal position for the driver's seat, exterior mirrors, and head-up display. Up to three people can instantly find their preferred position at the touch of a button – making driver changes quick and easy. You can also easily readjust the seat electrically and continuously.)
- Auxiliary heater (including ventilation in summer) + Auxiliary heater: remote control
- Telephone accessories: Multifunctional telephony (this equipment perfectly integrates the mobile phone into the vehicle - it connects the device to the external antenna and charges the mobile phone - both without cables or a cradle.)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (Service BF fällig und um 5241KM überzogen) - No evidence - No deduction
2	Wing mirror - left side	Cap - Scratch(es) - Smart repair
3	Boot lid / rear door	Boot lid (Kleberreste) - Glued / labelled - De-glue / neutralise
4	Side panel - rear left side	Mudguard - rear left side - Scratch(es) - Smart repair
5	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
6	Misc.	Inspection / maintenance (Service BF um 5241KM überzogen) - Due - Perform
7	Wheel / tyres	Alloy rim - front right side (Großflächig verkratzt) - Scratch(es) - Replace
8	Door - rear left side	Door - Scratch(es) - Paint
9	Door - rear right side	Door - Scratch(es) - Paint
10	Mudguard - right side	Mudguard - right side - Scratch(es) - Paint
11	Side panel - rear right side	Side panel - Scratch(es) - Paint
12	Front bumper	Front bumper - Scratch(es) - Paint
13	Door - front right side	Door - Dent / paintcoat damage - Repair and paint
14	Bonnet	Bonnet (Übermäßige Steinschläge) - Stone chips - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Mudguard - left side	Mudguard - left side - Scratch(es) - No deduction
3	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 5 Aug 2022	1.552,39 €
2	Rear, Side right, Provided by user / customer, from 22 May 2024	3.054,40 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

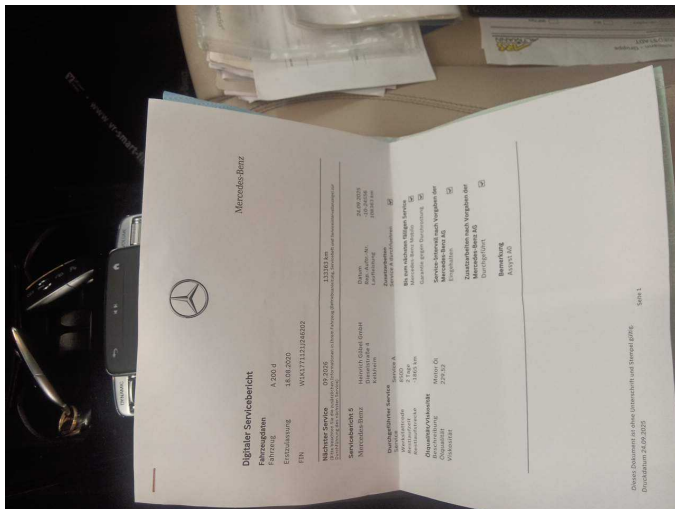


Figure 15: Documents

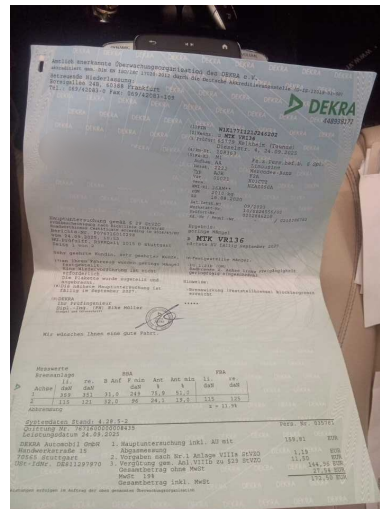


Figure 16: Documents



Figure 17: Navigation



Figure 18: Misc.

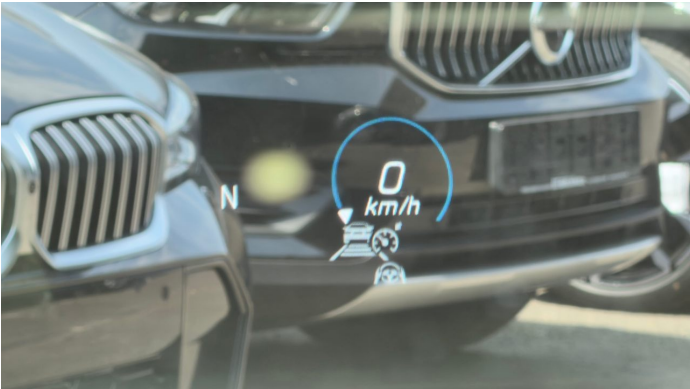


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

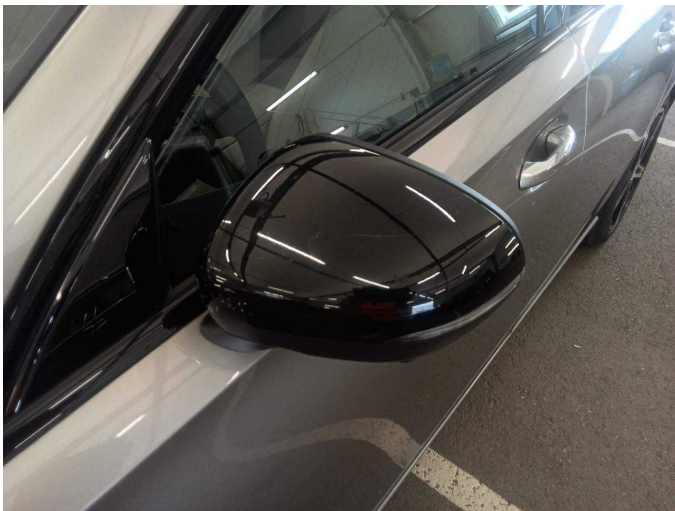

Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 3: Boot lid / rear door: Boot lid (Kleberreste) - Glued / labelled - De-glue / neutralise



Damage 3: Boot lid / rear door: Boot lid (Kleberreste) - Glued / labelled - De-glue / neutralise



Damage 4: Side panel - rear left side: Mudguard - rear left side - Scratch(es) - Smart repair



Damage 4: Side panel - rear left side: Mudguard - rear left side - Scratch(es) - Smart repair



Damage 4: Side panel - rear left side: Mudguard - rear left side - Scratch(es) - Smart repair



Damage 4: Side panel - rear left side: Mudguard - rear left side - Scratch(es) - Smart repair



Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 6: Misc.: Inspection / maintenance (Service BF um 5241KM überzogen) - Due - Perform



Damage 7: Wheel / tyres: Alloy rim - front right side (Großflächig verkratzt) - Scratch(es) - Replace



Damage 7: Wheel / tyres: Alloy rim - front right side (Großflächig verkratzt) - Scratch(es) - Replace



Damage 7: Wheel / tyres: Alloy rim - front right side (Großflächig verkratzt) - Scratch(es) - Replace




Damage 7: Wheel / tyres: Alloy rim - front right side (Großflächig verkratzt) - Scratch(es) - Replace




Damage 8: Door - rear left side: Door - Scratch(es) - Paint



Damage 8: Door - rear left side: Door - Scratch(es) - Paint

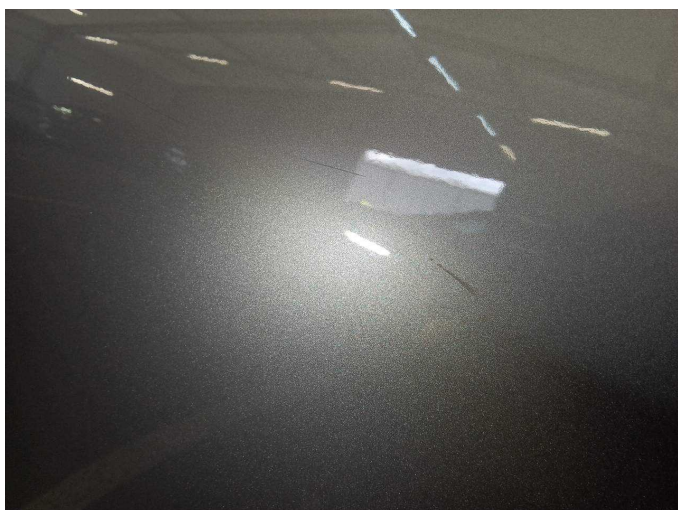

Damage 8: Door - rear left side: Door - Scratch(es) - Paint

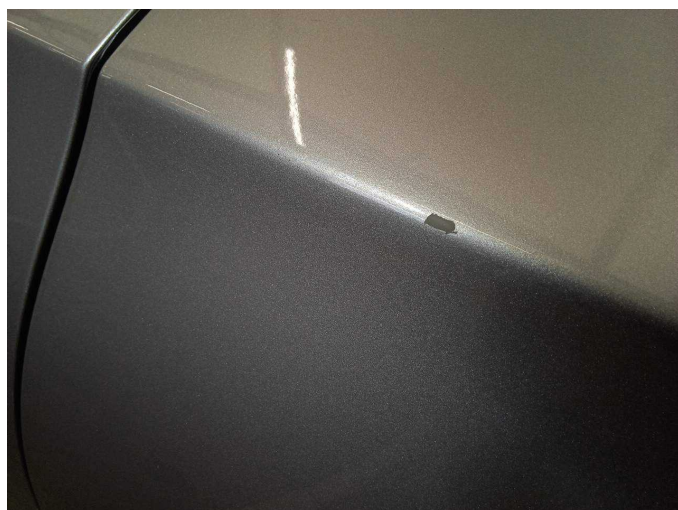

Damage 8: Door - rear left side: Door - Scratch(es) - Paint



Damage 9: Door - rear right side: Door - Scratch(es) - Paint



Damage 9: Door - rear right side: Door - Scratch(es) - Paint




Damage 9: Door - rear right side: Door - Scratch(es) - Paint



Damage 10: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint



Damage 10: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint

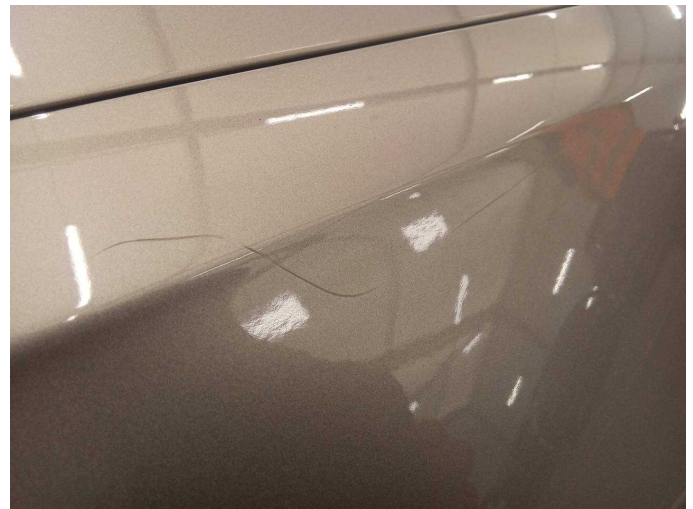

Damage 10: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint



Damage 10: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint




Damage 11: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 11: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 12: Front bumper: Front bumper - Scratch(es) - Paint

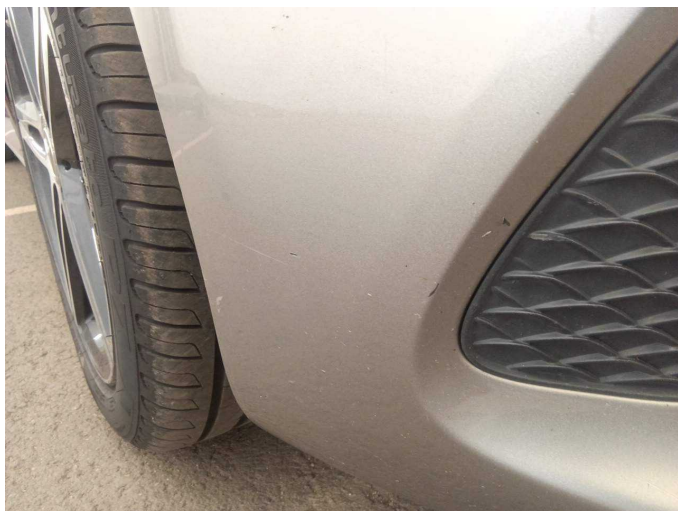

Damage 12: Front bumper: Front bumper - Scratch(es) - Paint



Damage 12: Front bumper: Front bumper - Scratch(es) - Paint



Damage 12: Front bumper: Front bumper - Scratch(es) - Paint



Damage 13: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 13: Door - front right side: Door - Dent / paintcoat damage - Repair and paint




Damage 13: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 13: Door - front right side: Door - Dent / paintcoat damage - Repair and paint




Damage 13: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

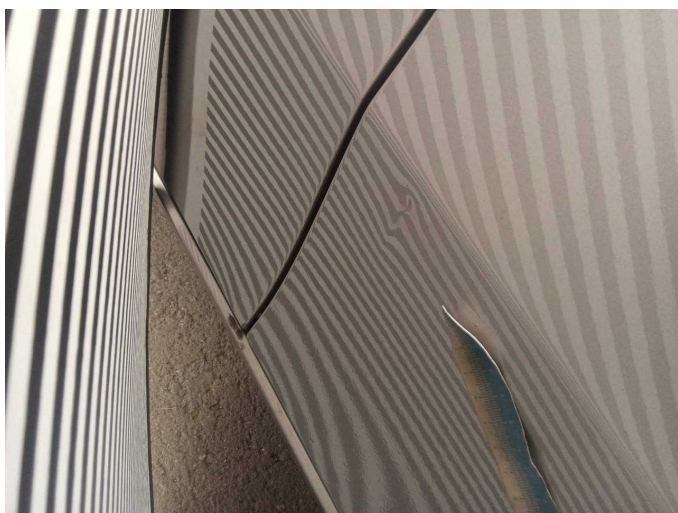


Damage 13: Door - front right side: Door - Dent / paintcoat damage - Repair and paint




Damage 14: Bonnet: Bonnet (Übermäßige Steinschläge) - Stone chips - Paint

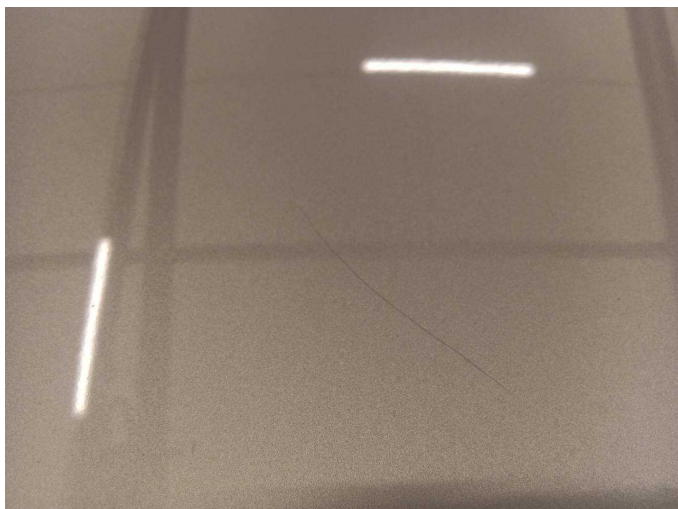

Damage 14: Bonnet: Bonnet (Übermäßige Steinschläge) - Stone chips - Paint

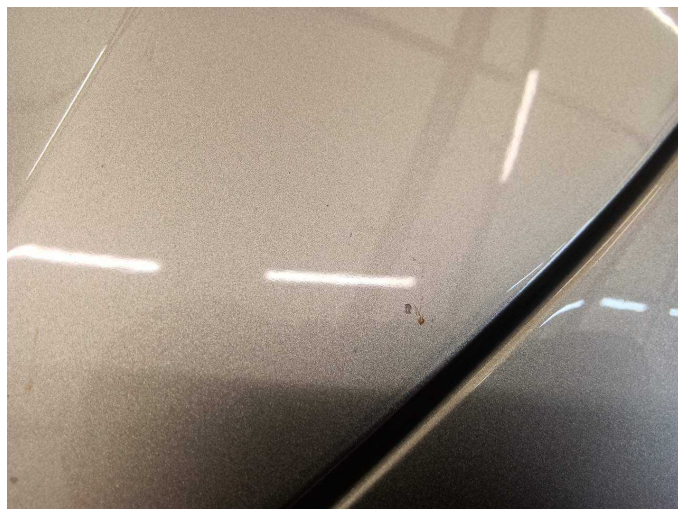


Damage 14: Bonnet: Bonnet (Übermäßige Steinschläge) - Stone chips - Paint

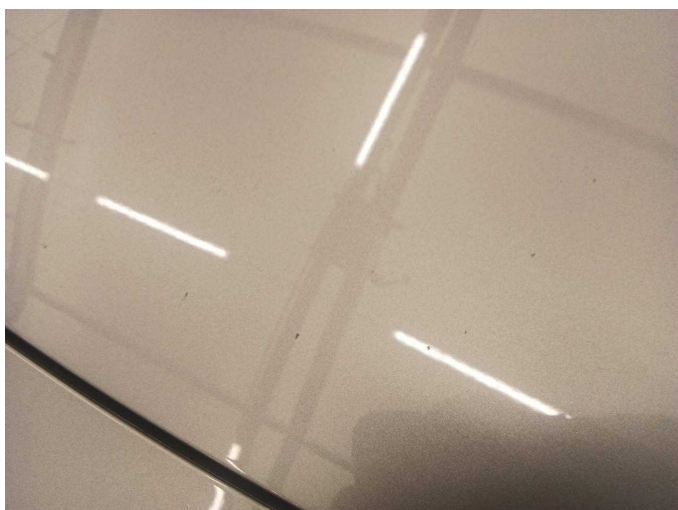


Damage 14: Bonnet: Bonnet (Übermäßige Steinschläge) - Stone chips - Paint



Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction

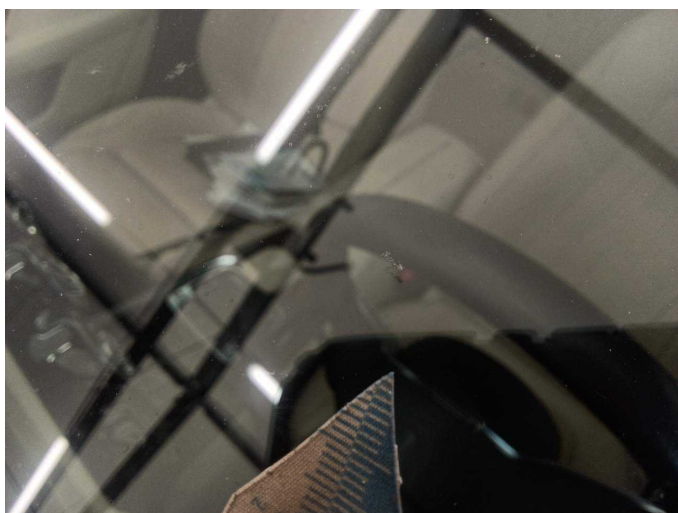

Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction

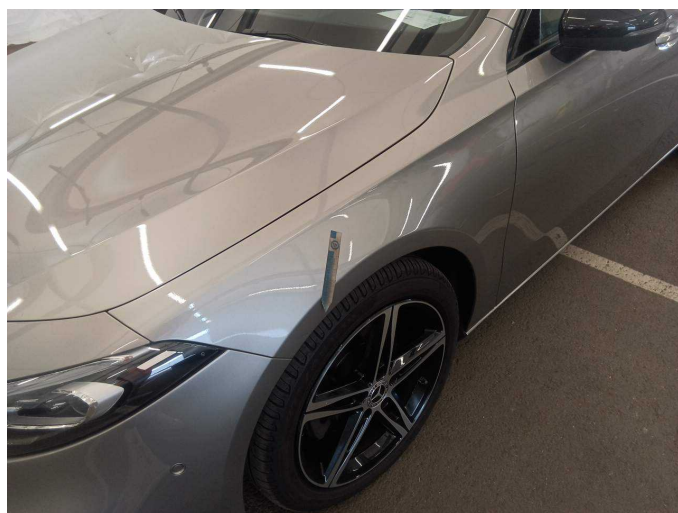

Wear and tear 2: Mudguard - left side: Mudguard - left side - Scratch(es) - No deduction



Wear and tear 2: Mudguard - left side: Mudguard - left side - Scratch(es)
- No deduction



Wear and tear 3: Rear bumper: Rear bumper - Scratch(es) - No deduction



Wear and tear 3: Rear bumper: Rear bumper - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1K1771121J246202
Hersteller / Modell: MERCEDES-BENZ MB A 200 d 8G-DCT Progressive

Datum	KM-Stand	Beschreibung
29.09.2025	108.369	HU + AU
24.09.2025	108.363	Bremsscheiben hinten; Regelwartungsdienst
20.09.2024	81.277	Regelwartungsdienst
04.01.2024	57.437	HU + AU; Systemtest/Eigendiagnose
19.10.2023	57.437	Bremsscheiben+Beläge v+h; Regelwartungsdienst
22.09.2022	35.850	Regelwartungsdienst
04.08.2021	15.509	Kleine Inspektion