



Expertise

Protocol number: 46028326
Order No. / Reference: 26472575
Inspection date: 18 Jun 2026

Manufacturer: Audi

Model: A4 Avant 45 TFSI quattro S tronic advanced

VIN: WAUZZZF4XNA014370



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A4 Avant 45 TFSI quattro S tronic advanced	
Vehicle Identification number	WAUZZZF4XNA014370
Mileage (Read)	107,968 km
First registration	22 Mar 2022
Number of holders	1
Next periodical technical inspection	05/2027
(Report on hand)	
Power / Engine displacement	195 kw / 1,984 ccm
Fuel type / Cylinder	Hybrid Petrol / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Brillantschwarz
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	-21 Tag(e)
Last service on / at	09/2025 at 94,428 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF433348
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BUZ 00157		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,195 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 93Y	Summer tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm
2)	245/45 R18 93Y	Summer tires (with run-flat tires) on Light alloy	Pirelli	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98H	Winter tyres on Light alloy	Dunlop	5mm / 5mm
2)	225/50 R17 98H	Winter tyres on Light alloy	Dunlop	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Accent areas matte black
- Anti-lock braking system (ABS)
- Audi connect emergency call & service with Audi connect Remote & Control
- Electrically adjustable and heated exterior mirrors
- Vehicle tool kit
- Fabric headliner
- Decorative inlays diamond lacquer silver grey
- Door sill trims with aluminum inlay at the front
- Electronic Differential Lock (EDS)
- Driver Information System
- electric window regulator
- Windscreen with acoustic glazing
- front and rear floor mats
- Transmission: S tronic 7-speed
- Interior lighting
- Child lock
- Automatic air conditioning
- boot floor mat
- Fuel tank with increased filling volume (58 l)
- LED taillights
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction
- Mild hybrid
- Non-smoking version
- Wheel: Alloy wheels, 5-arm dynamic
- Radio accessories: 8 speakers (passive) front and rear
- Tire pressure monitoring system
- Electromechanical power steering
- Seats: Standard front seats
- Seats: Front seats manually adjustable
- First aid kit with warning triangle
- Electronic immobilizer
- Reversible loading floor
- Airbag: Front side airbags and head airbag system
- "quattro" all-wheel drive with ultra technology
- Traction control (ASR)
- Audi drive select
- Audi pre sense city
- Exterior mirror housings in body color
- third brake light, raised
- Black roof rails
- Tachometer
- Electromechanical parking brake
- Electronic Stability Control (ESC)
- Chassis: Standard chassis
- Window channel strips in black (rubber)
- Remote key, without SafeLock
- Cruise control system including speed limiter
- rear window wiper
- Interior mirror dimming
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Headrests (5)
- Manual cargo cover
- LED headlights
- Steering column, manually adjustable in height and axis
- Light/rain sensor
- front center armrest
- Otto particulate filter
- Radio: MMI Radio plus
- Radio accessories: Digital radio reception (DAB)
- Tire repair kit
- Fabric seat covers Index
- Seats: Rear seat backrest foldable
- Start-stop system
- Glazing: Windscreen in heat-insulating and acoustic glazing
- Central locking "Keyless-Go" without deadbolt



Extra equipment

- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides
- High beam assist
- Electrically operated tailgate (The tailgate can be opened electrically by pressing the button on the vehicle key, in the driver's door, or the soft-touch button on the tailgate handle. Closing the tailgate is just as easy and convenient: simply press the button on the inside of the tailgate, the button in the driver's door, or the button on the vehicle key. A soft-close mechanism makes manual closing easier when necessary.)
- Business Package (MMI Navigation plus with MMI touch (including driver information system with color display) - Audi phone box - Leather steering wheel in 3-spoke design with multifunction plus - Heated front seats - Automatically dimming, frameless interior mirror - Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides - Rear parking aid - High-beam assistant - Manual sunshade for the rear door windows)
- Front seat heating
- Phone: Audi Phone Box
- Glazing: Privacy glazing (tinted windows) (rear window, rear door and side windows tinted)
- Rear parking sensors
- Chassis: Sport chassis (with firmer spring and damping for more direct road contact and sportier handling, lowered by 23 mm compared to standard chassis, shock absorbers and coil springs on front and rear axles)
- Hold assist (holds the vehicle indefinitely after stopping on typical road inclines and declines. The system is activated by pressing a button and allows the driver to start off comfortably.)
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction plus
- Black Optics Package (adds black accents to the exterior in the area of the Audi Singleframe grille, the trim strips on the side windows, the tailgate trim strip, and the front and rear bumpers. Design varies depending on model and equipment)
- Wheel: Audi Sport light alloy wheels, 10-Y-spoke, black, diamond-turned (8 J x 18 with 245/40 R 18 tires)
- Radio accessories: Audi sound system (10 speakers including center speaker and subwoofer - 6-channel amplifier - total output of 180 watts)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Steering system	Steering wheel - Abrasion - Loss in value
3	Trim / covers	Boot lid - interior trim - Scratch(es) - Loss in value
4	Seat - rear	Upholstery - Holes - Loss in value
5	Interior	Cargo area floor - Holes - Replace
6	Misc.	Inspection / maintenance (Kein Nachweis) - Due - Perform
7	Vehicle glazing	Rear window - Scratch(es) - Replace
8	Bonnet	Bonnet - Stone chips - Paint



Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Body	Body - Scratch(es) - No deduction
3	Mudguard - left side	Mudguard - left side - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side right, Provided by user / customer, from 29 Dec 2023	3.675,70 €

Repainting

No.	Repainting
1	Bonnet, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Bonnet	211 µm
--------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

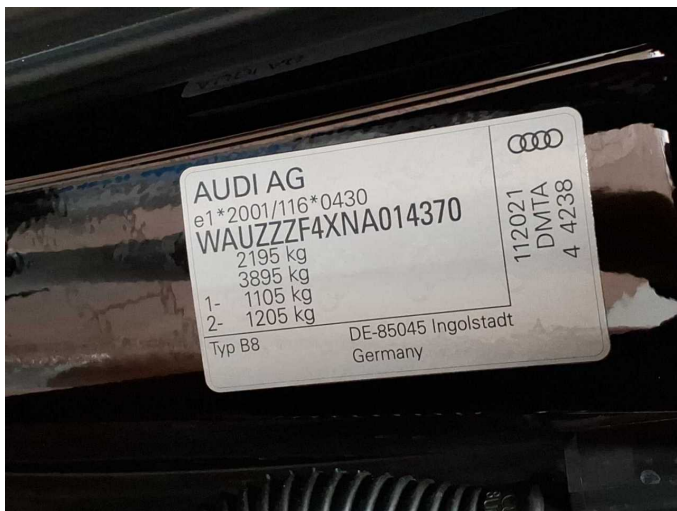


Figure 11: VIN



Figure 12: Mounted tyres

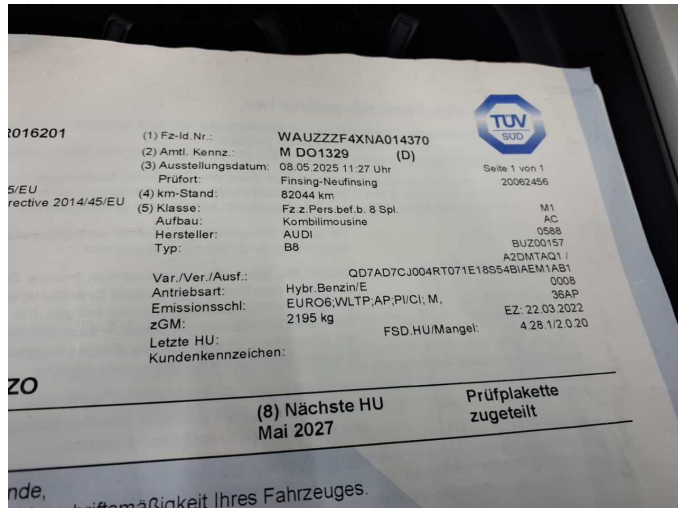


Figure 13: Documents

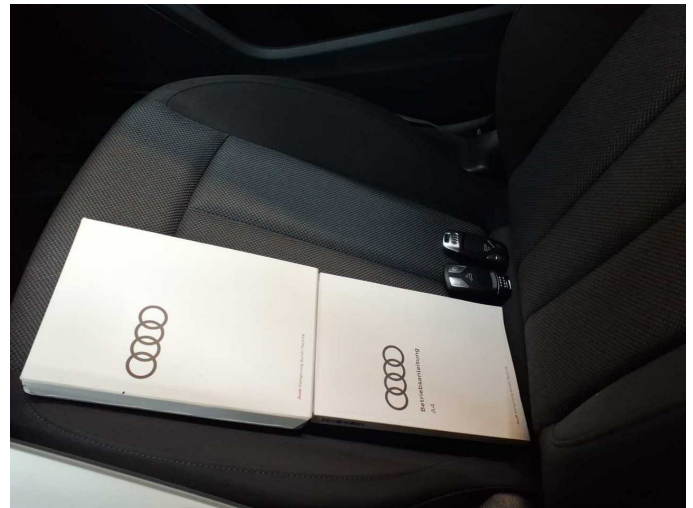


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

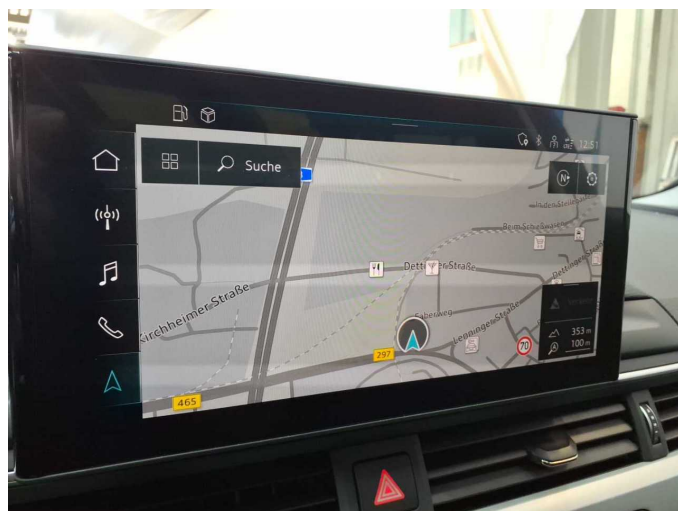


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

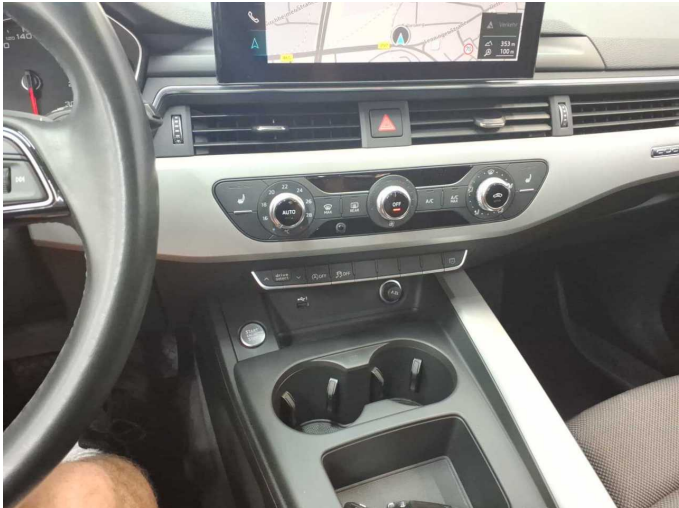


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

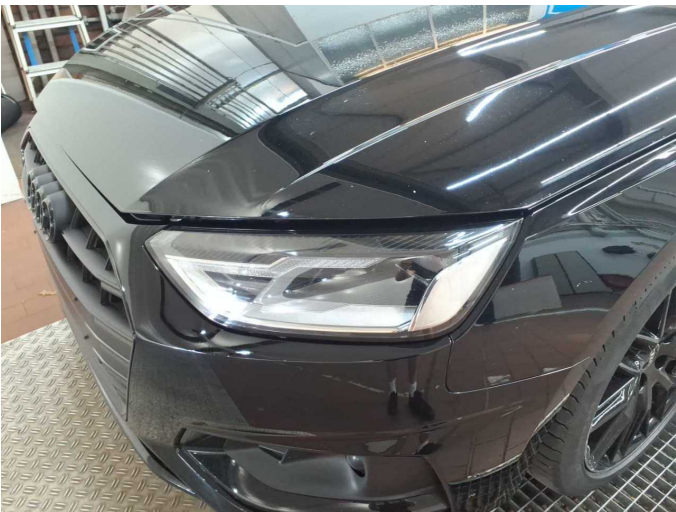


Figure 23: Misc.

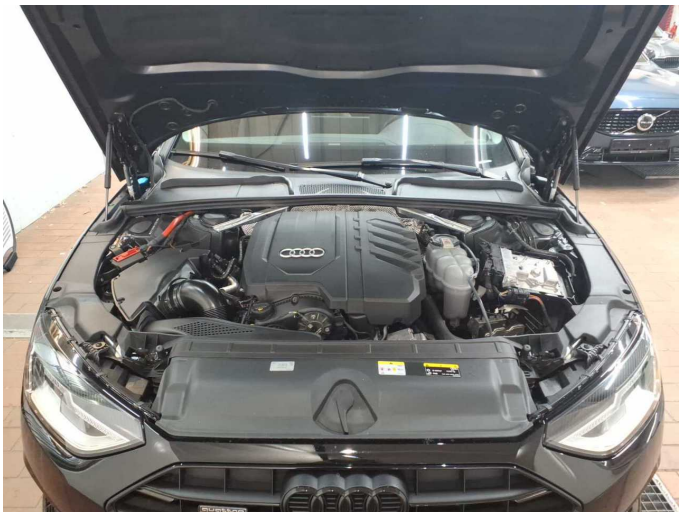


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

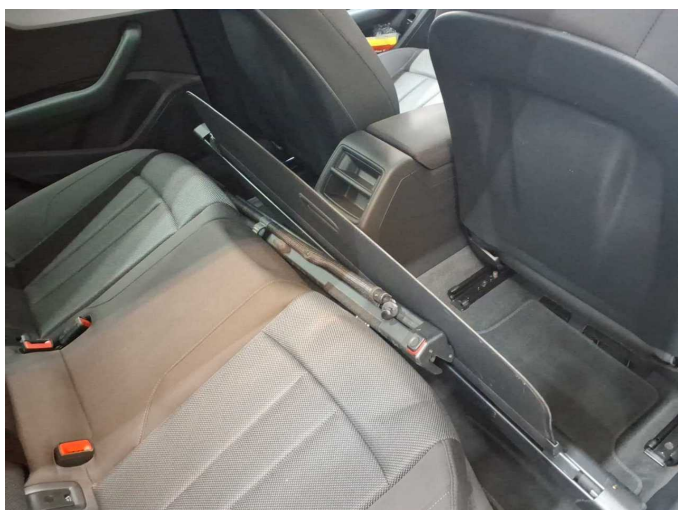


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

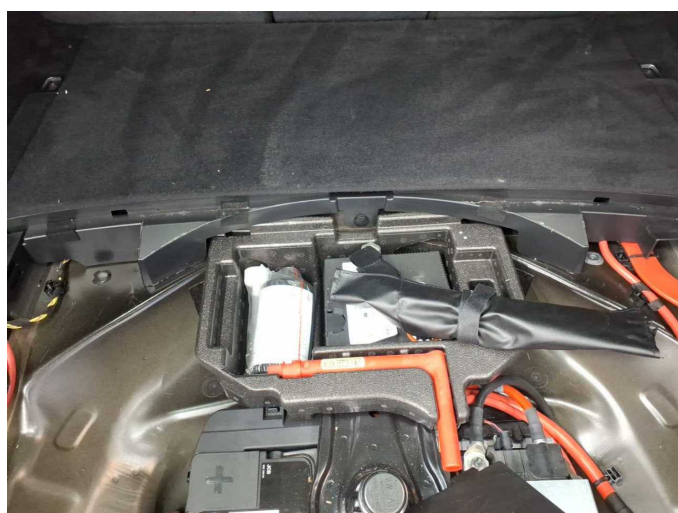



Figure 30: Misc.



Figure 31: Misc.




Figure 32: Misc.

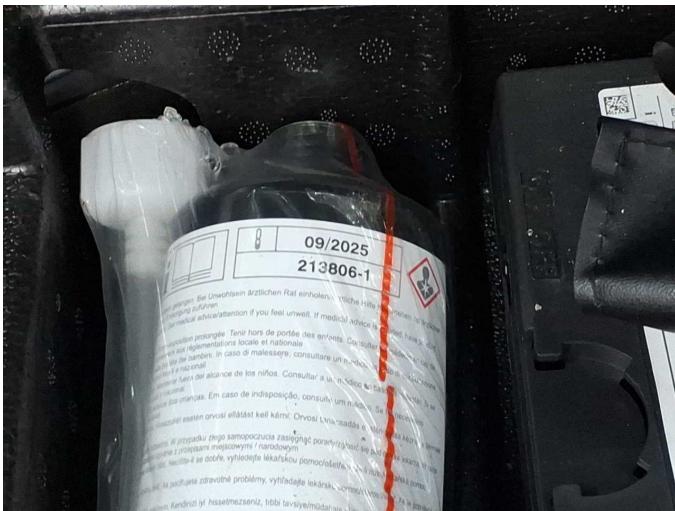


Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Steering system: Steering wheel - Abrasion - Loss in value

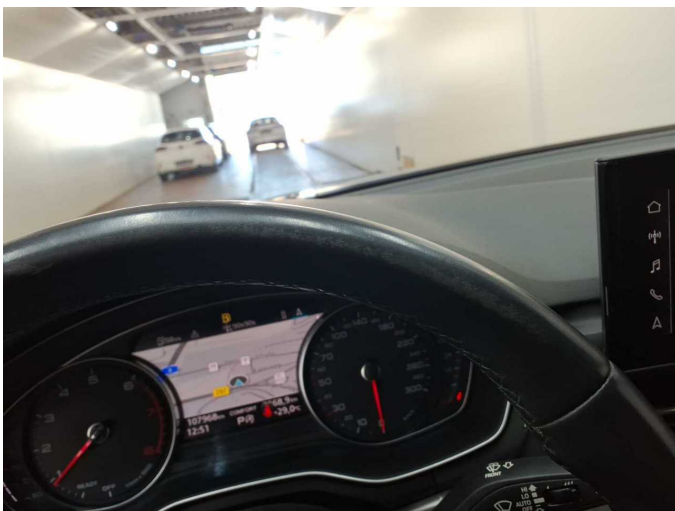

Damage 2: Steering system: Steering wheel - Abrasion - Loss in value

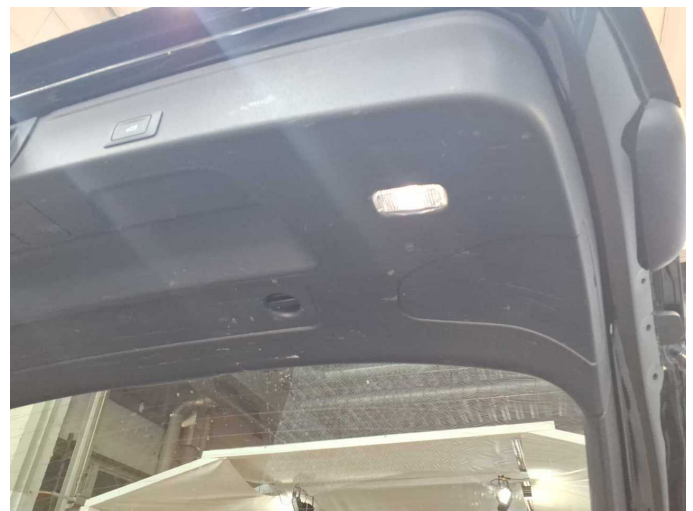


Damage 3: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value



Damage 3: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value



Damage 3: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value

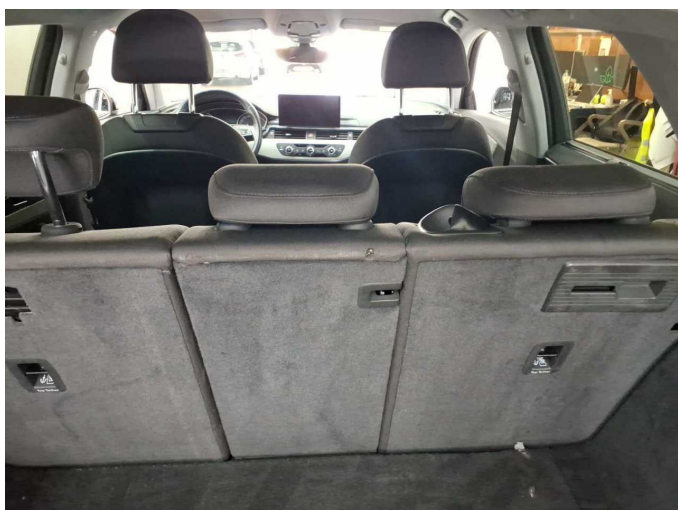

Damage 4: Seat - rear: Upholstery - Holes - Loss in value



Damage 4: Seat - rear: Upholstery - Holes - Loss in value



Damage 5: Interior: Cargo area floor - Holes - Replace



Damage 5: Interior: Cargo area floor - Holes - Replace



Damage 5: Interior: Cargo area floor - Holes - Replace




Damage 5: Interior: Cargo area floor - Holes - Replace



Damage 6: Misc.: Inspection / maintenance (Kein Nachweis) - Due - Perform



Damage 7: Vehicle glazing: Rear window - Scratch(es) - Replace

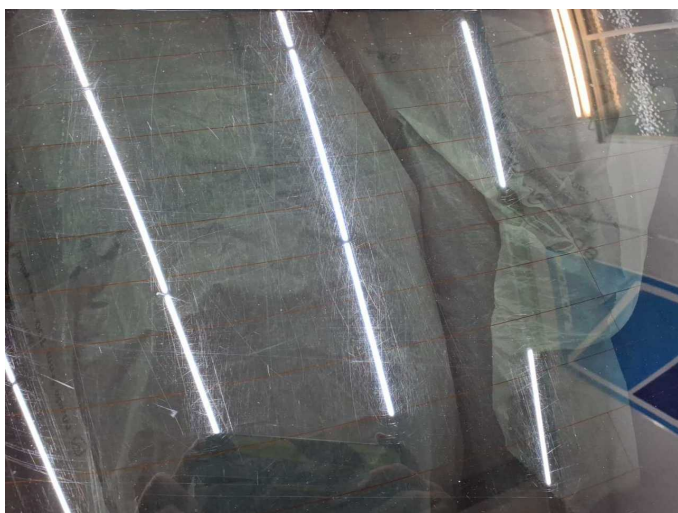

Damage 7: Vehicle glazing: Rear window - Scratch(es) - Replace



Damage 7: Vehicle glazing: Rear window - Scratch(es) - Replace




Damage 7: Vehicle glazing: Rear window - Scratch(es) - Replace



Damage 8: Bonnet: Bonnet - Stone chips - Paint



Damage 8: Bonnet: Bonnet - Stone chips - Paint

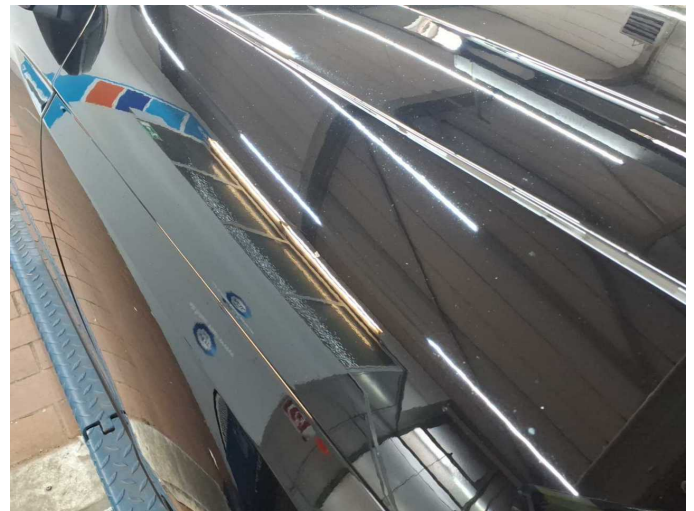

Damage 8: Bonnet: Bonnet - Stone chips - Paint



Damage 8: Bonnet: Bonnet - Stone chips - Paint




Damage 8: Bonnet: Bonnet - Stone chips - Paint



Damage 8: Bonnet: Bonnet - Stone chips - Paint



Damage 8: Bonnet: Bonnet - Stone chips - Paint

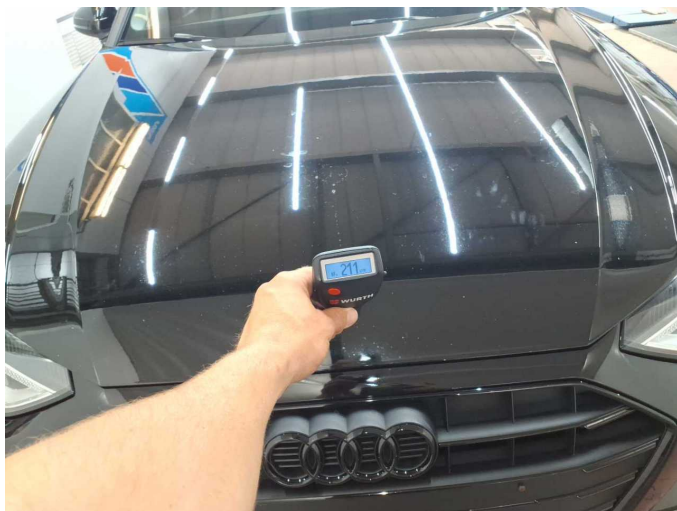

Repainting 1: Bonnet



Repainting 1: Bonnet



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF4XNA014370

Hersteller / Modell: AUDI AUDI A4 Avant 45 TFSI quattro S tronic advanced

Datum	KM-Stand	Beschreibung
25.09.2025	94.428	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben hinten; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
05.06.2025	84.438	Systemtest/Eigendiagnose
08.05.2025	82.044	AU; Regelwartungsdienst
26.11.2024	72.688	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges; Wartung Sonstiges
19.03.2024	55.226	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Getriebeöl ern/prüfen; Regelwartungsdienst; Zündkerzen ern
16.01.2024	49.770	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
28.03.2023	27.053	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges