



Expertise

Protocol number: 46168022
Order No. / Reference: 26510107
Inspection date: 24 Jun 2026

Manufacturer: Skoda
VIN: TMBJJ7NS0N8021718

Model: Kodiaq 2.0 TDI DSG Clever



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiaq 2.0 TDI DSG Clever	
Vehicle Identification number	TMBJJ7NS0N8021718
Mileage (Read)	107,841 km
First registration	1 Feb 2022
Number of holders	1
Next periodical technical inspection	02/2027
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Brilliant-Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	7,000 km
Last service on / at	10/2025 at 94,062 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GG212549
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / ART 02725		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,247 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99V	Summer tyres on Light alloy	Goodyear	3mm / 3mm
2)	235/50 R19 99V	Summer tyres on Light alloy	Goodyear	3mm / 3mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	145/85 R18 103M	Summer tyres on Steel	Sonstige	4 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartment on the left wheel arch
- Storage compartments (ticket holder on the windshield, closed storage compartment on the driver's side, 4 roof grab handles, rear with coat hooks, coat hooks on the B-pillar, high-visibility vest compartment in the front doors, sunglasses compartment in the headliner, storage compartments in the door panels (front and rear) with bottle holders (1.5l front, 1l rear), cup holder in the front center console with "Easy-Open" bottle opening, storage pockets on the front seatbacks)
- Anti-lock braking system (ABS)
- Traveller Plus (DSG) assistance system (Adaptive Cruise Control ACC (control range up to 210 km/h) - Lane Assist, Blind Spot Detection and Parking Assist, Exit Warning - Adaptive Lane Guidance - Park Assist - Traffic Jam and Emergency Assist - Traffic Sign Recognition)
- Hydraulic brake assist
- Cargo elements in the trunk
- Roof rails, black
- Anti-theft alarm system (with SAFE system, interior monitoring and tilt sensor)
- Third brake light (in the rear spoiler (LED))
- Electric tailgate operation including comfort opening
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear (including anti-pinch protection and child safety lock)
- front and rear floor mats
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec (Start/Stop automatic including brake energy recuperation)
- Aero rear window wiper including windshield washer system
- Kessy - keyless entry and start-stop system
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger, including humidity sensor, odor and allergen filter and air-conditioned glove compartment)
- LED headlights with LED daytime running lights (incl. adaptive front headlights (AFS): lighting system with fully automatic and situation-dependent light control (city, country road, motorway and bad weather mode), cornering lights, automatic headlight range control)
- Steering wheel: Leather steering wheel with multifunction buttons (height and reach adjustable - gearshift lever with leather elements)
- Front center armrest, including storage compartment
- MSR (Motor drag torque control)
- Fog lights with integrated LED daytime running lights
- Package: Family (Removable waste bin for the door panel - Sunshades for the rear side windows - Door edge protectors - Electric child safety lock adjustment)
- Radio: Amundsen (Clever) infotainment system (Amundsen dynamic radio navigation system - 8" capacitive color display - voice control - Infotainment Online (1-year subscription))
- Radio accessories: Wireless SmartLink (Apple CarPlay)
- Storage compartments behind the wheel arches in the trunk
- Removable waste bin for the door panel
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Allergen filter
- Extended warranty for 3 years, max. 50,000 km
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming.
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hill start assist
- Care Connect: Proactive services (10-year term) (Remote Access (1-year term))
- Clever decorative inlay
- Diesel particulate filter
- Tachometer
- eCall (automatic emergency call function in case of an accident with airbag deployment)
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor ((tunnel light, coming and leaving home function))
- Front radar assistant including city emergency braking function with pedestrian detection
- Tinted windows
- Illuminated glove compartment
- Heated rear window
- Rear spoiler
- ISOFIX preparation on the outer rear seats (including top tether)
- Boot cover, roll-up and removable
- Front and rear headrests are height-adjustable.
- Paint finish: Solid
- LED ambient lighting (decorative strips in the door panels with selectable color climate, LED reading lights in the front, LED lighting for the make-up mirrors in the sun visors)
- LED taillights
- Steering wheel: Heated sports leather steering wheel with multifunction buttons (including paddle shifters and gearshift lever with leather elements)
- Rear center armrest with cup holders and pass-through option
- Multifunction display in the instrument cluster, color
- Network program in the trunk
- Park Assist 3.0
- Front and rear parking sensors
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+



- Wheels: 19" Aronia AERO Platinum alloy wheels (7Jx19 tires 235/50 R19 99V ET43)
- Heated windshield washer nozzles
- Electromechanical power steering
- Seats: Heated front and outer rear seats
- Seats: Driver and front passenger seats are height-adjustable (including adjustable lumbar support)
- Skoda Care Connect (SOS emergency call function (Emergency Call including automatic activation in the event of an accident with airbag deployment), Mobility service (connection for rapid assistance in case of breakdown), Information service (connection to the hotline for all questions regarding vehicle functions), Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone)
- Sunset (rear window and rear side windows tinted dark)
- Variable fastening concept in the boot (only for 5-seaters)
- Lashing eyes in the trunk
- Immobiliser
- Radio accessories: SmartLink (MirrorLink, Android Auto and Apple CarPlay)
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable, longitudinally adjustable, backrest angle adjustable
- Headlights washer / wiper system
- Kodiahq safety belts (Height-adjustable three-point seat belts in the front, with belt tensioners - Three three-point seat belts in the rear - Belt fastening indicator in the front and in the second row of seats)
- Skoda Infotainment Online (online map updates for navigation (only in conjunction with Columbus infotainment system) - display of weather data, news, headlines - petrol stations and parking space search and much more)
- Sunshade roller blind for the rear side windows
- 12V socket - in the center console and in the trunk
- Bumpers painted in body color (exterior mirrors and door handles painted in body color)
- Telephone: Comfort hands-free telephone system including phone box (with inductive charging function (connection via external antenna))
- Central locking with remote control

Extra equipment

- Option to opt out of standard extended warranty
- Luggage net partition
- Paint finish: Metallic
- Swiveling trailer hitch (with electric release, including trailer stabilization)
- Wheels: 18" steel spare wheel, space-saving (tire 145/85 R18 incl. jack, wheel bolt wrench, load floor cover replaces tire mobility kit)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Mudguard - right side	Wheel well extension - Scratch(es) - Smart repair
2	Front bumper	Spoiler - Scratch(es) - Smart repair
3	Mudguard - right side	Mudguard - right side - dent(s) - Smooth repair work
4	Door - rear right side	Door - dent(s) - Smart repair
5	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
6	Front bumper	Front bumper (inkl. Radlauf re.) - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Trim / covers	Floor mats - Holes - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Accident damages

No.	Accident
1	Rear, Side - left

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

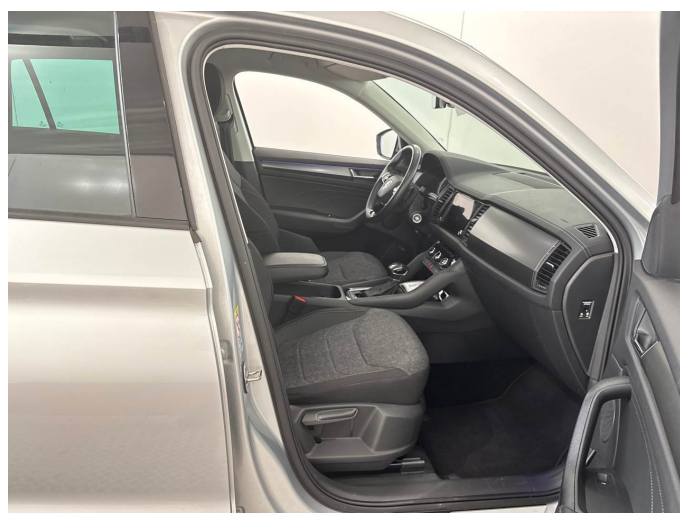


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

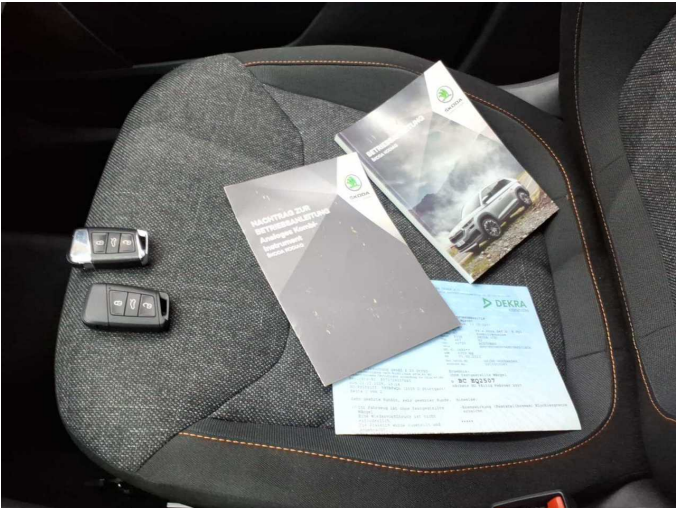


Figure 13: Documents

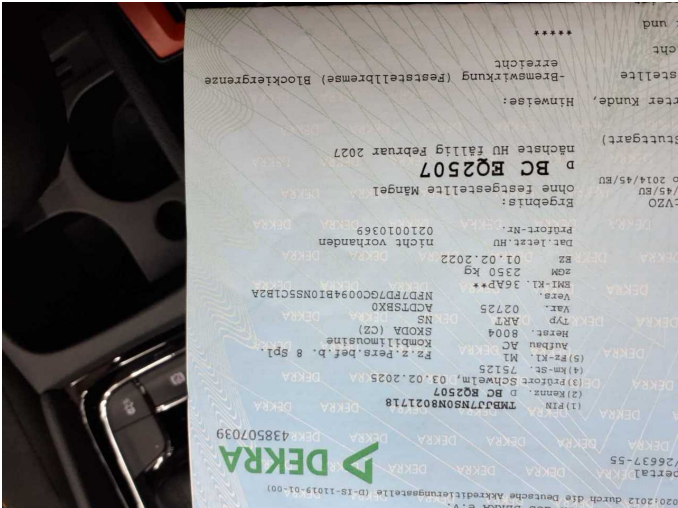


Figure 14: Documents



Figure 15: Documents



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.

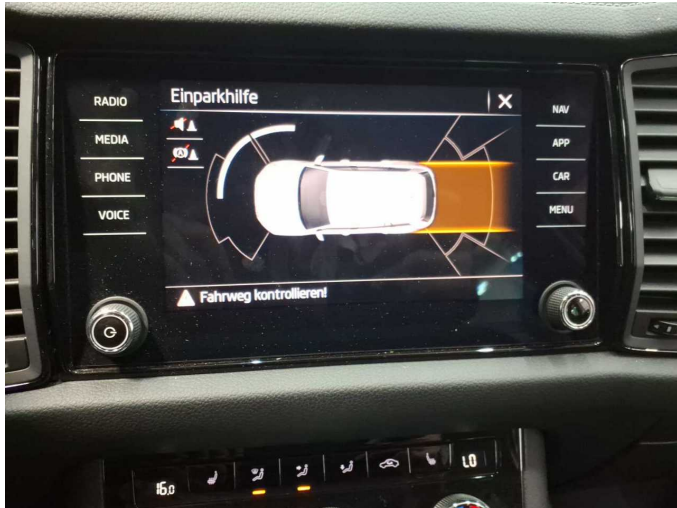


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

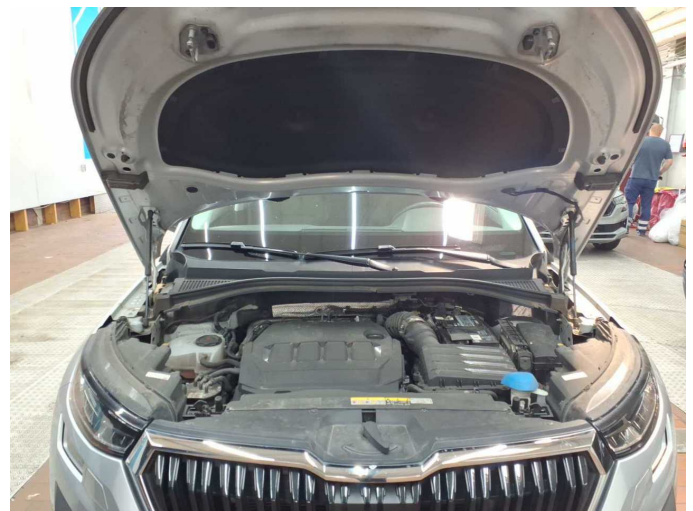


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

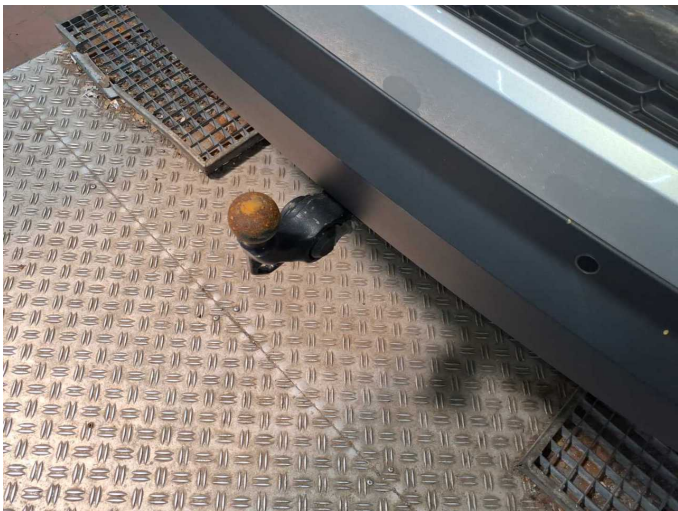


Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.



Figure 31: Misc.



Damage 1: Mudguard - right side: Wheel well extension - Scratch(es) - Smart repair

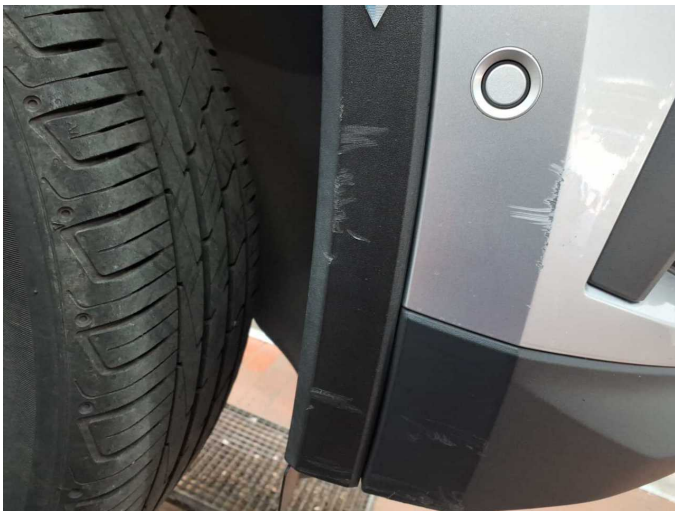

Damage 1: Mudguard - right side: Wheel well extension - Scratch(es) - Smart repair



Damage 2: Front bumper: Spoiler - Scratch(es) - Smart repair




Damage 3: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work



Damage 3: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work



Damage 4: Door - rear right side: Door - dent(s) - Smart repair

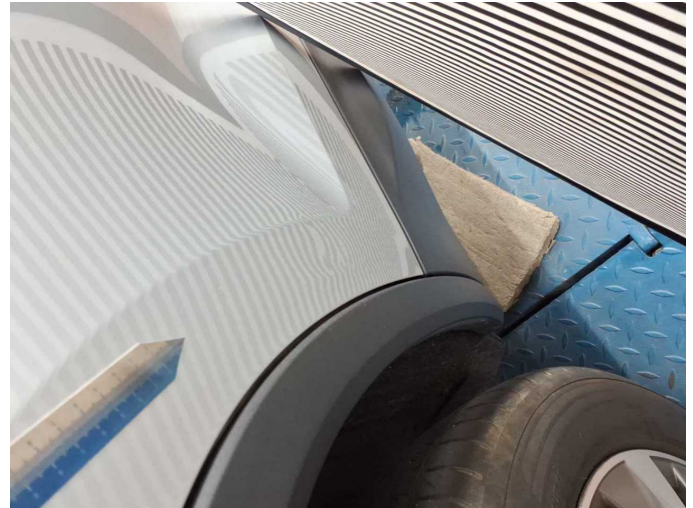

Damage 4: Door - rear right side: Door - dent(s) - Smart repair




Damage 4: Door - rear right side: Door - dent(s) - Smart repair




Damage 4: Door - rear right side: Door - dent(s) - Smart repair



Damage 5: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

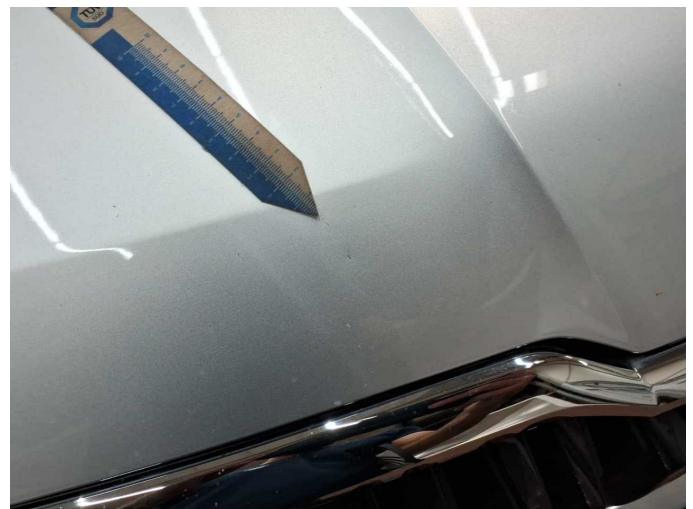


Damage 5: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

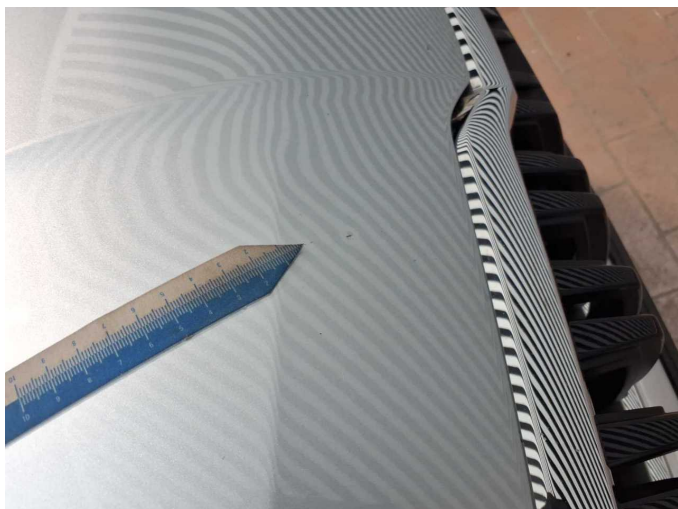

Damage 5: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 5: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

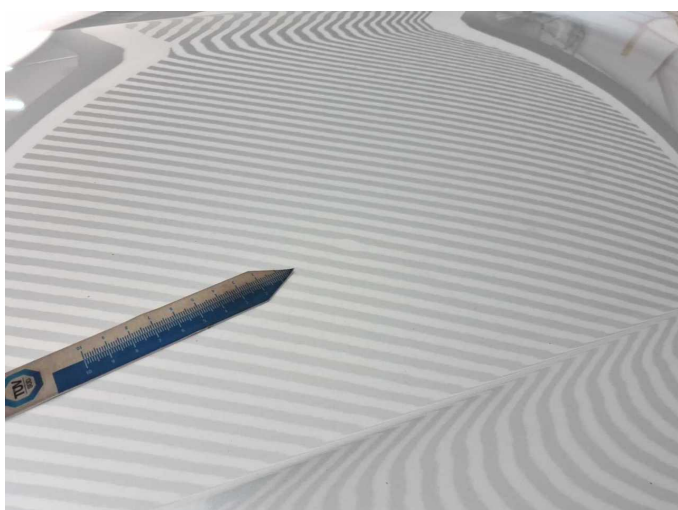

Damage 5: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 6: Front bumper: Front bumper (inkl. Radlauf re.) - Scratch(es) - Paint

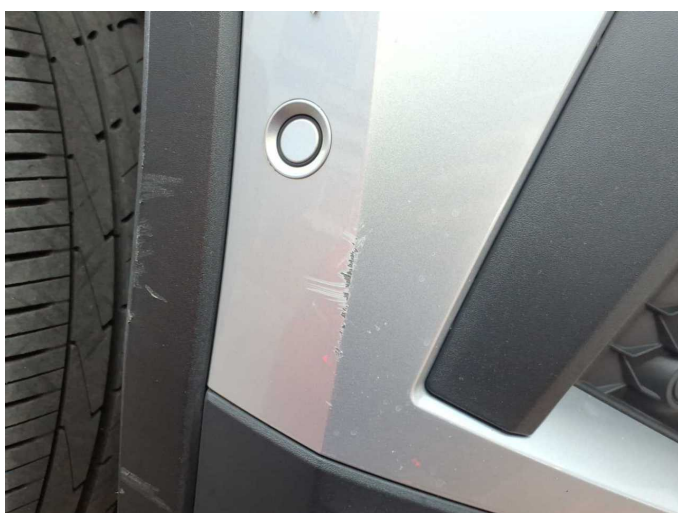


Damage 6: Front bumper: Front bumper (inkl. Radlauf re.) - Scratch(es) - Paint



Damage 6: Front bumper: Front bumper (inkl. Radlauf re.) - Scratch(es) - Paint



Damage 6: Front bumper: Front bumper (inkl. Radlauf re.) - Scratch(es) - Paint

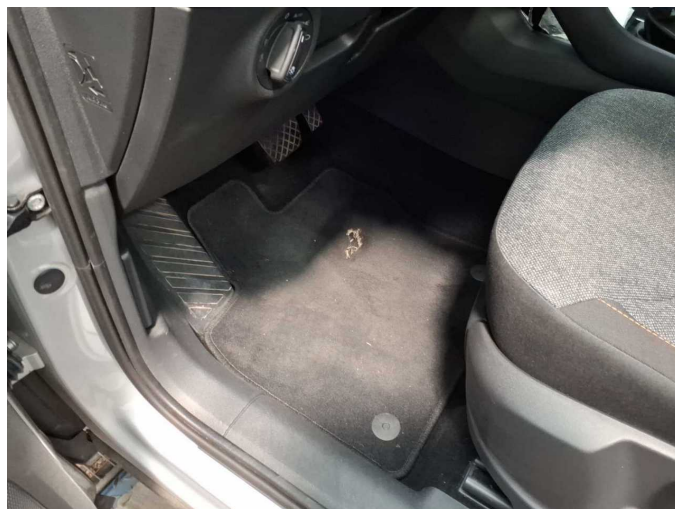

Wear and tear 2: Trim / covers: Floor mats - Holes - No deduction



Wear and tear 2: Trim / covers: Floor mats - Holes - No deduction



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJJ7NS0N8021718
Hersteller / Modell: SKODA SKODA Kodiaq 2.0 TDI DSG Clever

Datum	KM-Stand	Beschreibung
16.04.2026	106.817	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Systemtest/Eigendiagnose
07.10.2025	94.062	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
03.02.2025	75.125	HU + AU
18.12.2024	71.191	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
11.07.2024	60.633	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Wartung Sonstiges
08.12.2023	48.618	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
01.03.2023	30.684	Regelwartungsdienst; Wartung Sonstiges; Wartung Sonstiges