



Expertise

Protocol number: 46130348
Order No. / Reference: 26484964
Inspection date: 24 Jun 2026

Manufacturer: Audi

Model: Q5 50 TFSIe quattro S tronic S line

VIN: WAUZZZFY4P2114805



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi Q5 50 TFSIe quattro S tronic S line	
Vehicle Identification number	WAUZZZFY4P2114805
Mileage (Read)	180,419 km
First registration	30 May 2023
Number of holders	1
Power / Engine displacement	195 kw / 1,984 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Navarrablau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	-1,600 km
Last service on / at	02/2026 at 163,328 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS473956
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BYI 00099		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,660 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105W	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	235/55 R19 105W	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/65 R17 104H	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	235/65 R17 104H	Winter tyres on Light alloy	Continental	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Acoustic vehicle warning system
- "quattro" all-wheel drive with ultra technology
- Traction control (ASR)
- Audi drive select
- Audi pre sense city
- Exterior mirror housings in body color
- Fabric headliner
- Black roof rails with roof rack recognition
- Tachometer
- Rear parking sensors
- Electromechanical parking brake
- Electronic Differential Lock (EDS)
- Driver information system with color display
- Remote key (without Safe-Lock)
- Luggage compartment lid, electrically opening and closing
- Transmission: S tronic 7-speed
- Heated rear window
- PHEV hybrid drive system
- Interior lighting
- Manual child lock
- Automatic air conditioning
- 3-zone automatic climate control
- Front headrests
- Stainless steel loading sill protector
- LED headlights
- Light/rain sensor
- front center armrest
- Non-smoking version
- Wheel: On-board tools (excluding jack)
- Wheel: Tire repair kit
- Radio accessories: Data module Europe
- Seat belts
- Seats: Standard front seats
- Seats: Front seats manually adjustable
- Stationary air conditioning
- Phone: Bluetooth interface
- First aid kit with warning triangle
- Glazing: Clear glass
- Electronic immobilizer
- black decorative trim
- Airbag: Front side airbags and head airbag system
- Accent areas matte black
- Anti-lock braking system (ABS)
- Audi connect emergency call & service with Audi connect Remote & Control
- Electrically adjustable and heated exterior mirrors
- Hill descent control
- Roof edge spoiler
- Decorative inlays Micrometallic silver
- e-tron compact charging system
- Door sill trims with aluminum inlay at the front, illuminated, with S lettering
- Electronic Stability Control (ESC)
- Electric windows front and rear
- front and rear floor mats
- Cruise control system including speed limiter
- Household plug type E/F
- rear window wiper
- Industrial plug CEE 16A / 400V / long+straight
- Interior mirror dimming
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Rear headrests (3)
- Mode 3 charging cable
- LED taillights
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction
- Model designation according to new performance labeling
- Otto particulate filter
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio plus
- Electromechanical power steering
- Fabric seat covers (synonym)
- Seats: Rear bench seat plus
- Sun visor on driver and passenger side
- Start-stop system
- Separation net
- Glazing: Windscreen in heat-insulating and acoustic glazing
- thermal insulation glazing

Extra equipment

- Head-up Display (On request, the speed and other driver-relevant information from optional equipment such as assistance systems and navigation, as well as warning messages, are projected into the driver's direct field of vision - The multi-color display enables a high-contrast presentation - The projection surface of the discreetly integrated head-up display in the instrument panel is adjustable in height and brightness - Includes acoustically coated windshield)
- Ambient Lighting Package Plus (in addition to the standard interior lighting (LED): - Approach lighting in the exterior door handles - Entry lights on the underside of the front and rear doors (white) - Footwell lighting front and rear (white) - Interior door handles front and rear (white) - Ambient lighting in the front and rear doors, multi-colored - Illuminated storage compartment below the instrument panel - Ambient lighting on the front center console, multi-colored - Illuminated decorative inserts in the instrument panel and doors, multi-colored)
- Tour Assistance Package (adaptive cruise control - traffic jam assist - Audi active lane assist - predictive efficiency assist - Audi pre sense front - evasive steering assist - left turn assist - high beam assist - camera-based traffic sign recognition)
- S line interior package (sports seats in front - black cloth/leather combination with S embossing on the seatbacks - 3-spoke leather steering wheel with multifunction plus in black (perforated leather steering wheel grips) with S emblem; with contrast stitching, color-coordinated with the respective interior color; with shift paddles - matte brushed aluminum trim - glossy black accents - illuminated front door sills with aluminum inserts - stainless steel pedals and footrest (not for plug-in hybrids) - front and rear floor mats - black cloth headliner)
- Wheel: Light alloy wheels, 19" 5-twin-spoke star (S-design), polished (8.0 J x 19, tires 235/55 R 19)
- Seats: Lumbar support for the front seats, electric (4-way) (horizontally and vertically adjustable)
- Telephone: Audi smartphone interface (The Audi smartphone interface (Android Auto and Apple CarPlay) connects your smartphone to your Audi and seamlessly displays your smartphone content directly on the MMI display via USB. Navigation, telephony, music and selected third-party apps can be conveniently controlled via the MMI touchscreen as well as via voice control on your smartphone.)
- Paint finish: Metallic
- LED headlights: Matrix LED headlights with dynamic light display and dynamic turn signals (multifunction camera - headlight cleaning system). Front and rear LED headlights with the following functionalities: - visually enhanced daytime running lights - low beam - high beam - position lights - turn signals - cornering lights - all-weather lights - maneuvering lights - motorway lights - automatic dynamic headlight range control - static cornering lights - dynamic light display for coming home/leaving home functions.
- Parking Assistance Package (surround view cameras - Parking Assistant with Parking Aid Plus: The Parking Assistant with Parking Aid Plus detects suitable parking spaces. The driver is actively supported during parking maneuvers through targeted steering inputs. A visual display warns of obstacles. Within the detection range of the ultrasonic sensors, the Parking Assistant helps in finding a suitable parking space along the roadway. The system supports the driver during parking maneuvers through targeted steering inputs.)
- Business package (Audi phone box - MMI Navigation plus (incl. driver information system with color display) - Audi virtual cockpit - Heated front seats - Automatically dimming interior mirror - Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides incl. curb view function for the passenger mirror - High beam assist - Manual sunshade for rear door windows)
- Panoramic glass roof (2-piece, electric operation for tilting and opening the front glass element, tinted glass insert; including an electrically operated sunshade for the front and rear passengers, comfort closing from the outside via the vehicle key, ensures a light-flooded interior ambience, improves the interior climate through efficient ventilation, including integrated wind deflector.)
- Radio accessories: Bang & Olufsen Premium Sound System with 3D sound (19 speakers (including center speaker/subwoofer and additional 3D sound tweeters and midrange drivers) - 16-channel amplifier with 755 watts - illuminated front speaker grilles - speed-dependent volume adjustment - spatial sound reproduction thanks to the new 3D sound feature. This is created by additional speakers in the A-pillar, by the midrange drivers and by Fraunhofer Symphoria technology.)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door edge - Scratch(es) - Smart repair
2	Door - rear right side	Door - dent(s) - Smooth repair work
3	Wheel / tyres	Alloy rim - front left side - Scratched - Loss in value
4	Misc.	Inspection / maintenance - Due - Perform

Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction
2	Rear bumper	Rear bumper - Scratch(es) - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction
4	Vehicle glazing	Windscreen - Stone chips - No deduction
5	Door - front right side	Door - Scratch(es) - No deduction
6	Boot lid / rear door	Boot lid - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Tirefit filler

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 12 Jul 2025	4.829,31 €
2	Front, Provided by user / customer, from 28 May 2025	4.869,82 €

Repainting

No. Repainting

1	Mudguard - left side, Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
---	--

Paint coat thickness measurement

Mudguard - left side	189 µm	Door - rear left side	195 µm
----------------------	--------	-----------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

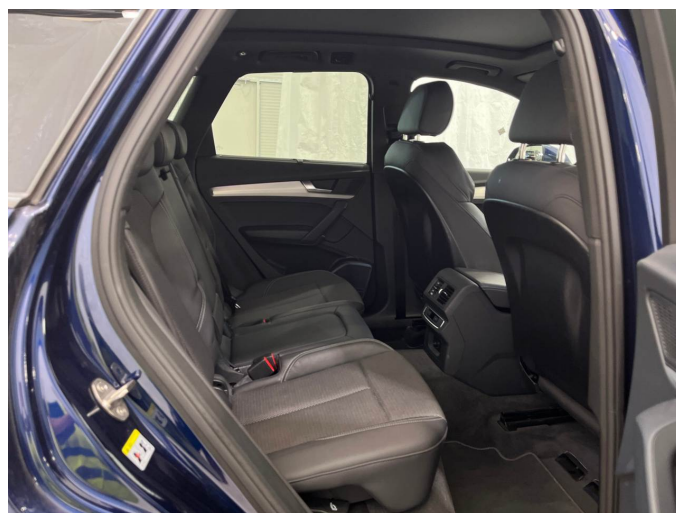


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

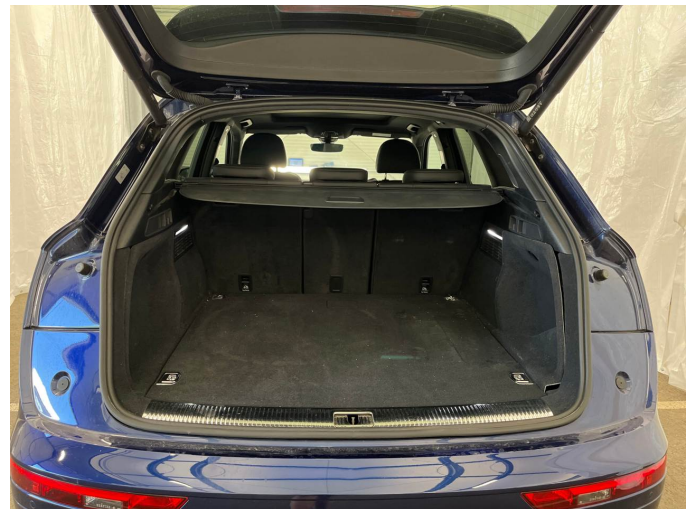


Figure 10: Cargo area

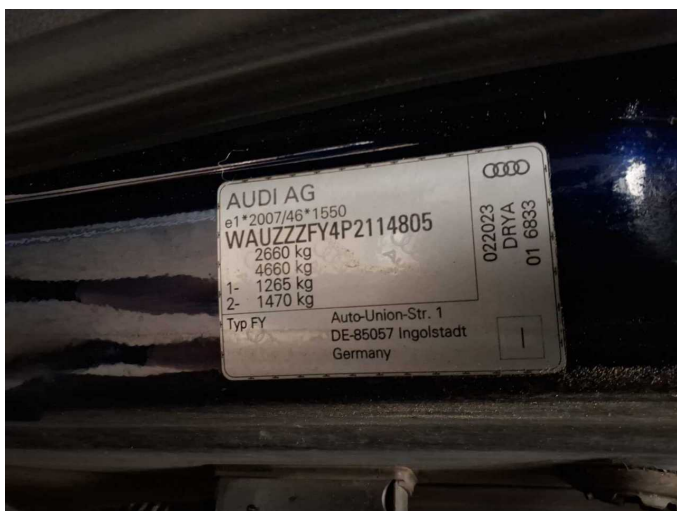


Figure 11: VIN



Figure 12: Mounted tyres

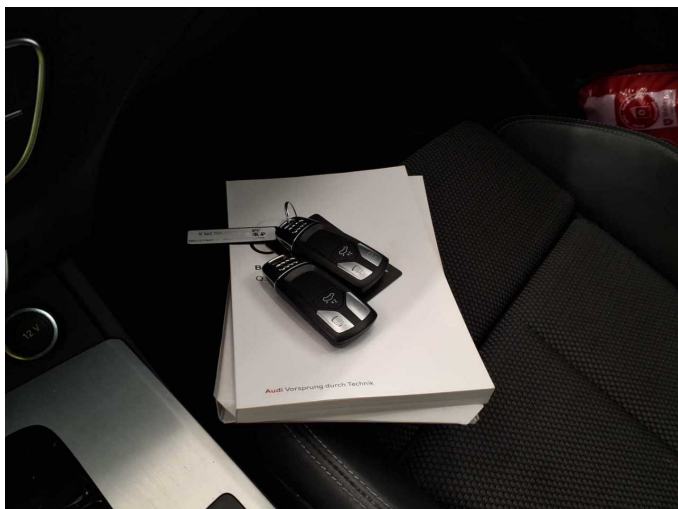


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

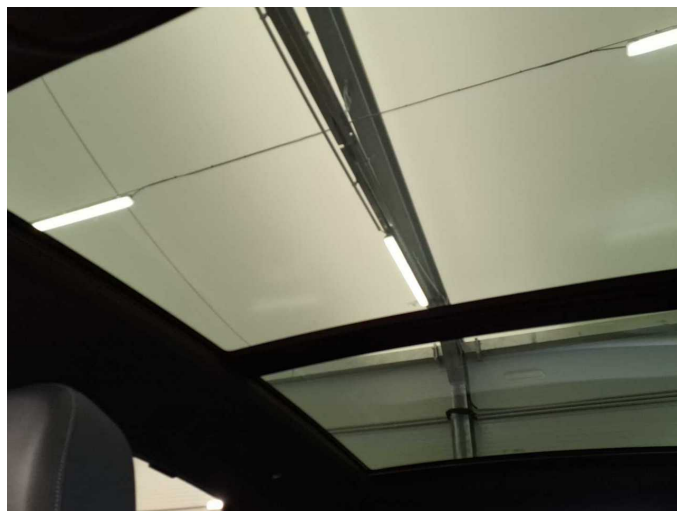


Figure 20: Misc.

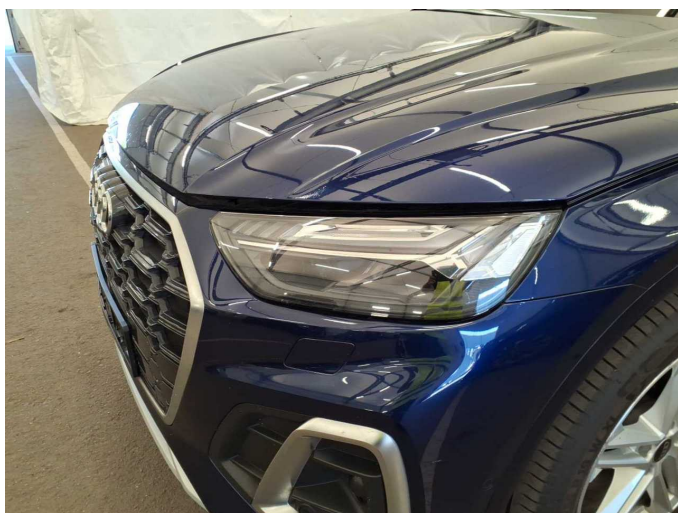


Figure 21: Misc.

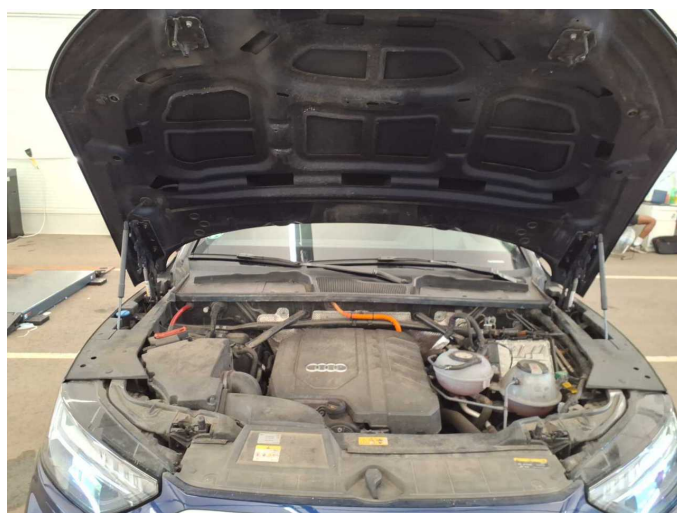


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.




Figure 26: Misc.




Figure 27: Misc.



Figure 28: Misc.

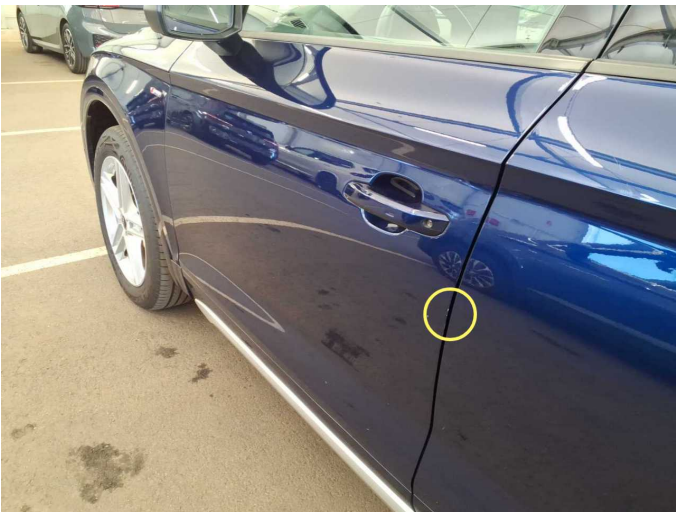

Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair

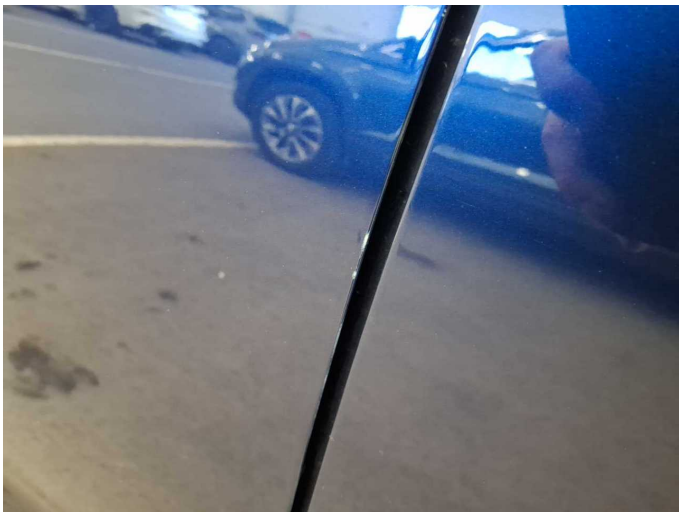

Damage 1: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Door - rear right side: Door - dent(s) - Smooth repair work




Damage 2: Door - rear right side: Door - dent(s) - Smooth repair work



Damage 3: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 3: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value

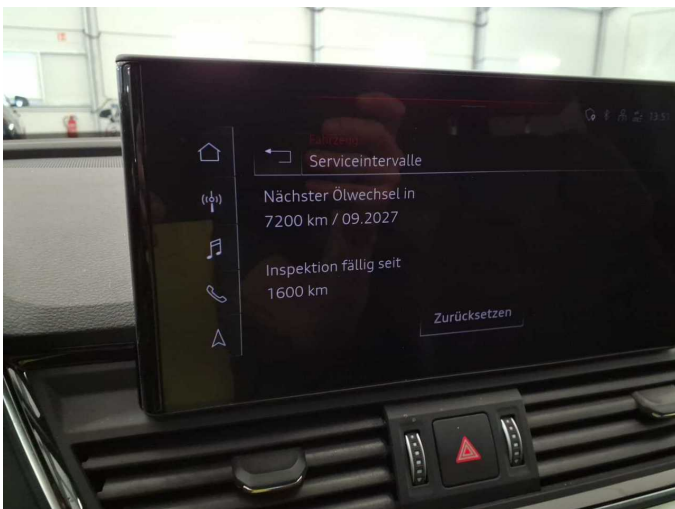

Damage 4: Misc.: Inspection / maintenance - Due - Perform



Repainting 1: Mudguard - left side, Door - rear left side



Repainting 1: Mudguard - left side, Door - rear left side



Repainting 1: Mudguard - left side, Door - rear left side



Repainting 1: Mudguard - left side, Door - rear left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZFY4P2114805
Hersteller / Modell: AUDI AUDI Q5 50 TFSle quattro S tronic S line

Datum	KM-Stand	Beschreibung
02.02.2026	163.328	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
29.01.2026	106.628	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
06.11.2025	148.773	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Regelwartungsdienst; Reparatur Sonstiges
26.08.2025	136.769	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
30.04.2025	123.110	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Regelwartungsdienst; Zündkerzen ern
11.10.2024	90.700	Luftfiltereinsatz ern; Regelwartungsdienst; Wartung Sonstiges
09.08.2024	79.498	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
03.04.2024	59.746	Getriebeöl ern/prüfen; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
16.02.2024	51.634	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
19.10.2023	27.783	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges