



Expertise

Protocol number: 46531252
Order No. / Reference: 26652761
Inspection date: 15 Jul 2026

Manufacturer: Audi

Model: A4 allroad quattro 40 TDI S tronic

VIN: WAUZZZF42PA057491



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A4 allroad quattro 40 TDI S tronic	
Vehicle Identification number	WAUZZZF42PA057491
Mileage (Read)	93,617 km
First registration	1 Jun 2023
Number of holders	1
Power / Engine displacement	150 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Ibisweiß
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Grey



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	21,700 km
Last service on / at	03/2026 at 85,264 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS462581
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BWK 00249		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,250 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 97Y	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	225/55 R17 97Y	Summer tyres on Light alloy	Continental	4mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 97H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/55 R17 97H	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- "quattro" all-wheel drive with ultra technology
- Traction control (ASR)
- Audi drive select
- Audi pre sense city
- Vehicle tool kit
- Fabric headliner
- Diesel particulate filter (DPF)
- Door sill trims with aluminum inlay at the front
- Electronic Differential Lock (EDS)
- Driver Information System
- electric window regulator
- Remote key, without SafeLock
- Luggage compartment lid, electrically opening and closing
- Transmission: S tronic 7-speed
- Interior lighting
- Child lock
- Automatic air conditioning
- boot floor mat
- Fuel tank with increased filling volume (58 l)
- Manual cargo cover
- Steering column, manually adjustable in height and axis
- Mild hybrid
- Non-smoking version
- Radio: MMI Radio plus
- Radio accessories: Digital radio reception (DAB)
- Tire repair kit
- Electromechanical power steering
- Seats: Standard front seats
- Seats: Front seats manually adjustable
- First aid kit with warning triangle
- Electronic immobilizer
- Central locking "Keyless-Go" without deadbolt
- Airbag for driver and front passenger
- Accent areas matte black
- Anti-lock braking system (ABS)
- Audi connect emergency call & service with Audi connect Remote & Control
- Exterior mirror housings in body color
- third brake light, raised
- Black roof rails
- Tachometer
- Electromechanical parking brake
- Electronic Stability Control (ESC)
- Chassis: Allroad standard chassis
- Window channel strips in black (rubber)
- front and rear floor mats
- Cruise control system with speed limiter
- rear window wiper
- Interior mirror dimming
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Headrests (5)
- Loading floor
- LED taillights
- Light/rain sensor
- front center armrest
- Wheel: Alloy wheels, 15 spokes
- Radio accessories: 8 speakers (passive) front and rear
- Tire pressure monitoring system
- Headlights using LED technology
- Fabric seat covers Index
- Seats: Rear seat backrest foldable
- Start-stop system
- Glazing: Windscreen in heat-insulating and acoustic glazing

Extra equipment

- Business Package (MMI Navigation plus with MMI touch (including driver information system with color display) - Audi phone box - Leather steering wheel in 3-spoke design with multifunction plus - Heated front seats - Automatically dimming, frameless interior mirror - Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides - Rear parking aid - High-beam assistant - Manual sunshade for the rear door windows)
- Comfort key with sensor-controlled luggage compartment unlocking (including visual differentiation on the top and bottom of the key; access authorization system: the key simply needs to be carried in the vehicle. Starting and stopping the engine via the engine start/stop button in the center console; locking and unlocking the vehicle from the outside via sensors on all door handles. Additionally, a foot gesture (kick movement) below the rear bumper unlocks the luggage compartment lid and opens it automatically, even when the vehicle is locked).
- Decorative inlay in silver aluminum ellipse (for dashboard, door panels and center console)
- Deletion of model designation and performance/technology lettering
- Front seat heating (heats seat and backrest center panels; with leather upholstery, sport seats and S sport seats also seat side bolsters - individually adjustable in multiple stages for driver and front passenger side via the climate control unit)
- Glazing: Sun protection glazing, tinted (rear window, rear door and side windows tinted)
- Mechanically swiveling towbar (Conveniently locks and unlocks via a release mechanism. - Mechanically swiveling ball head with electric release, controlled by a button in the luggage compartment - Ball shaft and head made of forged steel - Trailer stabilization via the electronic stability control (ESC) - Swiveling system socket allows continuous operation of electrical devices in the trailer or caravan, even while driving)
- Paint finish: Solid
- Parking Assistance Package (The parking assistant with parking aid plus detects suitable parking spaces. Targeted steering maneuvers actively support the driver when parking and exiting. A visual display warns of obstacles. For perpendicular parking spaces, the entry path is calculated; for parallel parking spaces, the entry and exit paths are calculated. Four wide-angle surround-view cameras capture the entire area immediately surrounding the vehicle.)
- Radio accessories: Audi sound system (10 speakers including center speaker and subwoofer - 6-channel amplifier - total output of 180 watts)
- Assistance package Tour in conjunction with Business (adaptive cruise control including Stop&Go function - traffic jam assistant - predictive efficiency assistant - Audi pre sense city (standard) - Audi pre sense front - swerve assistant - left turn assistant - camera-based traffic sign recognition - high beam assistant - Audi active lane assist)
- Auxiliary heating/ventilation (The auxiliary heater warms the interior and defrosts the windows without starting the engine. The auxiliary ventilation supplies fresh air and lowers the interior temperature. Both functions can be activated via a timer or separate remote control. An intelligent control system with timer and departure time programming calculates the heating duration efficiently in terms of time and energy. Two heating modes are selectable: defrost (defrost mode for the windows only) and warm (warm-up mode for additional preheating of the interior).
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides (including curb view function for passenger-side exterior mirror with integrated LED turn signal, including heated windshield washer nozzles; the curb view function folds the passenger-side mirror down when reverse gear is engaged, giving the driver a better view of the curb edge)
- LED matrix headlights, LED taillights and headlight cleaning system (Matrix LED technology combines a camera system with LED light sources and precise optics for highly adaptive light distribution. In addition to the matrix LED function, the headlights offer the following features: - visually enhanced daytime running lights - low beam - high beam - position lights - dynamic turn signals - cornering lights - all-weather lights - static cornering lights - motorway lights - automatic dynamic headlight range control - coming home/leaving home function)
- Package: Ambient Lighting Package (in addition to the interior lighting: - approach lighting in the exterior door handles - entry lights on the underside of the front doors - illuminated front cupholders - front footwell lighting - illuminated interior door handles - ambient door lighting - ambient lighting in the front center console)
- Rail system with fixing set (in the luggage compartment, with telescopic rod, fixing strap and variable lashing eyes for individual partitioning of the luggage compartment and for fixing objects)
- Roof: Panoramic glass roof (Impresses with its user-friendly operation. The front glass section can be opened and closed electrically. The sunshades are operated with the same ease. The panoramic glass roof can also be operated from outside using the remote key via comfort opening and closing. When open, the two-part panoramic glass roof improves the interior climate through efficient ventilation. An integrated wind deflector reduces wind noise.)



- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction plus (The steering wheel impresses with its high-quality look and aluminum trim and feels good in the hand. Height and reach of the steering wheel are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with 12 multifunction buttons. It also includes paddle shifters for manually changing gears with an automatic transmission.)
- Wheel: Audi new car tire warranty (36-month term from vehicle handover to the first customer)
- Storage and luggage compartment package (flexible transport of items and comfort while traveling, consisting of: - storage net on the back of the front seatbacks - cupholder in the rear center armrest - storage compartment on the driver's side - lockable glove compartment in the luggage compartment: - luggage compartment net - net recesses left and right - tension strap right)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
3	Rear bumper	Spoiler - Scratched - Smart repair
4	Engine	Engine cover - Damaged - Replace
5	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Smart repair
6	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Smart repair
7	Cab	Door rubber seal - left side - Damaged - Replace
8	Rear bumper	Rear bumper - Scratched - Paint
9	Front bumper	Front bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Professionally repaired, Invoice of repair done Non-existent	

Repainting

No.	Repainting
1	Bonnet, Professionally carried out, Invoice of repair done Non-existent



Paint coat thickness measurement

Bonnet

240 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

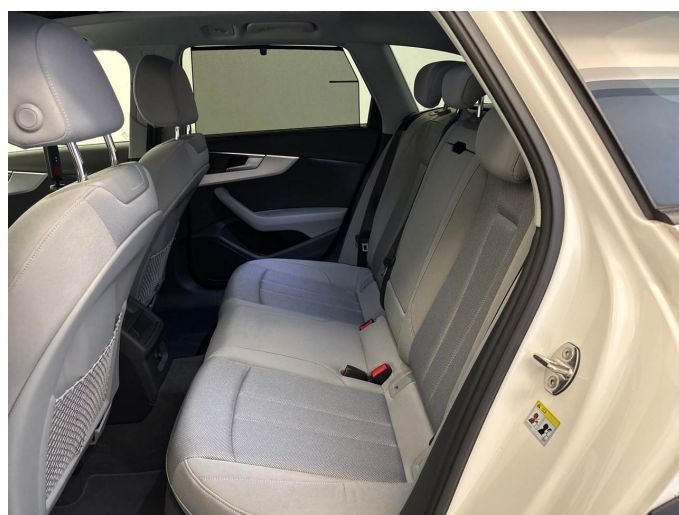


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

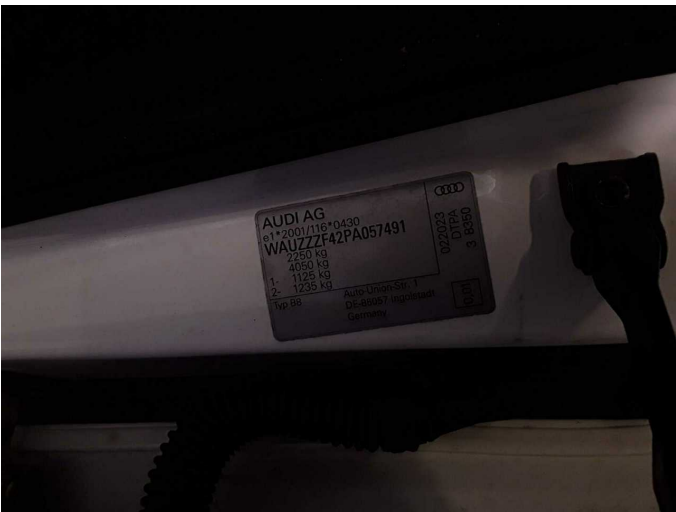


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation

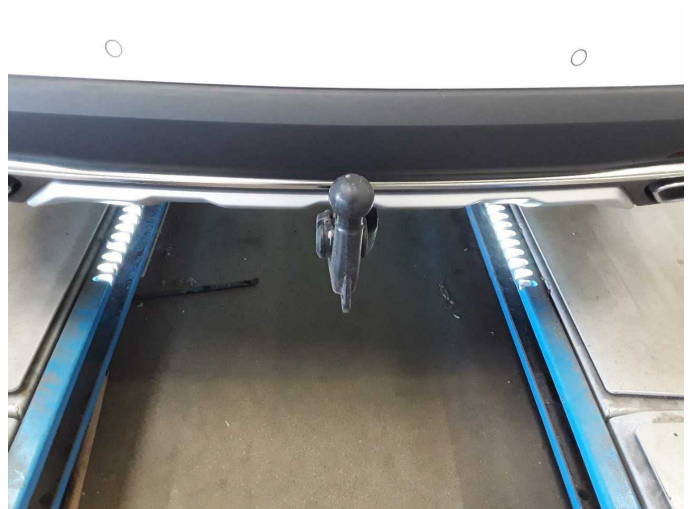


Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.

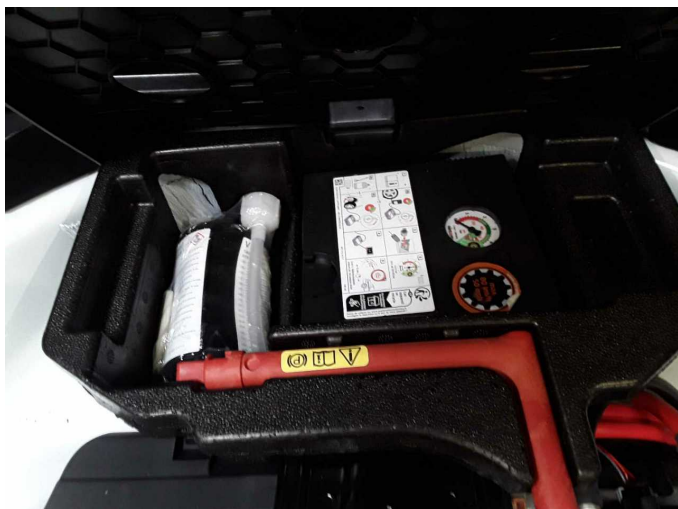


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

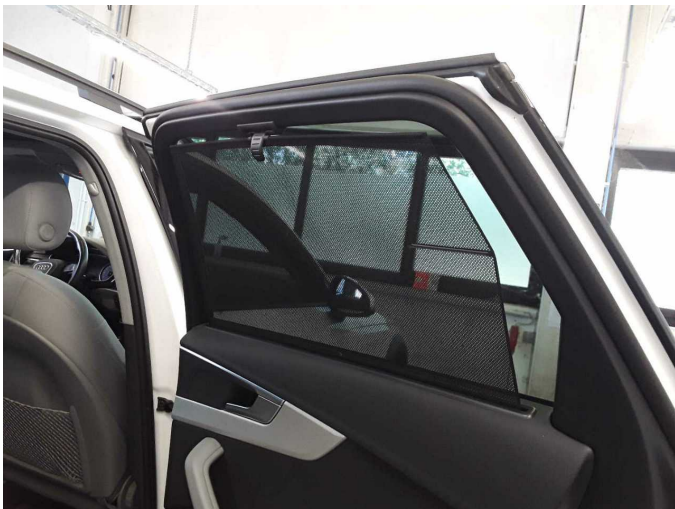


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Damage 2: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise




Damage 3: Rear bumper: Spoiler - Scratched - Smart repair



Damage 3: Rear bumper: Spoiler - Scratched - Smart repair



Damage 4: Engine: Engine cover - Damaged - Replace

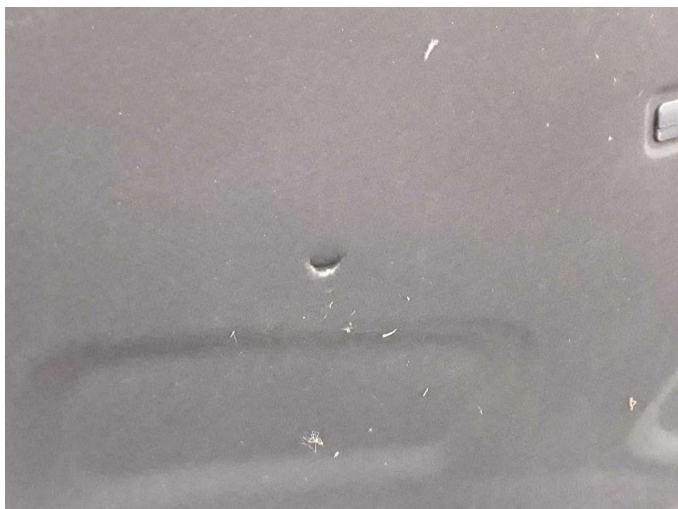


Damage 4: Engine: Engine cover - Damaged - Replace



Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Smart repair



Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Smart repair

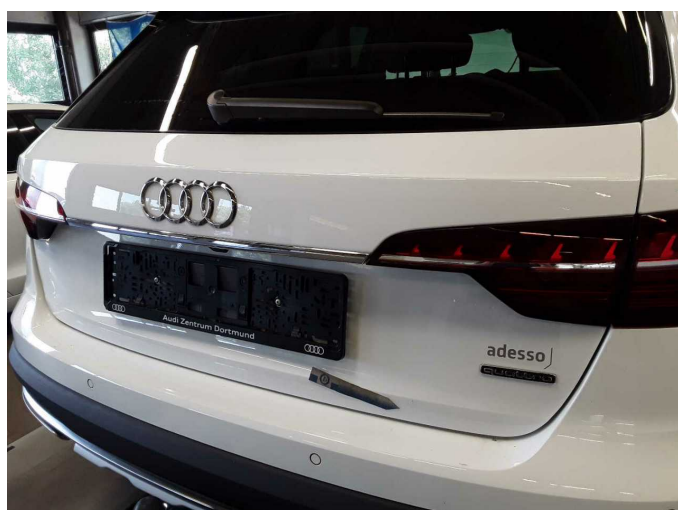

Damage 6: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage 6: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage 7: Cab: Door rubber seal - left side - Damaged - Replace



Damage 7: Cab: Door rubber seal - left side - Damaged - Replace



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint



Repainting 1: Bonnet



Repainting 1: Bonnet



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF42PA057491

Hersteller / Modell: AUDI AUDI A4 allroad quattro 40 TDI S tronic

Datum	KM-Stand	Beschreibung
25.03.2026	85.264	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
09.04.2025	57.822	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
15.04.2024	28.749	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges