



Expertise

Protocol number: 45877671
Order No. / Reference: 26574127
Inspection date: 10 Jun 2026

Manufacturer: Mercedes-Benz

Model: GLC 220 d 4Matic 9G-TRONIC AMG Line Advanced

VIN: W1NKM0FB8RU037267



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC 220 d 4Matic 9G-TRONIC AMG Line Advanced	
Vehicle Identification number	W1NKM0FB8RU037267
Mileage (Read)	96,668 km
First registration	6 Sept 2023
Number of holders	1
Power / Engine displacement	145 kw / 1,993 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	MOJAVESILVER METALLIC
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	9,037 km
Last service on / at	12/2025 at 80,705 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV727705
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BJX 00105		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,550 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105W	Summer tyres on Light alloy	Pirelli	6mm / 6mm
2)	235/55 R19 105W	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103H	Winter tyres on Light alloy	Continental	6mm / 5mm
2)	235/60 R18 103H	Winter tyres on Light alloy	Continental	8mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 09/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Adaptive Highbeam Assist
- Airbag: Kneebag for driver
- Airbag: Windowbag
- Active Lane Keeping Assist
- Ambient lighting
- AMG floor mats
- AMG Line Exterior
- AMG sports pedal assembly made of brushed stainless steel with black rubber studs
- ATTENTION ASSIST
- Basic services
- Roof rails made of glossy anodized aluminum
- Double cup holder
- Tachometer
- EASY-Pack: Cargo area cover
- Driver display
- Fingerprint scanner
- Rear window heated
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control
- Communication module (LTE) for the use of Mercedes me connect services
- Paint finish: Solid
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Center console in high-gloss black
- Navigation accessories: Pre-installation for Live Traffic Information
- Navigation: Hard disk navigation
- Package: Storage
- Package: Chrome Interior Package
- Package: Boot Comfort Package
- Package: Seating comfort
- Package: USB package
- Radio accessories: Digital radio (DAB)
- Tire pressure loss warning
- Wheels: 48.3 cm (19") AMG light-alloy wheels in 5-spoke design, painted tantalum grey
- Windscreen wipers with rain sensor
- Heated seats for driver and front passenger
- Phone accessories: Wireless charging system for mobile devices
- Pre-installation for digital key handover
- Immobiliser
- Central display
- Decorative elements: metal structure
- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- 4MATIC all-wheel drive
- AMG front apron with sporty air intakes and chrome trim element
- AMG Line interior
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Automatic passenger airbag deactivation
- Brake system with larger brake discs on the front axle
- Diesel particulate filter
- Downhill speed regulation (DSR)
- EASY-PACK tailgate
- Electronic Stability Program (ESP)
- Chassis: Sport chassis
- Transmission: 9G-TRONIC
- Rear window wiper/washer system
- Instrument panel and door sills in ARTICO man-made leather in black nappa look
- Radiator grille with Mercedes-Benz pattern and integrated Mercedes star
- LED High Performance Headlights
- Steering: Sport direct steering
- Mercedes-Benz emergency call system
- Navigation accessories: Extended MBUX functions
- Navigation accessories: Pre-installation for navigation services
- Navigation: MBUX Navigation Premium
- Package: AMG Line Advanced
- Package: Interior light
- Package: Parking package with reversing camera
- Package: Mirror Package
- Upholstery: ARTICO leatherette/MICROCUT microfiber
- Radio accessories: MBUX multimedia system
- Remote Services
- Wheels: Summer tires
- Wheel accessories: TIREFIT with tire inflator compressor
- Seats: 4-way lumbar support for driver and front passenger
- Sporty engine sound
- Phone accessories: Smartphone integration
- Cruise control
- High-visibility vest for drivers
- Heat-insulating dark tinted glass
- Central locking with remote control



Extra equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Airbag: Side airbags in the rear • Chassis: AGILITY CONTROL chassis with selective damping system • Paint finish: Metallic • Package: AMG Line Premium Plus (electrically adjustable driver's seat with memory function - Blind Spot Assist - Illuminated door sills with "Mercedes-Benz" lettering - Traffic Sign Assist - Acoustic glass - KEYLESS-GO Comfort Package - DIGITAL LIGHT with projection function - Parking Package with 360° camera - MBUX Augmented Reality for navigation - Panoramic sliding sunroof - Head-up display - THERMOTRONIC automatic climate control - Burmester 3D surround sound system) • Wheels: Winter complete wheels M+S 4-way 45.7 cm (18") (Light alloy wheels in 5-twin-spoke design, vanadium silver painted with 235/60 R 18 on 8 J x 18 ET 32.5) | <ul style="list-style-type: none"> • Towbar with ESP trailer stabilization • Fire extinguisher • Head-up display • Center console metal structure • Package: Winter Package (heated steering wheel - heated windshield washer system) • Radio accessories: Sound personalization • Radio accessories: Pre-installation for MBUX Entertainment • Wheels: 48.3 cm (19") AMG light-alloy wheels in 5-spoke design, painted tantalum grey in conjunction with Night Package. • Wheels: Complete summer wheel sets fitted at the factory • Auxiliary heater (with auxiliary ventilation) • Cargo net (This feature protects you from loose items in the luggage compartment. The cargo net is very easy to use. You can attach or remove it in just a few steps.) |
|---|---|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Mudguard - left side	Mudguard - left side - dent(s) - Smooth repair work
2	Door - rear left side	Door - dent(s) - Smooth repair work
3	Side panel - rear left side	Sill - Scratch(es) - Smart repair
4	Side panel - rear left side	Wheel well extension - Scratched - Replace
5	Roof	Roof rail - left side - dent(s) - Smooth repair work
6	Interior	Interior (Haare/ Folgekosten möglich) - Soiled - Clean
7	Wheel / tyres	Alloy rim - front left side - Scratched - Loss in value
8	Rear bumper	Rear bumper - Scratched - Paint
9	Bonnet	Bonnet - Scratch(es) - Repair and paint



Wear and tear

No.	Component group	Description
1	Side panel - rear right side	Wheel well extension - Scratch(es) - No deduction
2	Sill - right side	Trim - Scratched - No deduction
3	Mudguard - left side	Wheel well extension - Scratch(es) - No deduction
4	Boot lid / rear door	Boot lid - Scratch(es) - No deduction
5	Sill - right side	Sill - dent(s) - No deduction
6	Side panel - rear left side	Side panel - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der beiliegende Winterradsatz ist Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Damage 1: Mudguard - left side: Mudguard - left side - dent(s) - Smooth repair work



Damage 1: Mudguard - left side: Mudguard - left side - dent(s) - Smooth repair work



Damage 2: Door - rear left side: Door - dent(s) - Smooth repair work




Damage 2: Door - rear left side: Door - dent(s) - Smooth repair work



Damage 3: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear left side: Sill - Scratch(es) - Smart repair

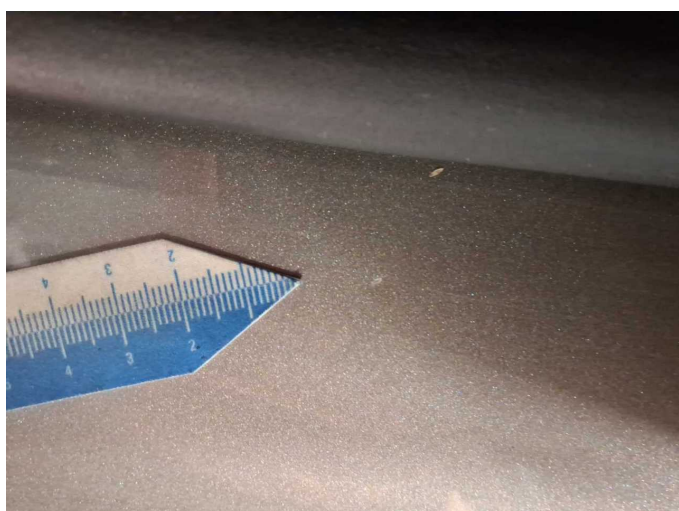

Damage 3: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 4: Side panel - rear left side: Wheel well extension - Scratched - Replace



Damage 4: Side panel - rear left side: Wheel well extension - Scratched - Replace



Damage 4: Side panel - rear left side: Wheel well extension - Scratched - Replace



Damage 5: Roof: Roof rail - left side - dent(s) - Smooth repair work



Damage 5: Roof: Roof rail - left side - dent(s) - Smooth repair work



Damage 5: Roof: Roof rail - left side - dent(s) - Smooth repair work




Damage 5: Roof: Roof rail - left side - dent(s) - Smooth repair work




Damage 6: Interior: Interior (Haare/ Folgekosten möglich) - Soiled - Clean




Damage 6: Interior: Interior (Haare/ Folgekosten möglich) - Soiled - Clean

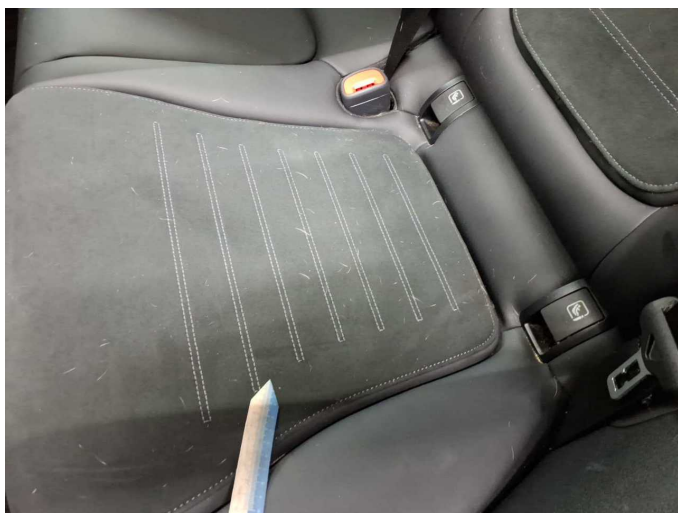


Damage 6: Interior: Interior (Haare/ Folgekosten möglich) - Soiled - Clean

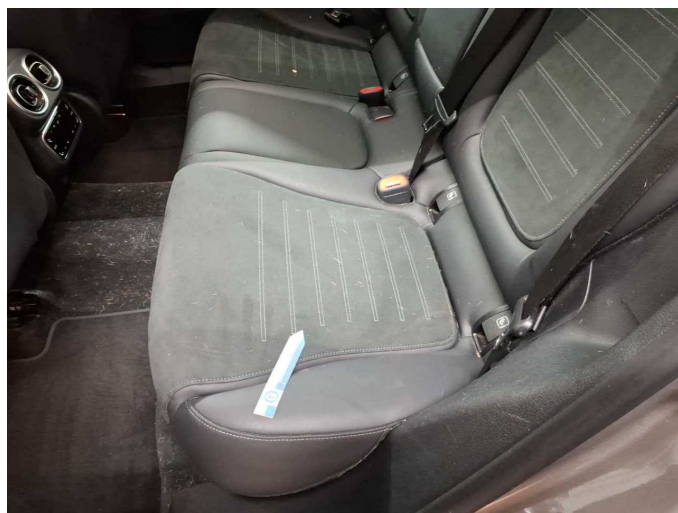

Damage 6: Interior: Interior (Haare/ Folgekosten möglich) - Soiled - Clean

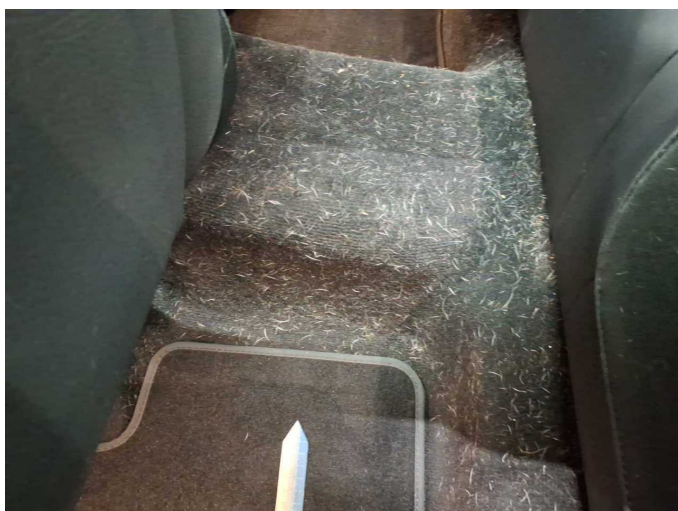

Damage 6: Interior: Interior (Haare/ Folgekosten möglich) - Soiled - Clean

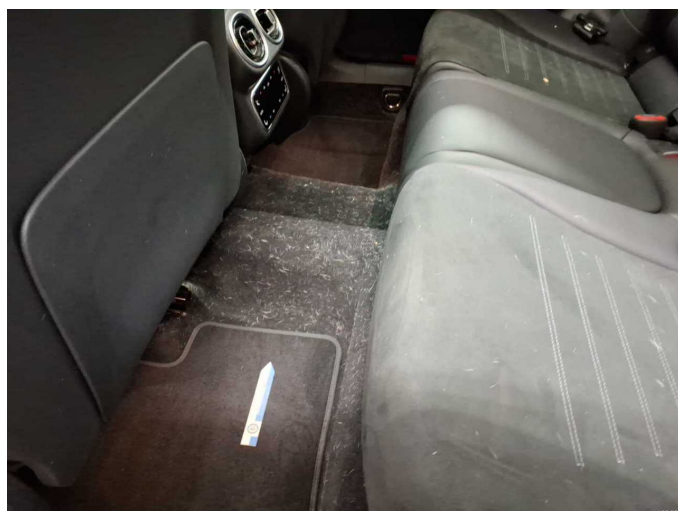

Damage 6: Interior: Interior (Haare/ Folgekosten möglich) - Soiled - Clean



Damage 7: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 7: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint




Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Bonnet: Bonnet - Scratch(es) - Repair and paint

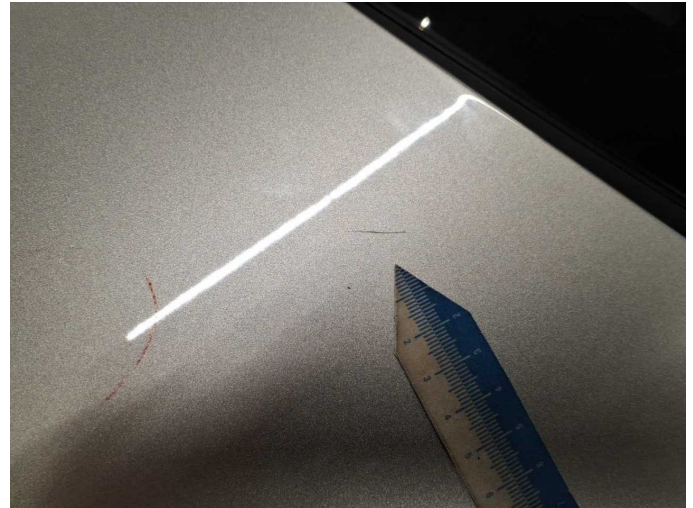

Damage 9: Bonnet: Bonnet - Scratch(es) - Repair and paint



Damage 9: Bonnet: Bonnet - Scratch(es) - Repair and paint



Damage 9: Bonnet: Bonnet - Scratch(es) - Repair and paint



Damage 9: Bonnet: Bonnet - Scratch(es) - Repair and paint



Wear and tear 1: Side panel - rear right side: Wheel well extension - Scratch(es) - No deduction



Wear and tear 1: Side panel - rear right side: Wheel well extension - Scratch(es) - No deduction



Wear and tear 2: Sill - right side: Trim - Scratched - No deduction



Wear and tear 2: Sill - right side: Trim - Scratched - No deduction




Wear and tear 3: Mudguard - left side: Wheel well extension - Scratch(es) - No deduction



Wear and tear 3: Mudguard - left side: Wheel well extension - Scratch(es) - No deduction



Wear and tear 4: Boot lid / rear door: Boot lid - Scratch(es) - No deduction

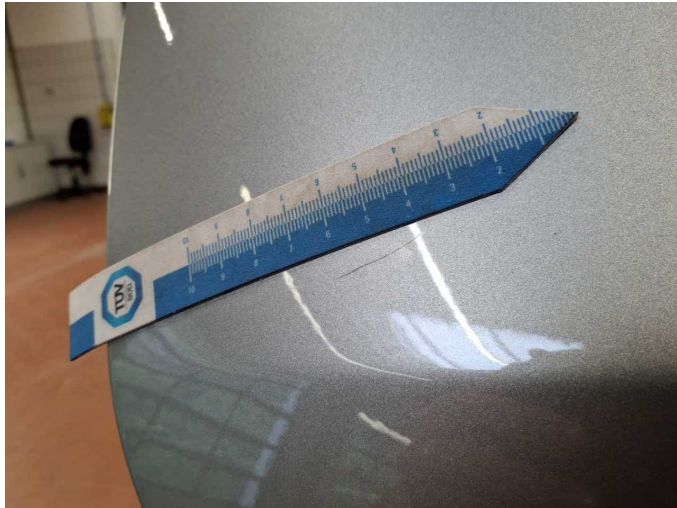

Wear and tear 4: Boot lid / rear door: Boot lid - Scratch(es) - No deduction



Wear and tear 6: Side panel - rear left side: Side panel - dent(s) - No deduction



Wear and tear 6: Side panel - rear left side: Side panel - dent(s) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1NKM0FB8RU037267

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLC 220 d 4Matic 9G-TRONIC AMG Line Advanced

Datum	KM-Stand	Beschreibung
09.12.2025	80.705	Regelwartungsdienst
17.04.2025	56.011	Regelwartungsdienst
16.07.2024	29.216	Regelwartungsdienst