



Expertise

Protocol number: 46495573
Order No. / Reference: 26711867
Inspection date: 10 Jul 2026

Manufacturer: Ford

Model: Tourneo Custom 320 L1H1 VA Autm. Trend

VIN: WF03XXTTG3NP86499



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Tourneo Custom 320 L1H1 VA Autm. Trend	
Vehicle Identification number	WF03XXTTG3NP86499
Mileage (Read)	153,392 km
First registration	23 Sept 2022
Number of holders	1
Power / Engine displacement	96 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	White University
Doors / Seats	5 / 8
Upholstery type	Cloth
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	8,000 km
Last service on / at	10/2025 at 120,784 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP437620
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BMX 03686		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	3,240 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	Summer tyres on Light alloy	Pirelli	7mm / 7mm
2)	215/65 R16 109T	Summer tyres on Light alloy	Pirelli	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109R	Winter tyres on Light alloy	Pirelli	6mm / 6mm
2)	215/65 R16 109R	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R16 109T	Summer tyres on Steel	Goodyear	6 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 2 batteries
- Anti-lock braking system with electronic brake force distribution (EBD)
- Flooring: Carpet
- roof, flat
- Headliner in driver's cab and passenger compartment (with glasses storage compartment on driver's side - with grab handle on passenger side - with storage compartment, small, center, 1-DIN slot)
- Windows, 2nd row: Awning windows in the side windows
- Windows: Windows in the 3rd row of the passenger compartment, fixed, right and left
- Ford Easy Fuel (comfortable fuel filler cap and misfuelling protection)
- Generator, 240 A
- Cruise control system with adjustable speed limiter
- Grab handle on the B-pillar of the passenger side
- Rear swing door with heated rear window (rear window wiper with automatic activation when reverse gear is engaged)
- Paint finish: Solid color paint
- Emergency brake assist including emergency brake light (pulsating illumination of the brake lights during hard braking)
- Front and rear parking pilot system
- Particulate filter: diesel particulate filter
- Radio: Audio system 19: Ford audio system including Ford SYNC 3 Lite with AppLink and DAB/DAB+ (Radio (FM/AM) - FordPass Connect incl. live traffic information - 4" TFT multifunction display (10.16 cm screen diagonal) - 10 speakers, antenna, 8 USB ports - Integrated control panel and audio remote control on the steering wheel - Ford SYNC Lite (communication and entertainment system, Bluetooth and USB, integration of various telephony functions and hands-free system, emergency call assistant...) - AppLink (control of selected smartphone apps via voice command, ...))
- Rear mud flaps
- Side protection strips, plastic
- Seat belts (front seat belt tensioners and force limiters - warning system for unfastened seat belts for driver and front passenger)
- Seats: Seat package 16A (Torneo Custom) (Driver's seat, 4-way manually adjustable (forward/backward, backrest, seat cushion tilt, height) - Individual passenger seat, 4-way manually adjustable (forward/backward, backrest, seat cushion tilt, height) - Height-adjustable headrests - Heated seats for driver and front passenger - Interior armrest for driver - Interior armrest on individual passenger seat - Manual lumbar support (driver's seat) - Front head/shoulder airbags and side airbags - TREND seat cover: fabric)
- Immobiliser
- Auxiliary heater, electric
- Driver and passenger side airbags
- Exterior mirrors, electrically adjustable, heated and folding (with integrated turn signals)
- On-board computer (with consumption and mileage information (e.g. remaining range) and outside temperature display)
- Tachometer
- Third brake light
- Electronic Stability Program (ESP) with Traction Control System (TCS) (Hill Start Assist - Crosswind Assist - Emergency Brake Assist - Rollover Protection)
- Electric front windows (with quickdown/up function for driver's side)
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Transmission: 6-speed automatic
- Lockable glove compartment with lid
- Interior lighting front and rear with delay function (also with reading lights in front)
- Front air conditioning (including dust and pollen filter)
- Steering column, adjustable (adjustable in height and reach)
- Package: Style color package (Exterior mirror caps painted in body color - Front and rear bumpers painted in body color - Door handles and tailgate handles painted in body color)
- Tire Pressure Monitoring System (TPMS)
- Wheels/Tires: Spare wheel, steel wheel
- Wheels: 6.5 J x 16 alloy wheels in a 10-spoke design (6.5 J x 16 with 215/65 R16 tires)
- Headlight dipped beam with switch-off delay (halogen projector headlights with LED daytime running lights and fog lights with cornering lights)
- Sliding door entry light automatically illuminates when the door is opened
- Sliding door: Sliding door, right and left (opening width 930 mm - incl. sliding door steps)
- Front mud flaps
- Power steering
- Seats: 2 rows of seats (3-3) (Trend) (in the 2nd row with 3 individual seats (removable and reversible) with adjustable backrests, height-adjustable headrests, outer armrest and 2 ISOFIX anchor points (each on the outer seat) - in the 3rd row with a single and double seat (removable) with adjustable backrests, height-adjustable headrests, outer armrest and 2 ISOFIX anchor points (on the middle seat and on the outer passenger side))
- Start-stop system
- Power outlet: 12-volt connection (in the passenger compartment)
- Lashing eyes 2
- Rear water heater
- Heat-insulating glazing, lightly tinted



Extra equipment

- Towing device (fixed, 13-pin socket - incl. trailer stability control (TSC))
- Radio: Audio system 23: Ford audio system including Ford SYNC 3 with AppLink and DAB/DAB+ (Radio (FM/AM) - FordPass Connect incl. live traffic information - 8" TFT multifunction display - 10 speakers, antenna, 8 USB ports - Integrated control panel and audio remote control on the steering wheel - Ford SYNC 3 with AppLink & touchscreen (Communication and entertainment system, Bluetooth and USB, integration of various telephony functions and hands-free system, voice control, SMS readout/sending function, privacy mode, emergency call assistant) - Supports Android Auto, Apple CarPlay)
- Reversing camera with image display in the multifunction display
- Voltage converter (230 V/150 Watt) Plug-in connection e.g. for connecting a laptop or charging a mobile phone)
- Programmable auxiliary heater (fuel-operated auxiliary heater including 2 batteries)
- Heat-insulating glazing, medium tint level of the side window(s) of the 2nd row.
- Air conditioning front and rear (incl. rear water heating - incl. dust and pollen filter)
- Radio: Audio System 24: Ford audio system including Ford SYNC 3 with AppLink, DAB/DAB+ navigation system (Radio (FM/AM) - FordPass Connect incl. live traffic information - 8" TFT multifunction display - 10 speakers, antenna, 8 USB ports - Integrated control panel and audio remote control on the steering wheel - Ford SYNC 3 with AppLink & touchscreen (communication and entertainment system, Bluetooth and USB, integration of various telephony functions and hands-free system, voice control, SMS readout/sending function, privacy mode, emergency call assistant) - Supports Android Auto and Apple CarPlay)
- Seats: Seat Package 16 (Touneo Custom) (Driver's seat, 4-way manually adjustable (forward/backward, backrest, seat cushion tilt, height) - Single passenger seat, 4-way manually adjustable (forward/backward, backrest, seat cushion tilt, height) - Height-adjustable headrests - Heated driver's seat - Heated passenger seat - Interior armrest for driver - Interior armrest on single passenger seat - Manual lumbar support (driver's seat) - Front head/shoulder airbags and side airbags - TREND seat cover: fabric)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front right side	Door - dent(s) - Smooth repair work
2	Mudguard - left side	Mudguard - left side - Dent / paintcoat damage - Smart repair
3	Roof	Roof - Corrosion - Smart repair
4	Bonnet	Bonnet - Scratch(es) - Paint
5	Boot lid / rear door	Boot lid - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
2	Door - rear right side	Door - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Accident damages

No. Accident

1 Rear, Side - left

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

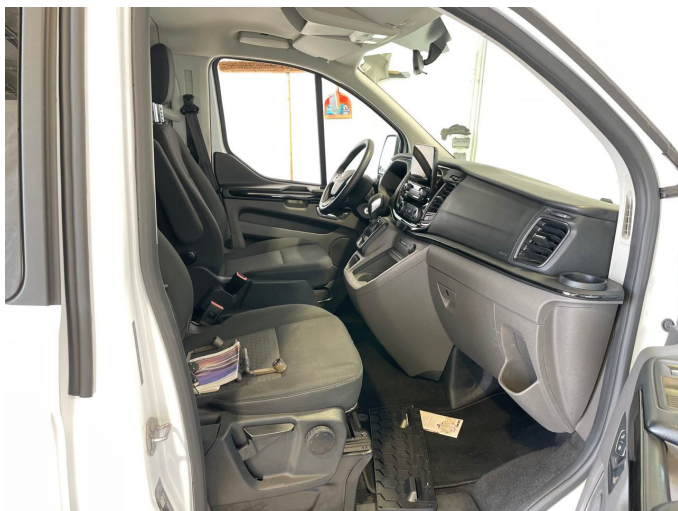


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

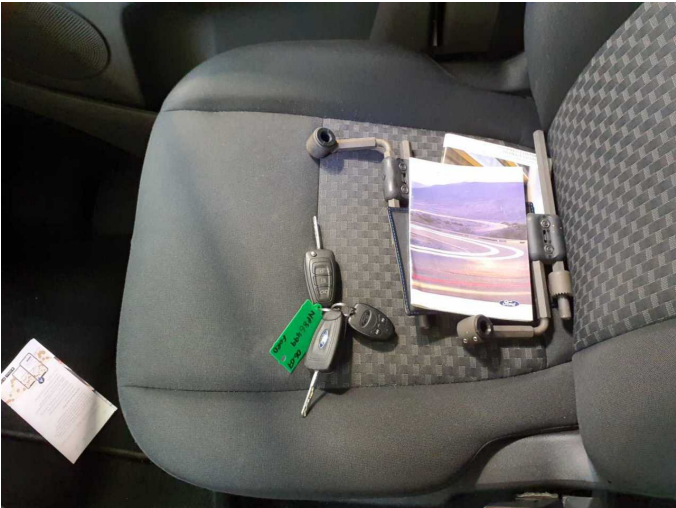


Figure 13: Documents

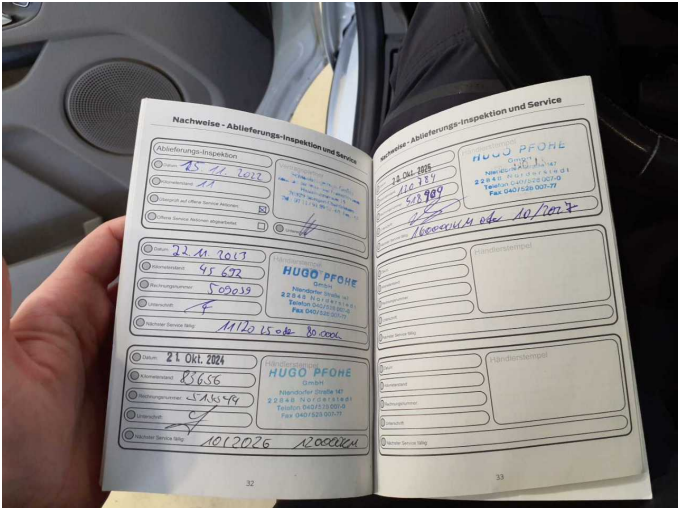


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

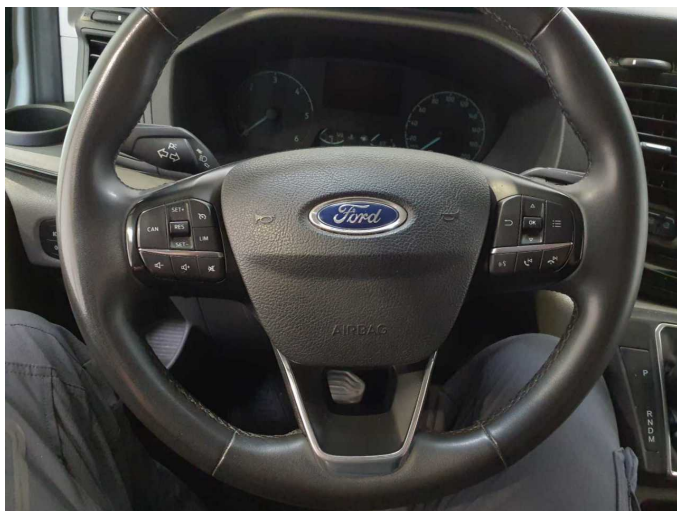


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

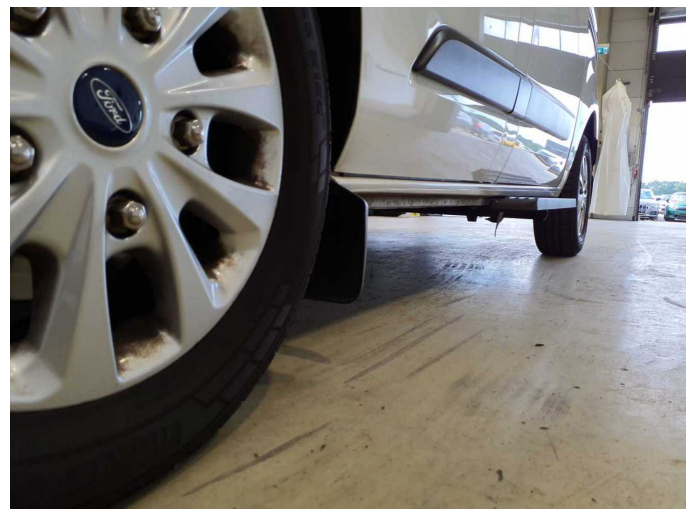


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

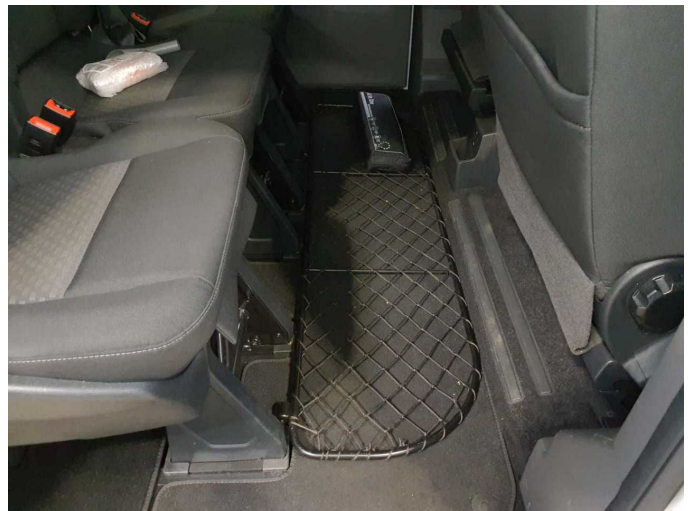


Figure 28: Misc.



Figure 29: Misc.

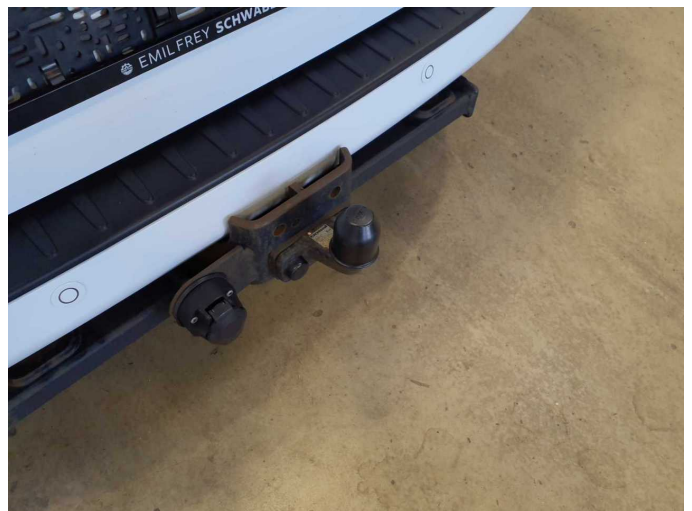


Figure 30: Misc.



Figure 31: Misc.




Figure 32: Misc.



Figure 33: Misc.



Damage 1: Door - front right side: Door - dent(s) - Smooth repair work

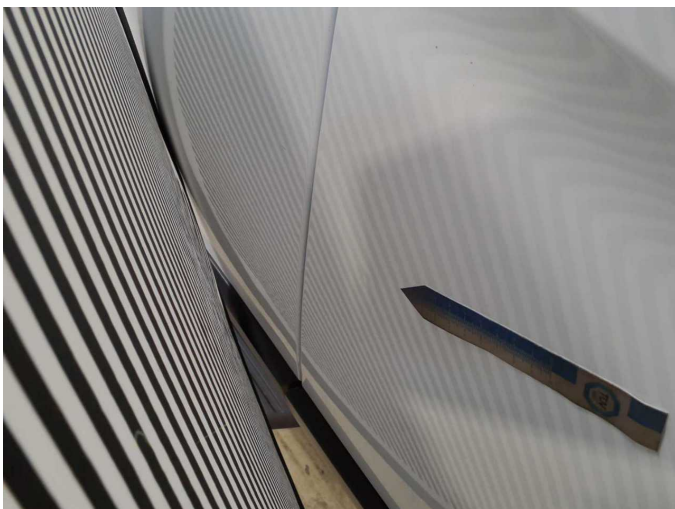

Damage 1: Door - front right side: Door - dent(s) - Smooth repair work




Damage 2: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Smart repair



Damage 2: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Smart repair



Damage 2: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Smart repair

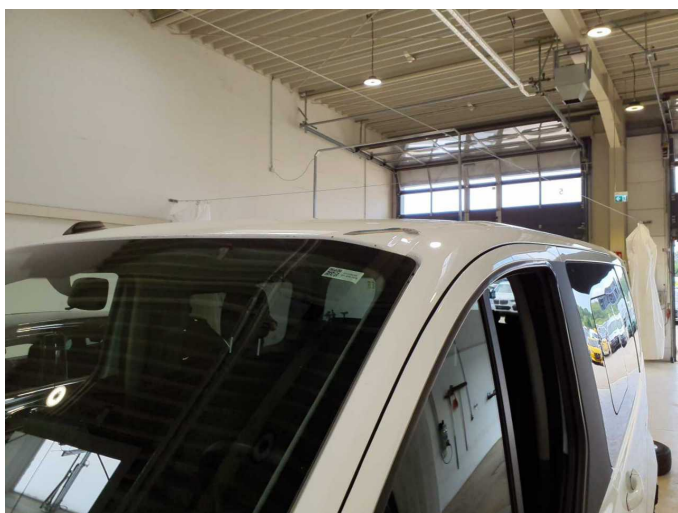

Damage 3: Roof: Roof - Corrosion - Smart repair



Damage 3: Roof: Roof - Corrosion - Smart repair



Damage 3: Roof: Roof - Corrosion - Smart repair




Damage 4: Bonnet: Bonnet - Scratch(es) - Paint



Damage 4: Bonnet: Bonnet - Scratch(es) - Paint



Damage 5: Boot lid / rear door: Boot lid - Scratch(es) - Paint

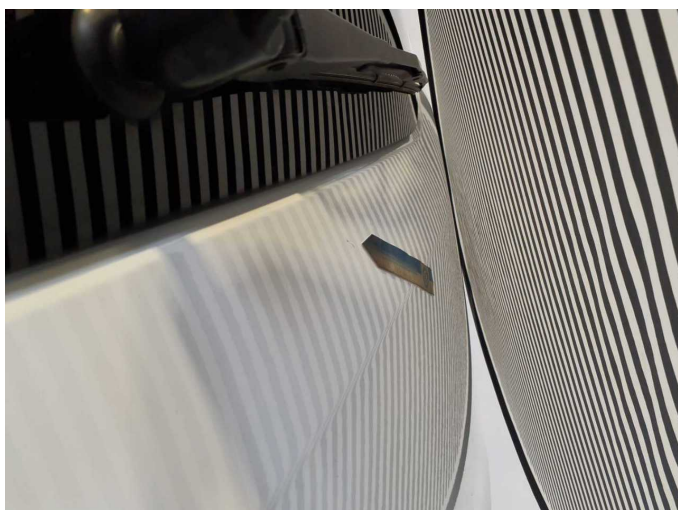

Damage 5: Boot lid / rear door: Boot lid - Scratch(es) - Paint




Damage 5: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left

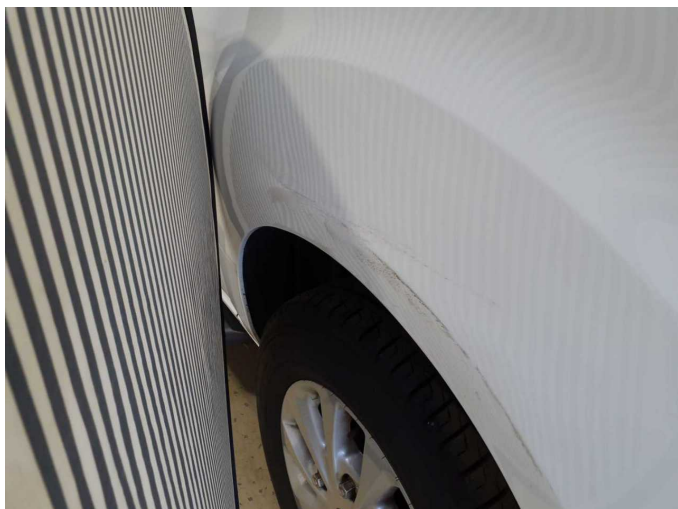

Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left