



Expertise

Protocol number: 46265751
Order No. / Reference: 26342947
Inspection date: 1 Jul 2026

Manufacturer: Skoda
VIN: TMBJC7NY4NF043831

Model: Enyaq iV 80



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Enyaq iV 80	
Vehicle Identification number	TMBJC7NY4NF043831
Mileage (Read)	76,768 km
First registration	21 Apr 2022
Number of holders	1
Next periodical technical inspection	02/2028
(Report on hand)	
Power / Engine displacement	150 kw / 0 ccm
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	SUV
Colour / colour code	Artic Silver Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Grey-Light grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	-39 Tag(e)
Last service on / at	05/2024 at 50,389 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ908560
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWS 00100		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,648 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101T	Winter tires (with run-flat tires) on Light alloy	Pirelli	7mm / 7mm
2)	235/55 R19 101T	Winter tires (with run-flat tires) on Light alloy	Pirelli	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R20 100T	Summer tires (with run-flat tires) on Light alloy	Pirelli	3mm / 3mm
2)	235/50 R20 100T	Summer tires (with run-flat tires) on Light alloy	Pirelli	4mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartments (Four roof grab handles, rear with coat hooks - Warning vest compartment in the doors - Storage compartments in the front door panels with 1.5l bottle holders - Storage compartments in the rear door panels - Umbrella compartments in the front doors - Ticket holder on the windshield - Ice scraper in the tailgate panel - Coat hooks on the B-pillars - Cup holder in the front center console - Storage compartments in the trunk)
- Evasive steering assist including turning assistant (The turning assistant monitors oncoming vehicles when you turn left (for left-hand drive vehicles). If there is an immediate danger, it brings the vehicle to a standstill and a warning signal sounds.)
- Design Selection Loft (seat covers in fabric/faux leather - decorative trim strips "brushed aluminum" - headliner in grey - front center armrest, including storage compartment - rear center armrest with cup holders and pass-through - floor mats - ambient lighting for front door panels, multicoloured - footwell lighting and illuminated door handle recesses - umbrella)
- Electric windows front and rear (including anti-pinch protection and child safety lock)
- Cruise control
- Transmission: 1-speed (EV)
- Tinted windows
- Heated rear window
- Rear window wiper including windshield washer system
- Automatic interior mirror dimming
- Isofix anchorage on the front passenger seat
- Isofix anchorage on the outer rear seats including top tether
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger, including odor and allergen filter)
- Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A) (Fast charging connector (CCS / Combo 2))
- Manual headlight range adjustment
- Package: Drive BASIC (paddle shifters for adjusting recuperation strength - driving profile selection - heated leather steering wheel with multifunction buttons - steering wheel with hands-off detection)
- Radio accessories: SmartLink (Android Auto and Apple CarPlay)
- Radio accessories: Wireless SmartLink
- Rain sensor and driving light assistant with coming and leaving home function
- Tire mobility kit (tire repair spray incl. compressor)
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable
- Power steering
- Safety lights in the front side doors
- Seats: Front seats are height-adjustable, including manually adjustable lumbar support.
- Speed limiter
- Lane keeping assistant (Lane Assist)
- 12V socket - in the trunk
- Airbag, center airbag front
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, front and rear head airbags
- Airbag, front side airbags
- acoustic windscreen
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Electrically adjustable, heated and folding exterior mirrors, including automatic dimming.
- Outdoor temperature display
- Hill start assist
- Grey headliner
- Digital instrument cluster (Virtual Cockpit)
- Third brake light
- E-Sound (external speaker for generating a driving sound)
- Electronic parking brake including auto-hold function
- Increased battery charging power max. 125 kW incl. 1 year free monthly basic fee at Ionity
- ESC Electronic Stability Control
- Front radar assist with pedestrian and cyclist detection and city emergency braking function (The front radar assist is a safety system with collision warning: If confronted with an unavoidable collision, it brakes the vehicle to minimize the consequences. It also performs emergency braking if a pedestrian or cyclist attempts to cross the vehicle's path. The front radar assist recognizes from the way the driver moves the vehicle that they are attempting to avoid an obstacle and actively intervenes in the steering to steer around it.)
- Child safety locks on the rear doors
- Removable boot cover
- Front and rear headrests are height-adjustable.
- Paint finish: Solid
- LED headlights with daytime running lights
- LED taillights
- Steering wheel adjustable for height and reach
- Package: Chrome (chrome trim strips on the outside of the side windows - AERO anodized roof rails)
- Package: Parking BASIC (front and rear parking sensors - reversing camera)
- Radio: Infotainment system with capacitive 13" color display (8 speakers - 2 x USB ports (Type-C) at the front - Navigation system preparation - DAB+ digital radio reception - Bluetooth hands-free phone system - Voice control - SmartLink (MirrorLink, Apple CarPlay, Android Auto) - Wireless SmartLink for Apple CarPlay and Android Auto)
- Wheels: 19" Proteus Silver alloy wheels (8Jx19 tires 235/55 R19 101T front, 255/50 R19 103T rear)
- Seat belts (Height-adjustable three-point seat belts in the front - Three three-point seat belts in the rear - Seat belt reminder indicators on the front and rear seats)



- Traffic sign recognition
- Immobiliser
- Central locking including remote control integrated into the key (EASY START (keyless start-stop system))

- Skoda Care Connect (SOS emergency call function (eCall including automatic activation in the event of an accident with airbag deployment) - Free remote vehicle access to iV-specific functions for 10 years (iV Remote Services Basic) such as starting and stopping the charging process, creating charging plans, setting the interior climate control before starting a journey, etc. - Mobility service (connection option for rapid assistance in the event of a breakdown) - Information service - Free remote vehicle access for 1 year (Remote Access))

Extra equipment

- Design Selection Lounge (seat covers in leather/artificial leather/ microfiber grey with decorative stitching in yellow - decorative strips "Anodized cross" - headliner in grey - front center armrest, including storage compartment - rear center armrest with cup holders and pass-through - floor mats - ambient lighting for instrument panel and front door trim, multicoloured - footwell lighting and illuminated door handle recesses - umbrella)
- Package: Drive SPORT BASIC (paddle shifters for adjusting recuperation strength - driving profile selection - heated leather steering wheel in sport design with multifunction buttons - steering wheel with hands-off detection - progressive steering)
- Package: Infotainment BASIC (Navigation system - Infotainment Online 3 years (Online map updates for navigation; Display of weather data, news, headlines; Charging station and parking space search; Online POI search; Online destination import))
- Package: Seating comfort BASIC (electrically adjustable driver's seat with memory function - electrically adjustable lumbar support in the driver's seat)
- Package: Transport (Net program in the trunk incl. charging cable bag - Variable loading floor in the trunk - Remote release of the rear seat backrests in the trunk - Cargo elements in the trunk)
- Chassis: Sport chassis
- Paint finish: Metallic
- Package: Convenience BASIC (KESSY (Keyless Entry and Start-Stop System) - Phonebox with inductive charging function (connection via the external antenna) - Sunset including acoustic side glazing at the front - Extended acoustic measures - Driver fatigue detection - Removable glasses compartment)
- Package: Driving Assistance BASIC (Adaptive Distance Assist (ACC) - Lane Change and Parking Assist - Proactive Occupant Protection)
- Package: Family PLUS (Sun protection roller blind for rear side windows - 230V socket and 2 x USB-C charging ports in the rear - Storage box for rear seat row - Folding tables on the front seat backrests - Sleeping package (Sleeping headrests for the outer rear seats and blanket))
- Package: Light & Sight BASIC (LED matrix headlights incl. AFS and dynamic high beam assist; in rain and bad weather conditions, the cornering and curve lights illuminate the area directly in front of the car better - headlight cleaning system - full LED taillights with animated turn signals)
- Wheels: 20" Vega Silver alloy wheels (front: 8Jx20 tires 235/50 R20 100T, Seal rear: 9x20 tires 255/45 R20 101T)
- heat pump

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
2	Rear bumper	Spoiler - Deformed - Replace
3	Misc.	Inspection / maintenance - Due - Perform



Wear and tear

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Seat - front	Seat cover - left side - Abrasion - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Body	Body - Scratch(es) - No deduction
5	Interior	Interior - Scratch(es) - No deduction
6	Front bumper	Front bumper - Stone chips - No deduction
7	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Tirefit complete

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Comments

-Der montierte Winterradsatz ist kein Bestandteil des
Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument cluster



Figure 9: Instrument panel



Figure 10: Interior 360° view



Figure 11: Cargo area



Figure 12: VIN



Figure 13: Mounted tyres

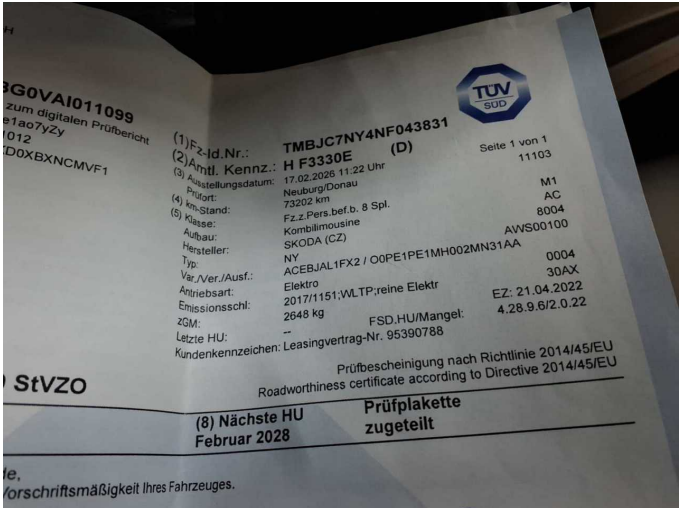


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation

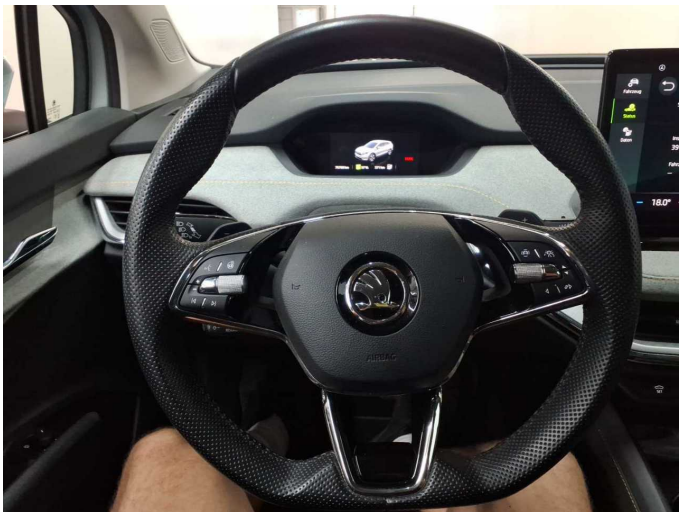


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

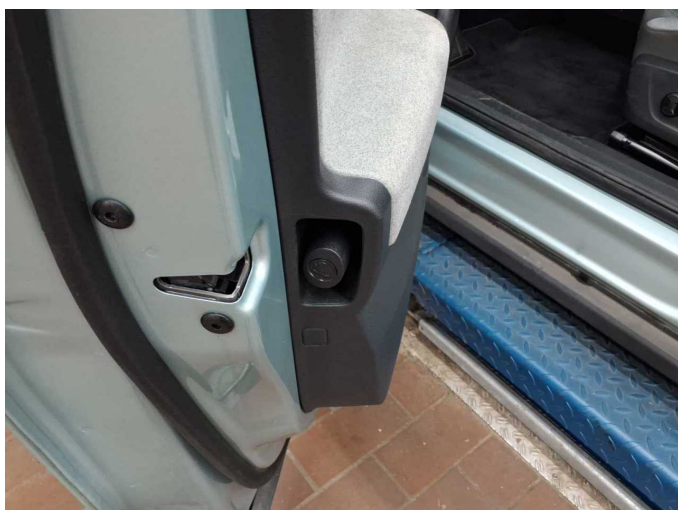


Figure 27: Misc.



Figure 28: Misc.

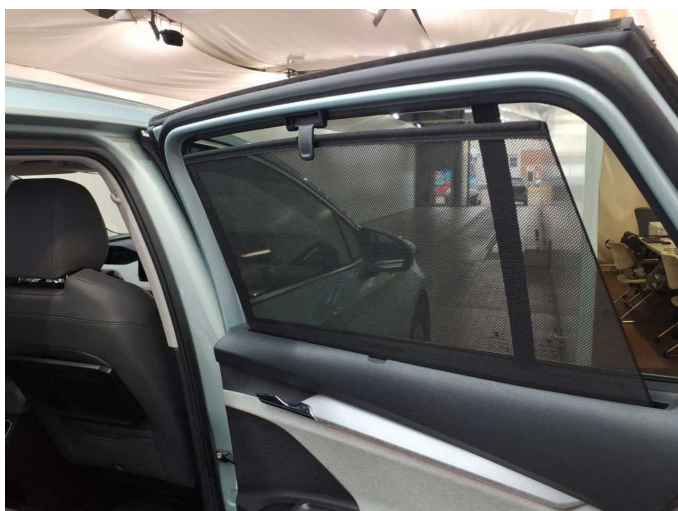


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.

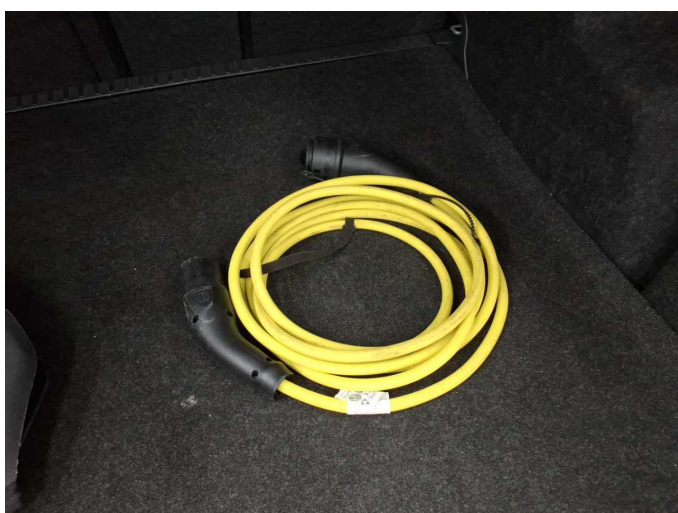


Figure 35: Misc.

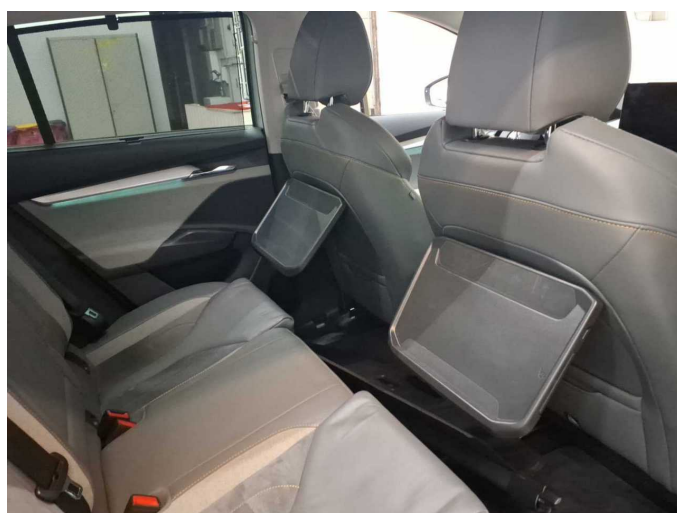


Figure 36: Misc.



Figure 37: Misc.



Damage 1: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 1: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 2: Rear bumper: Spoiler - Deformed - Replace



Damage 2: Rear bumper: Spoiler - Deformed - Replace



Damage 2: Rear bumper: Spoiler - Deformed - Replace



Damage 3: Misc.: Inspection / maintenance - Due - Perform



Wear and tear 7: Trim / covers: Boot lid - interior trim - Scratch(es) - No deduction



Wear and tear 7: Trim / covers: Boot lid - interior trim - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJC7NY4NF043831
Hersteller / Modell: SKODA SKODA Enyaq iV 80

Datum	KM-Stand	Beschreibung
16.07.2024	53.897	Systemtest/Eigendiagnose
11.06.2024	51.544	Systemtest/Eigendiagnose
25.05.2024	50.389	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst