



Expertise

Protocol number: 46668546
Order No. / Reference: 26681226
Inspection date: 23 Jul 2026

Manufacturer: Volkswagen

Model: Touran 2.0 TDI SCR DSG UNITED

VIN: WVGZZZ1TZMW025729



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Touran 2.0 TDI SCR DSG UNITED	
Vehicle Identification number	WVGZZZ1TZMW025729
Mileage (Read)	149,663 km
First registration	18 May 2021
Number of holders	1
Next periodical technical inspection	06/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Uranograu
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	27,000 km
Last service on / at	04/2026 at 148,131 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC183575
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BWR 00298		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,220 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Light alloy	Falken	8mm / 8mm
2)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- 2 USB-C ports on the front
- Storage compartments in the overhead console
- Airbag, head airbag system for front and rear passengers
- Extended warranty, 3 years following the manufacturer's warranty, maximum total mileage 50,000 km
- Front air vents and rotary light switch with chrome trim
- Electrically adjustable and heated exterior mirrors
- Exterior mirror housings and door handles in body color
- third brake light
- Roof rails, silver anodized
- Decorative inserts for special edition model (for instrument panel and door trim)
- Door sill trims for special edition model
- Electronic Stability Program (ESP) with counter-steering support
- Windscreen in heat-insulating glass
- Luggage management package (with luggage net that can be fixed to rails)
- luggage compartment cover
- Additional luggage compartment lighting
- Height-adjustable luggage compartment floor
- Glove compartment with cooling option
- Rear window wiper with intermittent function
- ISOFIX mounting points on rear seats
- Air conditioning system "Air Care Climatronic"
- Headrests (3) in the 2nd row of seats
- Front headrests
- Paint finish: Solid
- Headlight range control
- Illuminated makeup mirrors in the sun visors
- Multifunction display "Plus"
- Navigation system "Discover Media" incl. "Streaming & Internet" (screen diagonal 20.3 cm - touchscreen - FM radio reception - dual tuner with phase diversity - MP3 playback - SD card slot - USB-C with Apple compatibility - output power 4x20 watts - map with 2D display - traffic sign display - telephone interface - 3-way sound control - DAB+ digital radio reception)
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Tire pressure monitoring system (passive)
- Wheels: Tire Mobility Set
- Gearshift knob in leather
- Rear side windows and rear window tinted, absorbing 65 percent of the light
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Folding tables on the backs of the front seats
- Seats: Comfort seats in the front
- Seats: Front seats are height-adjustable
- Start-stop system
- 12V power outlet on the rear of the center console
- Storage compartment with lid on the instrument panel
- Airbag for driver and front passenger
- Ambient lighting
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto (selected apps for Android smartphones and Apple iPhones can be displayed and operated on the touchscreen of the radio or navigation system)
- Headliner in Storm Grey
- Decorative inlays "Piano Black"
- Diesel particulate filter
- Parking assistance
- Electronic parking brake including auto-hold function
- High beam control "Light Assist" (interior mirror automatically dimming - automatic headlight control with daytime running lights, "Leaving home" function and manual "Coming home" function - rain sensor - automatically switches on the high beam in darkness from 65 km/h - detects vehicles ahead and oncoming vehicles and automatically dims before they are dazzled)
- Transmission: 7-speed DSG
- Rear window heated
- Interior lights with delayed shut-off and dimming function
- LED license plate lighting
- Instrument cluster with electronic speedometer, odometer and trip odometer, tachometer
- Black radiator grille with chrome strips on the slats
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- front center armrest
- Fatigue detection
- Non-smoking version
- Emergency braking assistant "Front Assist"
- Emergency call service
- Package: Winter package (automatically heated front windshield washer nozzles - headlight cleaning system - heated front seats - washer fluid level warning lights)
- Pedals and footrest in brushed stainless steel
- Proactive occupant protection system in conjunction with "Front Assist"
- Wheels: Light alloy (4) "Dublin" 6.5 J x 16 (in black, surface polished, tires 205/60 R16)
- Drawers under the front seats
- electromechanical power steering
- Seat belts: 3 three-point automatic seat belts in the rear
- Seats: 3 individual seats in the 2nd row
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Voice control
- Dust and pollen filter
- Bumpers in body color
- First aid kit, warning triangle and high-visibility vest



- Textile floor mats
- Warning tone and light for unfastened seat belts front and rear
- Black trim strips on the side windows

- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote folding keys

Extra equipment

- Airbag: Side airbags for the outer rear seats (including front side airbags and head airbag system)
- Mesh partition
- Package: Driver Assistance Package (DSG) (Adaptive Cruise Control ACC "stop & go" up to 210 km/h with speed limiter, Emergency Brake Assist "Front Assist", City Emergency Brake function - Automatic headlight control with daytime running lights, "Leaving home" function and manual "Coming home" function - High beam control "Light Assist" - Automatically dimming interior mirror - LED headlights with daytime running lights - Dynamic headlight range control - Rain sensor)
- Traffic sign recognition
- Extended warranty: Cancelled
- Heated windshield (laminated safety glass windshield, noise-reducing and heated)
- Package: Family (foldable and removable reversible luggage compartment mat - electric child safety lock for rear doors, operable from the driver's seat - sunshade roller blind on the rear door windows)
- Rear View reversing camera (displays the rear of the vehicle in real time on the radio/navigation system display)
- Seats: Front seats and outer rear seats of the 2nd row are heated.
- 230V power outlet in the luggage compartment on the left (additional luggage compartment lighting, removable and usable as a flashlight)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Body	C-pillar - left side - dent(s) - Smart repair
3	Body	C-pillar - right side - Scratch(es) - Smart repair
4	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
5	Vehicle glazing	Windscreen with lane departure assistant - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Side panel - rear left side	Side panel - Scratch(es) - No deduction
3	Door - rear left side	Door - Scratch(es) - No deduction
4	Side panel - rear right side	Side panel - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No.	Repainting
1	Roof, Boot lid / rear door, Door - rear right side, Professionally carried out, Invoice of repair done Non-existent



Paint coat thickness measurement

Roof	278 µm	Boot lid / rear door	186 µm
Door - rear right side	216 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

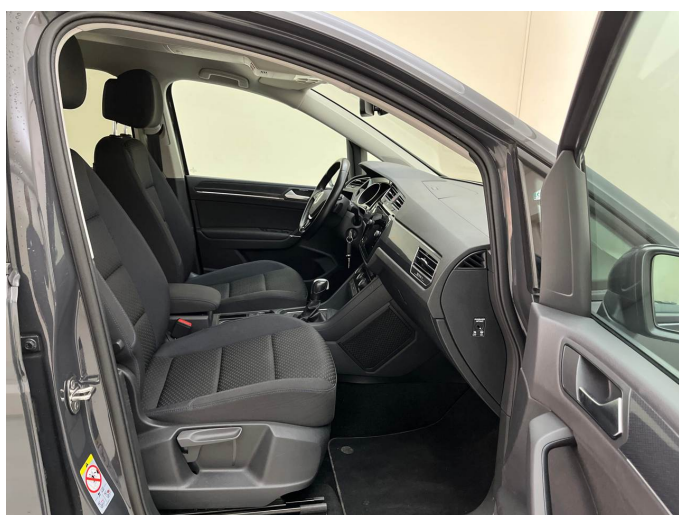


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

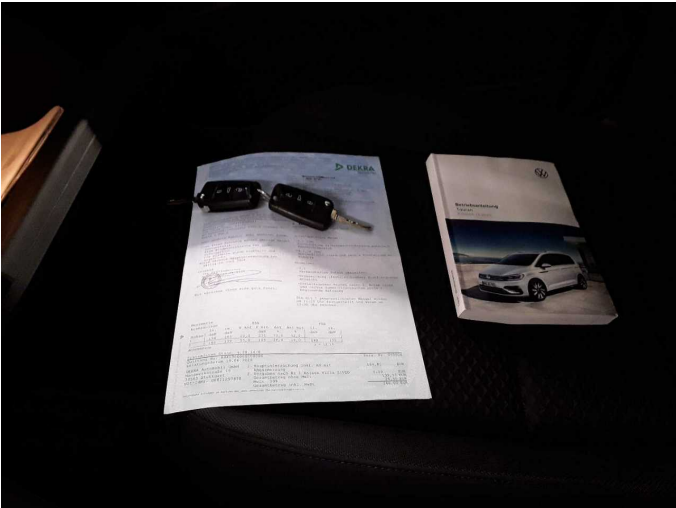


Figure 13: Documents

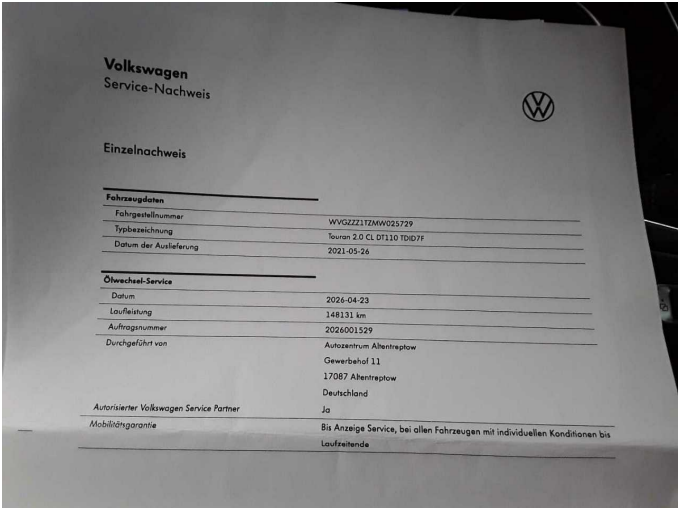


Figure 14: Documents

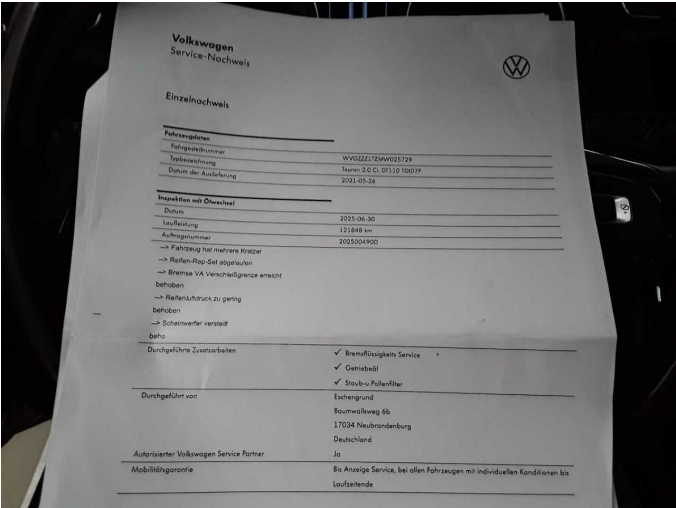


Figure 15: Documents

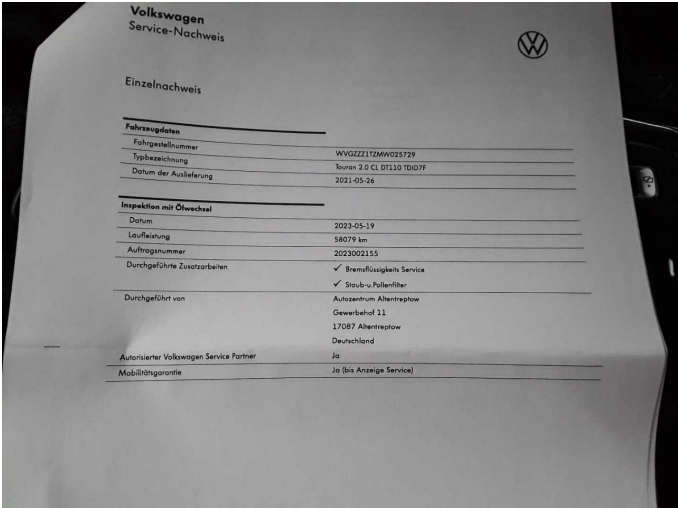


Figure 16: Documents



Figure 17: Documents

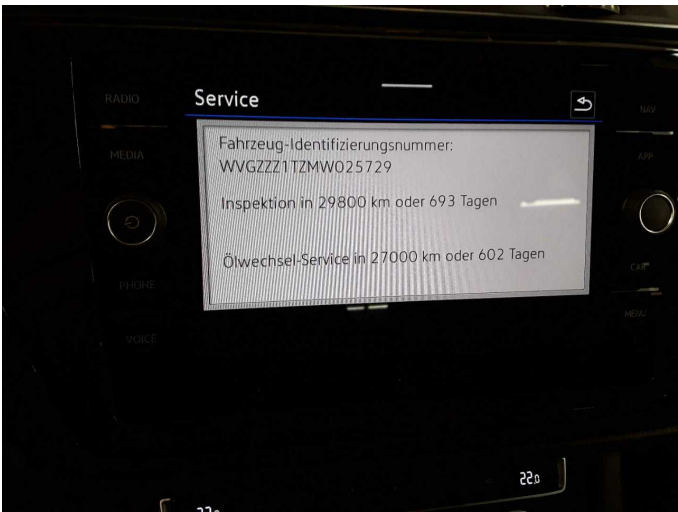


Figure 18: Documents



Figure 19: Additional tyres



Figure 20: Navigation



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

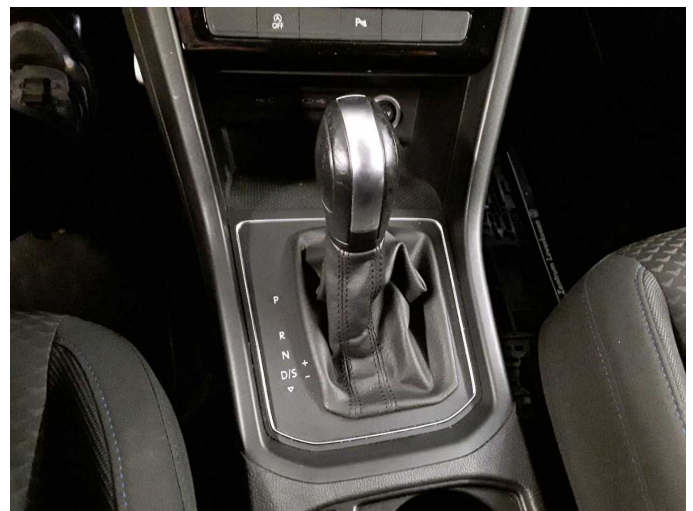


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

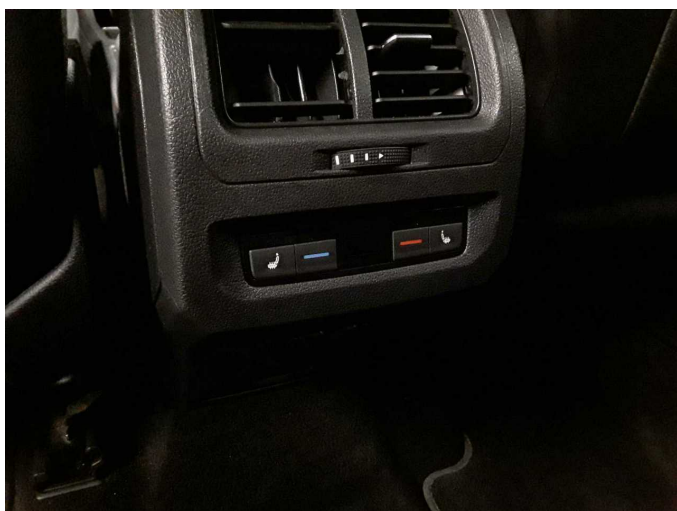


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.




Figure 33: Misc.



Figure 34: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace

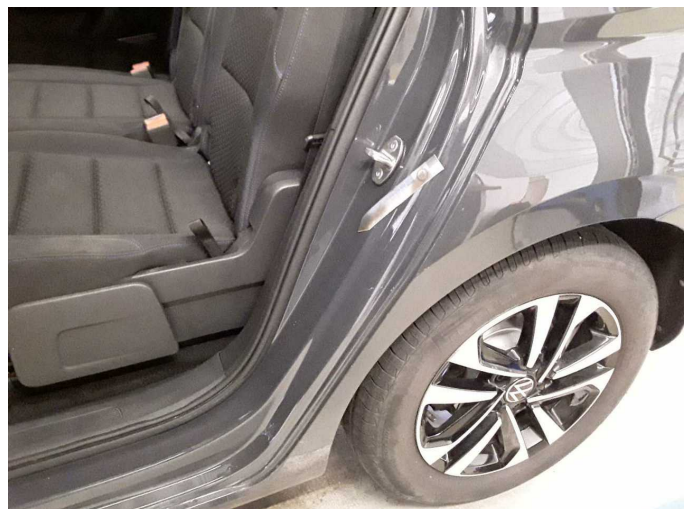

Damage 2: Body: C-pillar - left side - dent(s) - Smart repair



Damage 2: Body: C-pillar - left side - dent(s) - Smart repair

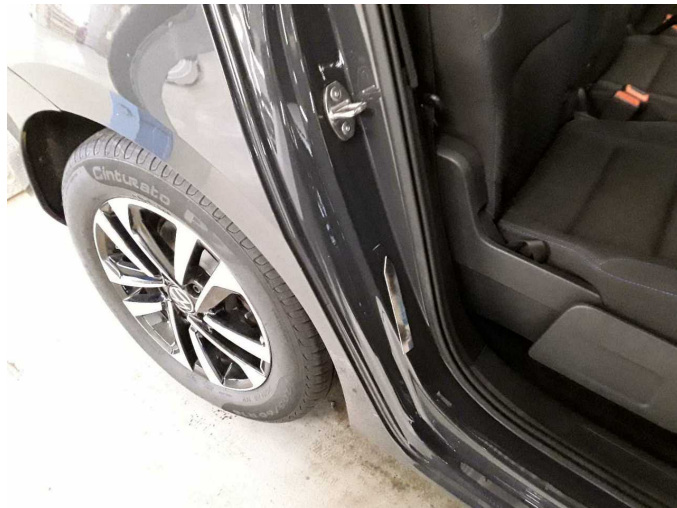

Damage 3: Body: C-pillar - right side - Scratch(es) - Smart repair



Damage 3: Body: C-pillar - right side - Scratch(es) - Smart repair



Damage 4: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value




Damage 4: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 5: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace



Damage 5: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace

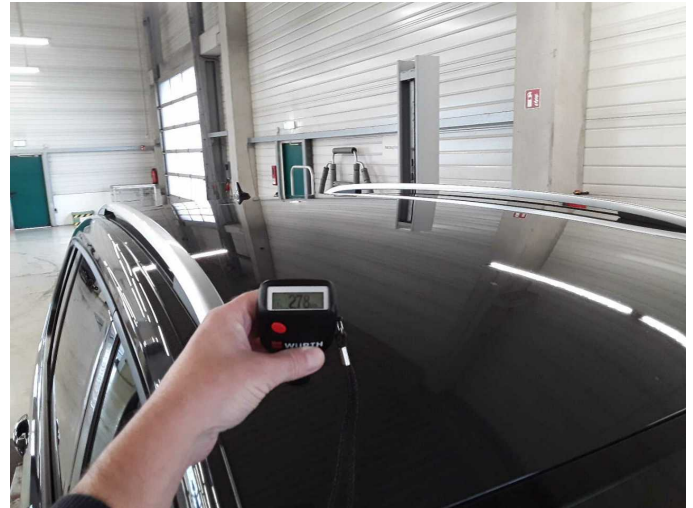

Roof: 278 μm



Boot lid / rear door: 186 μm



Door - rear right side: 216 μm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ1TZW025729

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Touran 2.0 TDI SCR DSG
UNITED

Datum	KM-Stand	Beschreibung
22.06.2026	149.368	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; HU + AU; Regelwartungsdienst; Wartung Sonstiges
23.04.2026	148.131	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
12.11.2025	133.150	Batterie ern; Systemtest/Eigendiagnose
30.07.2025	121.848	Bremsflüssigkeit ern; Bremsscheiben + Klötze v; Getriebeöl ern/prüfen; Motoröl b. Wartung; Regelwartungsdienst
28.06.2024	88.724	AU; Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
30.01.2024	75.010	Bremse Sonstiges; Bremsscheiben vorne; Reparatur Sonstiges
19.05.2023	58.079	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.09.2022	28.231	Motoröl b. Wartung; Regelwartungsdienst