



Expertise

Protocol number: 46404576
Order No. / Reference: 26561820
Inspection date: 8 Jul 2026

Manufacturer: Volkswagen

Model: Touran 2.0 TDI SCR DSG Comfortline

VIN: WVGZZZ1TZNW011463



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Touran 2.0 TDI SCR DSG Comfortline	
Vehicle Identification number	WVGZZZ1TZNW011463
Mileage (Read)	236,418 km
First registration	17 May 2022
Number of holders	1
Next periodical technical inspection	04/2027
(Report on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Oryxweiß Perlmutteffekt
Doors / Seats	5 / 7
Upholstery type	Alcantara / cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	-7,600 km
Last service on / at	10/2025 at 198,816 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ142239
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BWS 00725		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,230 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Light alloy	Goodyear	7mm / 7mm
2)	205/60 R16 96V	Summer tyres on Light alloy	Goodyear	8mm / 8mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Goodyear	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 2 USB-C ports on the front
- Storage compartments in the overhead console
- Airbag, head airbag system for front and rear passengers
- Exterior mirror housings and door handles in body color
- Headliner in Storm Grey
- Decorative inlays "New Brushed Design"
- Diesel particulate filter
- Parking assistance
- Electronic Stability Program (ESP) with counter-steering support
- luggage compartment cover
- Height-adjustable luggage compartment floor
- Transmission: 7-speed DSG
- Rear window heated
- Interior lights with delayed shut-off and dimming function, 2 reading lights front and rear
- Headrests (3) in the 2nd row of seats
- Black radiator grille with chrome strips on the slats
- Illuminated makeup mirrors in the sun visors
- Multifunction display "Plus"
- Non-smoking version
- Emergency call service
- Proactive occupant protection system in conjunction with "Front Assist"
- Wheels: Light alloy (4) "Karlstad" 6.5 J x 16
- Gearshift knob in leather
- electromechanical power steering
- Seats: 3 individual seats in the 2nd row
- Seats: Folding tables on the backs of the front seats
- Seats: Comfort seats in the front
- Seats: Front seats are height-adjustable
- 12V power outlet on the rear of the center console
- Daytime running light
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened seat belts front and rear
- Central locking without safe locking, with remote control and 2 remote folding keys
- Storage compartment with lid on the instrument panel
- Airbag for driver and front passenger
- Electrically adjustable and heated exterior mirrors
- third brake light
- black roof rails
- Decorative inlays "Piano Black"
- Tachometer
- Electronic parking brake including auto-hold function
- Windscreen in heat-insulating glass
- Baggage management package
- Additional luggage compartment lighting
- Speed limiter
- Glove compartment with cooling option
- Rear window wiper with intermittent function
- ISOFIX mounting points on rear seats
- Air conditioning
- Front headrests
- Headlight range control
- front center armrest
- Fatigue detection
- Emergency braking assistant "Front Assist"
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Tire pressure monitoring system (passive)
- Wheels: Tire Mobility Set
- Drawers under the front seats
- Seat belts: 3 three-point automatic seat belts in the rear
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Start-stop system
- Bumpers in body color
- Textile floor mats
- Prepared for "We Connect" and "We Connect Plus"
- Electronic immobilizer
- Green thermal insulation glazing
- Black trim strips on the side windows



Extra equipment

- 2 USB-C ports at the front, 2 USB-C charging ports at the rear of the center console
- Adaptive Cruise Control ACC "stop & go" up to 210 km/h and Emergency Brake Assist "Front Assist" (Adaptive Cruise Control ACC "stop & go", with speed limiter - Emergency Brake Assist "Front Assist" (for Adaptive Cruise Control ACC up to 210 km/h))
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto (selected apps for Android smartphones and Apple iPhones can be displayed and operated on the touchscreen of the radio or navigation system)
- Navigation system "Discover Media" incl. "Streaming & Internet" (screen diagonal 20.3 cm - touchscreen - FM radio reception - dual tuner with phase diversity - MP3 playback - SD card slot - USB-C with Apple compatibility - output power 4x20 watts - map with 2D display - traffic sign display - telephone interface - 3-way sound control - DAB+ digital radio reception)
- Package: Top Package (Ambient lighting light strips on front door trim; front door handles and armrests - "Piano Black" decorative inlays for instrument panel and front door trim - Deletion of storage compartments in overhead console - Interior lights with delayed shut-off and dimming function, 2 LED reading lights front and rear - LED footwell lighting front - LED taillights - Premium multifunction display with multicolor screen - Panoramic tilt/slide sunroof with panoramic roof in the rear - Darkened rear side windows and rear window)
- Paint finish: Pearlescent effect
- Seats: ergoActive seat with 14-way adjustment in conjunction with Business Package (lumbar support in the front, electrically adjustable on the driver's side, massage function on the driver's side - drawer under the right front seat - seat center panels in microfleece "ArtVelours" - top comfort seats in the front - heated front seats - height-adjustable front seats, ergoActive seat on the driver's side)
- "Comfort" telephone interface with inductive charging function (hands-free system)
- Active Lighting System (Dynamic Light Assist high beam control - automatic headlight control with daytime running lights, "Leaving home" function and manual "Coming home" function - automatically dimming interior mirror - LED headlights with cornering lights and LED daytime running lights - dynamic headlight range control with dynamic cornering lights - multifunction camera - rain sensor)
- Anti-theft alarm system (with interior monitoring, backup horn and tow-away protection)
- Chrome trim on the side windows
- Heated windshield (laminated safety glass windshield, noise-reducing and heated)
- Package: "Easy Open" incl. Safe locking (luggage compartment lid with sensor-controlled opening and electric closing - keyless locking and starting system "Keyless Access")
- Package: Business (Air Care Climatronic air conditioning with active combination filter, rear controls and 3-zone temperature control - cargo net partition - automatically heated front windshield washer nozzles - headlight cleaning system - heated front seats - washer fluid level warning light)
- Rear View reversing camera (displays the rear of the vehicle in real time on the radio/navigation system display)
- Seats: 2 individual seats in the 3rd row, foldable into the luggage compartment floor (3 individual seats in the 2nd row with armrest, 2 individual seats in the 3rd row, with headrests and "Easy Fold" folding function)
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters (with control options for multifunction display, radio and telephone)
- Towbar, foldable with electric release
- Traffic sign recognition

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Rear bumper	Rear bumper - Scratch(es) - Smart repair
3	Side panel - rear right side	Sill - dent(s) - Smart repair
4	Door - rear left side	Door - dent(s) - Smart repair
5	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
6	Misc.	Inspection / maintenance - Due - Perform
7	Front bumper	Front bumper - Scratch(es) - Paint

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 15 Apr 2026	1.729,85 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

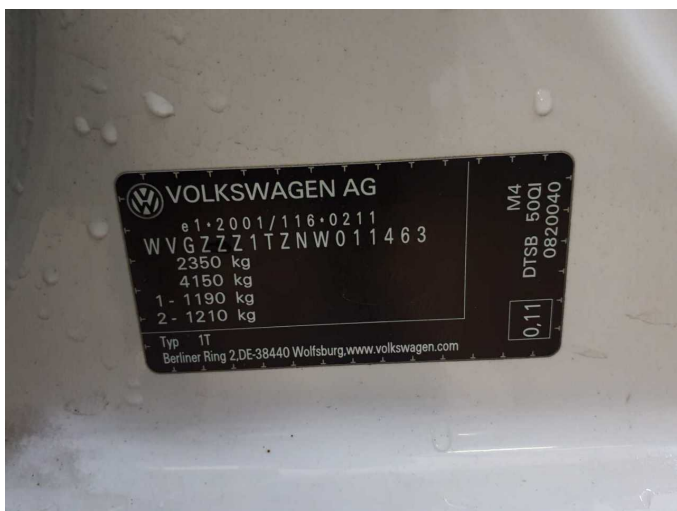


Figure 11: VIN



Figure 12: Mounted tyres

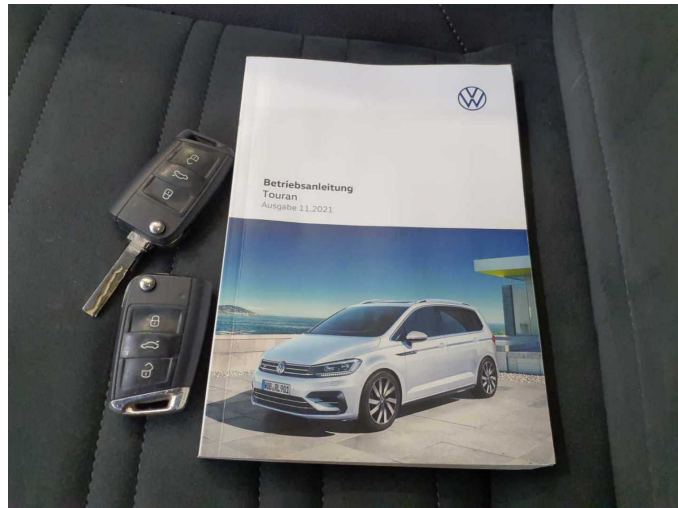


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

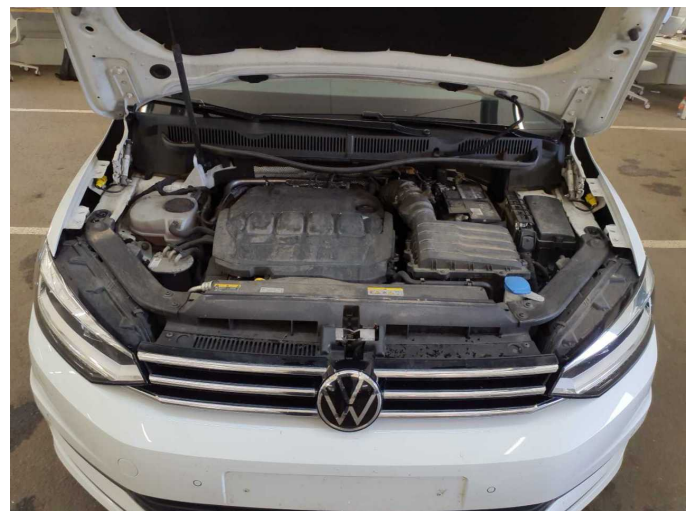


Figure 28: Misc.



Figure 29: Misc.

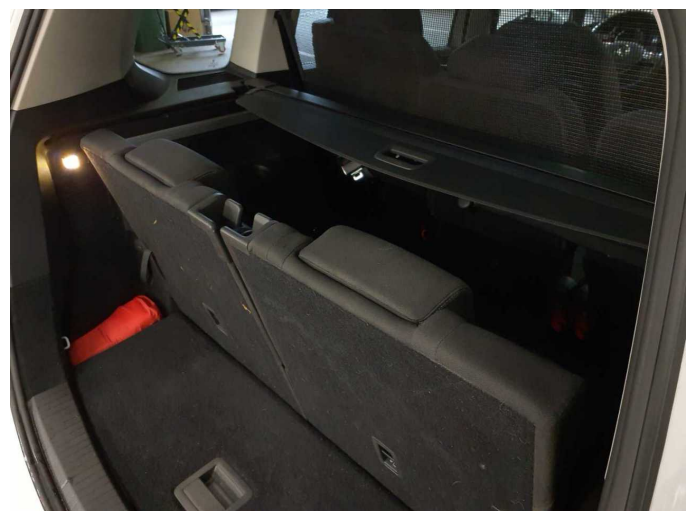


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.




Figure 34: Misc.



Figure 35: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace

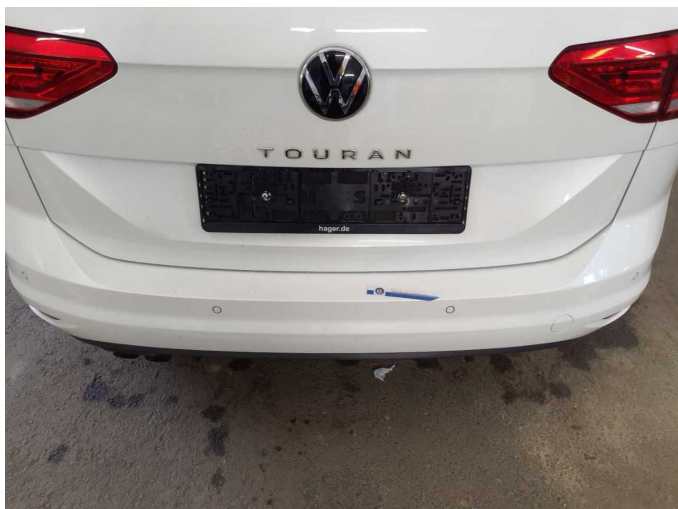


Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Sill - dent(s) - Smart repair

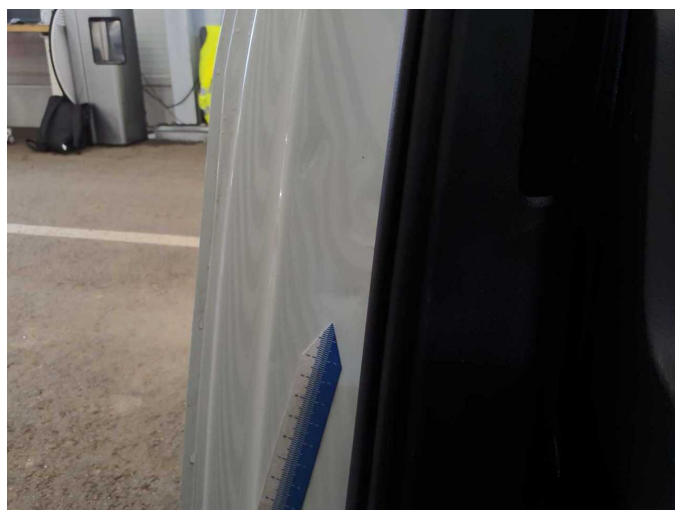

Damage 3: Side panel - rear right side: Sill - dent(s) - Smart repair



Damage 4: Door - rear left side: Door - dent(s) - Smart repair



Damage 4: Door - rear left side: Door - dent(s) - Smart repair



Damage 5: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 5: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Misc.: Inspection / maintenance - Due - Perform



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint




Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint

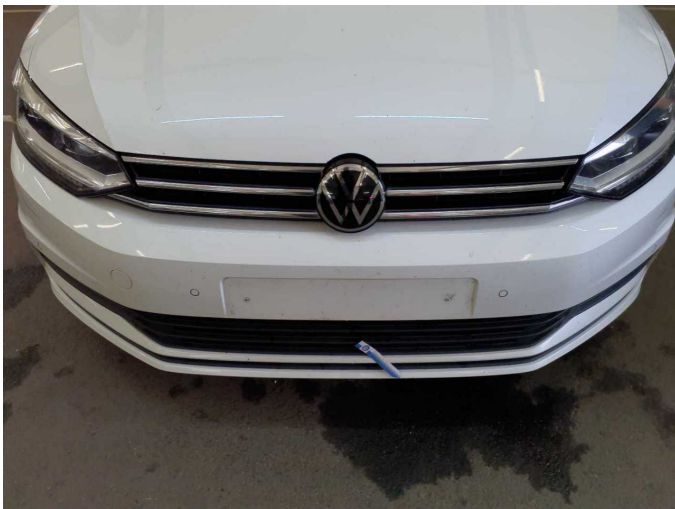

Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ1TZNW011463

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Touran 2.0 TDI SCR DSG
Comfortline

Datum	KM-Stand	Beschreibung
28.10.2025	198.816	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Turbolader ern; Wartung Sonstiges
17.04.2025	168.661	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben hinten; Bremsscheiben vorne; HU + AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
29.08.2024	131.157	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
27.11.2023	78.367	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
23.02.2023	34.214	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges