



SKODA OCTAVIA COMBI: GL-909-SB

Vinnumber:	TMBJJ8NX2PY075025	Versionname:	SKODA OCTAVIA COMBI 2.0 TDI 150 DSG7 Style VP [5P] bva 7-150CH-8cv (break)
First Registrationdate:	18/01/2023	Fiscalpower:	
Expertise Mileage:	116596	Power Kw:	110
Bodytype:	Break	Body colour:	Blue
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Diesel	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Rear view camera	
Steering wheel leather		Seat cover lining	
Seats F heated			Lining Other
Type of climate control	Autom climate control		Lining Semi-leather

Tyres

	205/55/17/91 H			
Summer tyres:	Fr.L.	Michelin: 35%	Fr.R.	Michelin: 35%
	Re.L.	Michelin: 40%	Re.R.	Michelin: 25%
Tyre profile depth FL				6.0
Tyre profile depth FR				6.0
Tyre profile depth RL				5.5
Tyre profile depth RR				6.5
Tyre size FL				205/55 R 17 91 H
Tyre size FR				205/55 R 17 91 H
Tyre size RL				205/55 R 17 91 H
Tyre size RR				205/55 R 17 91 H
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Remote ignition key (no insert), Missing, Repair/replace (lump sum)



Interior, Dirty, Cleaning



Alloy rim FR, Scratch(es), Acceptable



Bumper F, Deformed / Strained, Replace and paint




Door FR, Scratch(es), Paint



Wing RR, Scratch(es), Acceptable



Wiper arm rear, Incomplete, Replace

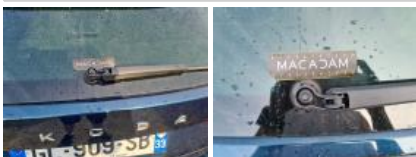

Bumper R, Scratch(es), Paint



Tailgate / Boot, Scratch(es), Paint



Fuel cap cover, Scratch(es), Paint



Historique Maintenance

Immatriculation: **GL-909-SB** Date de 1ère immatriculation: **18/01/2023**
Modèle: **Skoda OCTAVIA COMBI 2.0 TDI 150 DSG7 Style VP [5P] bva 7-150CH-8cv (break)**

Date	Kilométrage	Fournisseur	Descriptif
17/04/2026	110.856	ESPACE AUTO AQUITAINE MERIGNAC	HUILE BV RPLT
	0		REVISION ET CLIM
22/09/2025	92.036	ESPACE AUTO	BATTERIE RPLT
07/07/2025	84.458	CRYSTAL AUTO	AVOIR
07/07/2025	84.458	ESPACE AUTO	DIVERS ECHAPPEMENT
26/06/2025	84.458	CRYSTAL AUTO	ADBLUE
	0		PLAQUETTES AR RPLT
	0		BALAI ESSUIE GLACE AR
	0		LIQUIDE DE FREIN
	0		PLAQUETTES AV RPLT
	0		REVISION ET CLIM ET AIR ET CARBURANT
	0		BALAI ESSUIE GLACE AV
01/08/2024	56.395	CRYSTAL AUTO	ADBLUE
	0		REVISION ET CLIM
27/10/2023	26.384	CRYSTAL AUTO	REVISION
	0		BALAI ESSUIE GLACE AV AR
	0		ADBLUE
02/05/2023	9.015	CRYSTAL AUTO	REMPLACEMENT PNEUS ETE