



Expertise

Protocol number: 46516541
Order No. / Reference: 26500911
Inspection date: 9 Jul 2026

Manufacturer: Mercedes-Benz

Model: GLC 220 d 4Matic 9G-TRONIC Exclusive

VIN: W1N2539151F998726



Vehicle details

Manufacturer / Type / Model / Equipment

Mercedes-Benz GLC 220 d 4Matic 9G-TRONIC Exclusive

Vehicle Identification number W1N2539151F998726
Mileage (Read) 128,852 km
First registration 17 Mar 2022
Number of holders 1
Next periodical technical inspection 03/2027
(Report on hand)

Power / Engine displacement 143 kw / 1,950 ccm
Fuel type / Cylinder Diesel / 4
Gearbox / Number of gears Automatic / 9
Type of drive All-wheel drive
Type of vehicle SUV

Colour / colour code Graphitgrau Metallic
Doors / Seats 5 / 5
Upholstery type Cloth / leather combination
Colour of upholstery Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	307 Tag(e)
Last service on / at	05/2026 at 126,022 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF694371
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AKG 00193		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,500 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101V	Summer tyres on Light alloy	Pirelli	6mm / 6mm
2)	235/55 R19 101V	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103H	Winter tyres on Light alloy	Pirelli	2mm / 2mm
2)	235/60 R18 103H	Winter tyres on Light alloy	Pirelli	3mm / 2mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- Anti-lock braking system (ABS)
- Automatic passenger airbag deactivation
- On-board computer
- Roof rails in polished aluminum
- Tachometer
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Chassis: AGILITY CONTROL chassis
- electric parking brake
- Transmission: 9G-TRONIC
- rear window wiper
- Instrument panel and door sills in ARTICO man-made leather
- Remote trunk lid release
- Instrument cluster with 2 tubular round instruments, 13.97 cm (5.5") multifunction display
- Headrests 5-way
- Steering wheel: Multifunction sports steering wheel in 3-spoke design in black leather
- Mercedes-Benz emergency call system
- Package: Storage
- Upholstery: ARTICO leatherette/Grenoble fabric
- Radio accessories: Digital radio
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- Seats: Rear seat backrests foldable
- Seats: Front seats electrically adjustable
- High-visibility vest for drivers
- Central locking
- Airbag: Kneebag for driver
- Airbag: Windowbags
- 4MATIC all-wheel drive
- ATTENTION ASSIST
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Diesel particulate filter
- Third brake light in LED technology
- EASY-Pack cargo cover (removable)
- Driving light assistant
- Electric windows (4-way)
- Velour floor mats in interior color
- Rear window heated
- Interior headliner fabric crystal grey
- KEYLESS-GO start function
- Climate: THERMATIC automatic climate control with 2 climate zones
- Communication module (LTE) for the use of Mercedes me connect services
- LED High Performance Headlights
- Steering column mechanically adjustable in height and length
- Navigation accessories: Extended MBUX functions
- Package: Interior light
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Remote Services Plus
- Power steering
- Seats: i-Size child restraint system on the outer rear seats
- Cruise control
- Immobiliser
- Decorative elements: Linden wood, line structure, glossy brown



Extra equipment

- Ambient lighting (Design the interior according to your personal preference or current mood. With a total of 64 colors, the ambient lighting offers almost unlimited possibilities for lighting design and has the right color for every situation. Illuminated door sills on the driver and passenger sides.)
- Package: High-end infotainment (Media display with touch operation, smartphone integration: Apple CarPlay and Android Auto, connectivity package, navigation, traffic sign assistant: thanks to intelligent linking of camera and map data, it can recognize not only speed limits, no-overtaking zones and their cancellation, but also MBUX augmented reality for navigation, fully digital instrument display, wireless charging system for mobile devices in the storage compartment)
- Package: Night for standard exterior equipment (radiator grille with 2 louvers in high-gloss black with chrome inserts, 48.3 cm (19") 6-spoke alloy wheels, painted high-gloss black and polished with 235/55 R 19 tires on 8 J x 19 ET 38 rims, roof rails in black, front and rear underguards painted black, exterior mirror housings painted high-gloss black, beltline trim and window surrounds in high-gloss black, heat-insulating dark tinted glass from the B-pillar back)
- Radio accessories: Burmester surround sound system (with 13 speakers and 590 watts system power. Experience enhanced performance and exclusivity with legendary Burmester sound. The high-performance speakers create a first-class surround sound experience. This can be specifically optimized for the front and rear seats, intensifying the listening experience. A quality that is also visible thanks to the high-quality Burmester logos.)
- URBAN GUARD Vehicle Protection (The URBAN GUARD Vehicle Protection package offers comprehensive monitoring. It includes an anti-theft alarm system and tow-away protection that can detect changes in position. Movements inside the vehicle also trigger visual and audible warnings. The Mercedes me theft and parking collision detection system informs you via the app.)
- MBUX Augmented Reality for navigation has been removed
- Package: Advanced Park (Parking package with reversing camera, active parking assistant with PARKTRONIC)
- Package: Business (Advanced Parking Package: Active Parking Assist PARKTRONIC with reversing camera; Advanced Infotainment Package: Media display with touch operation, smartphone integration - Apple CarPlay and Android Auto, connectivity package navigation, traffic sign assist; Comfort Package: Heated seats for driver and front passenger, seat comfort package - electric and manual adjustment options for the front seats; larger fuel tank capacity)
- Package: Comfort (Seat heating for driver and front passenger, electric and manual adjustment options for driver and front passenger seats, electro-pneumatic 4-way lumbar support and lateral support adjustment with control element on the seat, electric seat cushion tilt adjustment, electric height adjustment, electric backrest adjustment, mechanical seat cushion depth adjustment by 6 cm with leg rest pad, mechanical longitudinal adjustment, mechanical headrest adjustment)
- Package: Mirrors (Electrically folding exterior mirrors, lowering right exterior mirror, automatic dimming function)
- Paint finish: Metallic
- Partition net for luggage compartment separation (and occupant protection)
- Plug-in module luggage compartment (telescopic poles)
- Wheels: 48.3 cm (19") alloy wheels, 4-piece set in 6-spoke design (high-gloss black painted and diamond-turned with 235/55 R 19 tires on 8 J x 19 ET 38 rims)
- Wheels: Complete summer wheel sets fitted at the factory
- Wheels: Winter complete wheels M+S 4x 45.7 cm (18") light alloy wheels in 5-spoke design (additionally vanadium silver painted (82R) with 235/60 R 18 on 8 J x 18 ET 38)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Door - front right side	Door edge - Scratch(es) - Smart repair
2	Door - front left side	Door edge - Scratch(es) - Smart repair
3	2nd wheel set	1 tyre - Does not meet the leasing specifications - Replace
4	2nd wheel set	1 tyre - Does not meet the leasing specifications - Replace
5	2nd wheel set	1 tyre - Does not meet the leasing specifications - Replace
6	2nd wheel set	1 tyre - Does not meet the leasing specifications - Replace
7	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - Loss in value
8	Rear bumper	Rear bumper - Scratch(es) - Paint
9	Bonnet	Bonnet (Übermäßige Steinschläge) - Stone chips - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

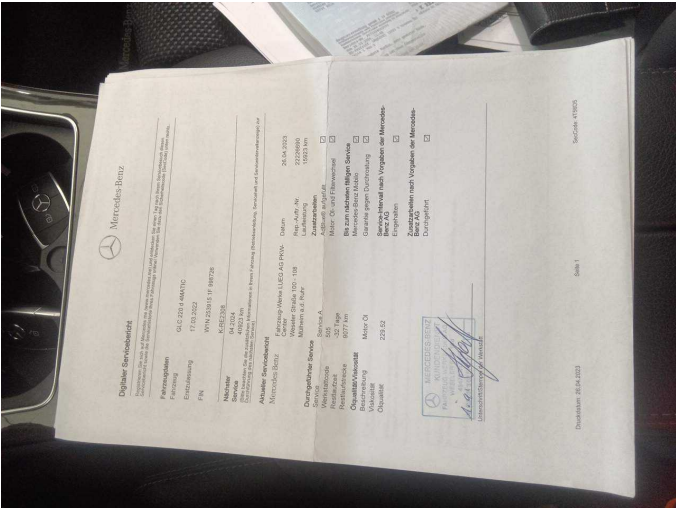


Figure 15: Documents

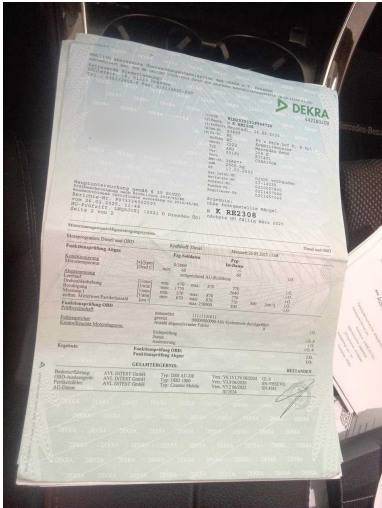


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

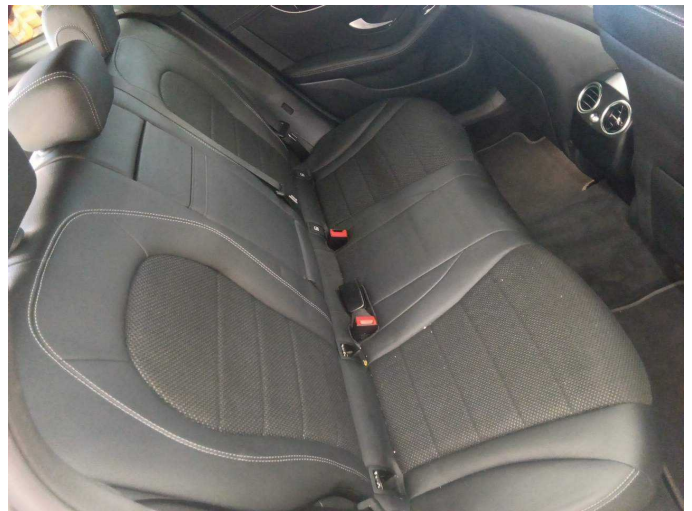


Figure 22: Misc.

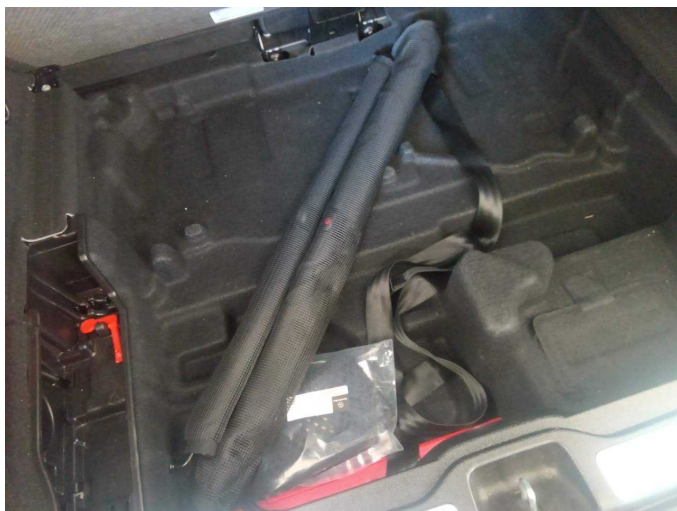


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

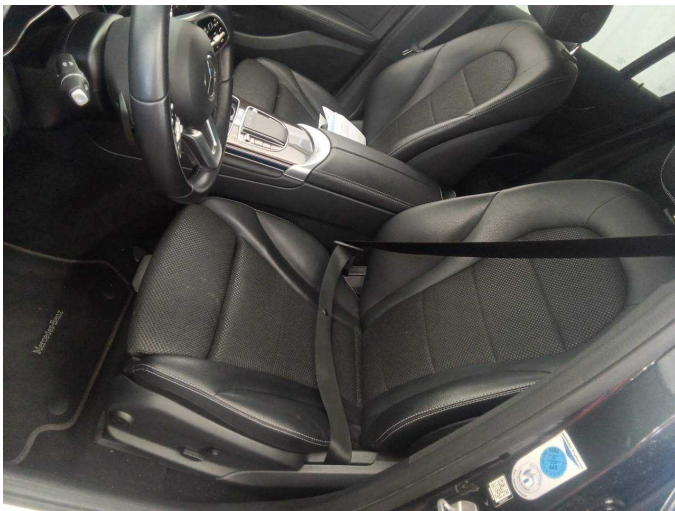


Figure 27: Misc.

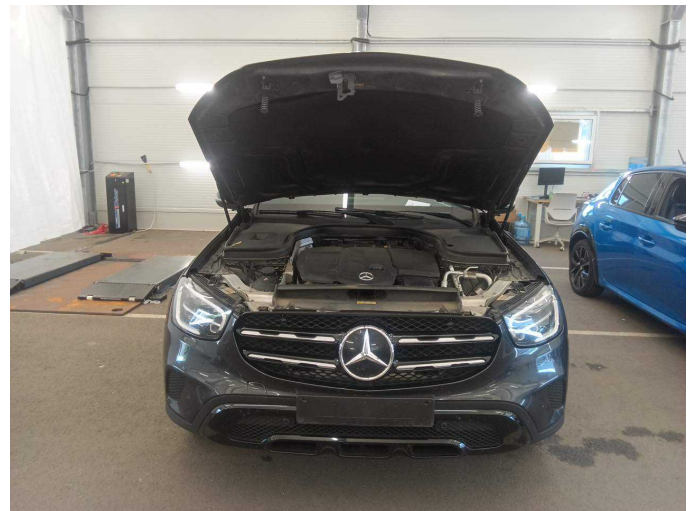


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.




Damage 1: Door - front right side: Door edge - Scratch(es) - Smart repair




Damage 1: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair

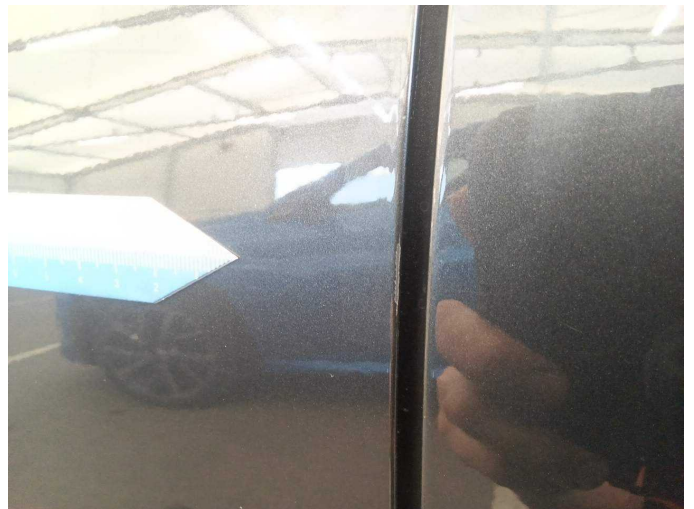

Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair

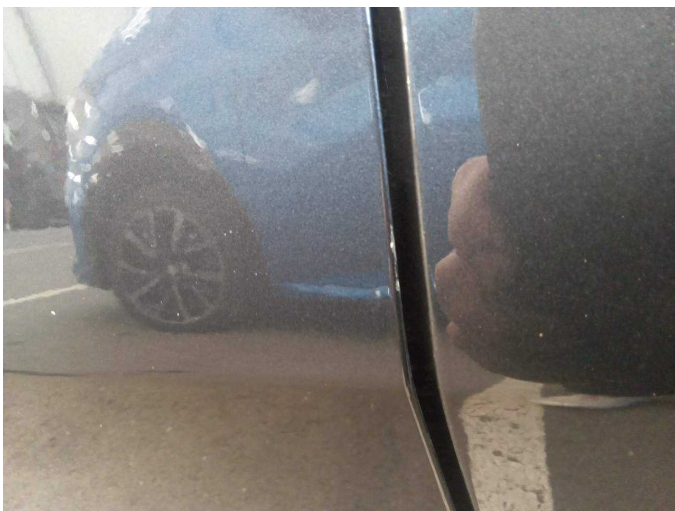

Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 3: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 3: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 4: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 4: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 4: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 4: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 5: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 5: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 5: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 5: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 6: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace




Damage 6: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 6: 2nd wheel set: 1 tyre - Does not meet the leasing specifications - Replace



Damage 7: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value

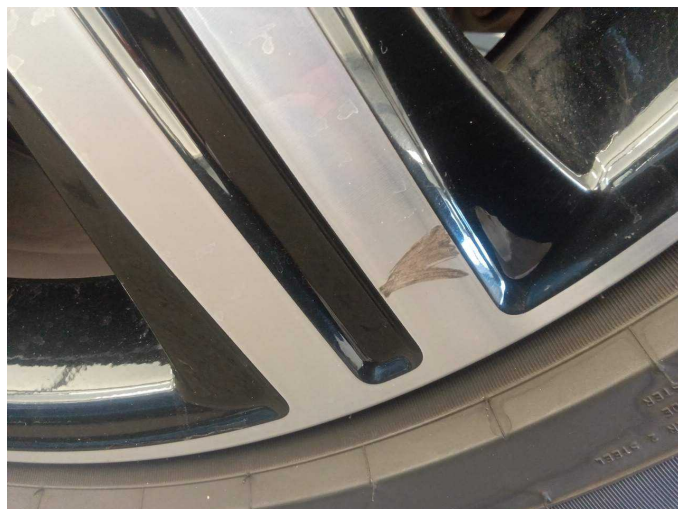

Damage 7: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 9: Bonnet: Bonnet (Übermäßige Steinschläge) - Stone chips - Paint



Damage 9: Bonnet: Bonnet (Übermäßige Steinschläge) - Stone chips - Paint



Damage 9: Bonnet: Bonnet (Übermäßige Steinschläge) - Stone chips - Paint



Damage 9: Bonnet: Bonnet (Übermäßige Steinschläge) - Stone chips - Paint



Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction



Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N2539151F998726

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLC 220 d 4Matic 9G-TRONIC Exclusive

Datum	KM-Stand	Beschreibung
11.05.2026	126.022	Bremsscheiben+Beläge v+h; Regelwartungsdienst
23.07.2025	97.411	Regelwartungsdienst
07.10.2024	68.886	Regelwartungsdienst
04.09.2024	64.842	Bremsklötze hinten
05.01.2024	42.111	Regelwartungsdienst
26.04.2023	15.923	Regelwartungsdienst