


2-DNT-828

2-DNT-828 · ST-line 125pk 92kw mHEV M6 5d · 15 June 2026 · Zaventem (BE)

Specifications

License Plate Number	2-DNT-828	Fuel Type	Hybrid Gasoline
Manufacturer	FORD	VIN	WF0NXXGCHNPL83916
Model	Focus	Cylinder Capacity	999 ^{cm3}
Model Versions	ST-line 125pk 92kw mHEV M6 5d	Transmission Type	Handmatig geschakelde transmissie
Body Type	5 door hatchback	First Admission	09-05-2023
Color	Silver	Odometer	86.174 ^{Km}
Paint Type	Metallic	Numer Of Keys	2
Production Year	2023	Interior	Black
KW	92	Number Headrests	5

Images

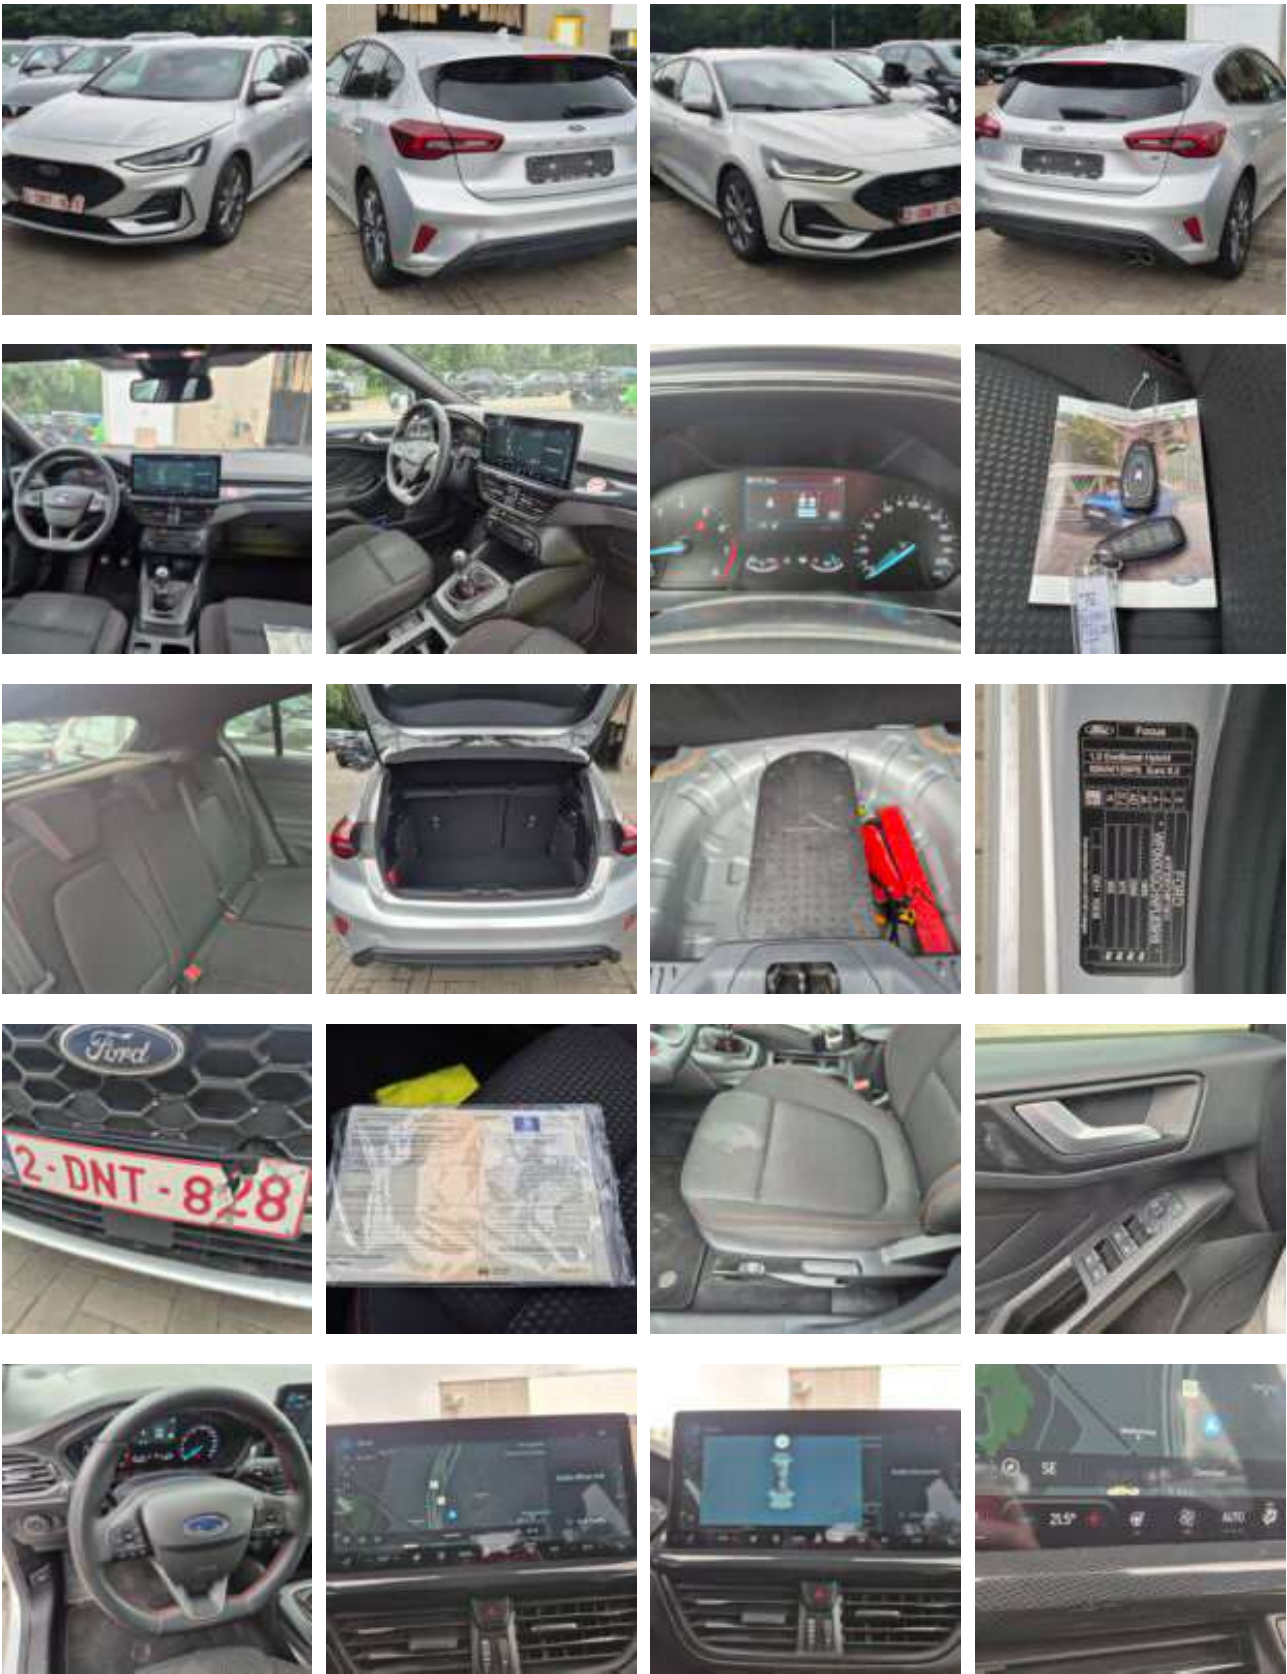



Accessories

ABS	Electric windows front
Airbags	Electrically adjustable exterior mirrors
Alloy wheels	Front & rear parking sensors
Audio System	Leather steering wheel
Automatic air conditioning	Navigation system
Bluetooth car kit	Roller cover / parcel shelf
Central door locking	Seat heating
Centre armrest	Steering wheel multifunction
Cruise control	Steeringwheel - Heated
Electric rear windows	Windscreen - Heated

Condition

Condition exterior Adequate	Last Maintenance Unknown
Condition interior Adequate	Previous Repairs Unknown

Tire Specifications

Tire	Profile	Brand	Width	Aspect Ratio	Radial	Type
Front Left	5 mm	Goodyear	215 mm	50 mm	17 inch	All Season
Rear Left	6 mm	Goodyear	215 mm	50 mm	17 inch	All Season
Front Right	5 mm	Goodyear	215 mm	50 mm	17 inch	All Season
Rear Right	6 mm	Goodyear	215 mm	50 mm	17 inch	All Season
Spare Tire Type	Compressor					

Damages



Damage Part	Damage Type	Repair Type	Acceptable
Reardoor – Left	Stonechipping	Touch-up / Polish	No



Damage Part	Damage Type	Repair Type	Acceptable
Frontdoor – Left	Stonechipping	Touch-up / Polish	No



Damage Part	Damage Type	Notes	Repair Type	Acceptable
Front	Dislocated / Loose	Zie foto's mogelijk verborgen schade	Panelbeating & Spray	



Damage Part	Damage Type	Repair Type	Acceptable
Grille	Broken	Replace	No



Damage Part	Damage Type	Notes	Repair Type	Acceptable
Bumper – Front	Broken	Kentekenplaat en houder	Replace	No



Damage Part	Damage Type	Repair Type	Acceptable
Bumper – Front	small dents / small scratches	Panelbeating & Spray	No



Damage Part	Damage Type	Repair Type	Acceptable
Alloy – Right Front	Damaged	Rim repair	No



Damage Part	Damage Type	Repair Type	Acceptable
Fender – Front Right	Small dent(s)	Restyle / Touch-up	No



Damage Part	Damage Type	Notes	Repair Type	Acceptable
Frontdoor – Right	Scratch(es)	Deurgreep	Spray	No



Damage Part	Damage Type	Repair Type	Acceptable
Frontdoor – Right	Dent(s) & Scratch(es)	Panelbeating & Spray	No



Damage Part	Damage Type	Repair Type	Acceptable
Skirt – Right	small dents / small scratches	Panelbeating & Spray	No



Damage Part	Damage Type	Repair Type	Acceptable
Reardoor – Right	Dent(s) & Scratch(es)	Panelbeating & Spray	No



Damage Part	Damage Type	Repair Type	Acceptable
spoiler RB	Broken	Replace	No



Damage Part	Damage Type	Repair Type	Acceptable
Bumper – Rear	Broken	Replace & Spray	No



Damage Part	Damage Type	Repair Type	Acceptable
Interior	Stains & dirt	Cleaning	No