



**TOYOTA Corolla: 7046-MBS**

Vinnnumber:	<b>SB1K93BE40E334659</b>	Versionname:	<b>1.8 125H BUSINESS PLUS E-CVT berlina con portón</b>
First Registrationdate:	<b>17/10/2022</b>	Fiscalpower:	<b>90kW 5P automática</b>
Expertise Mileage:	<b>291369</b>	Power Kw:	
Bodytype:	<b>Berline</b>	Body colour:	<b>White</b>
Gearbox:	<b>Automatic</b>	Type of rims (mounted):	<b>Aluminium</b>
Transmission:			
Fueltype:	<b>Hybrid</b>		
Engine functioning:	<b>Yes</b>		
Battery functioning:	<b>Yes</b>		
Vehicle running:	<b>No</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Type of rims (mounted):	<b>Aluminium</b>		
Certificate of Conformity:	<b>No</b>		
Category:	<b>Passenger Car</b>		
Registration Certificate Car (BE):	<b>No</b>		

**Options**

Number of keys total	<b>1</b>	Radio
Number keys remote	<b>1</b>	Central consol F
Windows electric F		Luggage cover
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Steering wheel leather		
Radio multimedia		
Type of climate control	<b>Autom climate control</b>	

**Tyres**

205/55/16/91 W				
Summer tyres:	Fr.L.	<b>Goodyear: 5 mm</b>	Fr.R.	<b>Goodyear: 5 mm</b>
	Re.L.	<b>Goodyear: 6 mm</b>	Re.R.	<b>Goodyear: 6 mm</b>
Tyre profile depth FL				<b>5.0</b>
Tyre profile depth FR				<b>5.0</b>
Tyre profile depth RL				<b>6.0</b>
Tyre profile depth RR				<b>6.0</b>
Tyre size FL				<b>205/55 R 16 91 W</b>
Tyre size FR				<b>205/55 R 16 91 W</b>
Tyre size RL				<b>205/55 R 16 91 W</b>
Tyre size RR				<b>205/55 R 16 91 W</b>
Tyre type FL				<b>Summer</b>
Tyre type FR				<b>Summer</b>
Tyre type RL				<b>Summer</b>
Tyre type RR				<b>Summer</b>
Tyre make FL				<b>259</b>
Tyre make FR				<b>259</b>
Tyre make RL				<b>259</b>
Tyre make RR				<b>259</b>

**Assistance equipment**

Repair kit	<b>No</b>
------------	-----------

Interior, Dirty, Cleaning



Interior, Not original part, Acceptable



Boot lid covering R, Scratch(es), Replace



Backrest cover FL, Worn, Acceptable



Armrest F M, Tear, Replace



MOT certificate, Missing, Repair/replace (lump sum)



Registration document, Missing, Repair/replace (lump sum)



Ignition key, Missing, Repair/replace (lump sum)



Tyre FL, Tear, Acceptable



Outside rear-view mirror base L, Broken, Replace and paint



Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Wing RL, Scratch(es), Repair and paint (complete)



Bumper F, Broken, Replace and paint



Wing RR, Dent(s) and scratch(es), Repair and paint (complete)



Door RR, Scratch(es), Repair and paint (complete)



Door FR, Dent(s) and scratch(es), Repair and paint (complete)




Mirror side repeater R, Broken, Replace



Outside rear-view mirror housing R, Scratch(es), Repair and paint (complete)



Wing FR, Dent(s) and scratch(es), Repair and paint (complete)

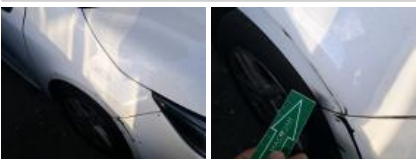

Alloy rim FR, Scratch(es), Repair/replace (lump sum)



Outer sill R, Scratch(es), Repair and paint (complete)



Tyre repair kit, Missing, Repair/replace (lump sum)



Tailgate / Boot, Scratch(es), Repair and paint (complete)



Bumper R, Dent(s) and scratch(es), Repair and paint (complete)



Bumper spoiler Rear, Scratch(es), Repair and paint (complete)



Bumper moulding RR, Missing, Replace



Tyres, No damage, Check



Bodywork, Glue residues, Remove lettering



