



OPEL GRANDLAND: GE-110-WH

Vinnumber:	W0VZCYHZXN6804333	Versionname:	OPEL GRANDLAND 1.5 DIESEL 130 ULTIMATE AUTO
First Registrationdate:	23/02/2022	Fiscalpower:	VP [5P] bva 8-131CH-7cv (SUV)
Expertise Mileage:	137356	Power Kw:	96
Bodytype:	SUV	Body colour:	Black
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Hybrid	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options


Number of keys total	2	Radio	
Number keys remote	2	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Steering wheel leather		Rear view camera	
Type of climate control	Autom climate control	Seat cover lining	Lining Alcantara

Tyres

	225/55/18/102 V			
Summer tyres:	Fr.L.	Michelin: 60%	Fr.R.	Michelin: 60%
	Re.L.	Goodyear: 45%	Re.R.	Goodyear: 60%
Tyre profile depth FL				4.2
Tyre profile depth FR				4.2
Tyre profile depth RL				5.2
Tyre profile depth RR				4.2
Tyre size FL				225/55 R 18 102 V
Tyre size FR				225/55 R 18 102 V
Tyre size RL				225/55 R 18 102 V
Tyre size RR				225/55 R 18 102 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				261
Tyre make FR				261
Tyre make RL				259
Tyre make RR				259

Assistance equipment

Jack	Yes
Seat cover FL, Tear, Replace	

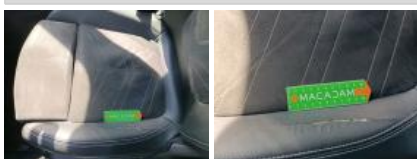

Alloy rim FR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Alloy rim FL bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Door lock FL, Strained, Replace



Bumper F, Scratch(es), Paint




Bumper moulding F, Scratch(es), Replace




Bumper spoiler F, Scratch(es), Paint



Door RR, Scratch(es), Paint

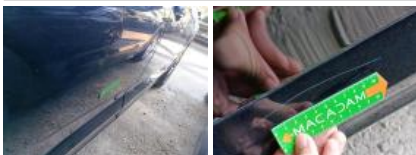

Door FR, Scratch(es), Paint

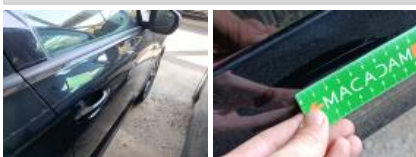

Rear bulkhead lining, Scratch(es), Repair/replace (lump sum)



Boot lid covering R, Scratch(es), Replace



Bumper R, Scratch(es), Paint



Historique Maintenance

Immatriculation: **GE-110-WH** Date de 1ère immatriculation: **23/02/2022**

Modèle: **Opel GRANDLAND 1.5 DIESEL 130 ULTIMATE AUTO VP [5P] bva 8-131CH-7cv (SUV)**

Date	Kilométrage	Fournisseur	Descriptif
20/10/2025	121.332	FAURIE MOTOR CHARENTE	REVISION
	0		LIQUIDE DE FREIN
	0		COURROIE ACCESSOIRES RPLT
	0		LIQUIDE DE REFROIDISSEMENT RPLT
15/04/2025	101.017	FAURIE MOTOR CHARENTE	REVISION ET CLIM ET AIR ET CARBURANT
28/08/2024	79.954	FAURIE MOTOR CHARENTE	REVISION
	0		DISQUES PLAQUETTES AV RPLT
21/12/2023	61.106	FAURIE MOTOR CHARENTE	LIQUIDE DE FREIN
	0		REVISION ET CLIM
27/09/2023	53.302	NORAUTO SAS (PRODUIT SPE)	REMPLACEMENT PNEUS ETE
30/05/2023	42.225	FAURIE MOTOR CHARENTE	BALAISSUIE GLACE AV AR
	0		REVISION ET CLIM
04/11/2022	22.908	FAURIE MOTOR CHARENTE	REVISION