



Expertise

Protocol number: 46454030
Order No. / Reference: 26664701
Inspection date: 9 Jul 2026

Manufacturer: Skoda
VIN: TMBJR0NX9TY062535

Model: Octavia Combi 1.5 TSI mHEV DSG Sportline



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 1.5 TSI mHEV DSG Sportline	
Vehicle Identification number	TMBJR0NX9TY062535
Mileage (Read)	7,470 km
First registration	5 Feb 2026
Number of holders	1
Next periodical technical inspection	02/2029
(Report not on hand)	
Power / Engine displacement	110 kw / 1,498 ccm
Fuel type / Cylinder	Hybrid Petrol / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Graphite Grau Metallic (F7C)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	22,600 km
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HT465007
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8004 / AVQ 00280		
Emission standard	EURO6;WLTP;EB;PI/CI;M, N1, N2	fine dust sticker	
Permitted total weight	1,910 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 91Y	Summer tyres on Light alloy	Kumho	6mm / 6mm
2)	225/45 R18 91Y	Summer tyres on Light alloy	Kumho	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 95H	Winter tyres on Light alloy	Pirelli	6mm / 6mm
2)	205/55 R17 95H	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	125/70 R18 99M	Summer tyres on Steel	Sonstige	8 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Emergency Steering and Turn Assist
- Storage compartments (storage compartments in the front door panels with 1.5l bottle holders, storage compartments in the rear door panels with 1.0l bottle holders, storage compartments in the doors with felt lining)
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Evasive steering and turning assistant
- Exterior mirrors painted black, door handles in body color
- Cup holders in the front center console
- Glasses compartment in the headliner
- black headliner
- AERO roof rails in gloss black
- Third brake light
- Electronic parking brake including auto-hold function
- Electronic Stability Control (ESC)
- Chassis: Sport chassis (sporty damper tuning, ground clearance reduced by approximately 15mm)
- High beam assist
- Front splitter and rear diffuser in black
- Front and rear footwell lighting
- Removable luggage roller blind
- Cruise control system
- Tinted windows
- Rear window wiper including windshield washer system
- Interior mirror automatically dimming
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Child safety lock for the rear doors and windows
- Fuel tank 45 l
- Crossroad Assist
- Black radiator grille frame
- LED headlights with LED daytime running lights
- Steering wheel: height and reach adjustable
- Steering wheel: Paddle shifters on the steering wheel
- Manual headlight range adjustment
- Front center armrest, including storage compartment
- Multi-collision brake
- Otto particulate filter
- Pedals in stainless steel look
- Radio: Music system (with 10" infotainment display)
- Radio accessories: 8 speakers
- Radio accessories: Bluetooth hands-free system
- Radio accessories: Wireless & Wired SmartLink (Apple CarPlay, Android Auto)
- Tire pressure monitoring
- Wheels: 18" Vega AERO alloy wheels, black gloss turned (7.5J x 18, ET 48 with 225/45 R18 tires)
- Storage compartment in the luggage compartment
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag: Center airbag front
- Traction control (ASR)
- Electrically adjustable, heated and folding exterior mirrors (automatic dimming (driver's side))
- Hill start assist
- Four roof grab handles (rear with coat hooks, ticket holder on the windshield)
- Digital Cockpit Plus
- Ice scraper in the fuel filler flap
- Electronic transverse differential lock (XDS+)
- Driving profile selection
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Front radar assistant (Front Assist) (evasive steering and turning assistant)
- Luggage compartment lighting with 2 lamps
- Intelligent Speed Assist (ISA)
- Transmission: 7-speed dual-clutch transmission (DSG)
- Heated rear window
- Interior features: Design Selection Sportline (fabric and synthetic leather interior combined with high-quality materials - grey decorative stitching in the interior - trim strips in dark carbon and piano black)
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger, and with anti-allergen filter & activated carbon filter)
- LED taillights in crystal glass look
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Sport design steering wheel
- Two reading lights at the front (including reading lights at the rear - trunk lighting)
- Engine drag torque control (MSR)
- Fatigue detection
- Front and rear parking sensors
- Progressive steering
- Radio accessories: 2 x USB charging ports in the rear and USB charging port in the rearview mirror
- Radio accessories: Digital radio reception DAB+
- Umbrella and broom compartments in the front doors
- Rain sensor and driving light assistant (Easy Light Assist)
- Tire mobility kit (tire repair spray incl. compressor)
- Rear view camera
- Electromechanical power steering
- Safety lights in the front side doors
- Seats: Heated front seats



- | | |
|---|---|
| <ul style="list-style-type: none"> • Seat belts (Height-adjustable three-point seat belts in the front, with belt tensioners - Three three-point seat belts in the rear - Seat belt reminder indicators in all seats) • Seats: Sports seats with integrated headrests in the front and height-adjustable headrests in the rear. • Seats: Front seats are height-adjustable (with adjustable lumbar support) • Sun visors with illuminated make-up mirror on driver and passenger side • Lane keeping assistant (Lane Assist) • Lane change and parking assist as well as exit warning • 12V socket in the trunk • Telephone: Phonebox with inductive charging function (connection via external antenna) • Front door sill trims • Traffic sign recognition • Lashing eyes in the trunk • Preparation for a trailer hitch (including trailer stabilization) • Immobiliser • Decorative trim in piano black around the air vents | <ul style="list-style-type: none"> • Seats: Rear seat backrest split 60:40 and foldable (with center armrest and pass-through option) • Seats: Pockets on the backs of the front seats including smartphone pockets • SKODA Connect (SOS emergency call function (eCall+ including automatic activation in the event of an accident with airbag deployment) - Mobility service (connection option for rapid assistance in case of breakdown) - Information service (connection option to the hotline for all questions relating to vehicle functions) - Free remote vehicle access for 3 years with access to vehicle data and functions via smartphone) • Glazing: Acoustic glazing in the front side windows and Sunset (dark tinted rear window and rear side windows) • Preparation for alcohol immobilizer • Wash water level check • Central locking including remote control integrated into the key and EASY Start |
|---|---|

Extra equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Chassis: Adaptive chassis DCC (10 mm reduced ground clearance) • Package: Infotainment Plus & Driving Assistance Plus (DSG) (13" infotainment screen - navigation system - voice control - Digital Cockpit Plus - head-up display - Infotainment Online (3-year subscription) - Adaptive Cruise Control (ACC) - Travel Assist - Intelligent Parking Assist (IPA) - Remote Parking Assist (RPA) - KESSY - anti-theft alarm system) • Package: Safety (Rear side airbags - Proactive occupant protection with rear impact detection) • Package: Winter Plus (Heated steering wheel - Heated windscreen - Heated outer rear seats - 3-zone Climatronic) • Panoramic sunroof, electric (deletion of the glasses compartment in the headliner) | <ul style="list-style-type: none"> • Luggage net partition • Paint finish: Metallic • Package: Light & Sight Plus and Comfort (Sportline Combi) (Headlight cleaning system - Matrix headlights - 360° surround view cameras (Area View) - Electrically operated child safety lock - Electric tailgate operation with comfort opening - KESSY - Anti-theft alarm system - Semi-automatic luggage compartment cover - Sunshades on the rear doors - Sleeping headrests on the outer rear seats) • Package: Simply Clever (Floor mats - Double-sided boot mat - Media holder - Tablet holder - Waste bin - Storage box for the center tunnel - 3rd vehicle key) • Radio accessories: CANTON sound system (12 speakers (10 speakers, 1 center speaker, 1 subwoofer) - including steel spare wheel) |
|---|---|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Engine	Engine cover - Broken / torn - Replace
2	Rear bumper	Rear bumper - Scratch(es) - Paint
3	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

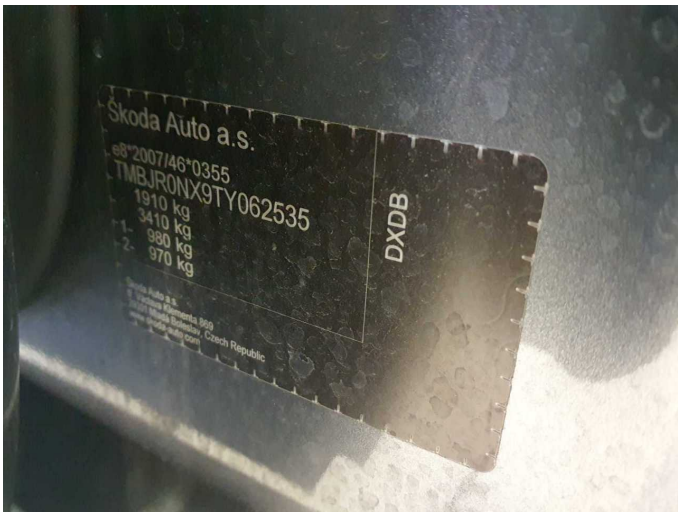


Figure 11: VIN



Figure 12: Mounted tyres

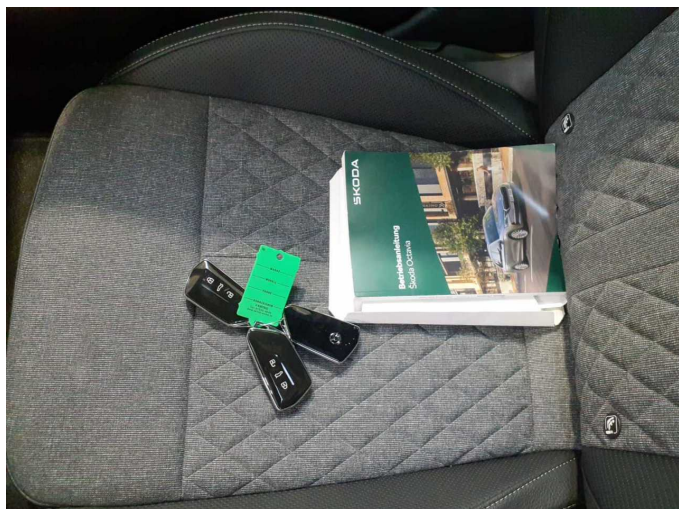


Figure 13: Documents



Figure 14: Navigation



Figure 15: Misc.

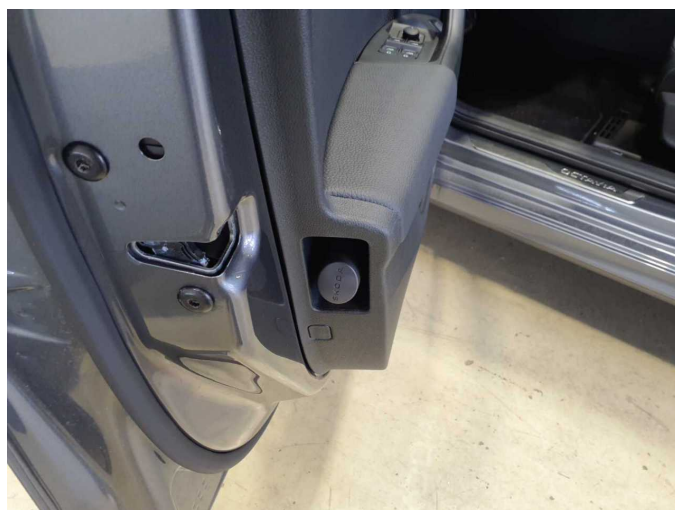


Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

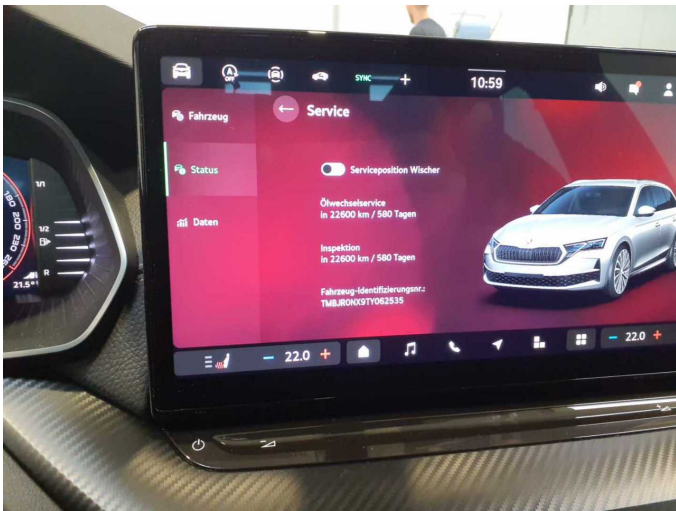


Figure 21: Misc.

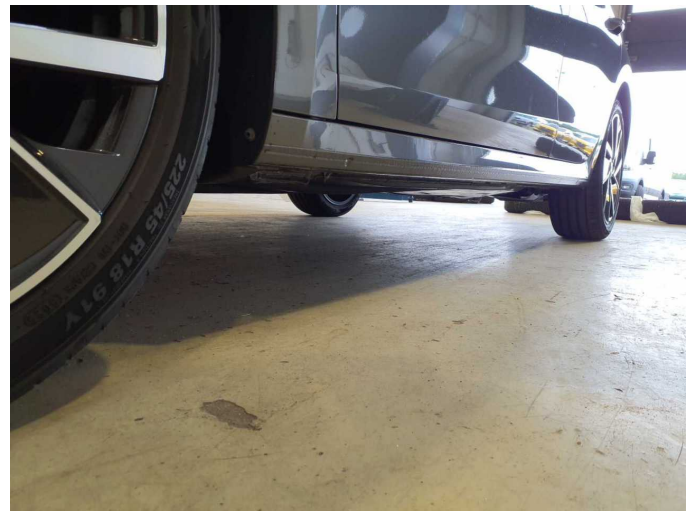


Figure 22: Misc.

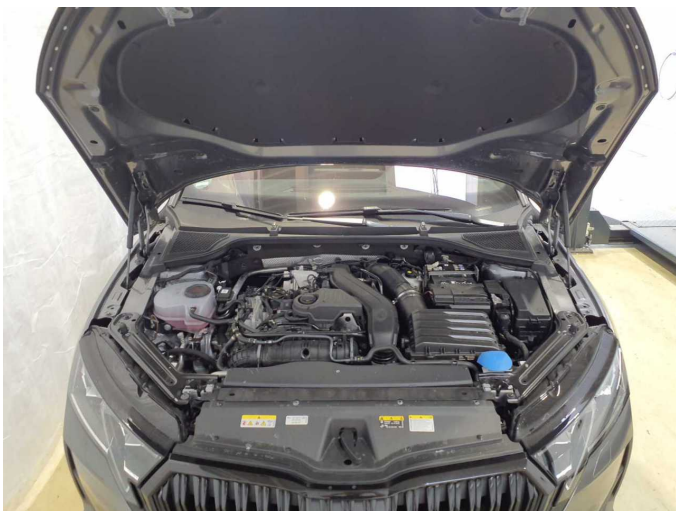


Figure 23: Misc.



Figure 24: Misc.

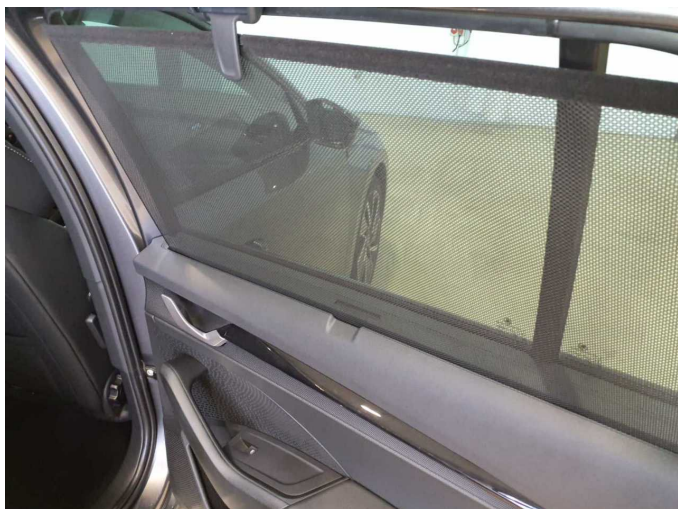


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

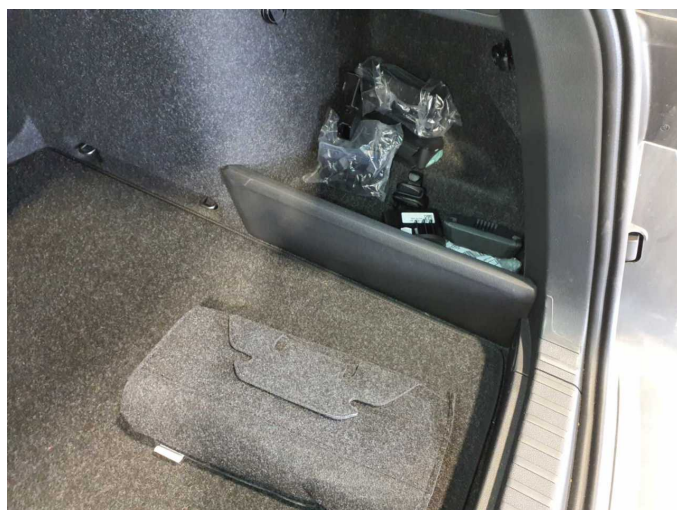


Figure 28: Misc.




Figure 29: Misc.



Damage 1: Engine: Engine cover - Broken / torn - Replace




Damage 1: Engine: Engine cover - Broken / torn - Replace

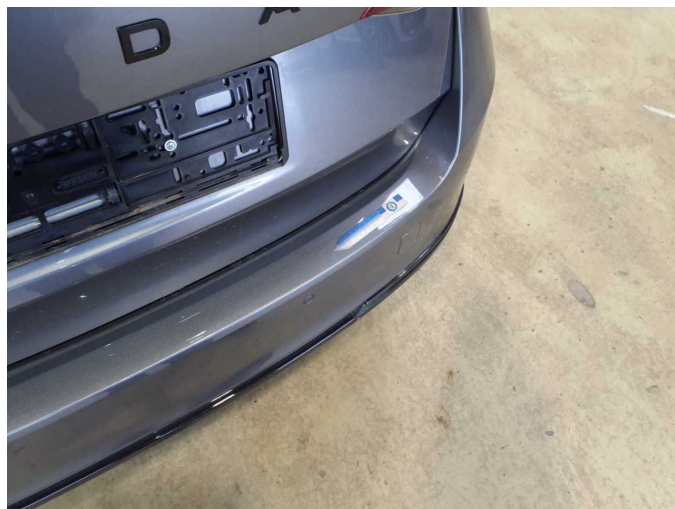


Damage 2: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Paint

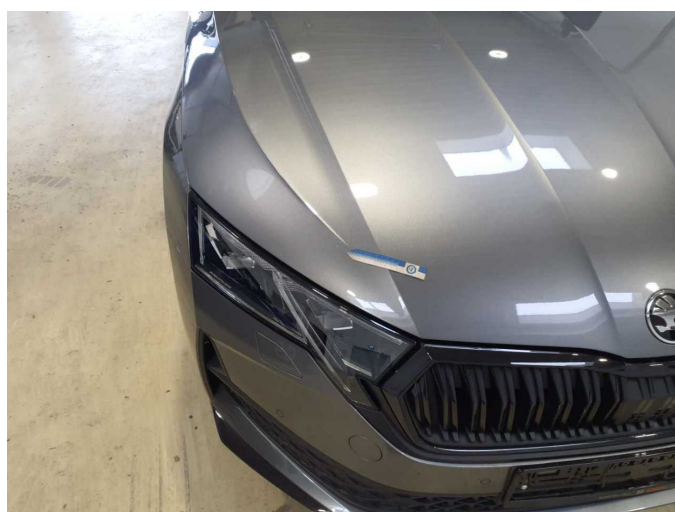

Damage 3: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

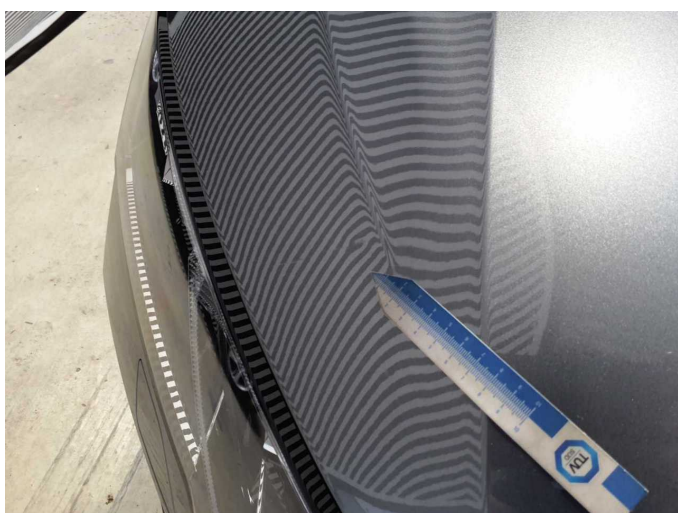

Damage 3: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 3: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint