



Expertise

Protocol number: 46738558
Order No. / Reference: 26800983
Inspection date: 27 Jul 2026

Manufacturer: Volkswagen

Model: ID.3 Pro S (5-Sitzer)

VIN: WVGZZZE1ZP8003668



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen ID.3 Pro S (5-Sitzer)	
Vehicle Identification number	WVGZZZE1ZP8003668
Mileage (Read)	69,313 km
First registration	2 May 2023
Number of holders	1
Fuel type	Electric
Power	70 kW
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	Station wagon
Colour / colour code	Black (041)
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Light grey-Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	214 Tag(e)
Last service on / at	02/2025 at 37,111 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS472460
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CKW 00067		
Emission standard	2017/1151	fine dust sticker	
Permitted total weight	2,300 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R19 93T	Summer tires (with run-flat tires) on Light alloy	Bridgestone	4mm / 3mm
2)	215/50 R19 93T	Summer tires (with run-flat tires) on Light alloy	Bridgestone	2mm / 2mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R22 93T	Winter tires (with run-flat tires) on Light alloy	Continental	5mm / 5mm
2)	215/50 R22 93T	Winter tires (with run-flat tires) on Light alloy	Continental	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Turning brake function and evasive steering support
- Airbags: Front and rear head airbags, front side airbags, center airbag
- Anti-lock braking system (ABS)
- Electrically adjustable and heated exterior mirrors
- Vehicle tool kit
- Car2X (Using the WLANp ITS G5 standard, all Car2X-enabled vehicles and traffic systems such as traffic lights can transmit data at high speed without using the mobile network. This works over a distance of around 800 meters - enough to warn of an invisible traffic jam.)
- Parking aid (warning signals for obstacles in the front and rear area)
- Speed limiter (in conjunction with online services)
- Rear window heated
- ISOFIX mounting points (for child seats on the outer rear seats and on the front passenger seat, i-Size compatible)
- Headrests (5) front and rear
- Charging: 11 kW AC charging capacity
- LED headlights with automatic headlight control
- Illuminated makeup mirrors in the sun visors
- Front center console with 2 cup holders
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Emergency call service (no registration required, service is activated upon delivery)
- Radio: "Ready 2 Discover" (Touchscreen - Voice control - Digital radio reception DAB+)
- Radio accessories: 2 USB-C ports at the front
- Tire pressure monitoring system (passive)
- Keyless start system without safe locking
- Electromechanical power steering (speed-dependent control)
- Seats: 3 rear seats, rear seat backrest asymmetrically split and foldable (with center armrest, pass-through, 2 cup holders)
- Lane keeping assistant "Lane Assist"
- Traffic sign recognition
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear
- Airbag for driver and front passenger (with passenger airbag deactivation)
- 30-color ambient lighting
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto
- third brake light
- CCS charging socket
- e-Sound (artificially generated engine noise to inform other road users about the approach of the e-vehicle)
- Black surround for the infotainment display and central controls
- Electronic Stability Program (ESP)
- Driving profile selection
- Transmission: Direct drive, 1-speed
- rear window wiper
- "Climatronic" air conditioning system (active combination filter - stationary air conditioning)
- Mode 3 Type 2 charging cable, 16 A
- LED taillights
- Steering wheel: Multifunction leather steering wheel (heated - touch controls)
- Fatigue detection (detects signs of possible driver fatigue based on characteristic steering behavior, time of day and driving duration and issues a visual and audible warning)
- Online update capability from ID.Software 2.1 onwards.
- Upholstery in microfleece "ArtVelours" (center panels of the front seats and the outer rear seats in microfleece "ArtVelours")
- Radio accessories: 4 + 1 speakers
- Wheels: 4 "Andoya" alloy wheels 7.5 J x 19 in black, polished finish (Airstop tires 215/50 R 19 - wheel locking with enhanced theft protection)
- Seat belts: Three-point automatic seat belts at the front with belt tensioners
- Seats: Armrests, front seats
- Seats: Front seats are height-adjustable
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened seat belts front and rear
- Central locking with remote control

Extra equipment

- Adaptive Cruise Control (ACC) "stop & go", with speed limiter
- Package: Assistance package (Anti-theft alarm system with interior monitoring, backup horn and tow-away protection - Proactive occupant protection system in conjunction with "Front Assist" - "Rear View" reversing camera - "Keyless Access" keyless locking and starting system with safe locking - Illuminated door handle recesses - "Park Assist Plus" parking assistant incl. parking aid)
- Paintwork: two-tone with black roof, solid color
- Charging cable: Mains charging cable for household socket
- Package: Comfort Package (Pro S) (2 USB-C ports in the front, 2 USB-C charging ports on the rear center console - Electrically adjustable, folding and heated exterior mirrors - Automatically dimming interior mirror - Center console with illuminated storage compartment with roller blind, 2 cup holders - Rain sensor - Automatically heated front windshield washer nozzles - Ambient lighting with logo projection - Heated front seats)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Roof	Roof - dent(s) - Smooth repair work
2	Wing mirror - left side	Cap - Scratch(es) - Smart repair
3	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
4	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Replace
5	Rear bumper	Rear bumper - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 tyre - Broken / torn - No deduction
2	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
3	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
4	Wheel / tyres	Tyres - complete set (Über 2mm) - No deduction
5	Door - front left side	Door - Scratch(es) - No deduction
6	Trim / covers	Floor mats - Broken / torn - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

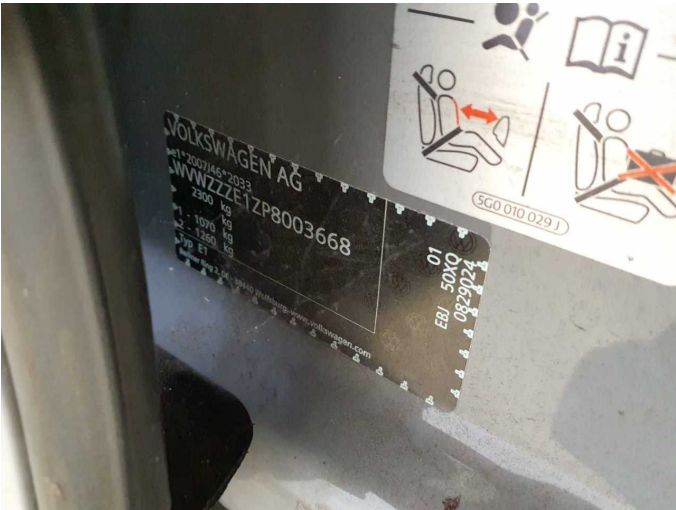


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

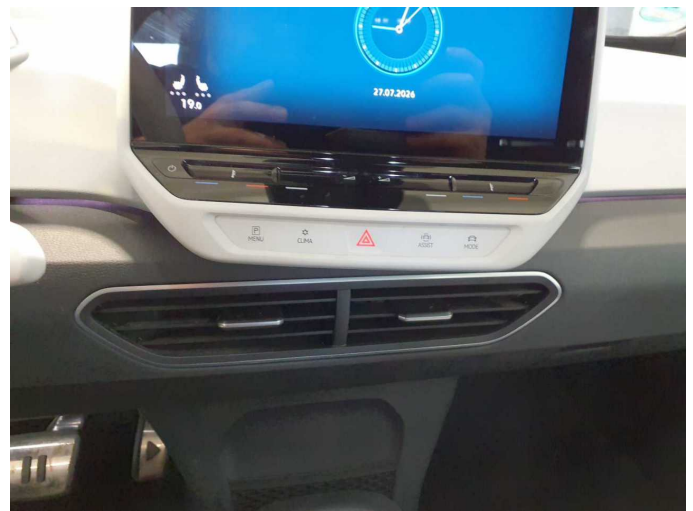


Figure 22: Misc.



Figure 23: Misc.

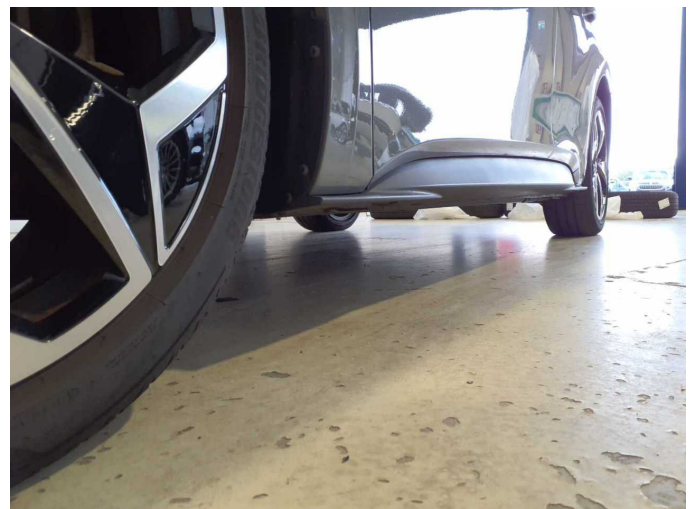


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

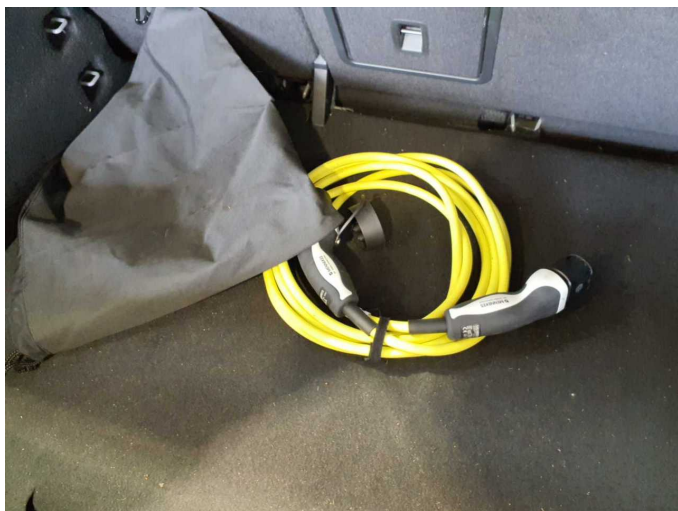


Figure 27: Misc.




Figure 28: Misc.



Damage 1: Roof: Roof - dent(s) - Smooth repair work



Damage 1: Roof: Roof - dent(s) - Smooth repair work

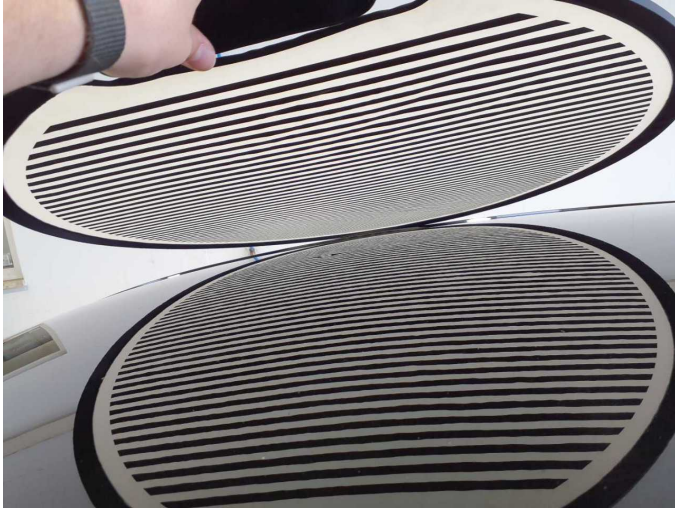

Damage 1: Roof: Roof - dent(s) - Smooth repair work



Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair




Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value

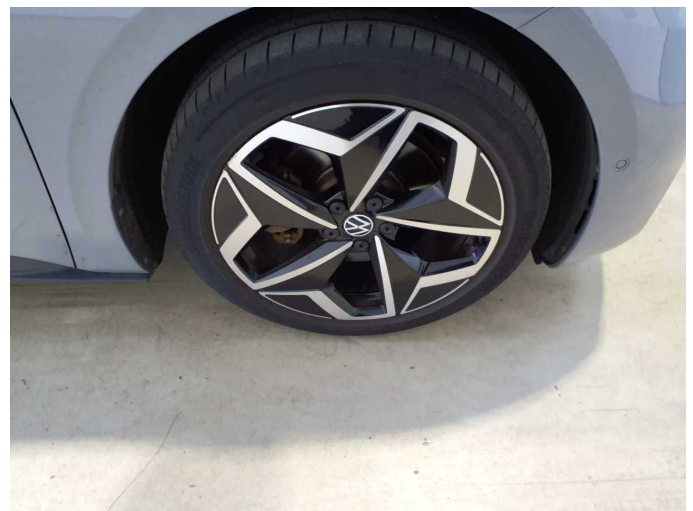

Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace




Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint

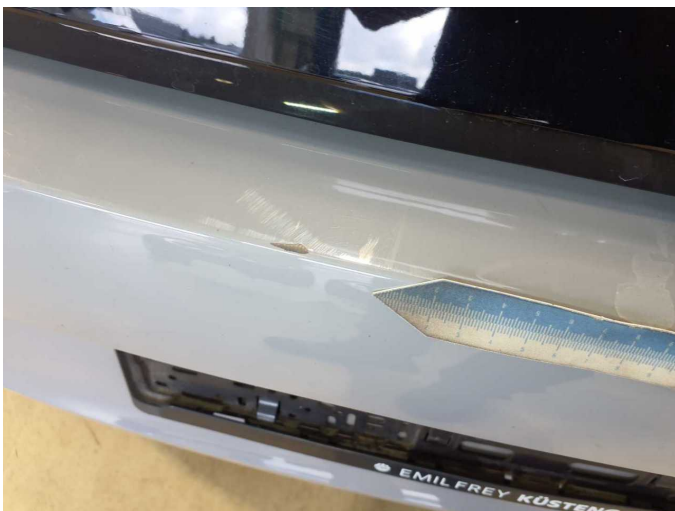

Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Wear and tear 1: 2nd wheel set: 1 tyre - Broken / torn - No deduction



Wear and tear 1: 2nd wheel set: 1 tyre - Broken / torn - No deduction



Wear and tear 2: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction




Wear and tear 3: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Wear and tear 5: Door - front left side: Door - Scratch(es) - No deduction



Wear and tear 5: Door - front left side: Door - Scratch(es) - No deduction

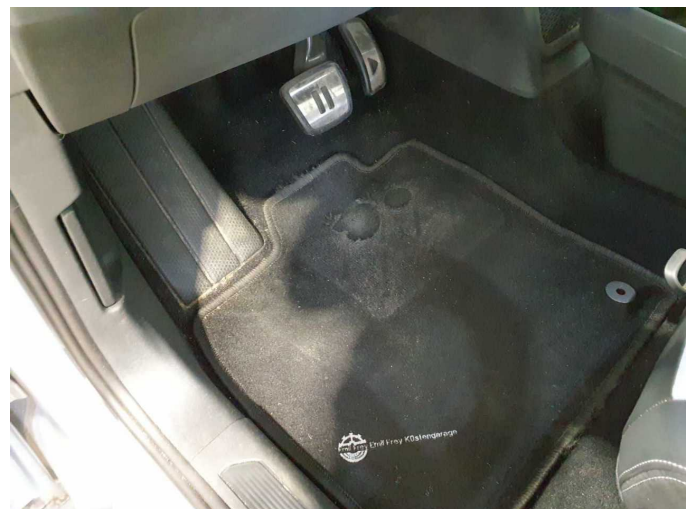

Wear and tear 6: Trim / covers: Floor mats - Broken / torn - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZE1ZP8003668

Hersteller / Modell: VOLKSWAGEN VW ID.3 Pro S (5-Sitzer)

Datum	KM-Stand	Beschreibung
25.02.2025	37.111	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst