



Expertise

Protocol number: 46549761
Order No. / Reference: 26510948
Inspection date: 15 Jul 2026

Manufacturer: Mercedes-Benz

Model: E 220 d T 9G-TRONIC Avantgarde

VIN: W1K2132041B072717



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz E 220 d T 9G-TRONIC Avantgarde	
Vehicle Identification number	W1K2132041B072717
Mileage (Read)	93,795 km
First registration	3 May 2022
Number of holders	1
Power / Engine displacement	147 kw / 1,993 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	Rear drive
Type of vehicle	Station wagon
Colour / colour code	GRAPHITGRAU - METALLICLACK
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	328 Tag(e)
Last service on / at	06/2026 at 93,441 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ453174
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BEG 00037		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,525 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100Y	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	245/45 R18 100Y	Summer tyres on Light alloy	Continental	5mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 97H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/55 R17 97H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ADAPTIVE BRAKE with hill start assist, pre-filling and drying braking in wet conditions
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Premium ambient lighting with 64 colors and 3 color zones
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Attention Assist
- Basic services
- On-board computer
- Diesel particulate filter
- Third brake light
- EASY-PACK cargo cover including EASY-PACK safety net
- Electronic Stability Program (ESP)
- Chassis: Air suspension on the rear axle with level control
- Electric window regulator with comfort operation and anti-pinch protection, 4-way
- Heated rear window with timer
- Interior headliner in nevagrau fabric
- THERMATIC automatic climate control
- LED High Performance Headlights
- Steering wheel: Multifunction steering wheel in Nappa leather in a 3-spoke design
- Mercedes-Benz emergency call system
- Center console piano black finish
- Navigation accessories: Pre-installation for Live Traffic Information
- Package: AVANTGARDE Exterior
- Upholstery: ARTICO leatherette/Norwich fabric
- Radio: Extended MBUX functions
- Radio accessories: Digital radio
- Tire pressure monitoring system
- Remote Services Plus
- Power steering
- Seats: Rear seat backrests foldable, 40/20/40 split
- Touchpad
- Electronic immobilizer
- Central locking
- AdBlue tank with a capacity of 23.5 liters
- Airbag for driver and front passenger
- Airbag: Kneebag for driver
- Airbag: Windowbags left/right
- AMG sports pedal assembly made of brushed stainless steel with rubber studs
- Foldable armrest for driver and front passenger
- Left and right exterior mirrors, heated and electrically adjustable, painted in body color
- Brake assist, active
- Tachometer
- DYNAMIC SELECT
- EASY-PACK tailgate
- Chassis: AGILITY CONTROL chassis with selective damping system and lowered suspension
- Velour floor mats
- Transmission: 9-speed automatic, 9G-TRONIC
- rear window wiper
- KEYLESS START
- Headrests 5-way adjustable for driver and front passenger, 4-way adjustable, and 2-way adjustable in the rear.
- Steering column mechanically adjustable in height and length
- Center console with on-the-fly storage compartment
- Navigation: Hard disk navigation
- Package: Storage
- Package: Seating comfort
- PRE-SAFE system
- Radio: MBUX multimedia system
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Windscreen wipers with rain sensor
- Seats: i-Size child seat attachment
- Power outlet: 12V socket in the cargo area
- High-visibility vest for drivers
- Green, heat-insulating glass all around
- Decorative elements: aluminum with longitudinal brushing, light finish



Extra equipment

- Adaptive High Beam Assist (You activate the system with one operation and then benefit from the long beam range.)
- Black fabric headliner
- Instrument panel and door sills in ARTICO man-made leather
- Paint finish: Metallic
- Center console wood ash black open pore
- Package: Business (without MBUX Augmented Reality) (MBUX High-End Package - Connectivity Package Navigation - Traffic Sign Assist - Smartphone Integration (Apple CarPlay and Android Auto) - Preparation for digital key handover - Widescreen Cockpit - Wireless charging system for mobile devices - Heated seats for driver and front passenger - Parking Package with reversing camera - Fuel tank with 66-liter capacity (916) (60l for diesel plug-in hybrids.)
- Package: Memory (driver and front passenger seats, steering column and exterior mirrors electrically adjustable and storable - seat longitudinal position and headrest height additionally electrically adjustable - distribution of the heated areas of the seat cushion and seat backrest storable - position of the optional head-up display adjustable and storable - 4-way lumbar support for driver and front passenger - seat cushion depth adjustment with gapless cushion - PRE-SAFE positioning function for the front passenger seat)
- Package: Mirrors (both exterior mirrors electrically foldable (button in the driver's door control panel) - automatic lowering of the passenger-side mirror glass to parking position when reverse gear is engaged - interior mirror and driver's side exterior mirror automatically dimming continuously - ambient lighting of the exterior mirror to illuminate the entry area)
- Wheels: 45.7 cm (18") light alloy wheels in a 5-twin-spoke design, painted in high-gloss black (8 J x 18 ET 43, tire size 245/45 R 18)
- Seats: Heated seats for driver and front passenger (selectable in three stages - Intelligent and comfortable: The seat heating switches off automatically)
- TIREFIT with tire inflation compressor
- Decorative elements, wood, ash, black, open-pore
- Brake system with larger brake discs on the front axle (drilled front brake discs and front brake calipers with "Mercedes-Benz" lettering).
- THERMOTRONIC automatic climate control (3-zone automatic climate control: enables individually adjustable climate for driver and front passenger as well as rear seats - 3 climate styles (MEDIUM/ FOCUS/DIFFUSE) - Climate control settings via the infotainment system or the climate control unit in the center console - Automatic recirculation (with navigation) - Sensors for detecting, e.g., interior/ exterior temperature, ... - Fine dust activated carbon filter for filtering dust, soot and pollen - Dew point sensors, defroster nozzles under the windshield - Residual heat function)
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC incl. Active Speed Limit Assist, Extended Automatic Restart on Highways, Route-Based Speed Adaptation with Traffic Jam Function (only when selecting Parking Packages), Active Steering Assist incl. Active Emergency Stop Assist with SOS Function, Emergency Lane Radio, Active Brake Assist incl. Turning and Intersection Radio, Traffic Jam Emergency Brake Radio, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist incl. Exit Warning, Pedestrian Warning Radio, PRE-SAFE PLUS)
- Package: Parking package with 360° camera (including Active Parking Assist with PARKTRONIC and 360° camera)
- Radio accessories: Burmester surround sound system (13 high-performance speakers - 9-channel DSP amplifier with a total output of 590 W - Frontbass technology with woofers integrated into the body shell for powerful bass reproduction - Sound optimization for the front and rear seats - Noise cancellation (VNC) - Sound preset: Surround function to generate a virtual surround sound - Multi-channel format support for true surround sound)
- Sunroof: Panoramic electric sunroof in glass design (with comfort and automatic rain closing, PRE-SAFE closing function, electric sunshade and anti-pinch protection)
- Power outlet: 2 USB ports in the rear with charging function
- Type designation removed from trunk lid

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Door - front right side	Door handle - outside - Scratch(es) - Smart repair
3	Side panel - rear left side	Sill - dent(s) - Smooth repair work
4	Sill - left side	Sill - dent(s) - Smooth repair work
5	Body	Underbody panelling - Scratch(es) - Replace
6	Front bumper	Front bumper (+ Blende) - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Vehicle glazing	Windscreen - Stone chips
3	Bonnet	Bonnet - Stone chips
4	Front bumper	Spoiler (Zierleiste) - Stone chips
5	2nd wheel set	1 alloy rim - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation

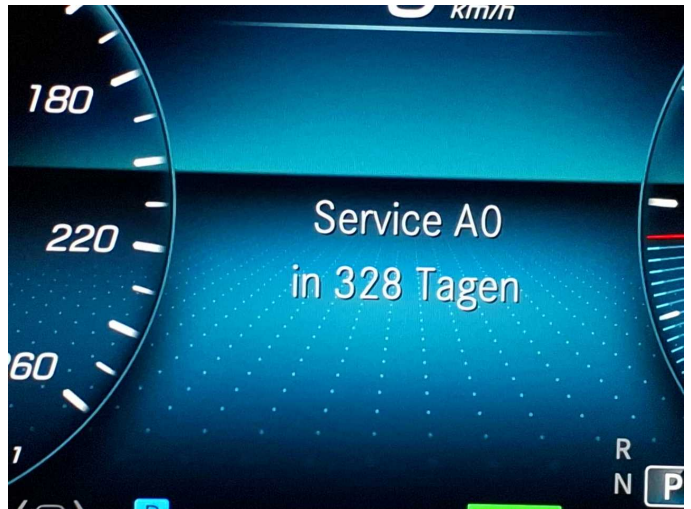


Figure 16: Misc.

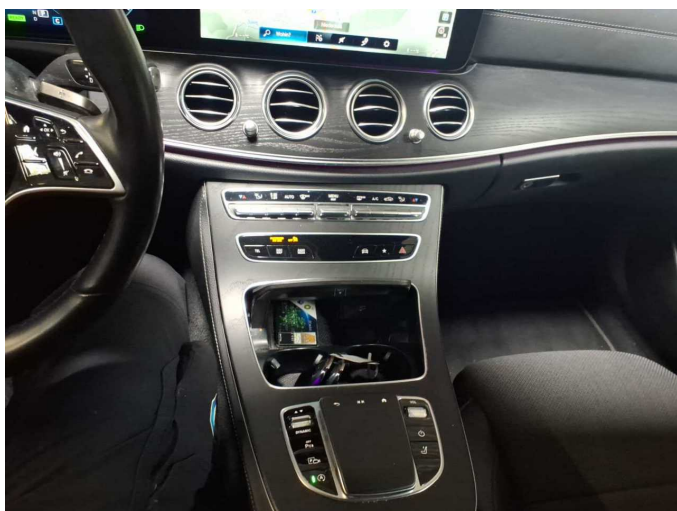


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

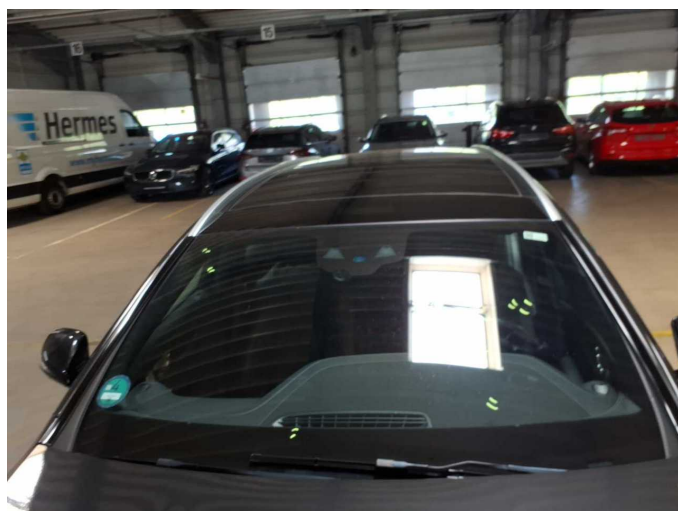


Figure 20: Misc.

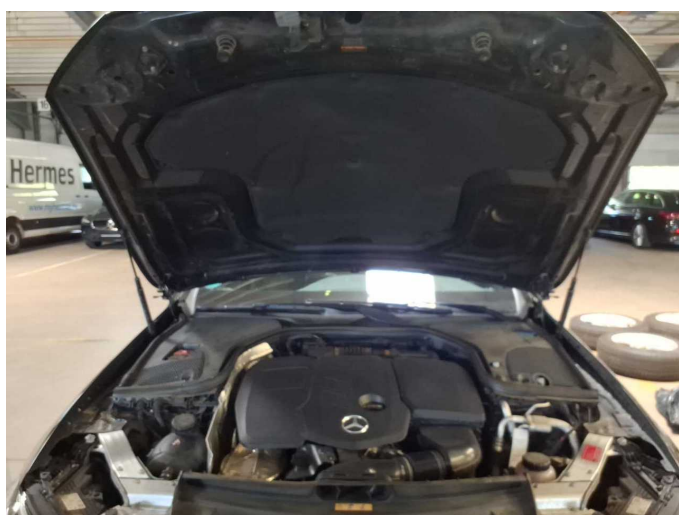


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

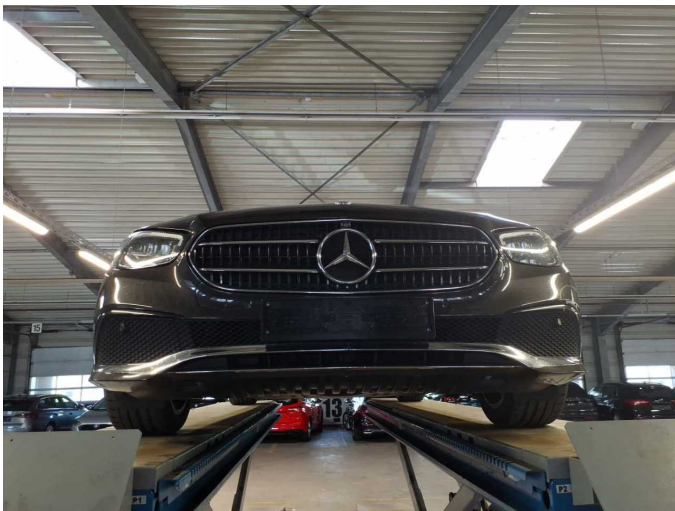


Figure 27: Misc.



Figure 28: Misc.

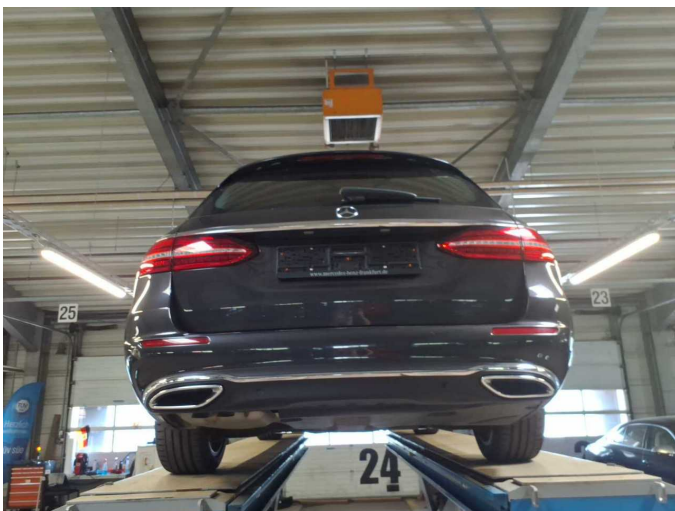


Figure 29: Misc.



Figure 30: Misc.



Damage 2: Door - front right side: Door handle - outside - Scratch(es) - Smart repair




Damage 2: Door - front right side: Door handle - outside - Scratch(es) - Smart repair




Damage 3: Side panel - rear left side: Sill - dent(s) - Smooth repair work



Damage 3: Side panel - rear left side: Sill - dent(s) - Smooth repair work

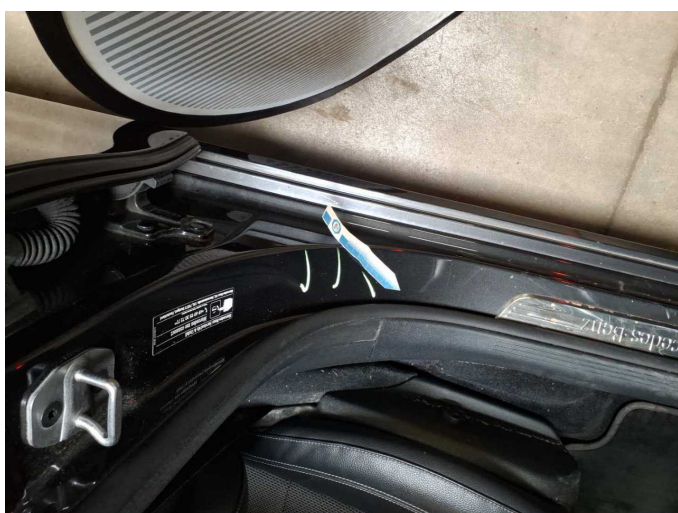

Damage 4: Sill - left side: Sill - dent(s) - Smooth repair work

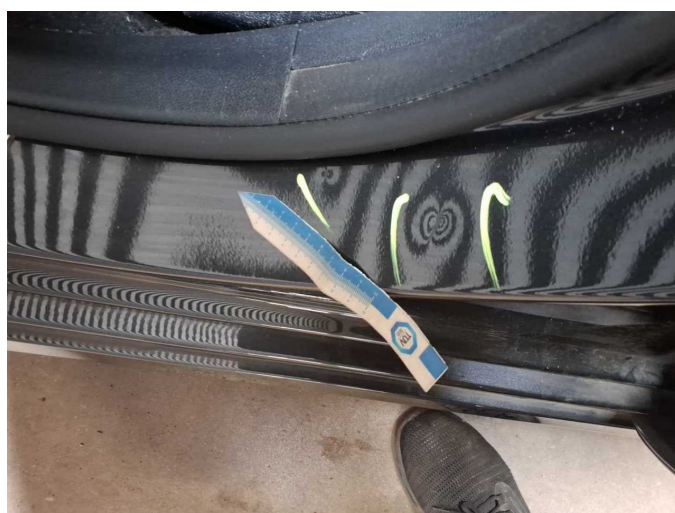

Damage 4: Sill - left side: Sill - dent(s) - Smooth repair work



Damage 5: Body: Underbody panelling - Scratch(es) - Replace




Damage 5: Body: Underbody panelling - Scratch(es) - Replace



Damage 5: Body: Underbody panelling - Scratch(es) - Replace



Damage 5: Body: Underbody panelling - Scratch(es) - Replace

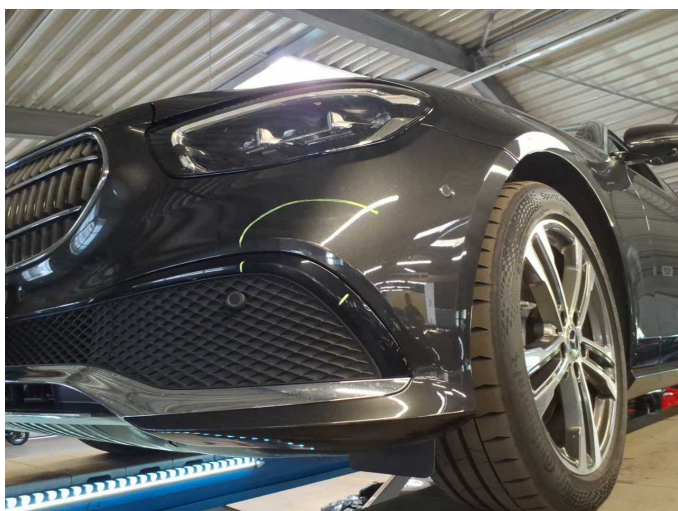

Damage 6: Front bumper: Front bumper (+ Blende) - Scratched - Paint



Damage 6: Front bumper: Front bumper (+ Blende) - Scratched - Paint




Damage 6: Front bumper: Front bumper (+ Blende) - Scratched - Paint




Damage 6: Front bumper: Front bumper (+ Blende) - Scratched - Paint




Wear and tear 2: Vehicle glazing: Windscreen - Stone chips

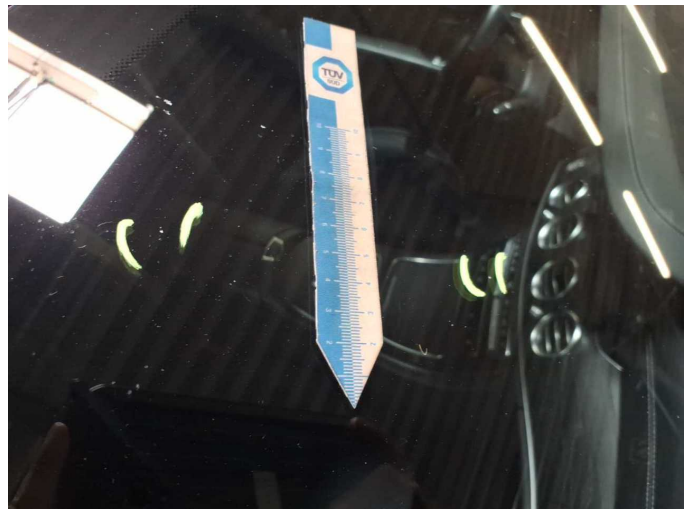


Wear and tear 2: Vehicle glazing: Windscreen - Stone chips

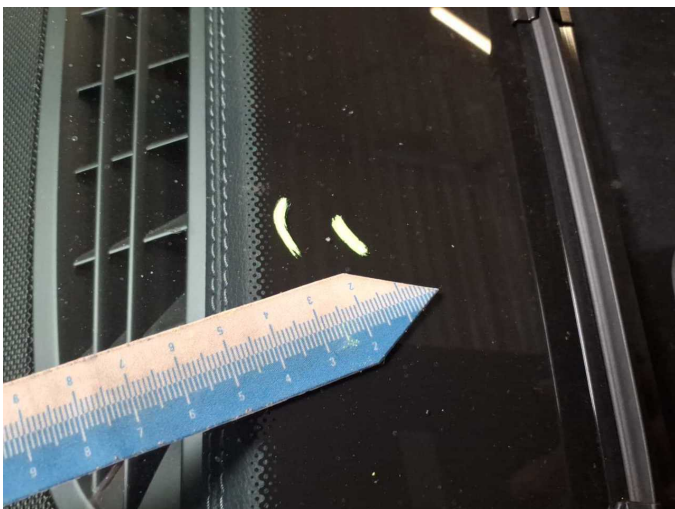

Wear and tear 2: Vehicle glazing: Windscreen - Stone chips

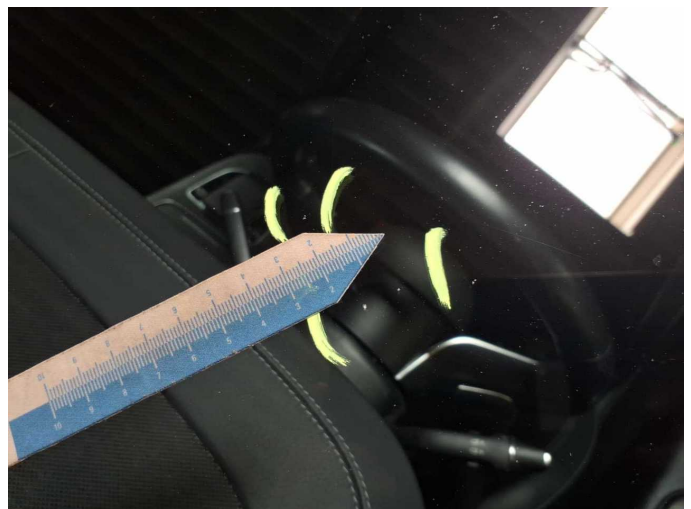


Wear and tear 2: Vehicle glazing: Windscreen - Stone chips

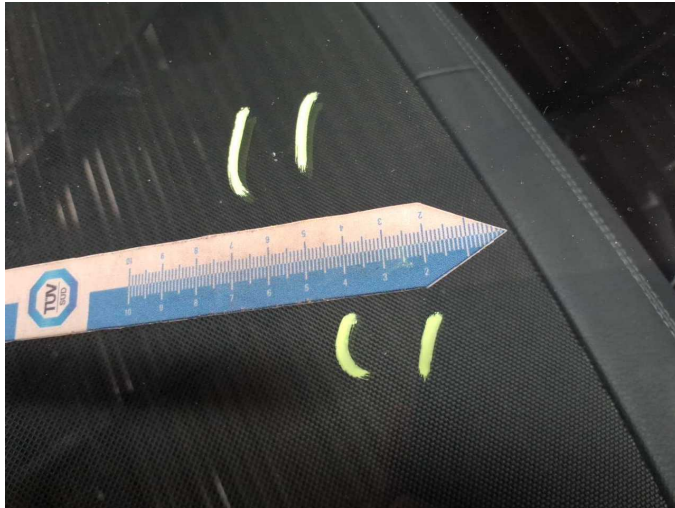


Wear and tear 2: Vehicle glazing: Windscreen - Stone chips



Wear and tear 2: Vehicle glazing: Windscreen - Stone chips

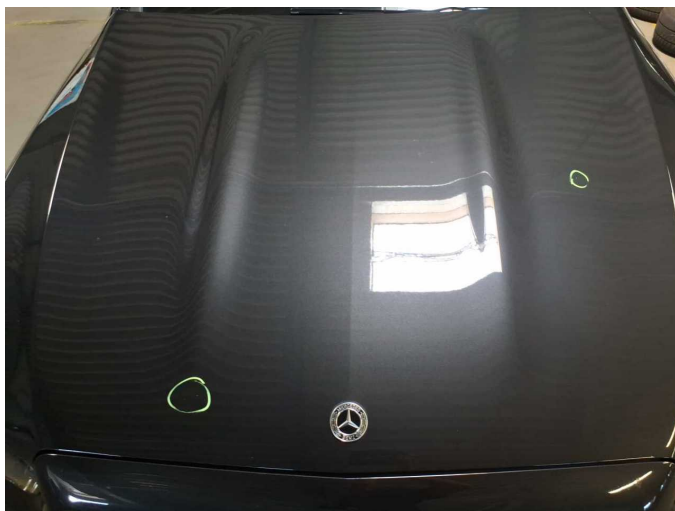

Wear and tear 3: Bonnet: Bonnet - Stone chips

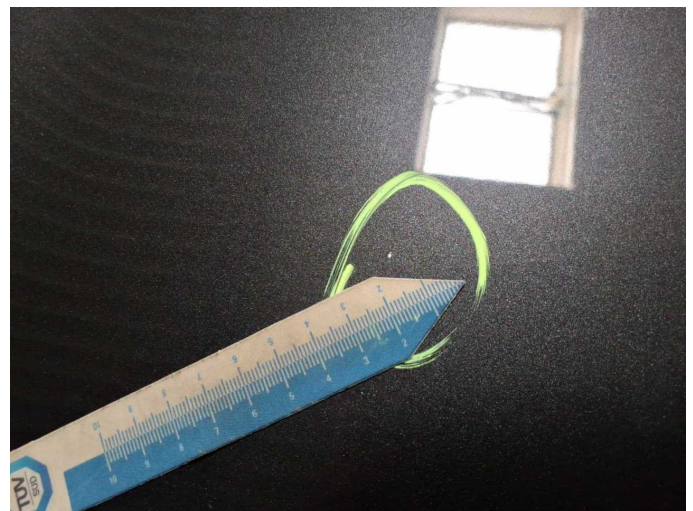


Wear and tear 3: Bonnet: Bonnet - Stone chips



Wear and tear 3: Bonnet: Bonnet - Stone chips



Wear and tear 4: Front bumper: Spoiler (Zierleiste) - Stone chips

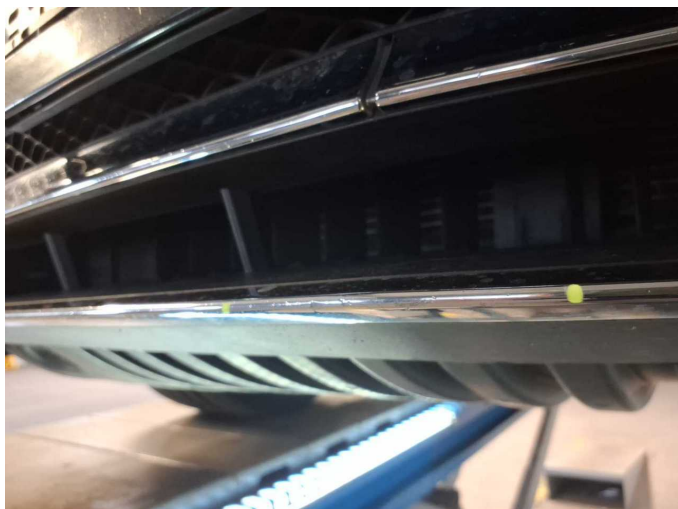

Wear and tear 4: Front bumper: Spoiler (Zierleiste) - Stone chips



Wear and tear 4: Front bumper: Spoiler (Zierleiste) - Stone chips



Wear and tear 5: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Wear and tear 5: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1K2132041B072717

Hersteller / Modell: MERCEDES-BENZ MB E 220 d T 9G-TRONIC Avantgarde

Datum	KM-Stand	Beschreibung
08.06.2026	93.441	Bremsscheiben vorne; Regelwartungsdienst
30.06.2025	67.909	HU + AU; Systemtest/Eigendiagnose
18.06.2025	67.909	Bremsklötze hinten; Regelwartungsdienst
27.02.2025	59.735	Systemtest/Eigendiagnose
06.06.2024	46.675	Regelwartungsdienst
22.05.2023	23.410	Regelwartungsdienst