



PEUGEOT 5008: GH-913-TW

Vinnumber:	VF3MRHNSUNS118869	Versionname:	PEUGEOT 5008 PureTech 130 S&S EAT8 GT VP [5P] bva 8-130CH-7cv (SUV)
First Registrationdate:	28/07/2022	Fiscalpower:	
Expertise Mileage:	137707	Power Kw:	96
Bodytype:	SUV	Body colour:	Green
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Petrol	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options

Number of keys total	2	Radio	
Number keys remote	2	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Windows electric R		Rear parking sensors	
Cruise Control		Rear view camera	
Steering wheel multifunctional		Seat cover lining	Lining Other
Steering wheel leather			Lining Leather
Type of climate control	Autom climate control		

Tyres

	225/55/18/102 V			
Summer tyres:	Fr.L.	Dunlop: 45%	Fr.R.	Dunlop: 50%
	Re.L.	Dunlop: 50%	Re.R.	Dunlop: 50%
Tyre profile depth FL				5.2
Tyre profile depth FR				4.8
Tyre profile depth RL				5.0
Tyre profile depth RR				4.8
Tyre size FL				225/55 R 18 102 V
Tyre size FR				225/55 R 18 102 V
Tyre size RL				225/55 R 18 102 V
Tyre size RR				225/55 R 18 102 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				257
Tyre make FR				257
Tyre make RL				257
Tyre make RR				257

Assistance equipment

Interior, Dirty, Cleaning



Seat cover FL, Tear, Replace



Alloy rim FL bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Alloy rim RL bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Alloy rim RR bitone/polychrome, Scratch(es), Repair/replace (lump sum)




Alloy rim FR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Door RL, Dent(s) and scratch(es), Repair and paint (complete)



Windscreen, Stone chip(s), Replace

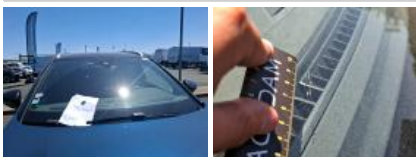

Windscreen glue kit, Required to install glazing, Repair/replace (lump sum)



Wing RR, Dent(s), Repair and paint (complete)



Door RR, Dent(s), Repair and paint (complete)



Boot lid covering R, Scratch(es), Replace



Bumper corner RL, Deformed / Strained, Repair and paint (complete)



Roof, Dent(s), Repair and paint (complete)



Historique Maintenance

Immatriculation: GH-913-TW Date de 1ère immatriculation: 28/07/2022

Modèle: Peugeot 5008 PureTech 130 S&S EAT8 GT VP [5P] bva 8-130CH-7cv (SUV)

Date	Kilométrage	Fournisseur	Descriptif
20/02/2026	131.124	CLARA AUTOMOBILES	REVISION
	0		BOITIER D ALLUMAGE RPLT
	0		DIVERS CLIM
	0		FILTRE CLIM RPLT
	0		FILTRE A AIR RPLT
09/04/2025	109.748	PROFIL PLUS	REMPLACEMENT PNEUS ETE
02/04/2025	109.230	CLARA 36	COURROIE ACCESSOIRES RPLT
	0		COURROIE DISTRIBUTION RPLT
	0		RECYCLAGE
27/03/2025	108.330	CLARA 36	DISQUES PLAQUETTES AR RPLT
	0		REVISION
	0		BALAI ESSUIE GLACE AR
	0		BALAIS ESSUIE GLACE AV
18/07/2024	86.031	CLARA 36	FILTRE CLIM RPLT
	0		REVISION
	0		LIQUIDE DE FREIN
	0		BOITIER D ALLUMAGE RPLT
	0		FILTRE A AIR RPLT
26/01/2024	65.963	CLARA 36	REVISION
	0		BALAI ESSUIE GLACE AR
	0		BALAIS ESSUIE GLACE AV
27/07/2023	43.849	CLARA 36	BOITIER D ALLUMAGE RPLT
	0		FILTRE A AIR RPLT
	0		FILTRE CLIM RPLT
	0		REVISION
09/02/2023	22.374	CLARA 36	REVISION