



Expertise

Protocol number: 46527606
Order No. / Reference: 26505329
Inspection date: 8 Jul 2026

Manufacturer: Volkswagen

Model: ID.3 Pro S (4-Sitzer)

VIN: WVGZZZE1ZPP035657



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen ID.3 Pro S (4-Sitzer)	
Vehicle Identification number	WVGZZZE1ZPP035657
Mileage (Read)	97,037 km
First registration	24 Apr 2023
Number of holders	1
Power / Engine displacement	70 kw / 0 ccm
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	Saloon car
Colour / colour code	Kings Red Metallic / Dach Schwarz
Doors / Seats	5 / 4
Upholstery type	Cloth
Colour of upholstery	Grey-Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	301 Tag(e)
Last service on / at	05/2025 at 56,992 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS509017
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0603 / CKW 00057		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,290 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R19 93T	Summer tires (with run-flat tires) on Light alloy	Continental	5mm / 5mm
2)	215/50 R19 93T	Summer tires (with run-flat tires) on Light alloy	Continental	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R19 93T	Winter tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm
2)	215/50 R19 93T	Winter tires (with run-flat tires) on Light alloy	Pirelli	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Turning brake function and evasive steering support
- Airbags: Front and rear head airbags, front side airbags, center airbag
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto
- third brake light
- CCS charging socket
- Black surround for the infotainment display and central controls
- Driving profile selection
- Transmission: Direct drive, 1-speed
- rear window wiper
- Headrests (5) front and rear
- Charging: 11 kW AC charging capacity
- LED headlights with automatic headlight control
- Illuminated makeup mirrors in the sun visors
- Fatigue detection
- Emergency call service
- Online update capability from ID.Software 2.1 onwards.
- Stainless steel pedals
- Radio accessories: 2 USB-C ports at the front
- Tire pressure monitoring system (passive)
- Keyless start system without safe locking
- electromechanical power steering
- Seats: 2 rear seats, rear seat backrest asymmetrically split and foldable
- Seats: Front seats are height-adjustable
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened seat belts front and rear
- Airbag for driver and front passenger
- 30-color ambient lighting
- Anti-lock braking system (ABS)
- Electrically adjustable and heated exterior mirrors
- Vehicle tool kit
- Car2X
- e-Sound
- Parking assistance
- Electronic Stability Program (ESP)
- Speed limiter
- Rear window heated
- ISOFIX mounting points
- Mode 3 Type 2 charging cable, 16 A
- LED taillights
- Steering wheel: Multifunction steering wheel in leather
- Front center console with 2 cup holders
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Package: Infotainment Package
- Upholstery in microfleece "ArtVelours"
- Radio accessories: 4 + 1 speakers
- Wheels: 4 "Andoya" alloy wheels 7.5 J x 19 in black, polished finish
- Seat belts: Three-point automatic seat belts at the front with belt tensioners
- Seats: Armrests, front seats
- Lane keeping assistant "Lane Assist"
- Traffic sign recognition
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear



Extra equipment

- Adaptive Cruise Control (ACC) "stop & go", with speed limiter
- Two-tone paintwork with black roof, metallic
- Charging cable: Mains charging cable for household socket
- Package: Infotainment Package "Plus" (6+1 speakers - Augmented Reality Head-up Display)
- Package: Interior Style "Plus" with steering wheel in Electric White (4-seater) (2 rear seats, electrically adjustable, asymmetrically split, folding, center armrest; 30-color ambient lighting; electrically folding, adjustable, and heated exterior mirrors; integrated display and control unit in Electric White; ErgoActive front seats with electric adjustment and longitudinally adjustable thigh support; pneumatically adjustable lumbar support for front seats with massage function; heated multifunction leather steering wheel with touch controls; stainless steel pedals with "Play/Pause" design; "ArtVelours" microfleece seat center panels; ambient lighting with logo projection; heated front seats)
- Package: Sport package "Plus" (Progressive steering - Adaptive chassis control DCC incl. driving profile selection)
- Textile floor mats front and rear
- Heat pump for range optimization
- Exterior Style "Silver" (rear roof trim and roof pillars in Silver, air intake and sills in Grey Tech Metallic - two-tone wheel covers)
- Package: Assistance Package "Plus" incl. "IQ.DRIVE" with "Travel Assist" (Adaptive Cruise Control ACC stop&go with speed limiter - Electrically adjustable, folding and heated exterior mirrors - Alarm with interior monitoring, backup horn and tow-away protection - Driving Assistance, Lane Keeping Assist, Emergency Assist - Memory function for "Park Assist Plus" - Multifunction leather steering wheel, touch controls - Park Assist+ - Proactive occupant protection in conjunction with Front Assist - Locking/starting system, safe locking - Lane Change Assist - Illuminated door handles - Ambient lighting with logo projection - Surround view with reversing camera)
- Package: Comfort Package "Plus" in conjunction with Interior Style Plus packages (2 USB-C ports in the front, 2 USB-C charging ports on the center console; electrically adjustable, folding, and heated exterior mirrors; removable luggage compartment floor; automatically dimming interior mirror; Air Care Climatronic air conditioning with active combination filter, auxiliary climate control, 2-zone; center console with illuminated storage compartment and roller blind, 2 cup holders; leather multifunction steering wheel, heated, with touch controls; rain sensor; heated windshield washer nozzles; ambient lighting with logo projection; heated front seats)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Repainting

No. Repainting

1 Mudguard - right side, Side panel - rear right side, Door - rear right side, Door - front right side

Paint coat thickness measurement

Mudguard - right side	182 µm	Side panel - rear right side	168 µm
Door - rear right side	168 µm	Door - front right side	207 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

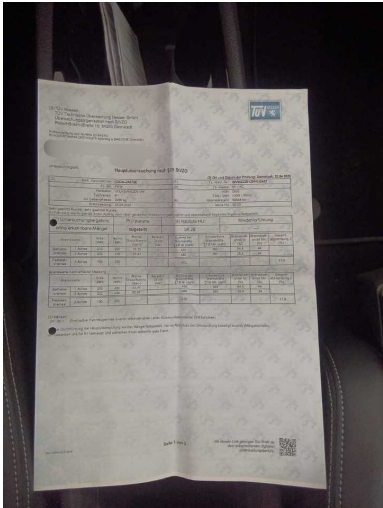


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

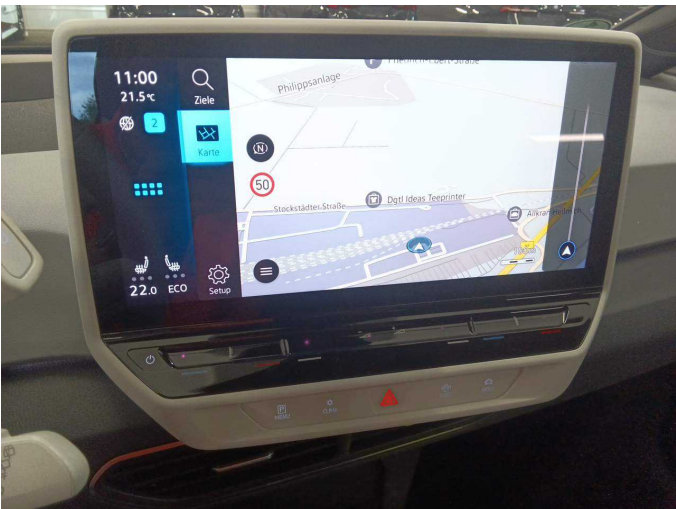


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

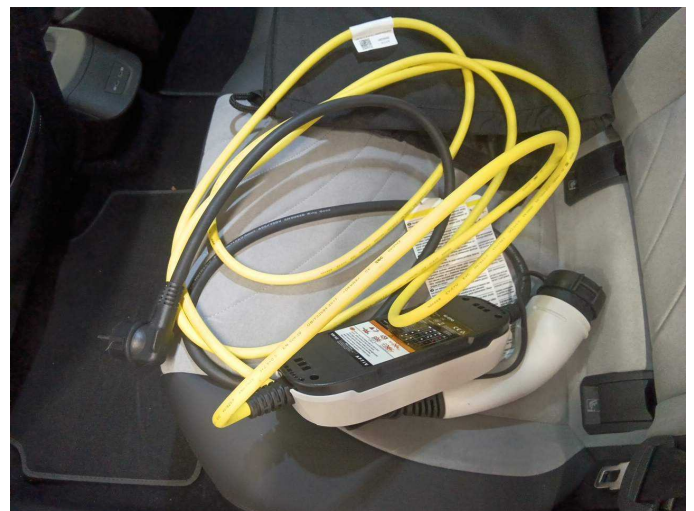


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Damage 2: 1



Damage 2: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 2: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value

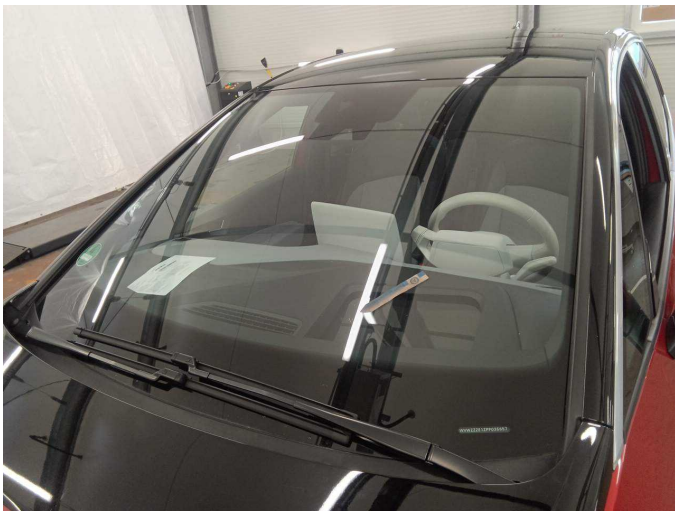

Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction



Repainting 1: Mudguard - right side, Side panel - rear right side, Door - rear right side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear right side, Door - rear right side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear right side, Door - rear right side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear right side, Door - rear right side, Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZE1ZPP035657

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN ID.3 Pro S (4-Sitzer)

Datum	KM-Stand	Beschreibung
06.05.2025	56.992	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst