

» Overview

Order number: 1002314868
Order completed: 20.02.2026 07:31
Report number: 10098675
VIN: WVVZZZAWZPU011796



Front Left 3/4



Rear Right 3/4



Mileage

» Vehicle Data

Vehicle category:	Passenger Car
Vehicle type:	Limousine
Make:	Volkswagen
Model:	Polo
Manufacturers and type code:	0603 / CIE
Date of first registration:	01.02.2023
Mileage:	68,708 km
Proof of mileage:	ReadOff
Exterior colour:	Pure White
Roof colour:	Pure White
Propulsion:	Front
Fuel:	Petrol
Engine size (cc):	1,000 ccm
Performance:	59 kW (81 PS)
Length:	
Height:	
Width:	
Permitted total weight:	
Wheelbase:	
Number of powered axles:	2
Cylinders:	3
Euronorm:	Euro 6
Number of doors:	4
Number of seats:	5
Gearbox:	Manual 5-speed
Upholstery type:	Lining fabrics
Interior colour:	Titanschwarz/Titanschwarz/Schwarz/ Ceramique
Number of keys:	2

» Documents & Maintenance

Statutory inspection date:	02.2026
Registration certificate available:	Yes
Registration certificate received:	No
License plate:	None
Maintenance book:	Digital
Maintenance:	Not testable
Maintenance last date:	
Maintenance last mileage:	
Remainder until next maintenance:	8,700 KM

2 USB-C ports in the front, 2 USB-C charging sockets on the center console in the rear	Drum brakes in rear
3 head restraints in rear	Dynamic Road Sign Display
3-cylinder SI engine 1.0 l	Electronic immobilizer
3-cylinder SI engine 1.0 l, 59 kW	Electronic Stability Control w/ driver steering recommendation, ABS, ASR, EDL and EDTC
3-point seat belt for center rear seat	Elimination of nameplate for engine designation on luggage compartment lid
3-point seat belts in front with height adjustment and seat belt pretensioners	Emergency call service; no registration required, service is activated upon delivery
3-point seat belts with seat belt pretensioners for the outer rear seats	Emission standard EU6 AP
4 doors	Equipment options subset for Germany
4 Steel wheels 5.5J x 15	Exterior mirrors, power-adjustable, folding and heated, w/ front passenger exterior mirror lowering function
5-speed manual transmission	First aid kit, warning triangle and safety vest
6 speakers	Foamed dashboard
Activated carbon canister (Evaporative Emission Control System (EVAP))	Fresh air intake system with combination filter
Air conditioning system with enhanced air filter with activated carbon	Front center armrest, longitudinally adjustable, with storage compartment
All-season tires 185/65 R15	Front seats with height adjustment
Alternator 140 A	Front stabilizer bar
App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto	Front-wheel drive
Aspherical exterior mirror on driver side	Fuel system for fuel-injected SI engine
Automatic headlight control with exit and entry lighting	Gearshift knob in leather
Autonomous Emergency Braking Front Assist	Green heat-insulating glass windows on sides and in rear
Battery 320 A (49 Ah)	Hand brake lever handle in leather
Body-colored bumpers, radiator grille with chrome trim	Hatchback
Body-colored exterior mirror housings and door handles	Headlight range control
Carpet mats in front and rear	Heated front seats
Carrier frequency 433.92 MHz-434.42 MHz	Height and longitudinally adjustable steering column
Central locking system without SAFELOCK, with radio remote control and 2 remote control folding keys	Hill start assist
Ceramique headliner	Illuminated vanity mirrors in sun visors
Chrome package	Initial standard fuel filling
Curtain airbags in front and rear, side airbags in front, center airbag	Inserts of front seats and outer rear seats in fabric "Life"
Decorative inserts "Lava Stone Black" for dashboard and front door trim panels	Instrument cluster with electronic speedometer, odometer and trip odometer, tachometer
Delivery equipment, water border	Interior lights with switch-off delay and dimmer, 2 reading lights in front and 2 in rear
Digital radio reception DAB+	ISOFIX anchors for child seats on outer rear bench seats and on front passenger seat, compatible for i-Size
Dimming interior rearview mirror	Laminated safety glass windshield, heat-insulating
Disc brakes in front (Geomet D)	Lane keeping system Lane Assist
Diversity antenna for FM reception	Leather multi-function steering wheel
Door and side trim panel	LED headlamps with LED separate daytime running light
Driver alert system	LED rear combination lamps
Driver and front passenger airbag with front passenger airbag deactivation	Left-hand drive
Driving on the right	License plate carrier in front and rear (ECE)
	Life

LongLife Service Regime	Speed limiter
Luggage compartment cover	Standard battery/alternator capacity
Luggage compartment floor	Standard climatic zones
Luggage compartment lighting	Standard pedal cluster
Lumbar supports in front	Standard rear axle
Manual in German (Germany)	Standard seats in front
Manual transmission MQ200	Standard version
Map pockets on the back of each front seat	Standard wheel bolts
Mobile phone interface	Start-stop system with regenerative braking
Multi-color Digital Cockpit, selection of different info profiles possible	Steel spare wheel with original equipment tire
Multifunction camera	Steel spare wheel with original equipment tire
Navigation system "Discover Media" incl. Streaming & Internet	Storage compartment for Manual under left front seat
Navigation system "Discover Media" incl. Streaming & Internet	Suspension range 03 installation control only, no requirement forecast
No special edition	Tire Pressure Monitoring System
No special purpose vehicle, standard equipment	Tires without specification of tire brand
Non-folding front passenger seat backrest	Tool kit and jack
Non-smoker's package: Storage compartment and 12-V outlet in front	Transport protection film (minimum protection) with additional transport protection measures
Not hot country	Type approval country Germany
Online service, with OCU, with head unit coding, without engine immobilizer interconnection	Unsplit rear bench seat, asymmetric split folding backrest
Operating permit, alteration	Vehicle class differentiation - 2G0- for build status Europe
Park Distance Control - warning signals for obstacles in the front and rear	Vehicles with special upgrade measures
Part set without country-specific prescriptive standard	Warning lamp for washer fluid level
Pedestrian and cyclist monitoring	Warning signal and warning light for front and rear seat belts not fastened
Power steering	Weight range 9 installation control only, no requirement forecast
Power windows	Wheel trims
Preparation for We Connect and We Connect Plus	Wheelbase
Radio	Windshield wiper intermittent control with light sensor
Rear exhaust tailpipe (standard)	Without Adaptive Chassis Control
Rear floor panel module, type 1	Without add. lights (interior lighting)
Rear fog lamp for driving on the right	Without additional front underbody guard
Rear overhang, short	Without additional tires
Rear shock absorption	Without adhesive film
Rear window wiper with intermittent control	Without alternative drive system
Refrigerant R1234yf	Without auxiliary heater/parking heater
Regional code " ECE " for radio	Without camera systems/accident sensors
Right exterior mirror, convex	Without decals and emblems
Safety-optimized front head restraints	Without differential lock
Service indicator 30 000 km or 2 years (variable)	Without ECO function
Shock absorption in front	Without extended safety system
Single-tone horn	Without exterior ambient lighting
South Africa manufacturing sequence	Without front fog lamps
Special identification label for EC for M1 passenger vehicles	Without headlamp washer system

Without heat accumulator/auxiliary heater
Without heated washer nozzles
Without interior light in footwell
Without lane change assist
Without light control
Without protective film for scuff plate
Without roof insert (standard roof)
Without second battery
Without special body measures
Without trailer hitch
Without voice control

» Tyres

MOUNTED TYRES

Make	Location	Position	Type	Rim	Dimensions	Profile depth
Vredestein	Front	Left	All season	Steel	185/65 R 15 88 V	7.0 mm
Vredestein	Front	Right	All season	Steel	185/65 R 15 88 V	7.0 mm
Vredestein	Rear	Left	All season	Steel	185/65 R 15 88 V	3.0 mm
Vredestein	Rear	Right	All season	Steel	185/65 R 15 88 V	3.0 mm

Permitted: Yes

Roadworthy: Yes

SPARE/EMERGENCY TYRE & ACCESSORIES

Spare tyre provided: Yes

Make	Location	Position	Type	Rim	Dimensions	Profile depth
Vredestein	Spare		All-seasons	Steel	185/65 R 15 88 V	8.0 mm

Permitted: Yes

Roadworthy: Yes

Jack present: Yes

» Devaluation Factors

Nr	Location	Damage type	Repair type
1	Bumper F	Deformed / Strained	Replace and paint
2	Bonnet	Dent(s) and scratch(es)	Repair and paint (complete)
3	Preparationtime bodywork	Paint preparation	Execute
4	Door seal FL	Tearred	Replace
5	Bumper moulding FR	Scratch(es)	Replace
6	Tyre RR	Out of tolerance	Replace
7	Tyre RL	Out of tolerance	Replace
8	Roof	Dent(s)	Paintless dent repair
9	Roof	Chemical polution	Polish
10	Hub cap FR	Scratch(es)	Replace
11	Inner door sill FL	Scratch(es)	Polish

» Usage Damages

Nr	Location	Damage type	Repair type
1	MOT certificate	Expired	Acceptable
2	Windscreen	Stone chip(s)	Acceptable
3	Bumper R	Scratch(es)	Acceptable
4	Central underbody	Deviation from delivery condition/scope	Acceptable

» Commercial devaluation

Known previous damages:	No
Previous damages detectable:	Yes
Repainting present:	Yes
Repainting professionally executed:	Yes
Paint thickness measurement performed:	Yes - with abnormalities/deviations

PAINTTHICKNESS MEASUREMENT RESULTS

Part	Paint (µm)
Paint thickness Bonnet (µm)	220.0

At least 3 measurements were carried out per component.

» Notes On The Assessment

Details of the assignment and the scope of the assessment:

The order was placed to prepare a condition report on the described vehicle.

The vehicle condition assessment was carried out in accordance with the order on the basis of the standards for vehicle assessments specified by the client. The expert makes the findings in the individual case on the basis of his own expertise and at his own expert discretion.

Vehicle identification:

WVWZZZAWZPU011796

VIN checked and matches documentation

Vehicle condition:

Average general condition

Inspection condition:

Sufficient

Lifting platform/lifting equipment used:

Yes

Testdrive carried out:

Yes

Engine test carried out:

Yes

» Remarks

This copy was generated electronically. It is valid without an original signature.

Additional notes on the condition report:

(20.02.2026 07:31) Das Fahrzeug wird nach der Bewertung vom Autohaus abgemeldet

» Commercial Pictures



Front Left 3/4



Front Right 3/4



Rear Left 3/4



Rear Right 3/4



Mileage




Sill outer L




Sill outer R



Chassis nr

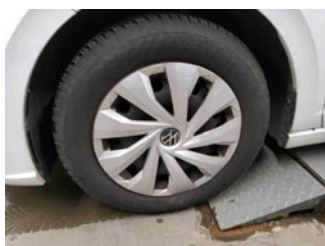


Wheel FL

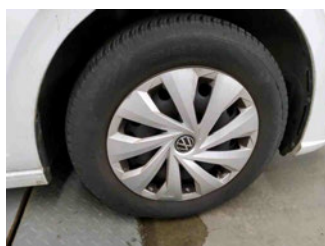

Wheel FR



Wheel RL

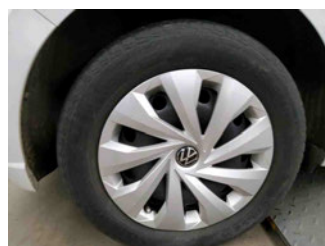

Wheel RR



Spare wheel



Central console



Engine compartment



Documents




Interior arrangement



Registration Certificate



Paint thickness Bonnet

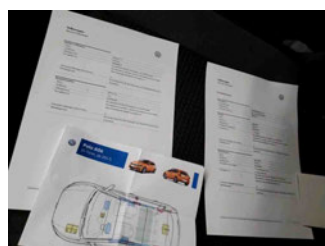

History Maintenance



Interior - front



Interior - rear



Underbody scan




GPS/Radio

» Devaluation Damages

DEVALUATION FACTORS

1 - Bumper F - Deformed / Strained - Replace and paint

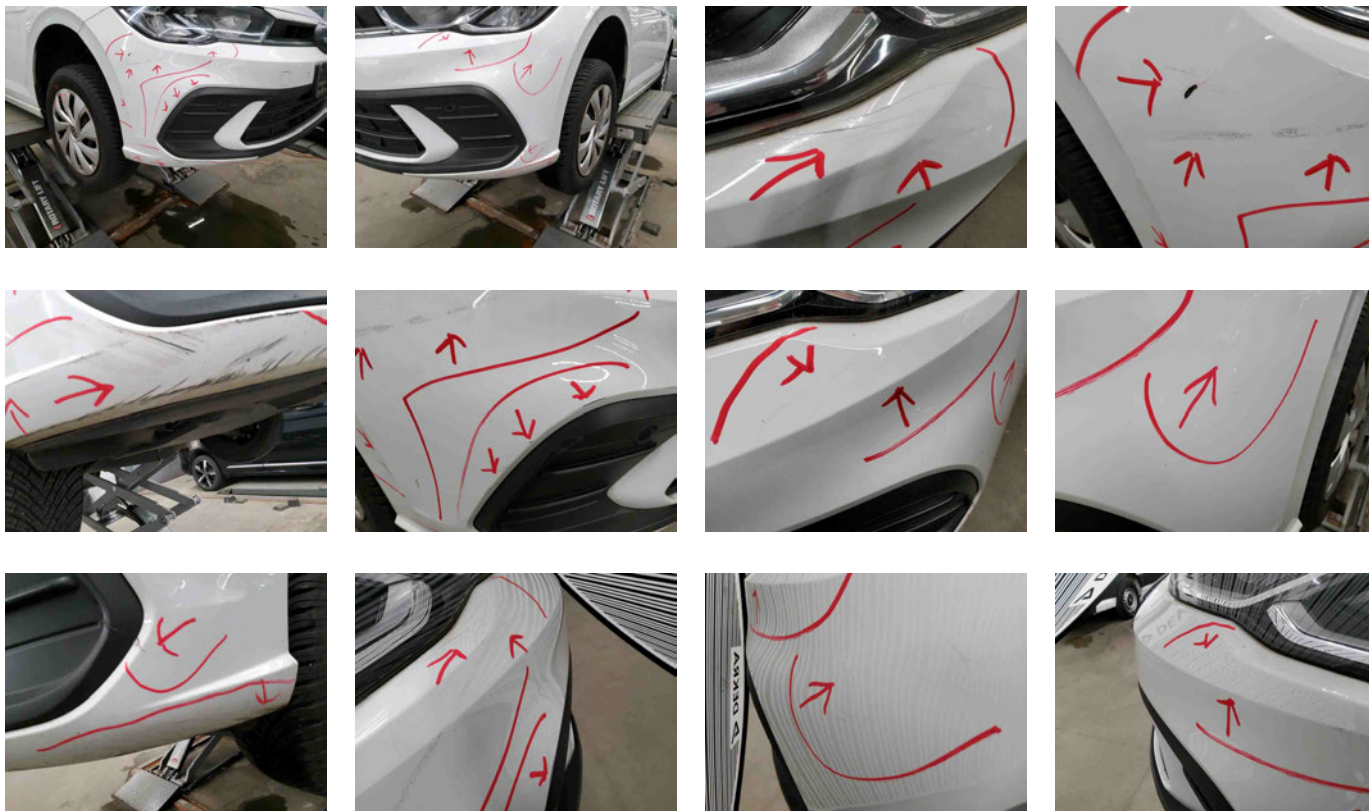

2 - Bonnet - Dent(s) and scratch(es) - Repair and paint (complete)



3 - Preparationtime bodywork - Paint preparation - Execute

4 - Door seal FL - Teared - Replace



5 - Bumper moulding FR - Scratch(es) - Replace



6 - Tyre RR - Out of tolerance - Replace

Comment	Reifen hinten rechts unterhalb des Mindestmaß von 4mm
---------	---




7 - Tyre RL - Out of tolerance - Replace


Comment	Reifen hinten links unterhalb des Mindestmaß von 4mm
---------	--



8 - Roof - Dent(s) - Paintless dent repair

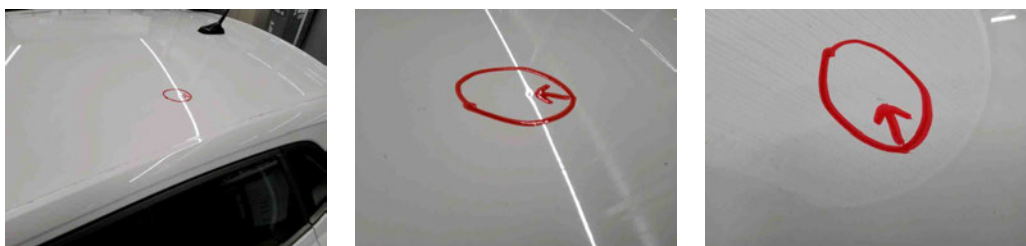

9 - Roof - Chemical polution - Polish

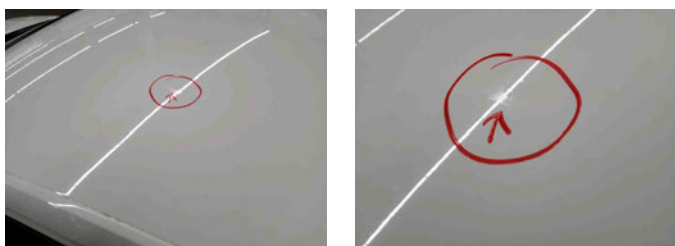

10 - Hub cap FR - Scratch(es) - Replace



11 - Inner door sill FL - Scratch(es) - Polish



USAGE DAMAGES

1 - MOT certificate - Expired - Acceptable



2 - Windscreen - Stone chip(s) - Acceptable

Comment

Frontscheibe Splitterungen ohne Rissbildung



3 - Bumper R - Scratch(es) - Acceptable



4 - Central underbody - Deviation from delivery condition/scope - Acceptable

Comment

verschrammt

