



## FIAT DUCATO: FZ-505-BB

|                         |                                 |                         |                                                              |
|-------------------------|---------------------------------|-------------------------|--------------------------------------------------------------|
| Vinnumber:              | <b>ZFA25000002R63349</b>        | Versionname:            | <b>FIAT DUCATO 2.3 Multijet 140 3.3 M H2 Pro Lounge</b>      |
| First Registrationdate: | <b>4/05/2021</b>                |                         | <b>VU [4P] bvm 6-140CH-8cv (fourgon tA'IA@simple cabine)</b> |
| Expertise Mileage:      | <b>999999</b>                   | Fiscalpower:            |                                                              |
| Bodytype:               | <b>Transporter</b>              | Power Kw:               | <b>103</b>                                                   |
| Gearbox:                | <b>MAN 6 VIT</b>                | Body colour:            | <b>White</b>                                                 |
| Transmission:           | <b>Front</b>                    | Paint type:             | <b>Opaque</b>                                                |
| Fueltype:               | <b>Diesel</b>                   | Interior colour:        | <b>Black</b>                                                 |
| Engine functioning:     | <b>No</b>                       | Type of rims (mounted): | <b>Steel</b>                                                 |
| Battery functioning:    | <b>No</b>                       | Dashboard color:        | <b>Black</b>                                                 |
| Vehicle running:        | <b>No</b>                       |                         |                                                              |
| Number of doors:        | <b>4</b>                        |                         |                                                              |
| Number of seats:        | <b>3</b>                        |                         |                                                              |
| Number head rests:      | <b>3</b>                        |                         |                                                              |
| Type of rims (mounted): | <b>Steel</b>                    |                         |                                                              |
| Category:               | <b>Light Commercial Vehicle</b> |                         |                                                              |

## Options

|                                |                               |                         |                     |
|--------------------------------|-------------------------------|-------------------------|---------------------|
| Number of keys total           | <b>1</b>                      | Radio                   |                     |
| Number keys remote             | <b>1</b>                      | Central consol F        |                     |
| GPS big screen color           |                               | Rear parking sensors    |                     |
| GPS storage                    |                               | Sliding door right-side |                     |
| GPS storage                    | <b>HD</b>                     | Seat cover lining       | <b>Lining Other</b> |
| Windows electric F             |                               |                         |                     |
| Cruise Control                 |                               |                         |                     |
| Steering wheel multifunctional |                               |                         |                     |
| Type of climate control        | <b>Manual climate control</b> |                         |                     |

## Tyres

|                       |       |               |       |                   |
|-----------------------|-------|---------------|-------|-------------------|
| 215/70/15/109 Q       |       |               |       |                   |
| Summer tyres:         | Fr.L. | Michelin: 50% | Fr.R. | Michelin: 35%     |
|                       | Re.L. | Michelin: 55% | Re.R. | Michelin: 40%     |
| Tyre profile depth FL |       |               |       | 5.0               |
| Tyre profile depth FR |       |               |       | 5.8               |
| Tyre profile depth RL |       |               |       | 4.6               |
| Tyre profile depth RR |       |               |       | 5.5               |
| Tyre size FL          |       |               |       | 215/70 R 15 109 Q |
| Tyre size FR          |       |               |       | 215/70 R 15 109 Q |
| Tyre size RL          |       |               |       | 215/70 R 15 109 Q |
| Tyre size RR          |       |               |       | 215/70 R 15 109 Q |
| Tyre type FL          |       |               |       | Summer            |
| Tyre type FR          |       |               |       | Summer            |
| Tyre type RL          |       |               |       | Summer            |
| Tyre type RR          |       |               |       | Summer            |
| Tyre make FL          |       |               |       | 261               |
| Tyre make FR          |       |               |       | 261               |
| Tyre make RL          |       |               |       | 261               |
| Tyre make RR          |       |               |       | 261               |

## Assistance equipment

|                                                         |            |      |            |
|---------------------------------------------------------|------------|------|------------|
| Spare wheel                                             | <b>Yes</b> | Jack | <b>Yes</b> |
| Remote ignition key, Missing, Repair/replace (lump sum) |            |      |            |



Interior, Stain, Cleaning



GPS, Missing, Replace



Wheel cover RL, Missing, Replace



Outside rear-view mirror base L, Scratch(es), Replace



Door FL, Scratch(es), Paint



Side panel L, Dent(s), Repair and paint (complete)



Door trim FL, Scratch(es), Replace



Bumper FL, Deformed / Strained, Replace





Bumper FR, Scratch(es), Dismount/Mount



Bumper grille, Broken, Replace



Sliding door R, Dent(s), Repair and paint (complete)



Side panel moulding R, Deformed / Strained, Replace



Car body corner RR, Dent(s) and scratch(es), Repair and paint (complete)



Side panel R, Dent(s), Repair and paint (complete)



Door FR, Scratch(es), Paint



Outside rear-view mirror base R, Broken, Replace



Side repeater R, Scratch(es), Replace



Outside rear-view mirror glass R, Broken, Replace



Wing FR, Scratch(es), Paint



Trunk door shutter, Missing, Replace



Trunk door stop button, Missing, Replace



Rear light L, Missing, Replace




Rear light R, Missing, Replace



Bumper R, Deformed / Strained, Replace



Parking sensor R, Broken, Replace

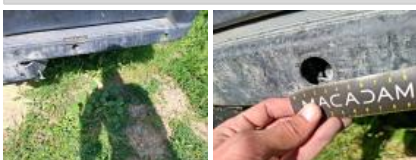

Parking sensor R, Broken, Replace



Bumper corner RR, Deformed / Strained, Repair and paint (complete)



Boot door panel RL, Dent(s), Repair and paint (complete)



Boot door lining R, Broken, Replace



Boot door lining R, Broken, Replace



Bodywork, Not original part, Remove lettering



Roof, cabin, Dent(s), Repair and paint (complete)



Historique Maintenance

Immatriculation: FZ-505-BB Date de 1ère immatriculation: 04/05/2021

Modèle: Fiat DUCATO 2.3 Multijet 140 3.3 M H2 Pro Lounge VU [4P] bvm 6-140CH-8cv (fourgon tôle simple cabine)

| Date       | Kilométrage | Fournisseur       | Descriptif                           |
|------------|-------------|-------------------|--------------------------------------|
| 23/06/2025 | 135.725     | LA SQUADRA VELOCE | FERMETURE DOSSIER TECHNIQUE          |
|            | 0           |                   | BATTERIE RPLT                        |
|            | 0           |                   | DIVERS ELEC                          |
|            | 0           |                   | FAISCEAU CABLAGE RPLT                |
| 12/02/2024 | 107.317     | LA SQUADRA VELOCE | DIVERS ECHAPPEMENT                   |
| 25/10/2023 | 98.502      | LA SQUADRA VELOCE | LIQUIDE DE FREIN                     |
|            | 0           |                   | REVISION ET CLIM ET AIR ET CARBURANT |
|            | 0           |                   | BALAIS ESSUIE GLACE AV               |
| 07/10/2022 | 52.813      | LA SQUADRA VELOCE | PLAQUETTES AV RPLT                   |
|            | 0           |                   | APPOINT D HUILE                      |
| 12/05/2022 | 49.892      | LA SQUADRA VELOCE | FERMETURE DOSSIER TECHNIQUE          |
|            | 0           |                   | KIT DISTRIBUTION RPLT                |
|            | 0           |                   | POMPE A EAU RPLT                     |
| 19/04/2022 | 46.412      | LA SQUADRA VELOCE | PLAQUETTES AR RPLT                   |
|            | 0           |                   | LAMPE AR RPLT                        |
|            | 0           |                   | BALAIS ESSUIE GLACE AV               |
|            | 0           |                   | REVISION ET CLIM ET AIR ET CARBURANT |
| 28/12/2021 | 31.730      | EDR AUTOMOBILES   | LAMPE RPLT                           |