



Expertise

Protocol number: 47164498
Order No. / Reference: 26755040
Inspection date: 20 Aug 2026

Manufacturer: Land Rover

Model: Range Rover Evoque P300e R-Dynamic SE

VIN: SALZA2BT9PH196841



Vehicle details	
Manufacturer / Type / Model / Equipment	
Land Rover Range Rover Evoque P300e R-Dynamic SE	
Vehicle Identification number	SALZA2BT9PH196841
Mileage (Read)	40,458 km
First registration	29 Jul 2022
Number of holders	1
Next periodical technical inspection	12/2027
(Report on hand)	
Fuel type	Hybr.B/E ext.aufl
Engine displacement / Cylinder	1,498 ccm / 4
Power	147 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Carpathian Grey Premium Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	Non-existent	Next maintenance in	0 km
Last service on / at	09/2024 at 20,365 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ307758
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1590 / AJK 00006		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,660 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R20 104Y	Summer tyres on Light alloy	Michelin	6mm / 6mm
2)	235/50 R20 104Y	Summer tyres on Light alloy	Michelin	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 107H	Winter tyres on Light alloy	Goodyear	7mm / 7mm
2)	235/60 R18 107H	Winter tyres on Light alloy	Goodyear	7mm / 7mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag: Driver and front passenger side with seat occupancy detection
- Perimetric alarm system
- All Terrain Progress Control (ATPC)
- Amazon Alexa
- Analog round instruments with TFT on-board computer
- Trailer Stability Assist (TSA)
- Attention assistant
- Exterior mirrors, electrically folding and heated, automatic dimming on driver's side
- Animated flashing lights, front and rear
- Roof in car color
- Decorative elements in Gradated Linear Dark Aluminium
- Third brake light
- Rear and front parking assist
- Electric Power Steering (EPAS)
- electric window regulator
- Adaptive Cruise Control (ACC) with Stop & Go
- Transmission: 8-speed automatic transmission
- electric tailgate
- rear window wiper
- Interior rearview mirror with automatic dimming function
- Child safety lock, electric
- Collision warning system when reversing
- rear headrests
- Cornering Brake Control (CBC)
- Charging: CCS fast charging with up to 32kW DC
- LED headlights with LED signature
- Steering wheel: Multifunction leather steering wheel
- Steering column manually adjustable
- Emergency Brake Assist (EBA)
- Package: Connection Package 1
- Electric parking brake (EPB)
- Upholstery: Duoleather
- Radio accessories: 10" touchscreen, adjustable
- Radio accessories: Apple CarPlay
- Rain sensor
- Remote
- Rear view camera
- Secure Tracker
- Sporty stainless steel pedals
- Voice control
- Start-stop system
- Telephone: Bluetooth-enabled telephone system
- Torque vectoring
- Traffic sign recognition with adaptive speed limiter
- Roll Stability Control (RSC)
- Airbag: Side airbags for driver and front passenger
- Airbag: Windowbags (head airbags) for the 1st and 2nd row of seats
- All-wheel drive (permanent)
- Ambient interior lighting
- Low Traction Launch
- Anti-lock braking system (ABS)
- Autonomous emergency braking assistant
- Hill Descent Control (HDC)
- Hill start assist
- Electronic brake force distribution (EBD)
- "Morzine" headliner (fabric) - Ebony
- Tachometer
- Dynamic Stability Control (DSC)
- Chrome door sill plates with Range Rover lettering
- Electronic Traction Control (ETC)
- High beam with automatic dimming (Auto High Beam Assist, AHBA)
- 2 front cup holders
- Heated rear window with timer
- Rear spoiler
- ISOFIX mounting points in the rear
- Automatic climate control (2-zone)
- Collision warning system monitor
- Front headrests
- Charging cable for charging stations (Mode 3 cable)
- Charging: Type 2 connector for AC charging (alternating current charging)
- Steering wheel: Paddle shifters in matte chrome
- Automatic headlight range control
- Otto particulate filter
- Package: Online Pack with data plan
- Pivi Pro with navigation
- Radio: Digital radio (DAB+)
- Radio accessories: Android Auto
- Radio accessories: Meridian sound system
- Tire pressure monitoring system (TPMS)
- Wheels: 20" alloy wheels, Style 5079 Gloss Sparkle Silver All Terrain summer tires
- Seats: Driver's seat adjustable in 14 ways (12-way electric, 2-way manual), with memory function
- Lane departure warning system
- Start/stop button for switching the engine on/off.
- Terrain Response 2 Automatic
- Blind spot lane assist including proximity sensor
- Lashing eyes in the cargo area
- Central locking



Extra equipment

- Cargo net
- Floor mats
- Glazing: Dark tinted windows from the B-pillar back.
- Package: Black Pack (The Black Pack includes: - Gloss black exterior mirror caps - Gloss black rear bumper with gloss black skirt - Gloss black radiator grille and surround - Gloss black Range Rover lettering on tailgate - Gloss black Range Rover lettering on bonnet - Gloss black side air intakes - Matte black front bumper with gloss black skirt)
- Paint finish: Premium metallic
- Roof: Panoramic roof with electric sunshade
- Wireless charging for smartphones
- Home charging cable (Mode 2 cable)
- Keyless Entry - Keyless access system
- Seats: Driver's seat 14-way adjustable (12-way electric, 2-way manual), heated with memory function (passenger seat 12-way adjustable (10-way electric, 2-way manual), heated - forward/backward - seat height - seat cushion tilt (driver's seat only) - backrest tilt - lumbar support, 4-way electric adjustable - headrest height, manually adjustable - heated front seats - rear bench seat 40:20:40 split with headrest in the middle - rear center armrest - memory function on driver's side)
- Steering wheel: Multifunction steering wheel, heated
- Wheels: 20" alloy wheels, Style 5079 Gloss Black All Terrain summer tires (8J x 20 with 235/50 R20 tires)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Door - front left side	Door edge - Scratch(es) - Smart repair
3	Misc.	Inspection / maintenance - Due - Perform

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Interior	Interior - Soiled - No deduction
4	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

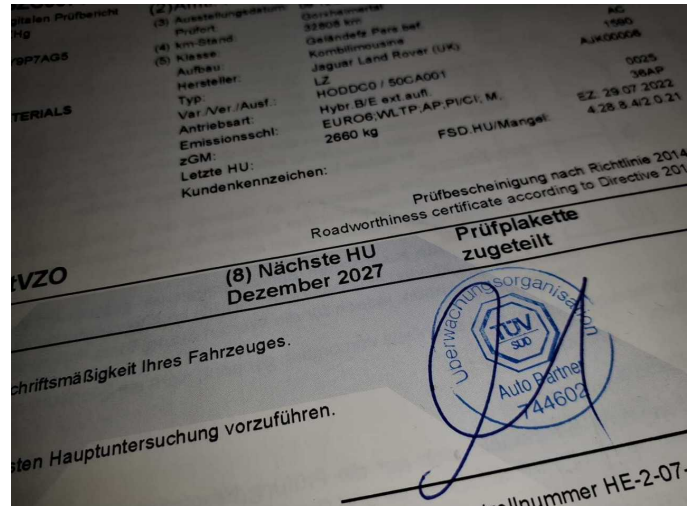


Figure 14: Documents



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

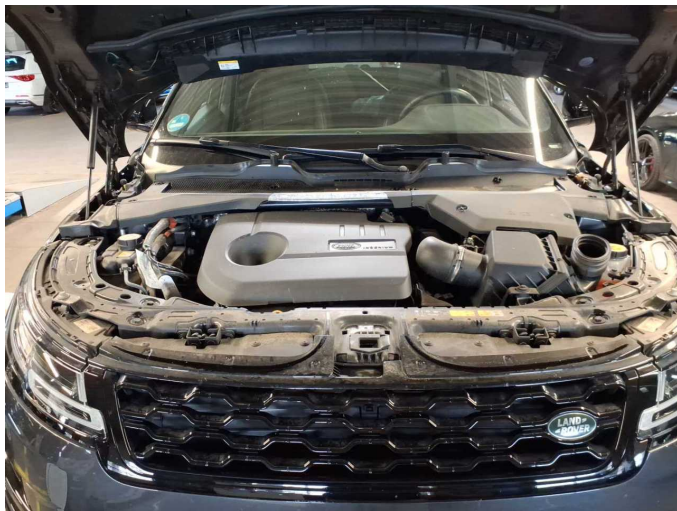


Figure 21: Misc.



Figure 22: Misc.

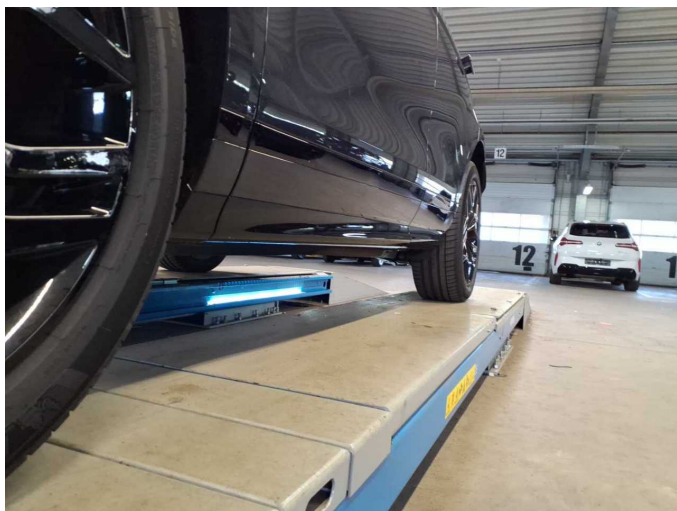


Figure 23: Misc.

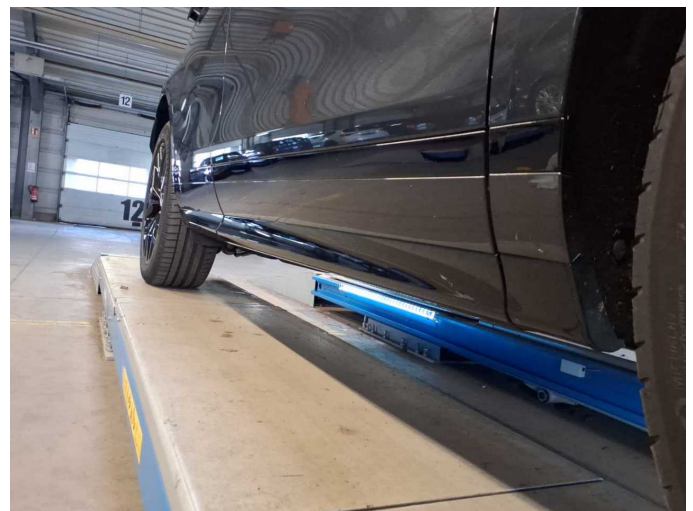


Figure 24: Misc.




Figure 25: Misc.



Figure 26: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace

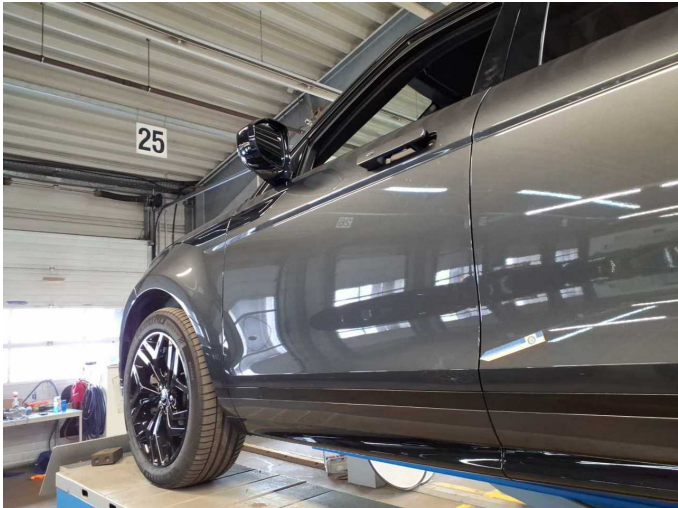

Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 3: Misc.: Inspection / maintenance - Due - Perform