



Expertise

Protocol number: 46667645
Order No. / Reference: 26664443
Inspection date: 23 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1NKM0FB0PU021481

Model: GLC 220 d 4Matic 9G-TRONIC Avantgarde Advanced



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC 220 d 4Matic 9G-TRONIC Avantgarde Advanced	
Vehicle Identification number	W1NKM0FB0PU021481
Mileage (Read)	97,686 km
First registration	9 May 2023
Number of holders	1
Next periodical technical inspection	06/2028
(Report on hand)	
Fuel type	Hybrid Diesel / E
Engine displacement / Cylinder	1,993 ccm / 4
Power	145 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Graphitgrau Metallic
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Brown-Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	138 Tag(e)
Last service on / at	09/2025 at 77,019 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS695052
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BJX 00045		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,550 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103V	Summer tyres on Light alloy	Michelin	6mm / 6mm
2)	235/60 R18 103V	Summer tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103H	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	235/60 R18 103H	Winter tyres on Light alloy	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Adaptive Highbeam Assist
- Airbag: Kneebag for driver
- Airbag: Windowbag
- Active Lane Keeping Assist
- Ambient lighting
- Traction control (ASR)
- Automatic passenger airbag deactivation
- Roof rails made of glossy anodized aluminum
- Double cup holder
- Tachometer
- EASY-PACK tailgate
- Electronic Stability Program (ESP)
- Chassis: AGILITY CONTROL chassis with selective damping system
- Transmission: 9G-TRONIC
- Rear window wiper/washer system
- Instrument panel in black with contrasting decorative stitching
- LED High Performance Headlights
- Mercedes-Benz emergency call system
- Center console in high-gloss black
- Navigation: MBUX Navigation Premium
- Package: Avantgarde Advanced
- Package: Interior light
- Package: Parking package with reversing camera
- Package: Mirror Package
- Radio accessories: Digital radio (DAB)
- Tire pressure loss warning
- Wheels: 45.7 cm (18") alloy wheels in a 5-twin-spoke design, painted black
- Windscreen wipers with rain sensor
- Heated seats for driver and front passenger
- Phone accessories: Smartphone integration
- Cruise control
- High-visibility vest for drivers
- Heat-insulating dark tinted glass
- Central locking with remote control
- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- 4MATIC all-wheel drive
- Anti-lock braking system (ABS)
- ATTENTION ASSIST
- Basic services
- Diesel particulate filter
- Downhill Speed Regulation (DSR)
- Dynamic front bumper with visual underguard
- EASY-Pack: Cargo area cover
- Driver display
- Fingerprint scanner
- Velour floor mats
- Rear window heated
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control
- Radiator grille with integrated Mercedes star
- Steering wheel: Multifunction sports steering wheel in leather
- Navigation accessories: Extended MBUX functions
- Package: Storage
- Package: Chrome Interior Package
- Package: Boot Comfort Package
- Package: Seating comfort
- Package: USB package
- Radio accessories: MBUX multimedia system
- Remote Services
- Wheels: Summer tires
- Wheel accessories: TIREFIT with tire inflator compressor
- Power steering
- Phone accessories: Wireless charging system for mobile devices
- Pre-installation for digital key handover
- Immobiliser
- Central display
- Decorative elements in diamond pattern, silver-grey



Extra equipment

- Towbar with ESP trailer stabilization
- Black fabric headliner
- Paint finish: Metallic
- Center console diamond pattern silver grey
- Package: Avantgarde Advanced Plus (electrically adjustable driver's seat with memory function - Blind Spot Assist - Illuminated door sills with "Mercedes-Benz" lettering - Traffic Sign Assist - Advanced Plus Package)
- Package: ENERGIZING Package Plus (Exclusive comfort programs - warmth - joy - coziness - freshness - vitality - PowerNap - Training: video instructions - Tips: 3-minute audio information for the sustainable promotion of health and well-being in everyday life - ENERGIZING COACH - Multi-contour seats for driver and front passenger - Seat climate control for driver and front passenger - AIR-BALANCE Package)
- Package: Off-road Engineering Package (comfort suspension with 20 mm higher ground clearance - metal underbody protection at the front - Gemtex durable plastic underbody protection on the sides)
- Package: Parking package with 360° camera (12 ultrasonic sensors: 6 each in the front and rear bumpers - 360° camera: four networked cameras, display on the media display, trailer mode - Active Parking Assist PARKTRONIC: detects parking spaces, assisted parking, assisted exiting, visual and acoustic warning of detected obstacles, display of camera and ultrasonic data on the central display, button for Active Parking Assist with PARKTRONIC - cross traffic warning - maneuvering brake - drive-away assist)
- Seats: Heated rear seats
- Seats: Front seat climate control (seat heating and ventilation)
- Auxiliary heater (with auxiliary ventilation)
- Type designation removed from trunk lid
- Digital Light (HD system with projection module - MULTIBEAM LED background module - Topography compensation keeps the beam range as constant as possible even with changes in altitude - Adaptive Highbeam Assist Plus - ULTRA RANGE highbeam - Active cornering light - Extended fog light, cornering light, country road light, city light, bad weather light, motorway light and motorway high beam - Cornering light with roundabout and intersection function - Off-road light - Adaptive full-LED taillights)
- Package: Driving Assistance Package Plus (Active Distance Assist DISTRONIC, Active Speed Limit Assist, Extended Automatic Restart, Route-Based Speed Adaptation with Traffic Jam Definition, Active Steering Assist, Active Lane Change Assist, Active Emergency Stop Assist with SOS Radio, Emergency Lane Radio, Active Brake Assist, Turn and Intersection Radio, Traffic Jam Emergency Brake Radio, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, Exit Warning Radio, PRE-SAFE PLUS Pedestrian Warning Function, Traffic Sign Assist, Active Traffic Jam Assist, PRE-SAFE Impulse Side)
- Package: Winter Package (heated steering wheel - heated windshield washer system)
- Upholstery: ARTICO two-tone leatherette
- Wheels: Complete summer wheel sets fitted at the factory
- Wheels: Winter complete wheels M+S 4-way 45.7 cm (18") (Light alloy wheels in 5-twin-spoke design, vanadium silver painted with 235/60 R 18 on 8 J x 18 ET 32.5)
- Sunroof: Panoramic sunroof (large glass module made of heat-insulating safety glass - mesh wind deflector in the front area - electric sunshade with one-touch operation - comprehensive protection concept: anti-pinch protection, automatic rain closing, automatic closing when the recirculation function is activated, PRE-SAFE closing function (only in conjunction with PRE-SAFE system))

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Trailer hitch	Trailer hitch (Betätigung) - Malposition - Un- / install
2	Mudguard - left side	Wheel well extension - Scratch(es) - Loss in value
3	Side panel - rear right side	Sill - dent(s) - Smart repair
4	Rear bumper	Rear bumper - Scratch(es) - Paint
5	Front bumper	Front bumper - Scratch(es) - Paint

Repainting

No. Repainting

- 1 Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
- 2 Door - front left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear left side	215 µm	Door - front left side	219 µm
-----------------------------	--------	------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

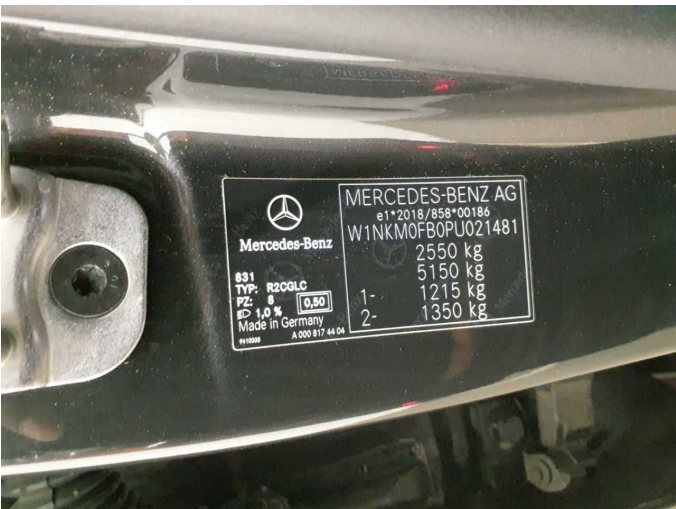


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

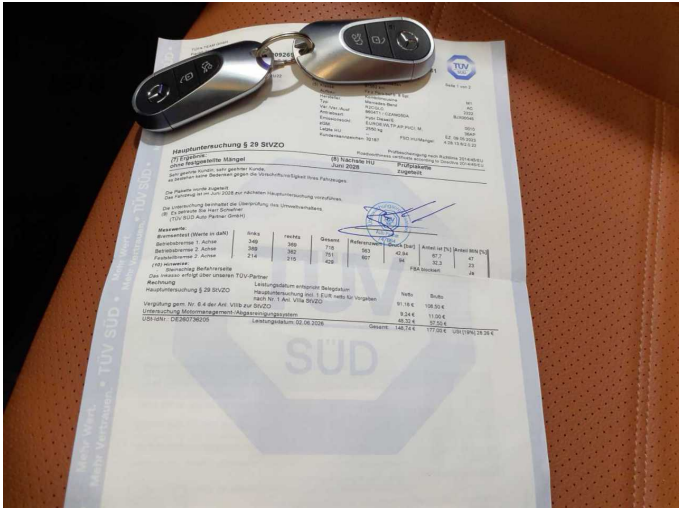


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

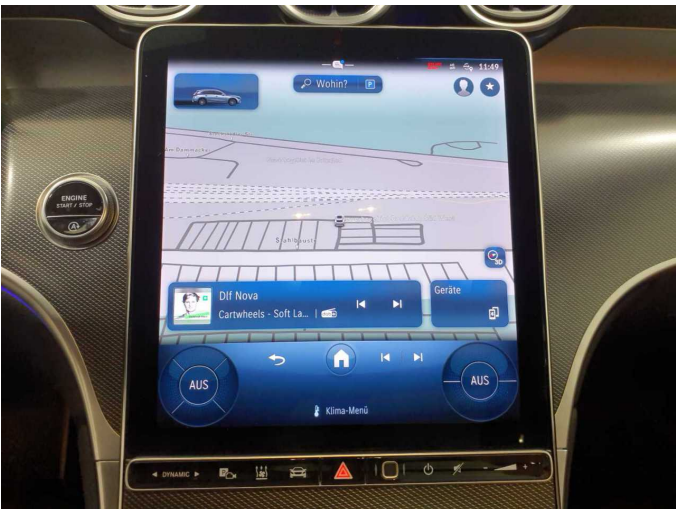


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

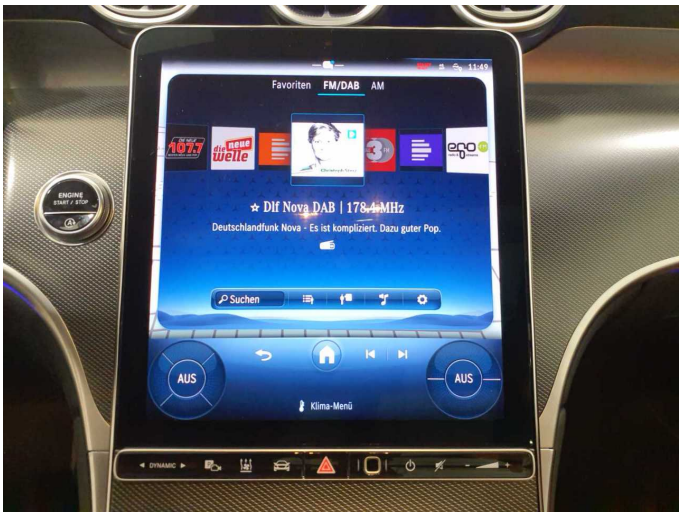


Figure 24: Misc.

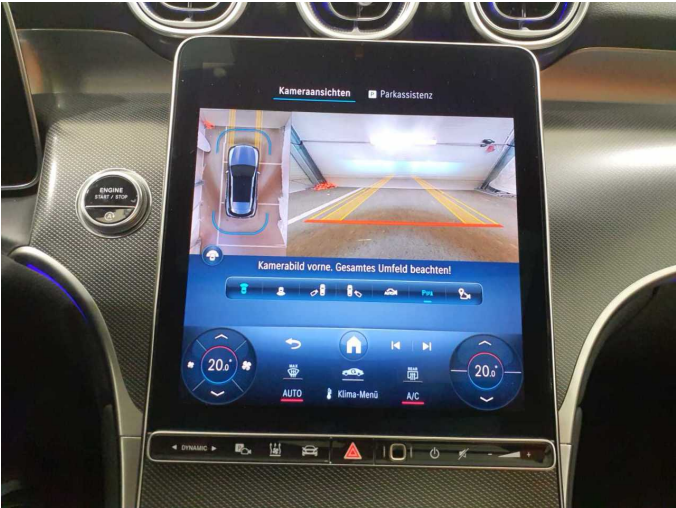


Figure 25: Misc.

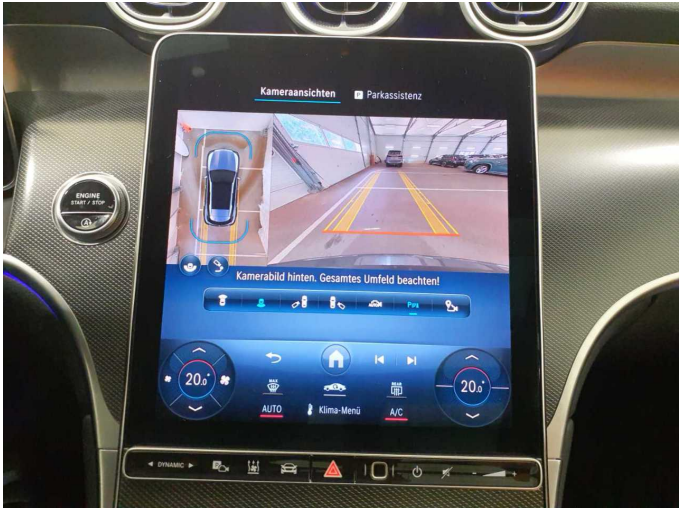


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

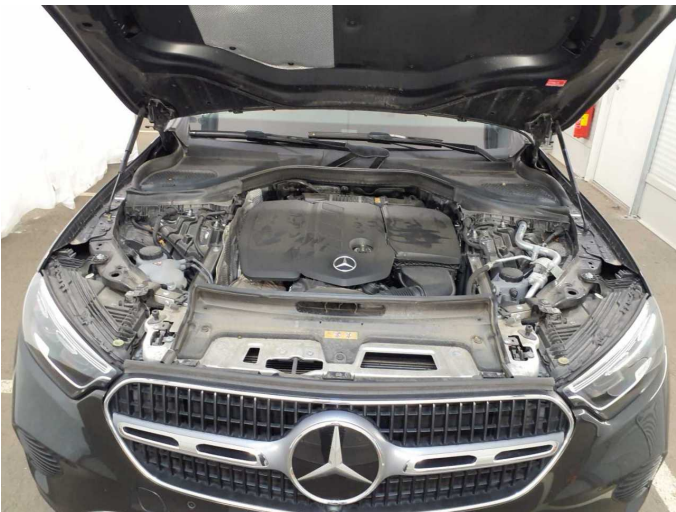


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.

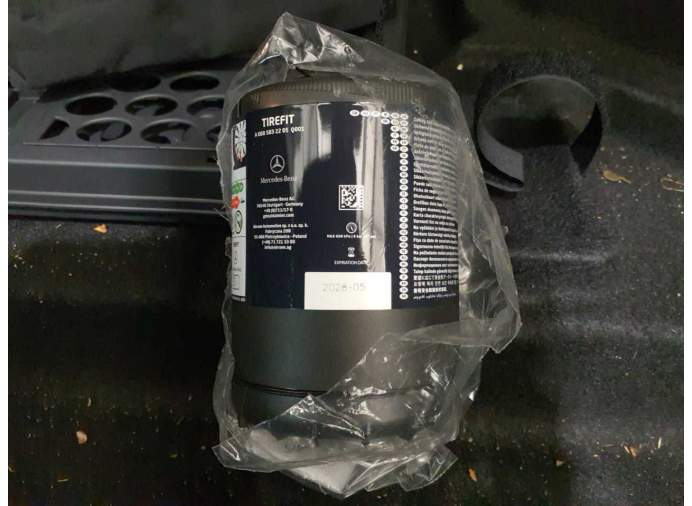


Figure 32: Misc.



Figure 33: Misc.



Damage 1: Trailer hitch: Trailer hitch (Betätigung) - Malposition - Un- / install



Damage 1: Trailer hitch: Trailer hitch (Betätigung) - Malposition - Un- / install




Damage 1: Trailer hitch: Trailer hitch (Betätigung) - Malposition - Un- / install



Damage 1: Trailer hitch: Trailer hitch (Betätigung) - Malposition - Un- / install



Damage 2: Mudguard - left side: Wheel well extension - Scratch(es) - Loss in value

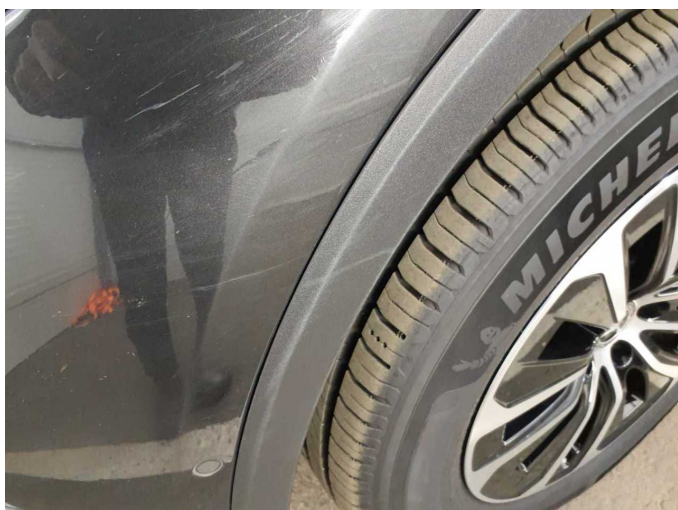

Damage 2: Mudguard - left side: Wheel well extension - Scratch(es) - Loss in value



Damage 2: Mudguard - left side: Wheel well extension - Scratch(es) - Loss in value




Damage 2: Mudguard - left side: Wheel well extension - Scratch(es) - Loss in value




Damage 3: Side panel - rear right side: Sill - dent(s) - Smart repair



Damage 3: Side panel - rear right side: Sill - dent(s) - Smart repair

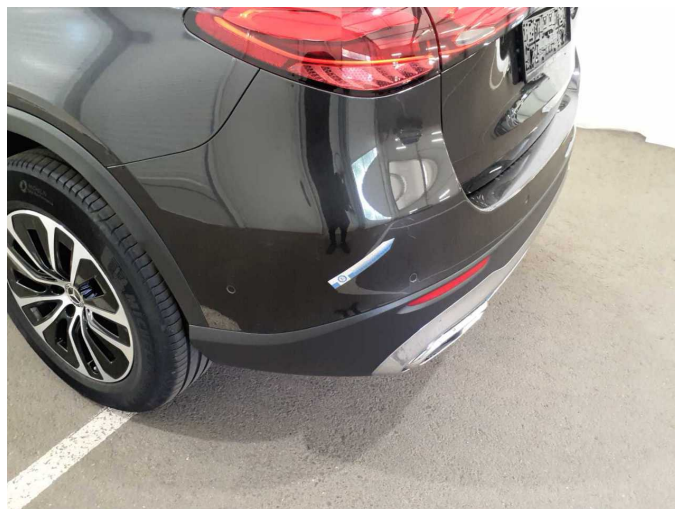

Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint

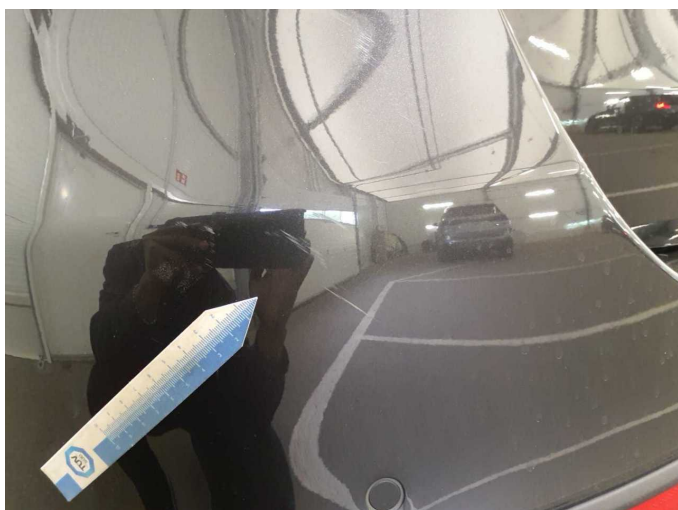


Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Front bumper: Front bumper - Scratch(es) - Paint

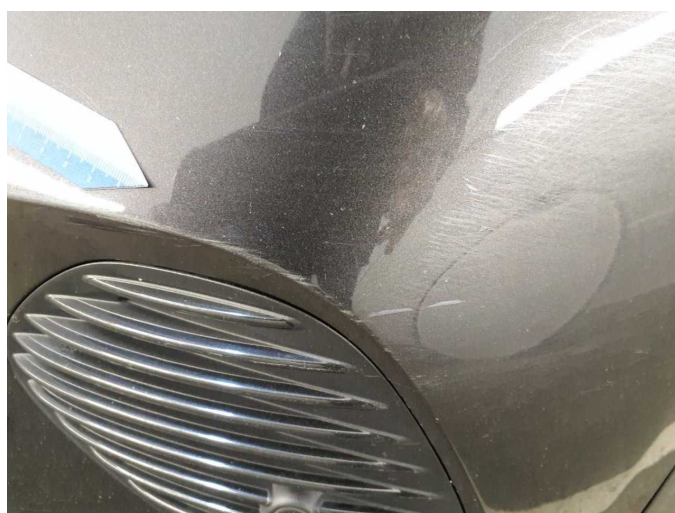

Damage 5: Front bumper: Front bumper - Scratch(es) - Paint




Damage 5: Front bumper: Front bumper - Scratch(es) - Paint



Damage 5: Front bumper: Front bumper - Scratch(es) - Paint



Damage 5: Front bumper: Front bumper - Scratch(es) - Paint

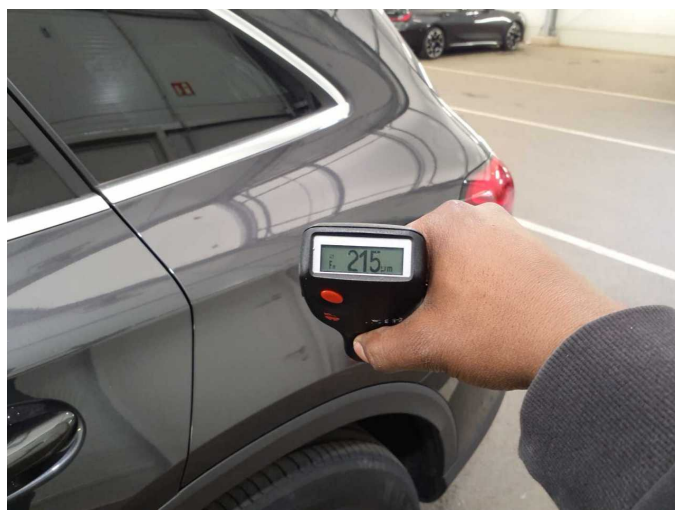

Repainting 1: Side panel - rear left side



Repainting 1: Side panel - rear left side



Repainting 2: Door - front left side



Repainting 2: Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1NKM0FB0PU021481

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLC 220 d 4Matic 9G-TRONIC Avantgarde Advanced

Datum	KM-Stand	Beschreibung
02.06.2026	97.552	HU + AU
04.09.2025	77.019	Regelwartungsdienst
11.12.2024	53.581	Regelwartungsdienst
21.02.2024	27.403	Regelwartungsdienst