



Expertise

Protocol number: 46814712
Order No. / Reference: 26774479
Inspection date: 31 Jul 2026

Manufacturer: Volkswagen

Model: ID.4 Performance Upgrade Pro

VIN: WVGZZZE2ZPE043084



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen ID.4 Performance Upgrade Pro	
Vehicle Identification number	WVGZZZE2ZPE043084
Mileage (Read)	43,748 km
First registration	30 Mar 2023
Number of holders	1
Next periodical technical inspection	03/2028
(Report on hand)	
Fuel type	Electric
Power	70 kW
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	SUV
Colour / colour code	Grenadillschwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	243 Tag(e)
Last service on / at	02/2025 at 25,298 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS460771
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0603 / CLQ 00108		
Emission standard	2017/1151	fine dust sticker	
Permitted total weight	2,660 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101T	Summer tyres on Light alloy	Bridgestone	5mm / 5mm
2)	255/50 R19 103T	Summer tyres on Light alloy	Bridgestone	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101T	Winter tyres on Steel rim with wheel cover	Bridgestone	7mm / 7mm
2)	255/50 R19 103T	Winter tyres on Steel rim with wheel cover	Bridgestone	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 2 USB-C ports on the front
- Airbag for driver and front passenger, with front passenger airbag deactivation
- Ambient lighting, 10 colors
- Electrically adjustable, folding and heated exterior mirrors
- Car2X
- e-Sound (artificially generated engine noise to inform other road users about the approach of the e-vehicle)
- ESP Electronic Stability Program (incl. ABS Anti-lock Braking System)
- Speed limiter (in conjunction with online services)
- Transmission: 1-speed automatic
- Back window, heater
- rear window wiper
- Interior mirror automatically dimming
- ISOFIX mounting points for child seats (mounting points for child seats on the outer rear seats and on the front passenger seat, i-Size compatible)
- Mode 3 Type 2 charging cable, 16 A
- Charging: 125 kW DC charging power (direct current)
- Steering wheel: Multifunction steering wheel with touch controls
- Navigation system "Discover Pro" (23.4 cm touchscreen - map with 2D display - traffic sign display - points of interest - App-Connect Wireless - voice control)
- Package: Infotainment package (Navigation system "Discover Pro": 23.4 cm touchscreen, map with 2D display, traffic sign display, points of interest, App-Connect Wireless, voice control - "Comfort" telephone interface with inductive charging function including hands-free system, Bluetooth audio, external antenna connection with LTE support)
- LED taillights
- Electromechanical power steering (speed-dependent control)
- Seats: Armrest for front seats
- Seats: Driver's seat height adjustable
- Seats: Rear bench seat undivided, backrest asymmetrically split and foldable
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking including remote control
- Turning brake function and evasive steering support
- Airbags: Front and rear head airbags, front side airbags, center airbag
- App-Connect Wireless for Apple CarPlay and Android Auto
- third brake light
- black roof rails
- Parking aid (warning signals for obstacles in the front and rear area)
- Driving profile selection (possibility to set different vehicle settings: Comfort (only in conjunction with Adaptive Chassis Control DCC), Normal, Sport, Eco, Individual - adjustable vehicle systems are: engine, Adaptive Chassis Control DCC, DSG, steering, start-stop system, cornering lights and "Dynamic Light Assist", Adaptive Cruise Control ACC, air conditioning)
- "Climatronic" air conditioning system (active combination filter - stationary air conditioning)
- Front and rear headrests (5)
- Charging: 11 kW AC charging power (alternating current)
- LED headlights with automatic headlight control
- Makeup mirrors in the sun visors
- Fatigue detection
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Emergency call service (no registration required, service is activated upon delivery)
- Upholstery: Seat center panels of the front seats and the outer rear seats in "Matrix" fabric
- Radio "Ready 2 Discover" (Digital radio reception DAB+ - Diversity antenna for FM reception)
- Radio accessories: 6 + 1 speakers
- Tire pressure monitoring system
- Keyless Start system (without safe locking)
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner (3 three-point automatic seat belts at the rear - warning tone and light for unfastened seat belts at the front and rear)
- Voice control
- Lane keeping assistant "Lane Assist"
- Ambient lighting with logo projection
- Traffic sign recognition
- Green thermal insulation glazing, sides and rear



Extra equipment

- Foldable towbar (electric release)
- Interior Style Platinum Grey with black steering wheel (30-color ambient lighting, leather multifunction steering wheel, heated, with touch controls, stainless steel pedals in "Play/Pause" design, asymmetrically split folding rear seat backrest with pass-through and center armrest, 2 cup holders, seat center panels of the front seats and outer rear seats in "ArtVelours" microfleece, height-adjustable front seats)
- Package: Design package (3D LED taillights with dynamic turn signals - Dynamic Light Assist high beam control for LED matrix headlights - IQ.LIGHT - LED matrix headlights with automatic headlight control, bad weather light, welcome function - illuminated strip between the headlights - tinted rear side windows and rear window)
- Package: Infotainment Package "Plus" (Head-up display - Navigation system "Discover Pro": 23.4 cm touchscreen, map with 2D display, traffic sign recognition, points of interest, App-Connect Wireless, voice control - Radio "Ready 2 Discover Max": DAB+ digital radio reception, diversity antenna for FM reception - Telephone interface "Comfort" with inductive charging function including hands-free system, Bluetooth audio, external antenna connection with LTE support - Sound system, 6 loudspeakers, digital channel amplifier, subwoofer, 450 W)
- Wheels: Alloy wheels (4) "Hamar" 8 J x 19 in black, gloss-turned finish (4 alloy wheels "Hamar" 8 J x 19 in black, gloss-turned surface - tires 235/55 R 19 front and 255/50 R 19 rear - wheel locks with enhanced theft protection)
- Heat pump for range optimization
- Luggage net
- Paint finish: Metallic
- Package: Assistance Package "Plus" including "IQ.DRIVE" in conjunction with Interior Top Sport "Plus" and Style ("Easy Open & Close" - tailgate with sensor-controlled opening and closing, with remote release; Adaptive Cruise Control "Stop & Go", with speed limiter; Anti-theft alarm with interior, backup horn and tow-away function; Driving Assistance "Travel Assist", Lane Keeping Assist "Lane Assist" and "Emergency Assist"; Multifunction leather steering wheel; Parking Assist "Park Assist Plus"; Precise occupant protection; Keyless locking and start system "Keyless Access", with Safe Security; Lane Change Assist "Side Assist"; Surround view "Area View" including reversing camera.)
- Package: Comfort package in conjunction with Interior Style (2 USB-C interfaces in the front, 2 USB-C charging ports on the rear center console - Windscreen in laminated safety glass, wirelessly heated and infrared-reflecting, noise-reducing - "Air Care Climatronic" air conditioning with active combination filter, stationary climate control and 2-zone temperature control - Variable center console with interchangeable inserts for cup holders and storage compartments - Rain sensor - Automatically heated windscreen washer nozzles in the front - Heated front seats)
- Wheels: Winter wheels (4) (additional), steel (4 steel winter wheels 8 J x 19 - winter tires 235/55 R 19 T front, 255/50 R 19 T rear)
- Textile floor mats front and rear

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Brightware / decorative strip (Frontscheibe links) - Scratch(es) - Replace
2	Bonnet	Bonnet - dent(s) - Smart repair
3	Vehicle glazing	Windscreen with lane departure assistant - Stone chips - Replace



Wear and tear

No.	Component group	Description
-----	-----------------	-------------

1	Door - front left side	Door - Scratch(es) - No deduction
---	------------------------	-----------------------------------

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

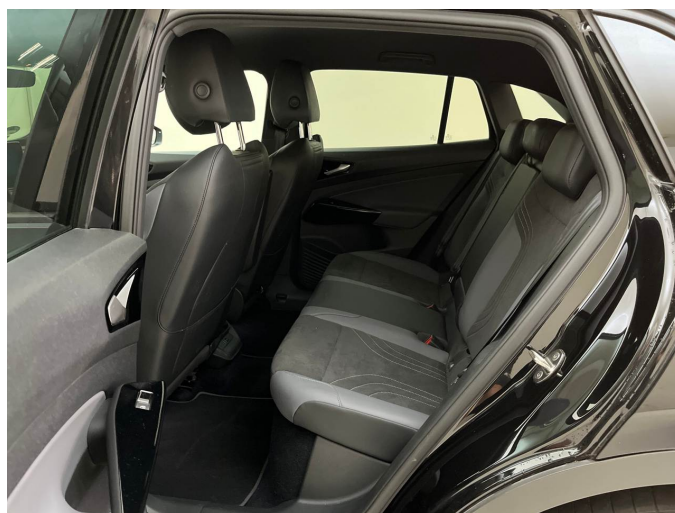


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

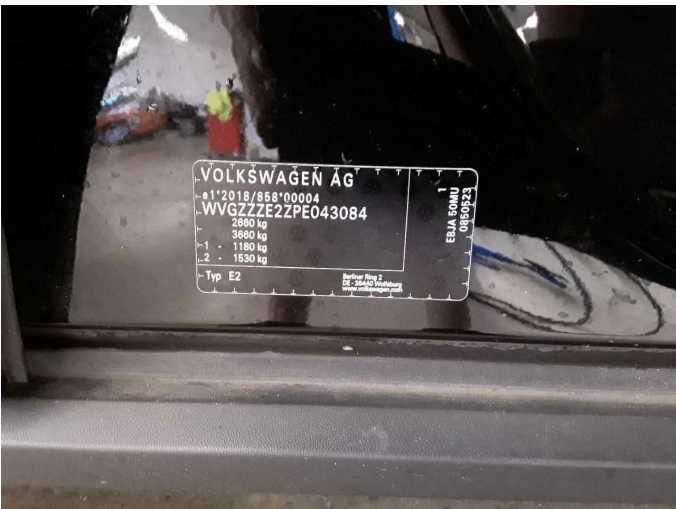


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

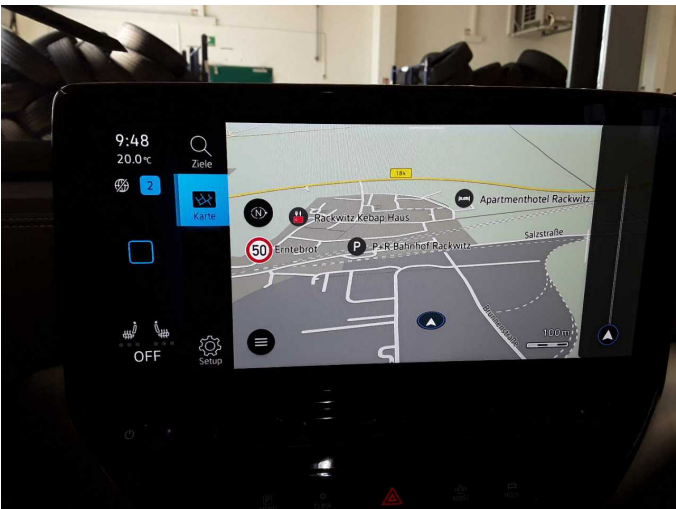


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.


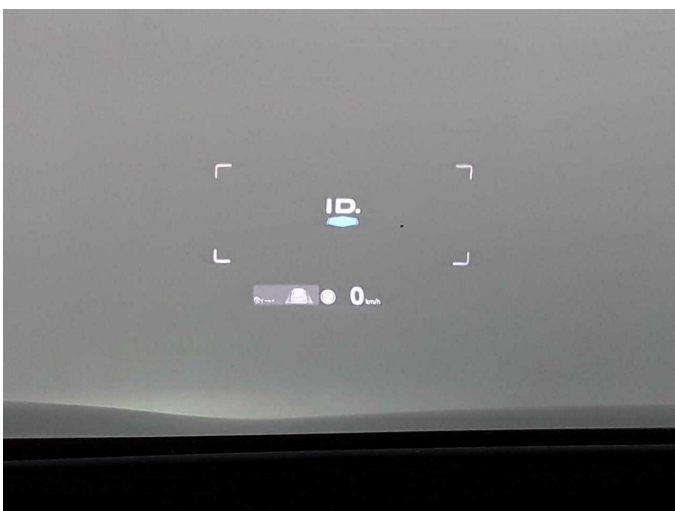


Figure 29: Misc.



Damage 1: Trim / covers: Brightware / decorative strip (Frontscheibe links) - Scratch(es) - Replace

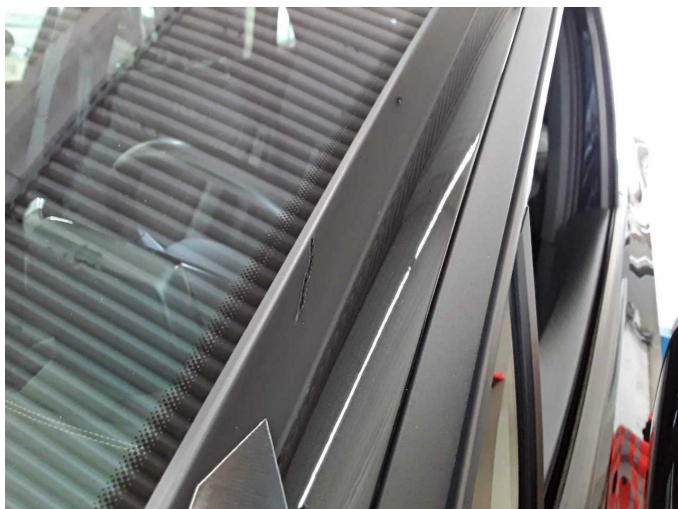

Damage 1: Trim / covers: Brightware / decorative strip (Frontscheibe links) - Scratch(es) - Replace




Damage 2: Bonnet: Bonnet - dent(s) - Smart repair



Damage 2: Bonnet: Bonnet - dent(s) - Smart repair



Damage 3: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace

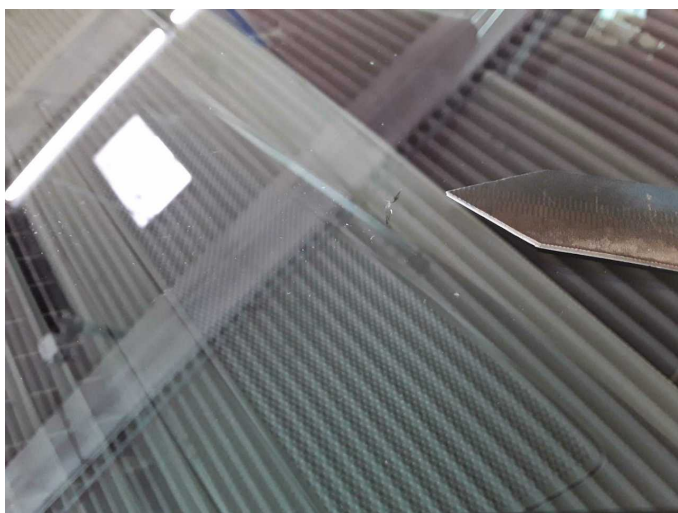

Damage 3: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZE2ZPE043084

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN ID.4 Performance Upgrade Pro

Datum	KM-Stand	Beschreibung
24.02.2025	25.298	Bremsflüssigkeit ern; Regelwartungsdienst