



Expertise

Protocol number: 46840719  
Order No. / Reference: 26726164  
Inspection date: 31 Jul 2026

Manufacturer: Volkswagen

Model: Passat Variant 2.0 TDI SCR DSG Business

VIN: WVGZZZ3CZPE040713



| Vehicle details                                    |                             |
|----------------------------------------------------|-----------------------------|
| Manufacturer / Type / Model / Equipment            |                             |
| Volkswagen Passat Variant 2.0 TDI SCR DSG Business |                             |
| Vehicle Identification number                      | WVGZZZ3CZPE040713           |
| Mileage (Read)                                     | 148,592 km                  |
| First registration                                 | 18 Apr 2023                 |
| Number of holders                                  | 1                           |
| Fuel type                                          | Diesel                      |
| Engine displacement / Cylinder                     | 1,968 ccm / 4               |
| Power                                              | 110 kW                      |
| Gearbox / Number of gears                          | Automatic / 7               |
| Type of drive                                      | Front drive                 |
| Type of vehicle                                    | Station wagon               |
| Colour / colour code                               | Deep Black Perleffekt (C9X) |
| Doors / Seats                                      | 5 / 5                       |
| Upholstery type                                    | Cloth                       |
| Colour of upholstery                               | Black-Grey                  |



## Vehicle details

|                                                  |                          |                                |                                                            |
|--------------------------------------------------|--------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>               | digital proof / complete | <b>Next maintenance in</b>     | 5,300 km                                                   |
| <b>Last service on / at</b>                      | 10/2025 at 123,844 km    |                                |                                                            |
| <b>Key is / should be</b>                        | 2 / 2                    | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                  |                          | <b>Letter No.</b>              | GS389958                                                   |
| <b>Previous damage / Accident</b>                | None detectable          | <b>Repainting</b>              | Detectable                                                 |
| <b>Inspection conditions</b>                     | sufficient               | <b>Lifting equipment / pit</b> | No                                                         |
| <b>Test drive</b>                                | Not performed            | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/ type code number</b> | 0603 / BQS 04367         |                                |                                                            |
| <b>Emission standard</b>                         | EURO6                    | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                    | 2,200 kg                 | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size      | Type of tyre                               | Manufacturer | Tread depth |
|----|----------------|--------------------------------------------|--------------|-------------|
| 1) | 215/60 R16 95H | Winter tyres on Steel rim with wheel cover | Dunlop       | 2mm / 2mm   |
| 2) | 215/60 R16 95H | Winter tyres on Steel rim with wheel cover | Dunlop       | 5mm / 5mm   |

### Additional tyres

| #  | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|----|----------------|-----------------------------|--------------|-------------|
| 1) | 215/60 R16 95V | Summer tyres on Light alloy | Bridgestone  | 0mm / 1mm   |
| 2) | 215/60 R16 95V | Summer tyres on Light alloy | Bridgestone  | 5mm / 5mm   |

### Replacement

| Typ | Tyre size | Type of tyre            | Manufacturer | Tread depth |
|-----|-----------|-------------------------|--------------|-------------|
|     | Tirefit   | Expiration date 11/2026 |              |             |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



## Equipment

## Standard equipment

- ISOFIX mounting points (for attaching 2 child seats to the rear seats, also for i-Size child seats)
- Front headrests (safety-optimized, longitudinally and height-adjustable)
- LED headlights with daytime running lights
- Headlight range control
- Front center armrest, height and length adjustable, with storage box (2 rear air vents with chrome slats)
- Fatigue detection (detects signs of possible driver fatigue based on characteristic steering behavior, time of day and driving duration and issues a visual and audible warning)
- Mesh partition
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Package: Light and Sight Package "Plus" (LED lights in the front footwell - Electrically adjustable and heated exterior mirrors, automatically dimming on the driver's side - Entry/warning lights in the front doors, in LED technology - Automatic headlight control, with daytime running lights, "Leaving Home" function and manual "Coming Home" function - Interior light with delayed shut-off and dimming function, 2 LED reading lights each in the front and rear - Automatically dimming interior mirror - Illuminated vanity mirrors - Extendable sun visors - Rain sensor)
- Radio accessories: Digital radio reception DAB+ (reception of digitally broadcast radio stations and traffic information in addition to the analog station offering - reception depends on the local availability of digital networks - expanded range of radio programs - improved reception performance)
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Gearshift knob in leather
- Keyless start system without safe locking
- Seat belts: Three-point automatic seat belt (seat belt for middle rear seat - seat belts for outer rear seats - front seat belts with height adjustment and belt tensioner)
- Seats: Front seats are height-adjustable (ergoComfort seat on the driver's side - with electric backrest adjustment)
- 12V power outlet on the rear center console (and in the luggage compartment)
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking with remote control
- Airbag, head airbag system for front and rear passengers (including front side airbags)
- App-Connect (Volkswagen offers three interfaces for connecting smartphones with numerous possibilities: - Apple CarPlay - Android Auto from Google - MirrorLink)
- Cup holders (2) front
- Hill start assist
- Air conditioning (with active combination filter)
- Rear headrests (3)
- LED fog lights and cornering lights
- LED taillights
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- Multifunction display "Premium" with multi-color display (showing, among other things: - Outside temperature - Average consumption - Average speed - Trip distance - Trip time - Gear recommendation - Speed warning - Comfort - Current consumption - Range - Service - Time with extended display options, e.g.: - Digital speedometer - Digital oil temperature display - Lights & visibility - Language - Auxiliary heater - Winter tires)
- Emergency call service (no registration required, service is activated upon delivery)
- Upholstery: Fabric "Business" (seat center panels of the front seats and the outer rear seats in fabric "Weave")
- Proactive occupant protection system in conjunction with "Front Assist" (detects critical traffic situations with increased accident potential - prepares vehicle occupants and the vehicle for a possible accident by tightening the front, fastened seat belts and securing the driver and front passenger, and closing open windows and the sunroof except for a gap)
- Radio "Composition" (touchscreen with 16.5 cm screen diagonal - 8 speakers - output power 4 x 20 watts - diversity antenna for FM reception - dual tuner - RDS - MP3 playback - USB-C interface - 3-way tone control)
- Tire pressure monitoring system (passive)
- Wheels: 4 light alloy wheels "Sepang" 6.5 J x 16 (tires 215/60 R 16, optimized for rolling resistance)
- Rear bench seat undivided, backrest asymmetrically split and foldable, with center armrest (and pass-through option)
- Power steering (electromechanical, speed-dependent)
- Seats: Comfort seats in the front
- Seats: Lumbar support in the front (driver's side electrically adjustable)
- Lane Assist (warns with a corrective steering intervention if the vehicle unintentionally leaves the lane)
- Start-stop system (with brake energy recuperation)
- Telephone interface
- Textile floor mats (front and rear)
- Warning tone and light for unfastened seat belts front and rear
- Airbag for driver and front passenger (airbag deactivation switch on the passenger side)
- Anti-lock braking system (ABS)
- Adaptive Cruise Control (ACC) "stop & go", including speed limiter
- Electrically adjustable and heated exterior mirrors, ambient lighting (automatically dimming on the driver's side)
- Chrome trim on the side windows
- black roof rails



- third brake light
- Headliner in Mistral Grey
- Diesel particulate filter
- Parking aid - warning signals for obstacles in the front and rear area
- Electronic stability program and electromechanical brake booster
- Remote release for luggage compartment lid
- Windscreen made of laminated safety glass, heat and sound insulating
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- Interior lights with delayed shut-off and dimming function (2 LED reading lights each at the front and rear)

### Extra equipment

- Anti-theft alarm system (interior monitoring, backup horn and tow-away protection - illuminated make-up mirror in the sun visors, extendable sun visors)
- Chassis: Rear suspension with fully automatic level control
- Exterior mirrors with ambient lighting and passenger-side mirror lowering function (foldable and heated - dimming on the driver's side)
- Keyless locking and starting system "Keyless Access" with safe locking mechanism
- Navigation system "Discover Pro" incl. "Streaming & Internet" (4x20 Watt App-Con. Wireless Digital Cockpit. Operation with proximity sensor. Dual tuner with phase differentiation. DAB. Vehicle menu. Speed. Volume adjustment. Gestures. 32 GB SSD hard drive. Map 2D display. Tone control. 3-way TFT display with touchscreen. MP3. Navigation for Europe. Voice control. Telephone contact. Address. Telephone interface. "Comfort" with inductive charging. 2 USB iPod/iPhone. Traffic sign recognition. "We Connect Plus" incl. "We Connect". Dynamic route guidance. RDS. TMC tuner. Mobile key pre-activation, vehicle via smartphone.)
- Package: "Easy Open & Close" package including safe locking (extendable and removable luggage compartment cover with electric opening - tailgate with sensor-controlled opening and closing, with remote unlocking - keyless locking and starting system "Keyless Access" with safe locking)
- Paint finish: Pearl effect
- Removable luggage compartment protective mat (back of the rear seat backrest with black rubber coating)
- Steering wheel: Multifunction leather steering wheel, heated, with paddle shifters
- Towbar, foldable (with electric release)
- Voice control
- Wheels: 4 alloy wheels "Aragon" 6.5 J x 16 (tires 215/60 R 16 - wheel locks with enhanced theft protection)

- Tachometer
- Entry/warning lights in LED technology in the front doors
- Electronic parking brake including auto-hold function
- Automatic headlight control (with daytime running lights, "Leaving home" function and manual "Coming home" function)
- Pedestrian detection
- Adjustable luggage compartment floor
- Rear window heated
- rear window wiper

- Decorative inlays in brushed aluminum (for instrument panel, door panels)
- Driving profile selection (possibility to set different vehicle settings: Comfort, Normal, Sport, Eco, Individual - adaptable vehicle systems include: engine, adaptive chassis control DCC, DSG, steering, start-stop system, cornering lights and "Dynamic Light Assist", automatic distance control ACC, air conditioning)
- IQ.LIGHT - LED matrix headlights, including dark red LED taillights (Dynamic Light Assist high beam control for LED matrix headlights - LED fog lights and cornering lights - LED taillights with dynamic turn signals - LED headlights with LED daytime running lights, cornering lights and dynamic turn signals - Dynamic headlight range control with dynamic cornering lights - Rear fog lights on both sides, reversing lights on both sides)
- Laminated safety glass, noise-reducing for front and side windows (including rear side windows and tinted rear window)
- Package: "Business Premium" package incl. navigation (from Business trim level) (2 USB-C ports in the front, USB-C charging socket in the rear, 230V socket, App-Connect incl. wireless, Apple CarPlay, Android Auto, "Travel Assist" driver assistance system and "Lane Assist" lane keeping assist system, Air Care Climatronic with 3-zone temperature control, active combination filter and rear controls, lumbar support in the front, electric on the driver's side, massage function on the driver's side, "Rear View" reversing camera, heated windshield washer nozzles, Comfort telephone interface, inductive charging function, heated front seats)
- Proactive occupant protection system and lane change assistant "Side Assist" (Proactive occupant protection system in conjunction with "Front Assist" and "Side Assist" - lane change assistant "Side Assist" and parking assistant)
- Seats: Front passenger seat backrest folds down completely
- Wheels: Winter wheels (additional), light alloy, "Aragon" 6.5 J x 16 (AirStop winter tires 215/60 R 16 H)



## Brief expert findings

|                      |                                                                                                                                                                                                                                               |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)                                                                  |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.                                                                     |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent. |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                                                                                         |
| Engine function test | An engine test run was performed.                                                                                                                                                                                                             |

## Value reducing factors

| No. | Component group              | Description                                                                      |
|-----|------------------------------|----------------------------------------------------------------------------------|
| 1   | Front structure              | Emblem - Stone chips - Loss in value                                             |
| 2   | Trim / covers                | C-pillar - trim - interior, right side - Scratch(es) - Replace                   |
| 3   | Side panel - rear right side | Sill - Dent / paintcoat damage - Smart repair                                    |
| 4   | Side panel - rear left side  | Sill - Dent / paintcoat damage - Smart repair                                    |
| 5   | Mudguard - left side         | Mudguard - left side - Scratch(es) - Smart repair                                |
| 6   | Trim / covers                | Boot lining - Scratch(es) - Replace                                              |
| 7   | Door - front left side       | Door - Scratch(es) - Smart repair                                                |
| 8   | Seat - rear                  | Upholstery - Broken / torn - Loss in value                                       |
| 9   | 2nd wheel set                | 2 tyres - Worn - Replace                                                         |
| 10  | Wheel / tyres                | Tyre - front - Worn - Replace                                                    |
| 11  | Door - front left side       | Door seal - Broken / torn - Replace                                              |
| 12  | Trim / covers                | Boot lid - interior trim - Scratch(es) - Replace                                 |
| 13  | Side panel - rear right side | Side panel - Dent / paintcoat damage - Repair and paint                          |
| 14  | Side panel - rear left side  | Side panel (Spachtel eingefallen) - Unprofessionally repaired - Repair and paint |
| 15  | Door - rear left side        | Door - Scratch(es) - Paint                                                       |
| 16  | Door - rear right side       | Door - Dent / paintcoat damage - Repair and paint                                |
| 17  | 2nd wheel set                | 1 alloy rim - Scratch(es) - Replace                                              |
| 18  | Rear bumper                  | Rear bumper - Dent / paintcoat damage - Repair and paint                         |
| 19  | Bonnet                       | Bonnet - Corrosion - Repair and paint                                            |
| 20  | Roof                         | Roof - Corrosion - Repair and paint                                              |



## Wear and tear

| No. | Component group         | Description                                               |
|-----|-------------------------|-----------------------------------------------------------|
| 1   | Vehicle glazing         | Rear window - Scratch(es) - No deduction                  |
| 2   | Headlight               | Headlight - right side - Stone chips - No deduction       |
| 3   | Headlight               | Headlight - left side - Stone chips - No deduction        |
| 4   | Door - front right side | Door - dent(s) - No deduction                             |
| 5   | Steering system         | Steering wheel - Abrasion - No deduction                  |
| 6   | Seat - front            | Seat cover - left side - Scratch(es) - No deduction       |
| 7   | Trim / covers           | Door trim - rear left side - Scratch(es) - No deduction   |
| 8   | Trim / covers           | Door trim - rear right side - Scratch(es) - No deduction  |
| 9   | Trim / covers           | Door trim - front right side - Scratch(es) - No deduction |
| 10  | Front bumper            | Front bumper - Scratch(es) - No deduction                 |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Repainting

### No. Repainting

- 1 Side panel - rear left side, Unprofessionally carried out, Invoice of repair done Non-existent

## Paint coat thickness measurement

Side panel - rear left side 575 µm |

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear

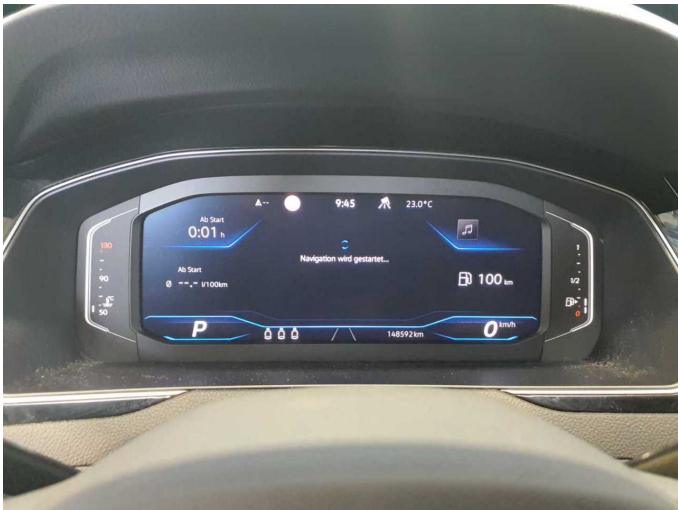


Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

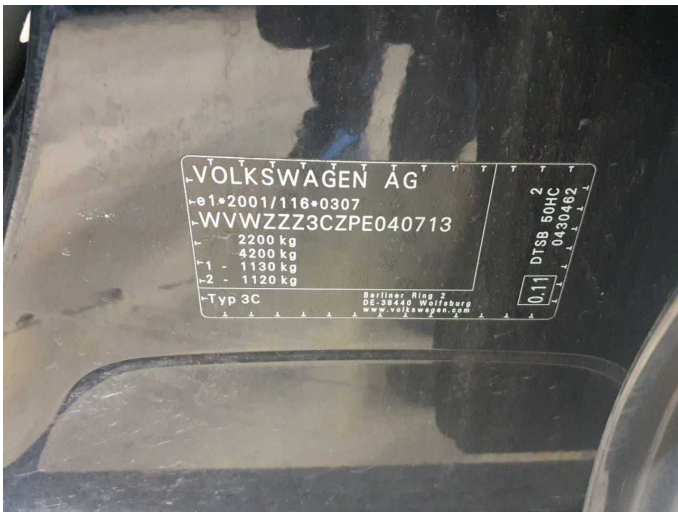


Figure 11: VIN



Figure 12: Mounted tyres

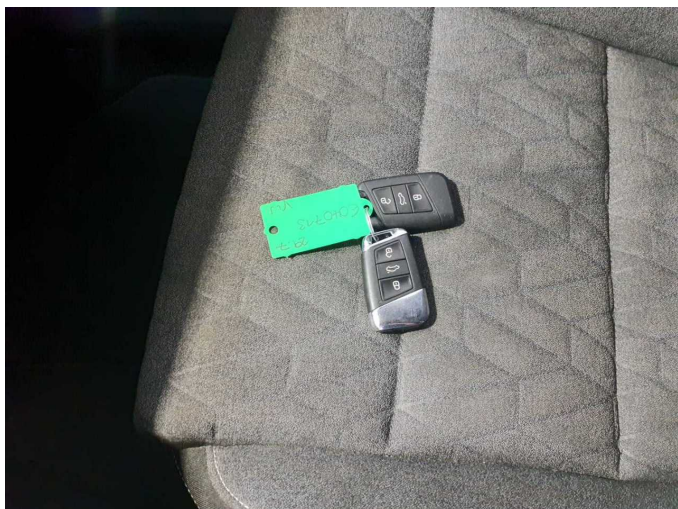


Figure 13: Documents

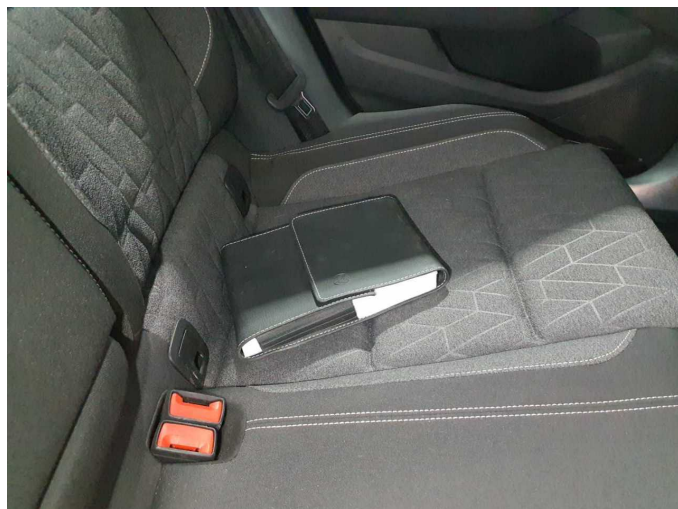


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

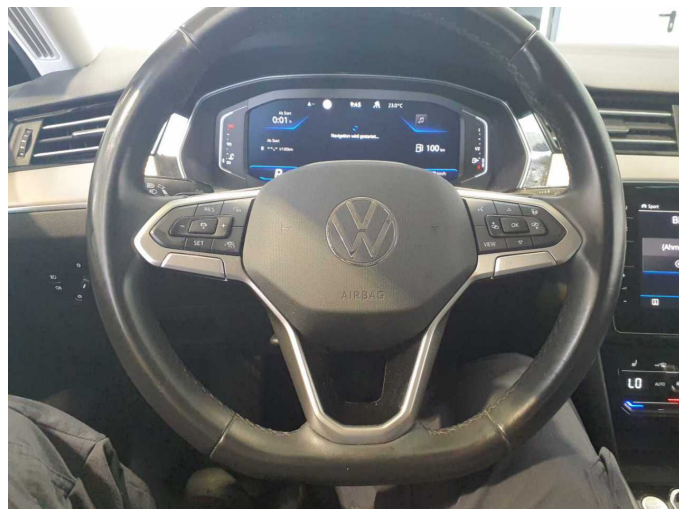


Figure 20: Misc.

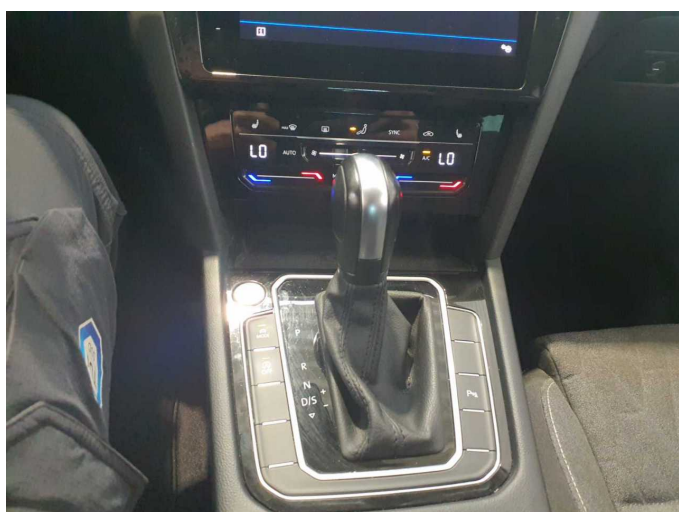


Figure 21: Misc.



Figure 22: Misc.

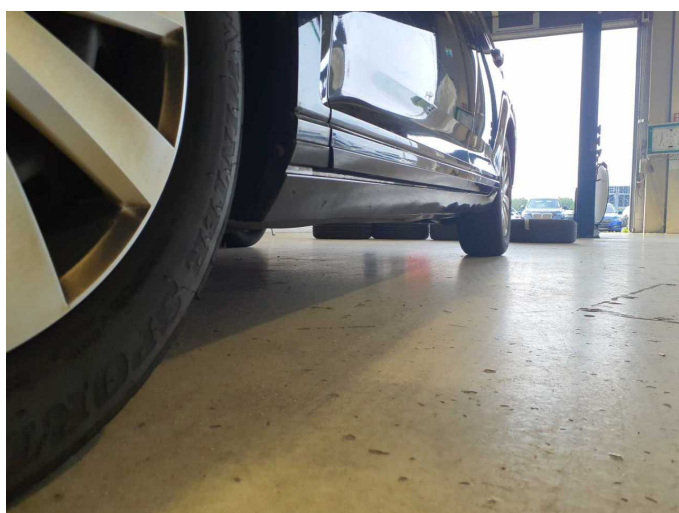


Figure 23: Misc.

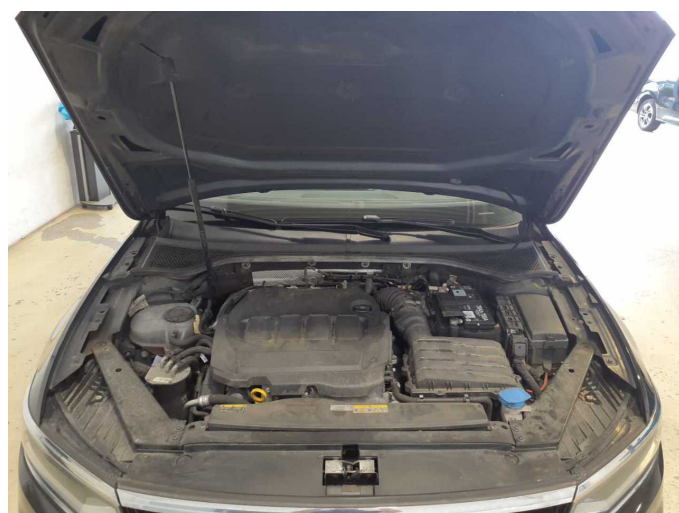


Figure 24: Misc.



Figure 25: Misc.




Figure 26: Misc.




Figure 27: Misc.




Figure 28: Misc.

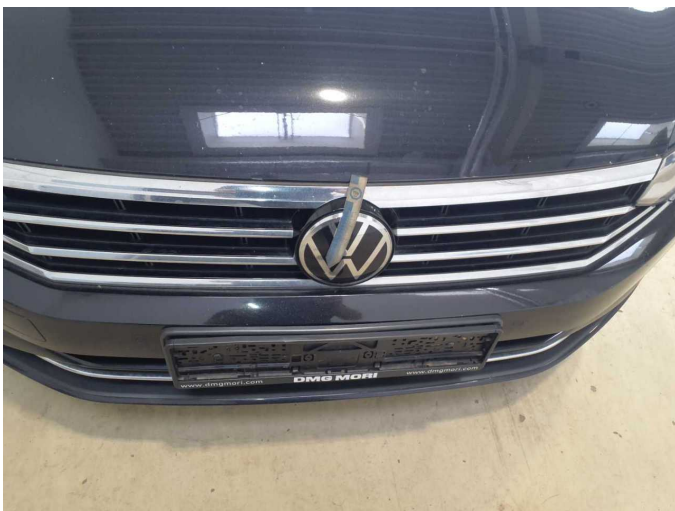


Damage 1: Front structure: Emblem - Stone chips - Loss in value

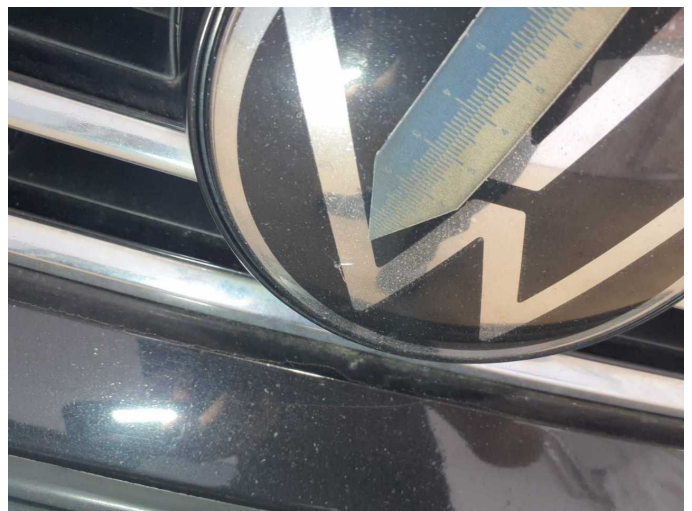


Damage 1: Front structure: Emblem - Stone chips - Loss in value

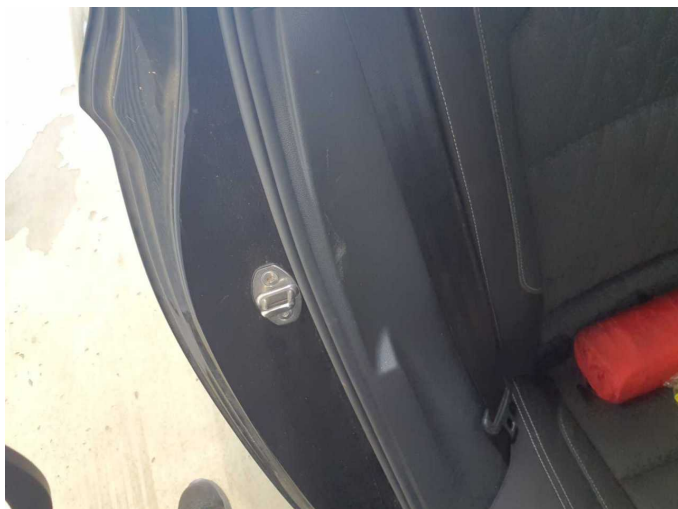


**Damage 2:** Trim / covers: C-pillar - trim - interior, right side - Scratch(es) - Replace

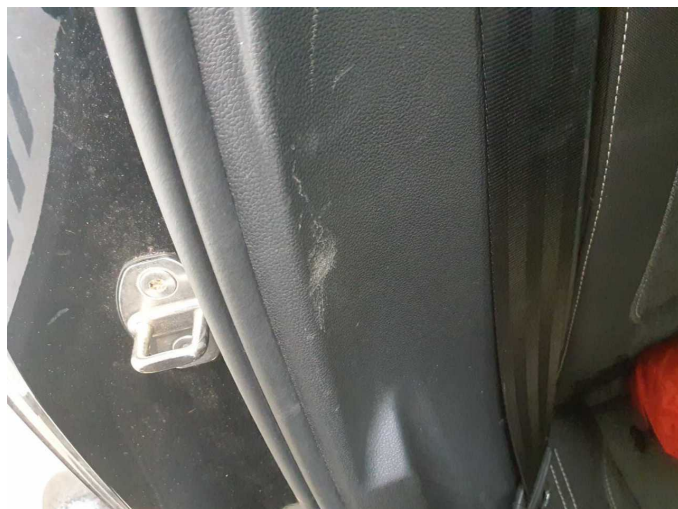


**Damage 2:** Trim / covers: C-pillar - trim - interior, right side - Scratch(es) - Replace

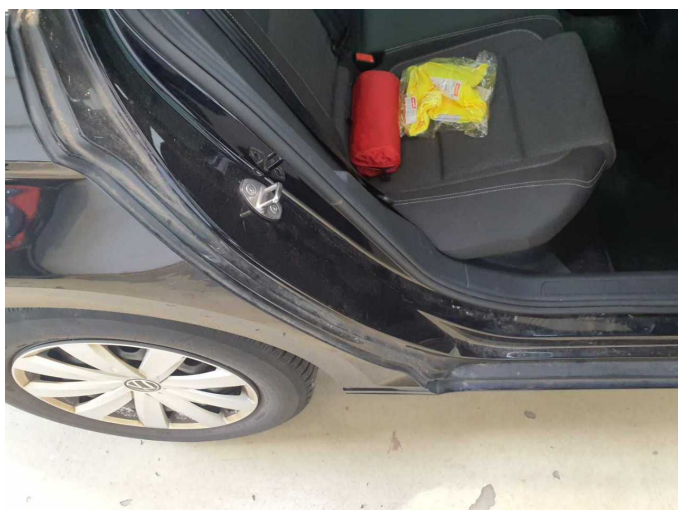

**Damage 3:** Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

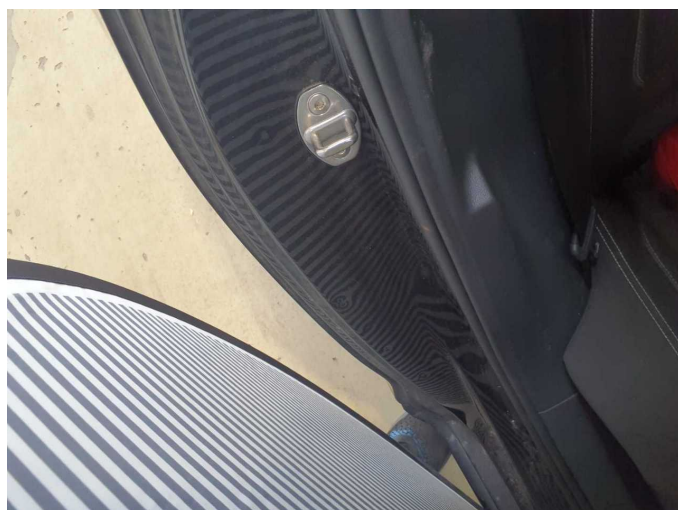

**Damage 3:** Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

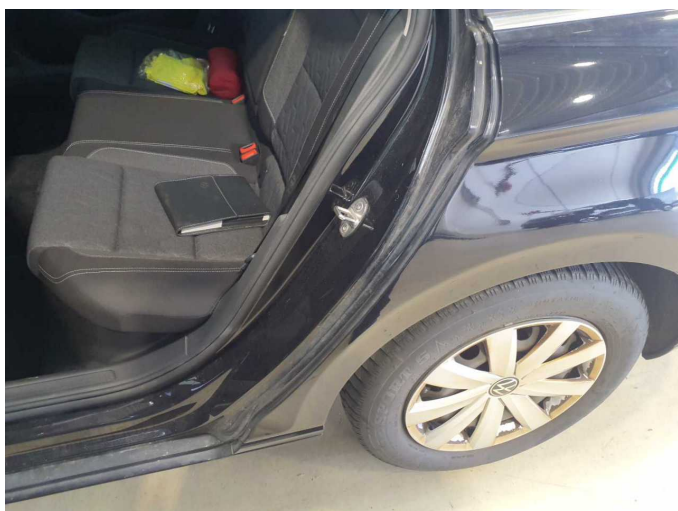

**Damage 4:** Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



**Damage 4:** Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



**Damage 5:** Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



**Damage 5:** Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



**Damage 6:** Trim / covers: Boot lining - Scratch(es) - Replace



**Damage 6:** Trim / covers: Boot lining - Scratch(es) - Replace



**Damage 7:** Door - front left side: Door - Scratch(es) - Smart repair



**Damage 7:** Door - front left side: Door - Scratch(es) - Smart repair



**Damage 8:** Seat - rear: Upholstery - Broken / torn - Loss in value




**Damage 8:** Seat - rear: Upholstery - Broken / torn - Loss in value




**Damage 9:** 2nd wheel set: 2 tyres - Worn - Replace




**Damage 9:** 2nd wheel set: 2 tyres - Worn - Replace

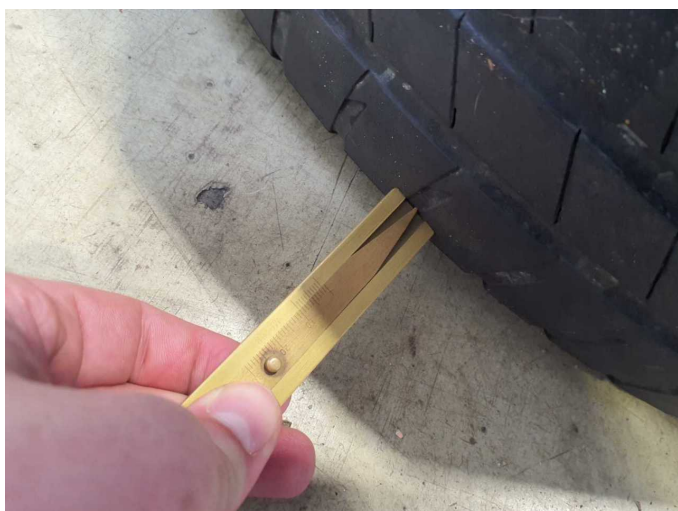

**Damage 9:** 2nd wheel set: 2 tyres - Worn - Replace

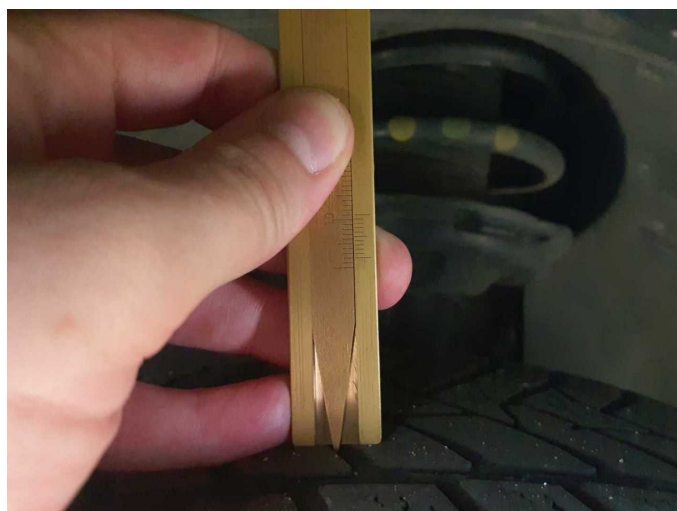

**Damage 10:** Wheel / tyres: Tyre - front - Worn - Replace

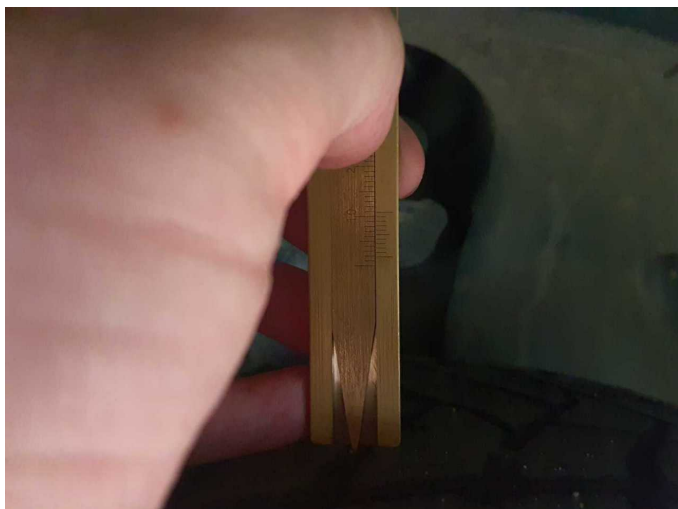

**Damage 10:** Wheel / tyres: Tyre - front - Worn - Replace



**Damage 11:** Door - front left side: Door seal - Broken / torn - Replace



**Damage 11:** Door - front left side: Door seal - Broken / torn - Replace



**Damage 12:** Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



**Damage 12:** Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



**Damage 13:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



**Damage 13:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



**Damage 13:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



**Damage 14:** Side panel - rear left side: Side panel (Spachtel eingefallen)  
- Unprofessionally repaired - Repair and paint



**Damage 14:** Side panel - rear left side: Side panel (Spachtel eingefallen)  
- Unprofessionally repaired - Repair and paint



**Damage 14:** Side panel - rear left side: Side panel (Spachtel eingefallen)  
- Unprofessionally repaired - Repair and paint



**Damage 14:** Side panel - rear left side: Side panel (Spachtel eingefallen)  
- Unprofessionally repaired - Repair and paint



**Damage 15:** Door - rear left side: Door - Scratch(es) - Paint



**Damage 15:** Door - rear left side: Door - Scratch(es) - Paint



**Damage 16:** Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



**Damage 16:** Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



**Damage 16:** Door - rear right side: Door - Dent / paintcoat damage - Repair and paint




**Damage 16:** Door - rear right side: Door - Dent / paintcoat damage - Repair and paint




**Damage 17:** 2nd wheel set: 1 alloy rim - Scratch(es) - Replace



**Damage 17:** 2nd wheel set: 1 alloy rim - Scratch(es) - Replace

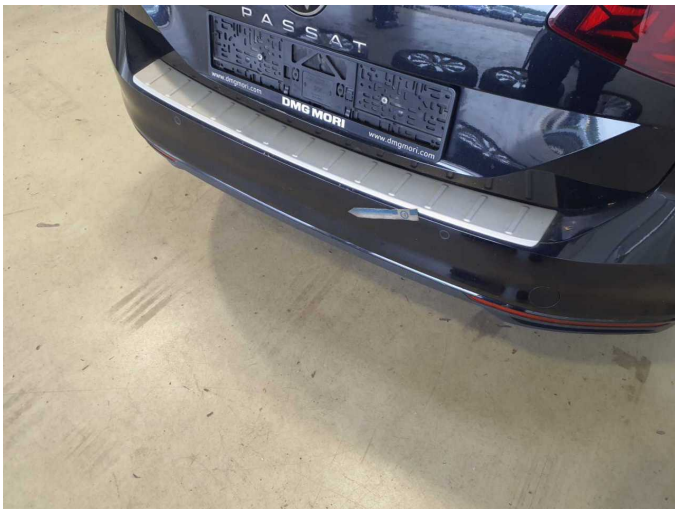

**Damage 18:** Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

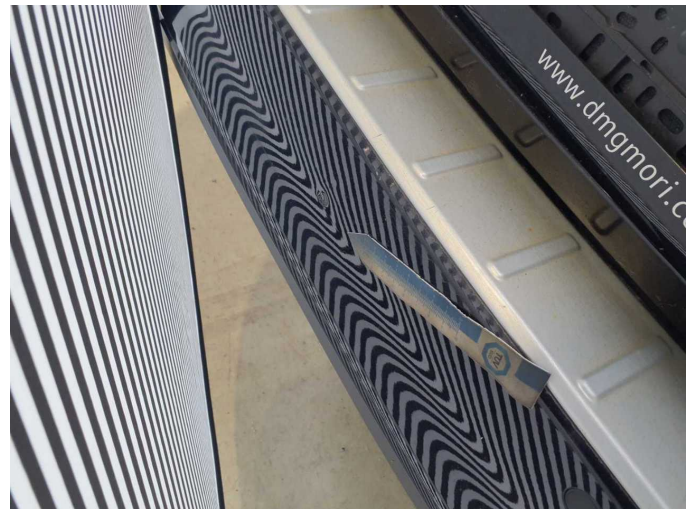

**Damage 18:** Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



**Damage 18:** Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



**Damage 18:** Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



**Damage 18:** Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




**Damage 19:** Bonnet: Bonnet - Corrosion - Repair and paint



**Damage 19:** Bonnet: Bonnet - Corrosion - Repair and paint



**Damage 19:** Bonnet: Bonnet - Corrosion - Repair and paint

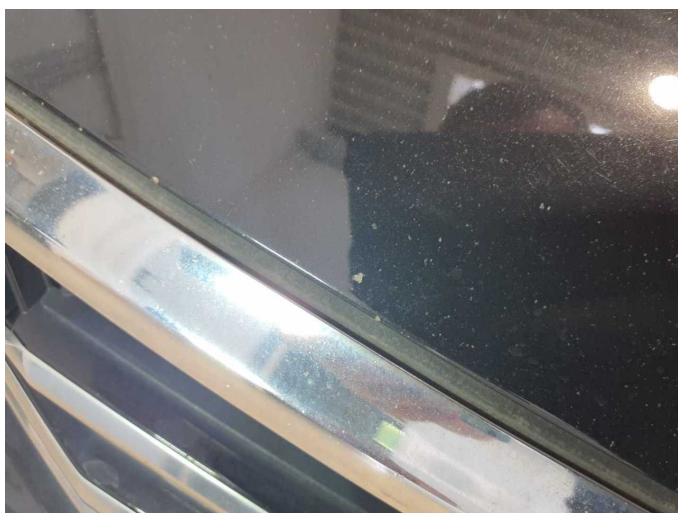

**Damage 19:** Bonnet: Bonnet - Corrosion - Repair and paint



**Damage 20:** Roof: Roof - Corrosion - Repair and paint




**Damage 20:** Roof: Roof - Corrosion - Repair and paint



**Damage 20:** Roof: Roof - Corrosion - Repair and paint




**Wear and tear 4:** Door - front right side: Door - dent(s) - No deduction

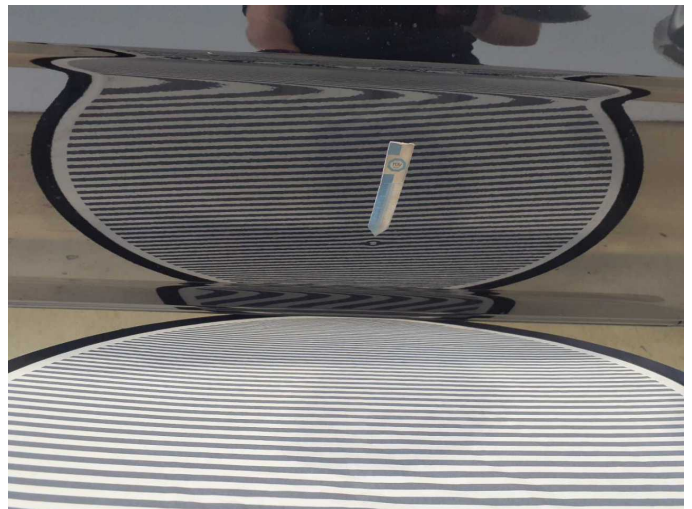

**Wear and tear 4:** Door - front right side: Door - dent(s) - No deduction



**Wear and tear 5:** Steering system: Steering wheel - Abrasion - No deduction

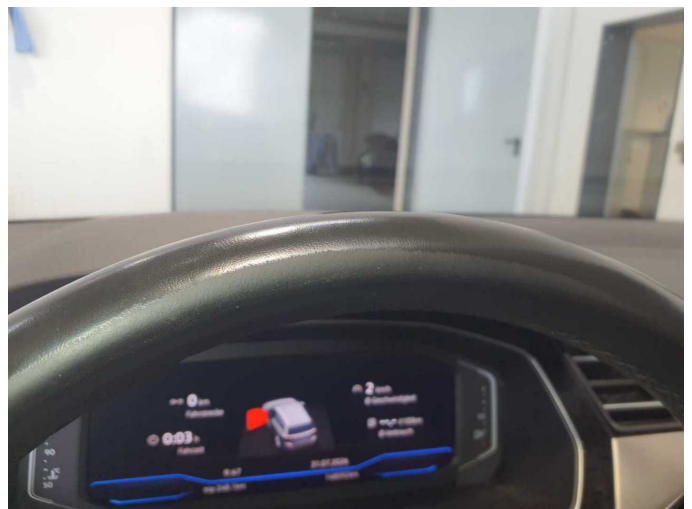

**Wear and tear 5:** Steering system: Steering wheel - Abrasion - No deduction



**Wear and tear 6:** Seat - front: Seat cover - left side - Scratch(es) - No deduction



**Wear and tear 6:** Seat - front: Seat cover - left side - Scratch(es) - No deduction



**Wear and tear 7:** Trim / covers: Door trim - rear left side - Scratch(es) - No deduction



**Wear and tear 7:** Trim / covers: Door trim - rear left side - Scratch(es) - No deduction



**Wear and tear 8:** Trim / covers: Door trim - rear right side - Scratch(es) - No deduction




**Wear and tear 8:** Trim / covers: Door trim - rear right side - Scratch(es) - No deduction



**Wear and tear 9:** Trim / covers: Door trim - front right side - Scratch(es) - No deduction



**Wear and tear 9:** Trim / covers: Door trim - front right side - Scratch(es) - No deduction

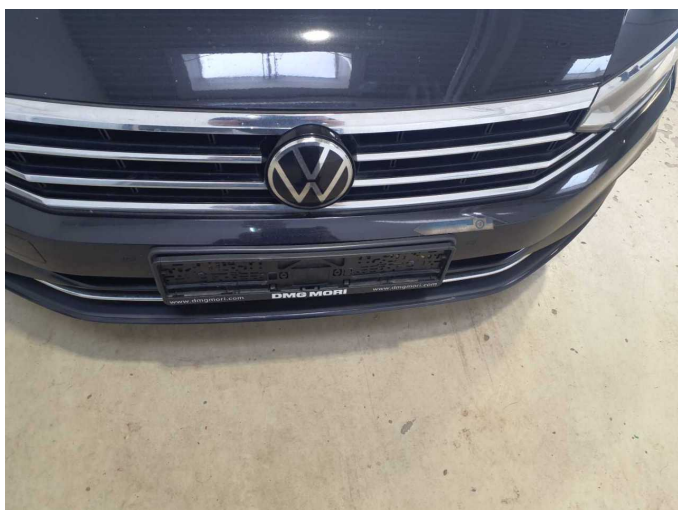

**Wear and tear 10:** Front bumper: Front bumper - Scratch(es) - No deduction



**Wear and tear 10:** Front bumper: Front bumper - Scratch(es) - No deduction



**Wear and tear 10:** Front bumper: Front bumper - Scratch(es) - No deduction



**Repainting 1:** Side panel - rear left side



**Repainting 1:** Side panel - rear left side