



PEUGEOT 5008: [redacted]

Vinnumber:	VF3MCYHZRLS088984	Versionname:	1.5 BlueHDi 96kW S&S EAT8 Allure
First Registrationdate:	27/02/2020	Fiscalpower:	
Expertise Mileage:	167591	Power Kw:	96
Bodytype:		Body colour:	Black
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:		Parking lot:	1724
Fueltype:	Diesel		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		

Options

Number of keys total	1	Seats electric F L	
Cruise Control		Luggage cover	
Steering wheel multifunctional		Front parking sensors	
Seats F heated		Rear parking sensors	
Radio multimedia		Type of Tow bar	No Tow bar
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Tyres

205/55/19/92 H				
Summer tyres:	Fr.L.	Semperit: 5 mm	Fr.R.	Semperit: 5 mm
	Re.L.	Semperit: 5 mm	Re.R.	Semperit: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				205/55 R 19 92 H
Tyre size FR				205/55 R 19 92 H
Tyre size RL				205/55 R 19 92 H
Tyre size RR				205/55 R 19 92 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				2477
Tyre make FR				2477
Tyre make RL				2477
Tyre make RR				2477

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT 2329,05

Ignition key, Missing, Replace 350,09



Seat cover FL, Damaged, Acceptable 0,00



Engine insulation, Damaged, Replace 0,00




Bonnet, Chemical pollution, Repair and paint (complete) 406,19




Windscreen, Scratch(es), Replace 0,00



Alloy rim RL polished, Scratch(es), Repair and paint (complete) 204,21

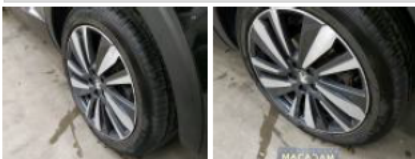

Wing RL, Bad repair, Check 0,00

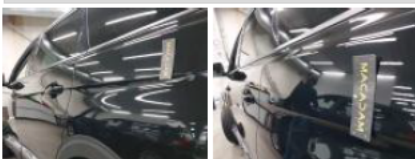

Door FL, Scratch(es), Spot repair 148,33



Alloy rim FL polished, Scratch(es), Repair and paint (complete) 204,21



Bumper moulding R, Scratch(es), Acceptable 0,00



Rear window, Scratch(es), Replace 0,00




Bumper trim R, Scratch(es), Acceptable 0,00



Alloy rim FR polished, Scratch(es), Repair and paint (complete) 204,21



Door FR, Scratch(es), Acceptable 0,00

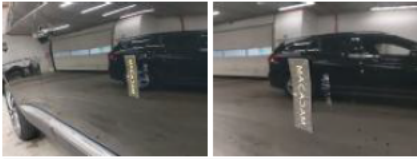

Door RR, Dent(s) and scratch(es), Repair and paint (complete) 445,79



Wing RR, Scratch(es), Acceptable 0,00



Alloy rim RR polished, Scratch(es), Repair and paint (complete) 204,21



Step R, Scratch(es), Repair and paint (complete) 161,81

