



Expertise

Protocol number: 46402139
Order No. / Reference: 26638780
Inspection date: 2 Jul 2026

Manufacturer: Opel
VIN: VXKUHZKWZP4289085

Model: Corsa-e



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Corsa-e	
Vehicle Identification number	VXKUHZKWZP4289085
Mileage (Read)	8,962 km
First registration	20 Jun 2024
Number of holders	1
Power / Engine displacement	62 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Kristall Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	-400 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HB397201
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	1889 / AHA 00006		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	1,897 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/55 R16 91H	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	195/55 R16 91H	Summer tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/55 R16 87H	Winter tyres on Steel rim with wheel cover	Fulda	8mm / 8mm
2)	195/55 R16 87H	Winter tyres on Steel rim with wheel cover	Fulda	8mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartments (storage compartment in the center console, front and rear cup holders in the center console; glove compartment; storage compartment in the front doors, suitable for 1.5-liter beverage bottles; storage compartment in the rear doors, suitable for 0.5-liter beverage bottles)
- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Hill Start Assist
- On-board computer
- third brake light
- Headliner, Grey
- Electronic brake force distribution (EBD)
- Driver information display 7", color (fully digital)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Pedestrian protection
- Intelligent speed control and limiter
- Transmission: Continuously variable direct drive
- Back window, heater
- rear window wiper
- Heating and ventilation system with pollen filter
- Child safety lock in the rear doors, manual
- automatic climate control
- Front headrests and 3 rear headrests, height adjustable
- LED headlights (LED daytime running lights - high beam assist - LED turn signals in exterior mirrors)
- Steering column adjustable for height and reach
- Front reading lights
- myOpel App, with Astra Electric specific functions (battery charge level indicator and range monitoring - remote control of climate control and charging settings)
- Onboard charger (7.4 kW/16 A, single-phase, vehicle-integrated charging unit)
- Electric parking brake
- Parkpilot, rear parking aid (with acoustic warning signal when reversing)
- Upholstery: Cloth
- Quickheat rapid heating system
- Radio: Digital radio reception DAB+
- Radio: Multimedia radio with 10" color touchscreen display (automatic music recognition (title, album, artist, cover) for audio devices with USB connection, Bluetooth audio streaming, hands-free calling via Bluetooth interface, phonebook and call list display, smartphone integration via Apple CarPlay, Android Auto, voice control (e.g., navigation (Google Maps, Apple Maps), music, phone, reading and dictating text messages), 1 USB port in the center console, steering wheel controls, dual tuner, graphic equalizer, 6 speakers)
- Seats: Passenger seat, 4-way manually adjustable (length and backrest angle)
- Adaptive brake light
- Airbag system (front airbags, driver and front passenger - side airbags, driver and front passenger - head airbags, front and rear outer (front and side airbag, front passenger, manually deactivatable))
- Active pedestrian warning tone (AVAS) (ambient noise up to a driving speed of 50 km/h)
- Electrically adjustable and heated exterior mirrors for driver and passenger side (manually foldable - exterior mirror housing in black)
- Roof design line, in black
- Decorative trim strip Akoya Grey/High-gloss black
- Electronic Stability Program Plus (ESP Plus)
- Driving modes: 3 adjustable (ECO, Normal and Sport)
- Front collision warning with automatic emergency braking and pedestrian detection (Active between 5 and 85 km/h, depending on the detected obstacle - Moving obstacle: 5-85 km/h - Stationary obstacle: 5-80 km/h - Pedestrian: 5-60 km/h. Monitors the distance to the vehicle ahead. If a collision is imminent, the braking system is prepared and, if necessary, emergency braking is initiated. At speeds below 30 km/h, the vehicle is braked to a complete stop. Above 30 km/h, the system reduces the impact speed by a maximum of 22 km/h.)
- Charging cable: Mode 3 charging cable (22 kW, 3-phase) for public charging, 6 meters long
- Steering wheel: Comfort steering wheel (flattened at the bottom)
- Make-up mirror, sun visor for driver and front passenger
- Driver fatigue detection (Based on steering behavior and driving time, it detects signs of possible driver fatigue and issues a visual and audible warning (3-stage warning).)
- OpelConnect with telematics services (Connect One: - Emergency call/breakdown call - Vehicle status and information - Route and trip information; Connect Plus: - Live Navigation (including real-time traffic information, fuel prices, POI search) - Remote Control (activating the headlights and horn, as well as locking and unlocking the vehicle remotely via the myOpel app) - e-Remote Control (remote charging and climate control via the myOpel app) - Free2Move eSolutions - e-ROUTES (navigation app) - ChatGPT (voice control))
- Keyless Start system
- Side impact protection
- Power steering (speed-dependent)
- Seat belt: Three-point seat belts in all seats (belt force limiter, front and rear outer seats; belt tensioner, front and rear outer seats; warning tone and light for unfastened seat belts, front and rear outer seats)
- Visibility equipment
- Seats: Driver's seat, 6-way manually adjustable (length, seat height and backrest angle)
- Seats: Rear seat backrest split 60:40 and foldable
- 12V power outlet in the center console, front
- Front bumper with sporty look



- Seats: Comfort seats, black
- Lane Keeping Assist (warning in case of unintentional lane departure (between 65 km/h and 180 km/h) via a warning light in the driver information display. The Lane Keeping Assist also alerts the driver by gently counter-steering, but does not continuously steer the vehicle.)
- Traffic sign recognition (recognition of speed limits and their cancellation, as well as display of the recognized sign in the driver information display (depending on visibility and weather conditions))
- Central locking with remote control

- Traction Control (TC) Plus (traction control with engine and brake intervention)
- Exterior door handles, in car color
- Ambient lighting
- Pre-installation for ISOFIX child seat mounting system (rear outer)
- heat pump
- Heat-insulating glazing, tinted
- Ignition keys (2) (one of which is foldable and has a radio remote control)

Extra equipment

- 16-inch steel winter wheel set 195/55 R 16 87H
- Onboard charger (vehicle-integrated charging unit, 3-phase (11 kW))
- Wheels: 6.5 J x 16 alloy wheels in 5-spoke diamond cut design, in high-gloss black, (195/55 R16 - low rolling resistance tires)

- Infotainment package
- Package: Comfort Package (Heated seats, multi-stage, driver and front passenger - Heated leather steering wheel - Center armrest with storage compartment, front - Comfort seat, 6-way adjustable for driver and front passenger)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Roof	Roof rail - left side - dent(s) - Smooth repair work
2	Door - front right side	Door - Scratch(es) - Smart repair
3	Misc.	Inspection / maintenance - Due - Perform

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 wheel cover - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Front bumper	Front bumper - Stone chips - No deduction
5	Sill - right side	Sill - Scratch(es) - No deduction
6	Side panel - rear right side	Side panel - dent(s) - No deduction
7	Boot lid / rear door	Boot lid - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

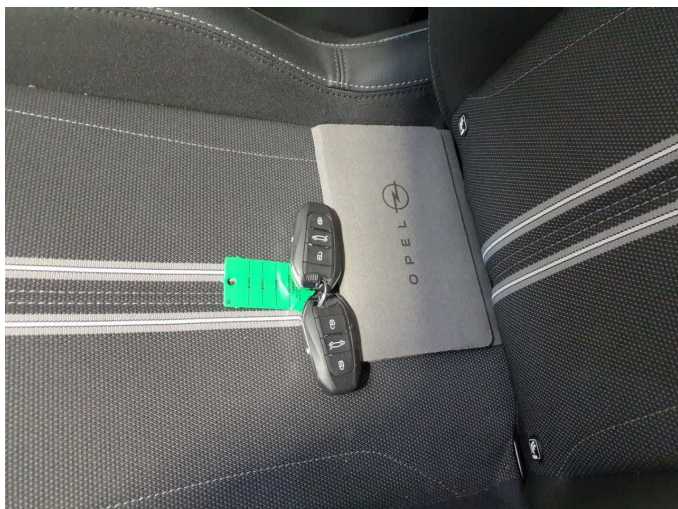


Figure 13: Documents



Figure 14: Additional tyres

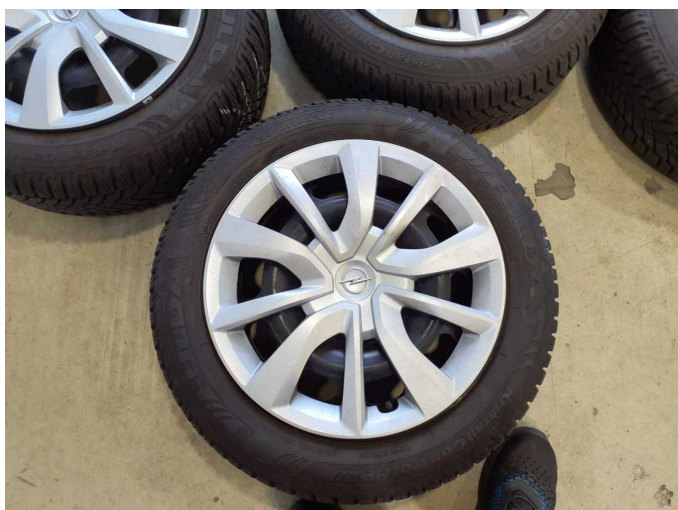


Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

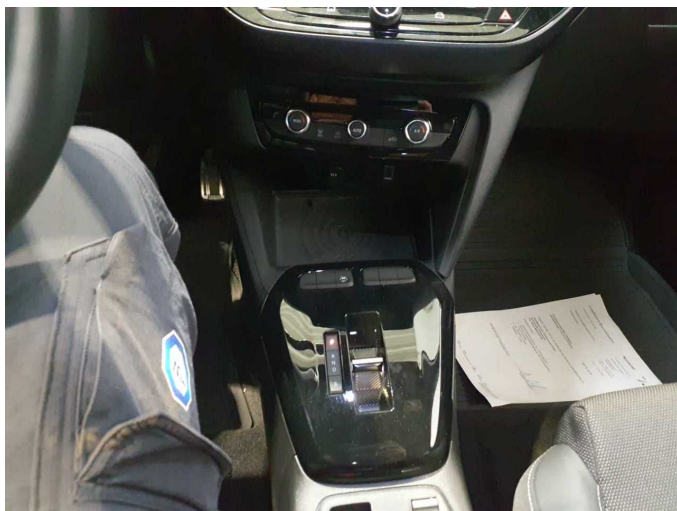


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

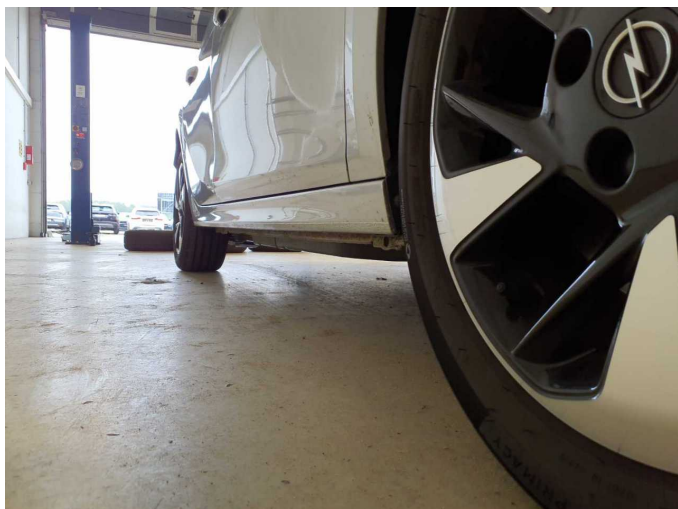


Figure 25: Misc.




Figure 26: Misc.




Figure 27: Misc.



Damage 1: Roof: Roof rail - left side - dent(s) - Smooth repair work

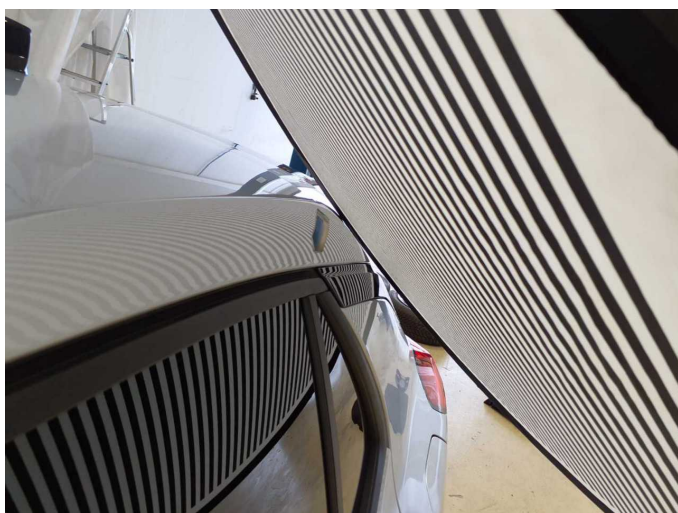


Damage 1: Roof: Roof rail - left side - dent(s) - Smooth repair work

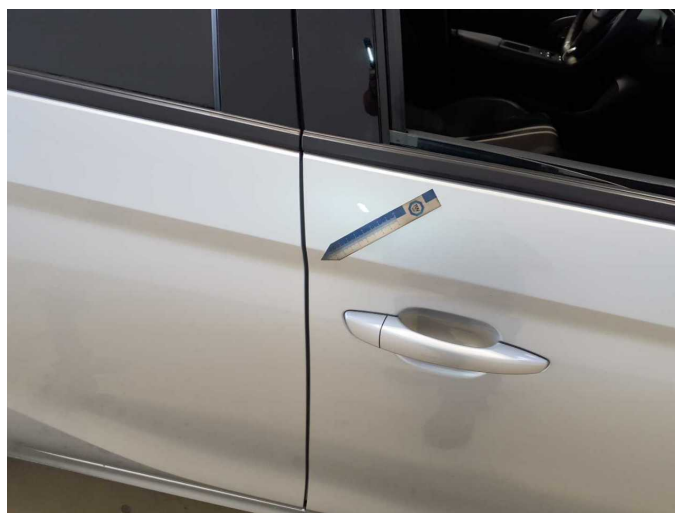

Damage 2: Door - front right side: Door - Scratch(es) - Smart repair



Damage 2: Door - front right side: Door - Scratch(es) - Smart repair

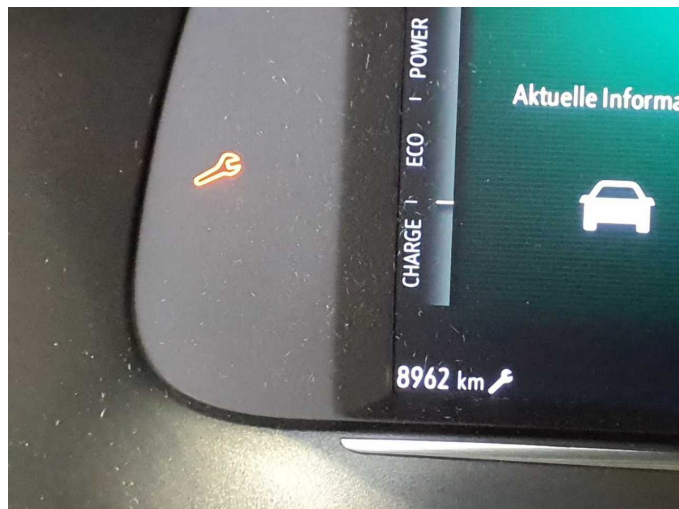


Damage 3: Misc.: Inspection / maintenance - Due - Perform



Wear and tear 6: Side panel - rear right side: Side panel - dent(s) - No deduction



Wear and tear 6: Side panel - rear right side: Side panel - dent(s) - No deduction

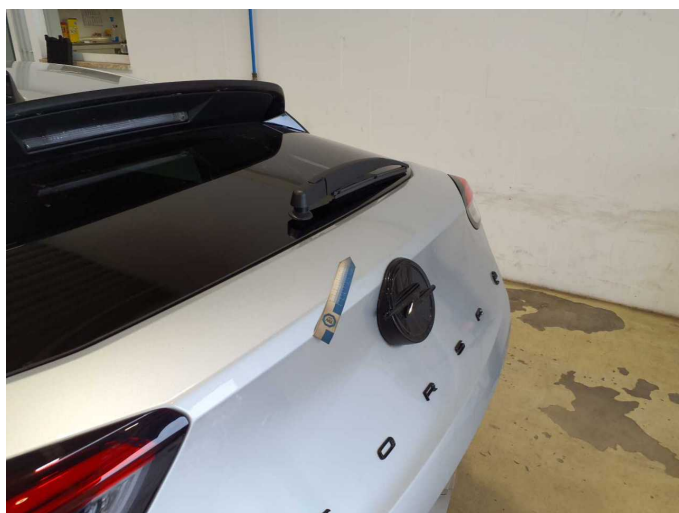

Wear and tear 7: Boot lid / rear door: Boot lid - dent(s) - No deduction



Wear and tear 7: Boot lid / rear door: Boot lid - dent(s) - No deduction