



Expertise

Protocol number: 46415259
Order No. / Reference: 26566699
Inspection date: 7 Jul 2026

Manufacturer: Volkswagen
VIN: WVGZZCDZNW508917

Model: Golf Variant 2.0 TDI SCR DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Golf Variant 2.0 TDI SCR DSG Style	
Vehicle Identification number	WVGZZCDZNW508917
Mileage (Read)	200,210 km
First registration	13 Oct 2021
Number of holders	1
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	oryxweiss perlmutteffekt (0K1)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details			
Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	-1,500 km
Last service on / at	03/2026 at 192,000 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF289883
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CNN 00699		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,060 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/40 R18 92Y	Summer tyres on Light alloy	Pirelli	3mm / 3mm
2)	225/40 R18 92Y	Summer tyres on Light alloy	Pirelli	3mm / 3mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91H	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	205/55 R16 91H	Winter tyres on Light alloy	Goodyear	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- 2 USB-C ports on the front
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Ambient lighting 30-color (LED light in the front footwell, light color selectable)
- Adaptive Cruise Control ACC "stop & go" (Adaptive Cruise Control ACC incl. speed limiter - Emergency braking assistant "Front Assist" with pedestrian and cyclist detection)
- Exterior mirror housings and door handles in body color
- Car2X (Using the WLANp ITS G5 standard, all Car2X-enabled vehicles and traffic systems such as traffic lights can transmit data at high speed without using the mobile network. This works over a distance of around 800 meters - enough to warn of an invisible traffic jam.)
- Digital Cockpit Pro, multicolor (various info profiles selectable)
- Electronic differential lock XDS
- Electronic stability program and electromechanical brake booster (Anti-lock braking system with brake assist - Electronic brake force distribution - Traction control - Electronic differential lock - Engine drag torque control - Trailer stabilization)
- Windscreen made of laminated safety glass, heat and sound insulating
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- Rear spoiler in car color
- Air conditioning system "Air Care Climatronic" (with active combination filter, rear controls and 3-zone temperature control)
- Paint finish: Solid
- LED Plus headlights (LED headlights for low and high beam - dynamic headlight range control - bad weather light and cornering light)
- Steering wheel: Multifunction leather steering wheel with paddle shifters
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection (detects critical distance situations to other vehicles and helps to shorten the stopping distance - warns the driver visually and audibly in dangerous situations as well as with a preventive braking jolt with pedestrian and cyclist detection - also reacts to pedestrians and cyclists)
- Tire pressure monitoring system (passive)
- Wheels: Alloy wheels (4) "Nottingham" 7.5 J x 17 (tires 225/45 R17)
- Rear bench seat undivided, backrest asymmetrically split and foldable with center armrest
- Electromechanical power steering (speed-dependent control)
- Seat belts: Three-point automatic seat belts for the outer rear seats
- 2 USB charging ports on the rear of the center console
- Airbag: Head airbag system for front and rear passengers including front side airbags
- App-Connect (selected apps for Android smartphones and Apple iPhones can be displayed and operated on the touchscreen of the radio or navigation system)
- Electrically adjustable and heated exterior mirrors with memory function and passenger-side mirror lowering function.
- third brake light
- Chrome strip at the bottom of the side windows
- black roof rails
- Decorative inlays "New Brushed Dark Metal" (for instrument panel and front door panels)
- Diesel particulate filter and SCR catalyst
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Electronic parking brake including auto-hold function
- Driving assistant "Travel Assist" and lane keeping assistant "Lane Assist"
- Automatic headlight control, with LED daytime running lights (as well as welcome and farewell lights)
- Electric windows, front and rear
- Pedestrian protection measures expanded
- luggage compartment cover
- Rear window heated
- Rear window wiper with intermittent function
- ISOFIX mounting points (for child seats on the outer rear seats and on the front passenger seat, i-Size compatible)
- Rear headrests (3)
- Front headrests (safety-optimized)
- LED reading lights at the front (2) and 2 at the rear
- LED taillights
- Illuminated strip between headlights and door handle recesses
- Front center armrest adjustable in height and length
- Fatigue detection (detects signs of possible driver fatigue based on characteristic steering behavior, time of day and driving duration and issues a visual and audible warning)
- Emergency call service (no registration required, service is activated upon delivery)
- Radio "Composition" (touchscreen with 21 cm screen diagonal - 4+1 speakers - output power 4 x 20 watts - FM radio reception - dual tuner with phase diversity for the best possible radio reception - Radio Data System (RDS) - MP3 playback - USB-C interface with Apple compatibility - DAB+ digital radio reception - telephone interface (hands-free system, Bluetooth audio))
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Keyless start system without safe locking
- Seat belts: Three-point automatic seat belt for the middle rear seat
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner



- Seats: ergoActive seat with 14-way adjustment and memory function on the driver's side (driver's seat with electric adjustment, memory function and sliding thigh support - lumbar support in the front, electrically adjustable on the driver's side, massage function on the driver's side - sport comfort seats in the front, center panels of the front seats and outer rear seats in microfleece "ArtVelours")
- Textile floor mats front and rear
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote folding keys

Extra equipment

- Easy Open & Close - tailgate with sensor-controlled opening and closing, with remote unlocking
- Keyless locking and starting system "Keyless Access" with safe locking mechanism
- Package: IQ.DRIVE package including "Emergency Assist" (Adaptive Cruise Control ACC "stop & go", with speed limiter - Electrically folding/adjustable exterior mirrors with memory function, separately heated - Driving assistant "Travel Assist", lane keeping assistant "Lane Assist" and "Emergency Assist" - Multifunction camera - Parking assistant "Park Assist" including parking aid - Lane change assistant "Side Assist")
- Package: Winter (DSG) (Multifunction steering wheel in leather, heated, with shift paddles - Windscreen washer nozzles automatically heated - Front seats heated)
- Paint finish: Pearlescent effect
- Power outlet in the luggage compartment, 230 V
- Radio accessories: "Harman Kardon" sound system (8+1 speakers, 480 watts total power, 12-channel amplifier, subwoofer)
- Rear side windows and rear window tinted
- Rear View reversing camera
- Towbar, foldable with electric release
- Wheels: Alloy wheels (4) "Bergamo" 7.5 J x 18 (in black, polished surface - with individual installation - wheel locks with enhanced theft protection - tires 225/40 R 18)

- Seats: Sport comfort seats in the front (center panels of the front seats and outer rear seats in microfleece "ArtVelours")
- Start-stop system (with brake energy recuperation)
- 12-volt power outlet in the luggage compartment
- Bumpers in body color
- Telephone interface with inductive charging function
- Ambient lighting with logo projection
- Green thermal insulation glazing, sides and rear
- Anti-theft alarm system "Plus" (anti-theft alarm system with interior monitoring, backup horn and tow-away protection - keyless start system "Keyless Start" with safe locking)
- Lane change assistant "Side Assist", parking assistant and exit warning (alerts the driver with visual signals in the respective exterior mirror to vehicles that could pose a danger when changing lanes - Parking assistant: monitors the area behind and beside the vehicle when reversing out of a parking space, issues visual and acoustic warning signals if a vehicle is detected crossing the parking space path, can initiate emergency braking to reduce the severity of a collision or to prevent a collision altogether)
- Navigation system "Discover Pro" incl. "Streaming & Internet" (6+1 speakers - App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Navigation system "Discover Pro" incl. "Streaming & Internet" - Radio - Voice control - Traffic sign recognition)
- Package: Light and Sight Package incl. High Beam Control "Light Assist" (High Beam Control "Light Assist" - Automatically Dimming Interior Mirror - Multifunction Camera - Rain Sensor)
- Panoramic tilt/slide sunroof (2 LED reading lights at the front and 2 at the rear)
- Progressive steering (the steering ratio is progressively increased with increasing steering angle - the steering behavior becomes noticeably more direct depending on the driving situation, the steering wheel movements are significantly reduced and thus steering comfort is increased)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Seat - front	armrests - Soiled - Clean
2	Trim / covers	Trim / covers (Tirefit) - Missing - Replace
3	Equipment	Tirefit filler - Expired - Replace
4	Wing mirror - left side	Cap - Scratch(es) - Smart repair
5	Wheel / tyres	Pressure sensor - on - Perform diagnosis
6	Front bumper	Front bumper - Scratch(es) - Smart repair
7	Rear bumper	Rear bumper - Scratch(es) - Smart repair
8	Boot lid / rear door	Boot lid - Paint defect - Smart repair
9	Roof	Roof rail - right side - Corrosion - Smart repair
10	Roof	Roof - Corrosion - Smart repair
11	Misc.	Inspection / maintenance - Due - Perform
12	Sill - left side	Sill (Farbabweichung) - Unprofessionally repaired - Paint
13	Sill - right side	Sill - Deformed - Repair and paint
14	Door - rear left side	Door (Klarlackläufer) - Unprofessionally repaired - Paint
15	Mudguard - right side	Mudguard - right side - Deformed - Replace
16	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
17	Mudguard - left side	Mudguard - left side - Dent / paintcoat damage - Repair and paint
18	Wheel / tyres	Wheel rims - complete set - Scratched - Replace

Wear and tear

No.	Component group	Description
1	2nd wheel set	2 alloy rims - Scratched - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side - left, Provided by user / customer, from 30 Mar 2024	13.611,15 €

Repainting

No.	Repainting
1	Side panel - rear left side, Door - rear left side, Door - front left side, Unprofessionally carried out, Invoice of repair done Non-existent

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

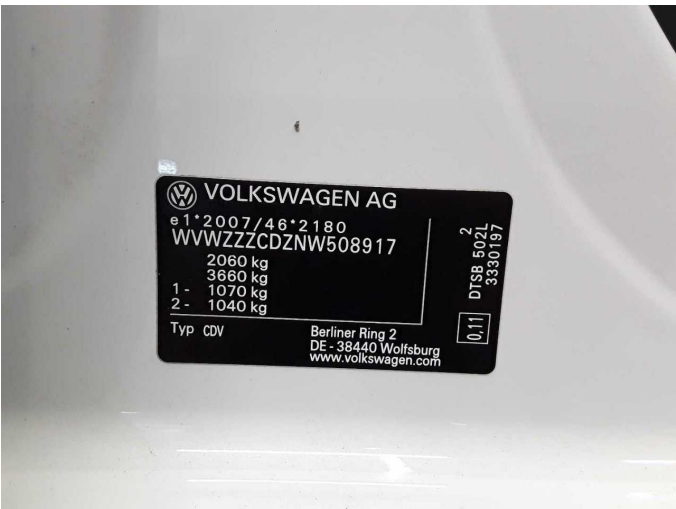


Figure 11: VIN



Figure 12: Mounted tyres

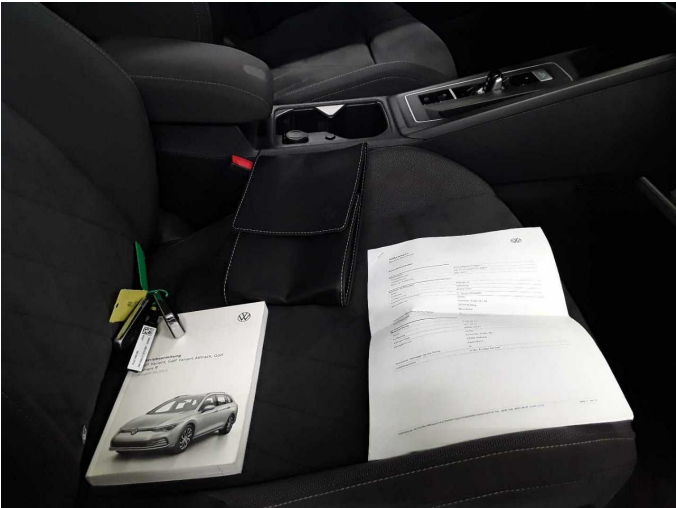


Figure 13: Documents

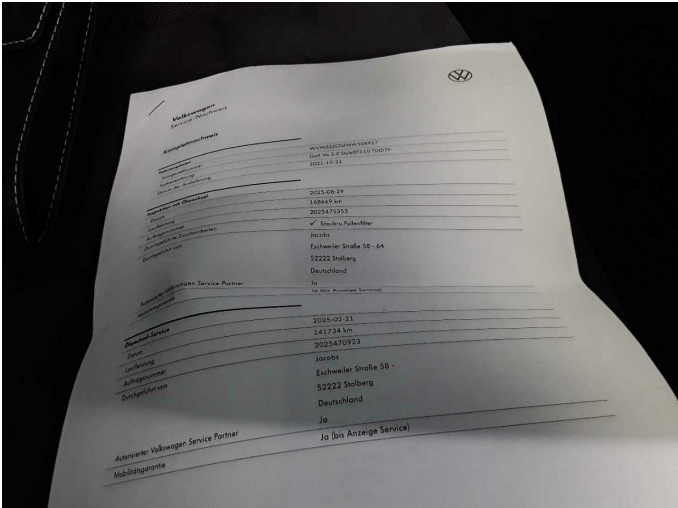


Figure 14: Documents

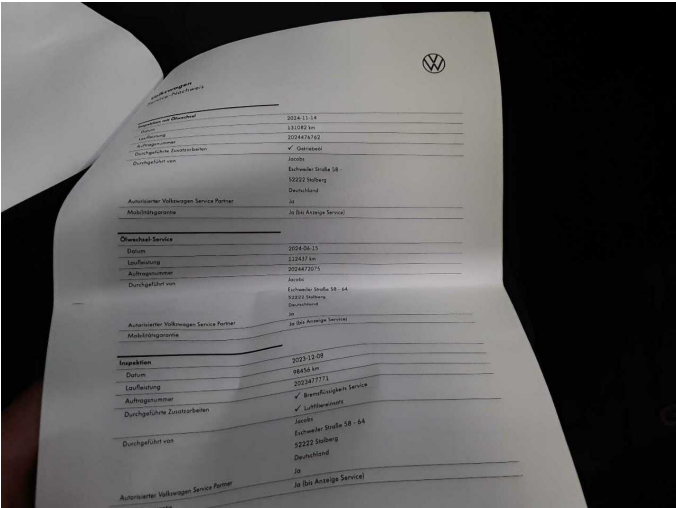


Figure 15: Documents

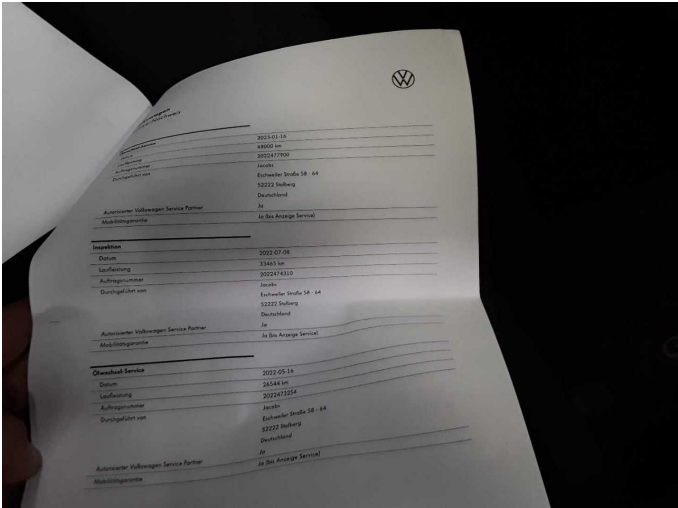


Figure 16: Documents

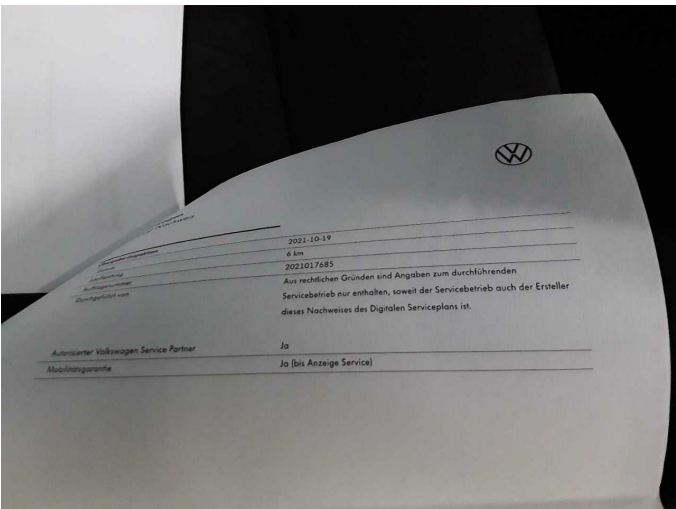


Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

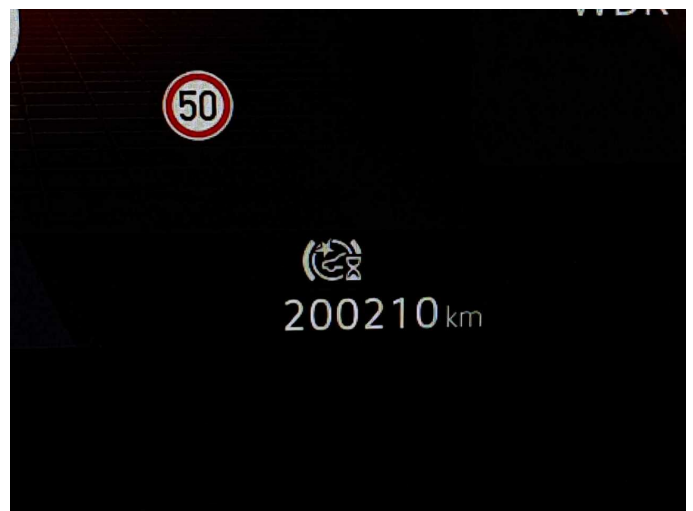


Figure 30: Misc.



Figure 31: Misc.


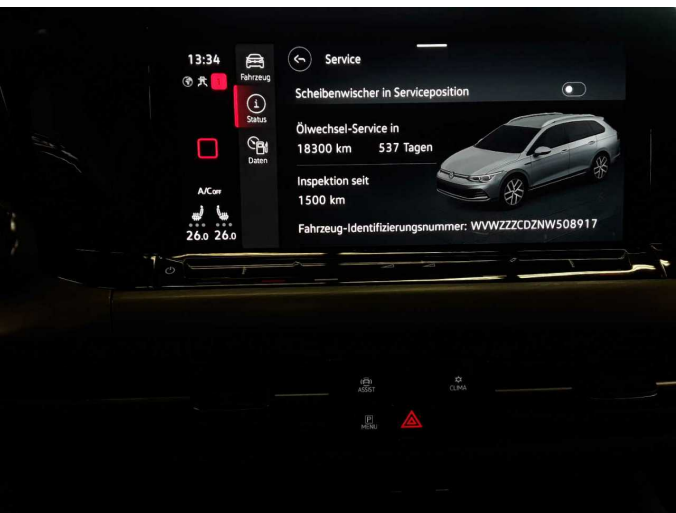


Figure 32: Misc.




Damage 1: Seat - front: armrests - Soiled - Clean

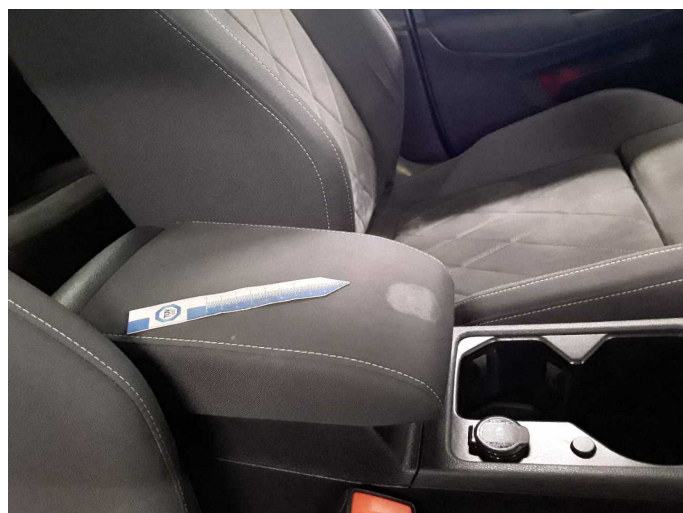

Damage 1: Seat - front: armrests - Soiled - Clean



Damage 2: Trim / covers: Trim / covers (Tirefit) - Missing - Replace

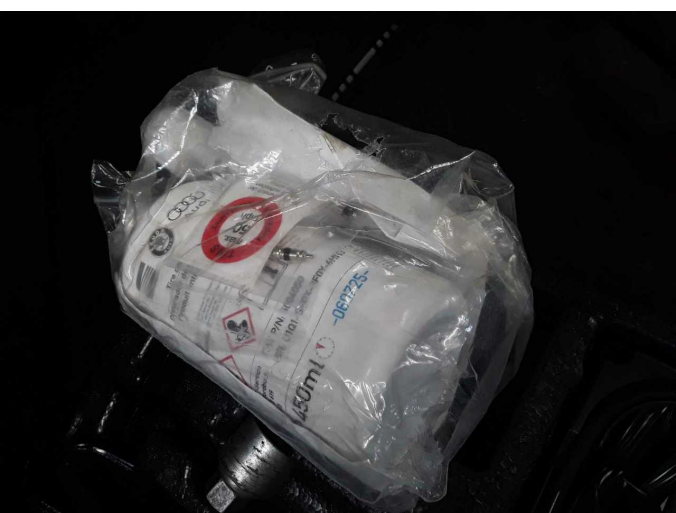


Damage 3: Equipment: Tirefit filler - Expired - Replace



Damage 4: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 4: Wing mirror - left side: Cap - Scratch(es) - Smart repair

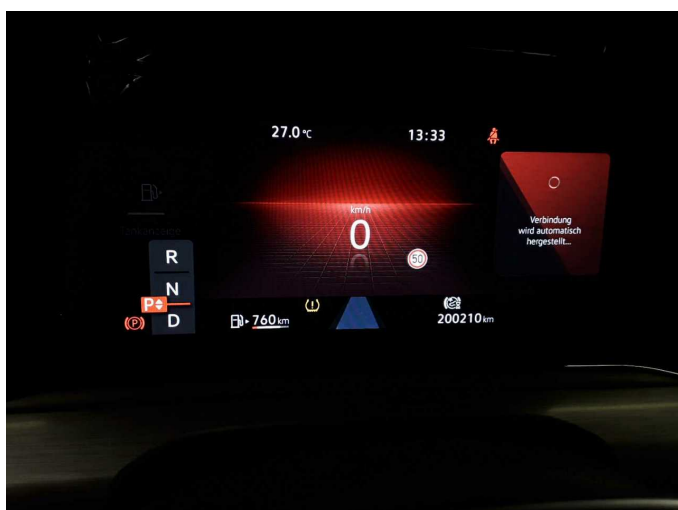


Damage 5: Wheel / tyres: Pressure sensor - on - Perform diagnosis



Damage 6: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 6: Front bumper: Front bumper - Scratch(es) - Smart repair

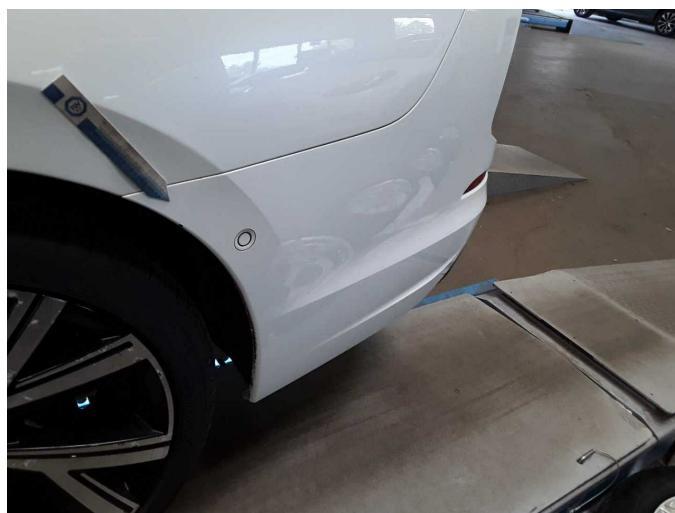

Damage 7: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 7: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 8: Boot lid / rear door: Boot lid - Paint defect - Smart repair



Damage 8: Boot lid / rear door: Boot lid - Paint defect - Smart repair




Damage 9: Roof: Roof rail - right side - Corrosion - Smart repair



Damage 9: Roof: Roof rail - right side - Corrosion - Smart repair



Damage 10: Roof: Roof - Corrosion - Smart repair

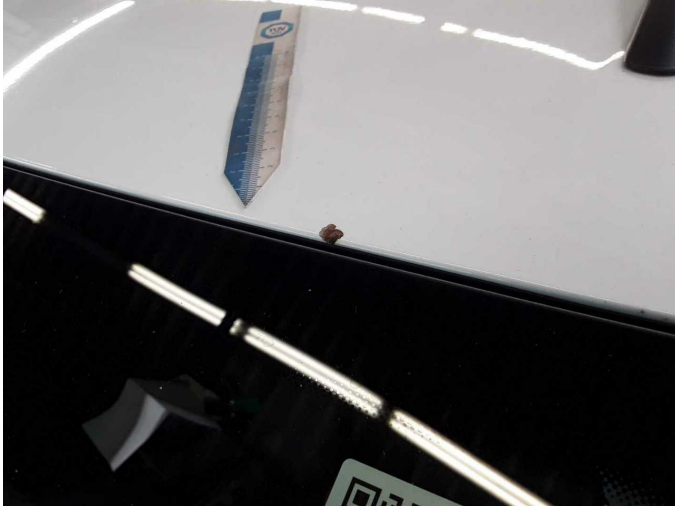

Damage 10: Roof: Roof - Corrosion - Smart repair



Damage 11: Misc.: Inspection / maintenance - Due - Perform



Damage 12: Sill - left side: Sill (Farbabweichung) - Unprofessionally repaired - Paint



Damage 12: Sill - left side: Sill (Farbabweichung) - Unprofessionally repaired - Paint



Damage 12: Sill - left side: Sill (Farbabweichung) - Unprofessionally repaired - Paint



Damage 12: Sill - left side: Sill (Farbabweichung) - Unprofessionally repaired - Paint



Damage 13: Sill - right side: Sill - Deformed - Repair and paint



Damage 13: Sill - right side: Sill - Deformed - Repair and paint



Damage 13: Sill - right side: Sill - Deformed - Repair and paint



Damage 13: Sill - right side: Sill - Deformed - Repair and paint



Damage 13: Sill - right side: Sill - Deformed - Repair and paint




Damage 13: Sill - right side: Sill - Deformed - Repair and paint



Damage 14: Door - rear left side: Door (Klarlackläufer) - Unprofessionally repaired - Paint



Damage 14: Door - rear left side: Door (Klarlackläufer) - Unprofessionally repaired - Paint

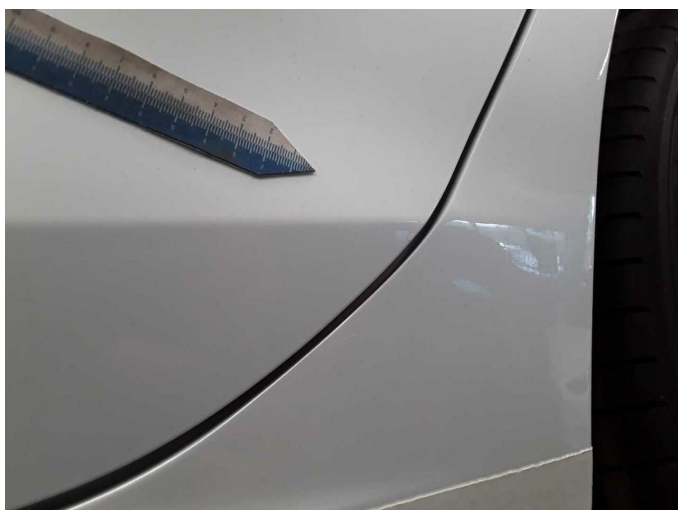

Damage 14: Door - rear left side: Door (Klarlackläufer) - Unprofessionally repaired - Paint




Damage 15: Mudguard - right side: Mudguard - right side - Deformed - Replace



Damage 15: Mudguard - right side: Mudguard - right side - Deformed - Replace



Damage 16: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

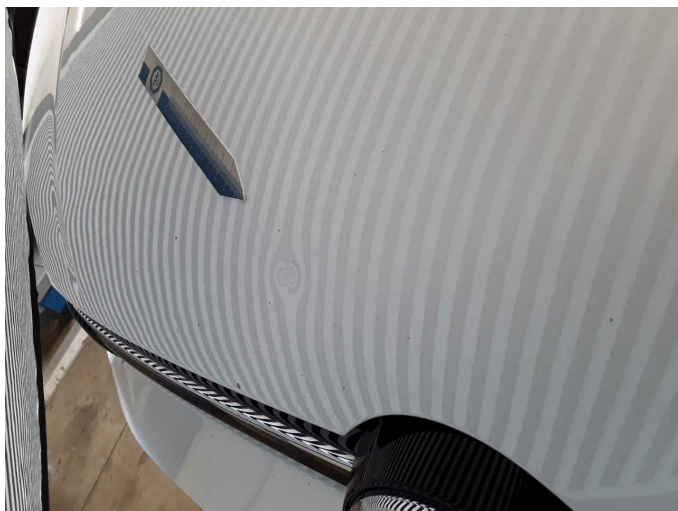


Damage 16: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 16: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 17: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint

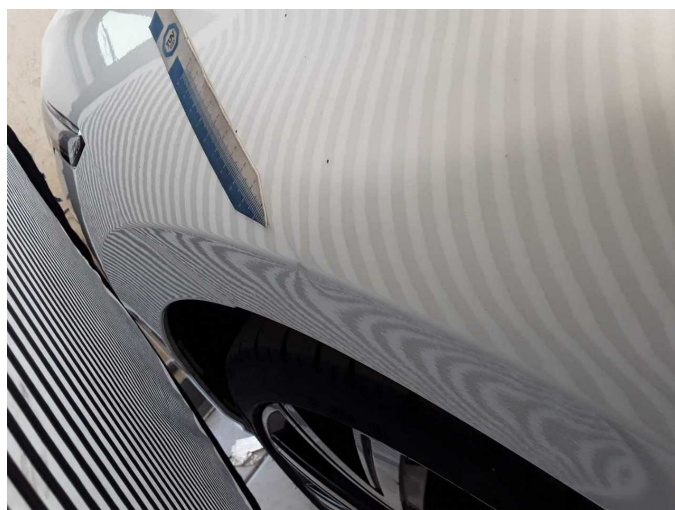

Damage 17: Mudguard - left side: Mudguard - left side - Dent / paintcoat damage - Repair and paint



Damage 18: Wheel / tyres: Wheel rims - complete set - Scratched - Replace



Damage 18: Wheel / tyres: Wheel rims - complete set - Scratched - Replace



Damage 18: Wheel / tyres: Wheel rims - complete set - Scratched - Replace



Damage 18: Wheel / tyres: Wheel rims - complete set - Scratched - Replace



Damage 18: Wheel / tyres: Wheel rims - complete set - Scratched - Replace



Damage 18: Wheel / tyres: Wheel rims - complete set - Scratched - Replace



Damage 18: Wheel / tyres: Wheel rims - complete set - Scratched - Replace



Damage 18: Wheel / tyres: Wheel rims - complete set - Scratched - Replace



Damage 18: Wheel / tyres: Wheel rims - complete set - Scratched - Replace



Repainting 1: Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Side panel - rear left side, Door - rear left side, Door - front left side



Repainting 1: Side panel - rear left side, Door - rear left side, Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZCDZNW508917

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Golf Variant 2.0 TDI SCR DSG
Style

Datum	KM-Stand	Beschreibung
23.03.2026	192.000	Bremsflüssigkeit; Bremsflüssigkeit ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
29.08.2025	168.669	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
30.05.2025	151.197	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne
21.02.2025	141.734	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
26.11.2024	131.082	Batterie ern; Systemtest/Eigendiagnose
19.11.2024	131.082	Getriebeöl ern/prüfen; Regelwartungsdienst; Wartung Sonstiges
20.06.2024	112.437	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
08.12.2023	98.456	Bremsflüssigkeit; Bremsflüssigkeit ern; Luftfiltereinsatz ern; Regelwartungsdienst; Wartung Sonstiges
31.07.2023	82.018	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
24.04.2023	64.500	Regelwartungsdienst
19.01.2023	47.982	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
08.07.2022	33.465	Regelwartungsdienst
16.05.2022	26.544	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges