


2-DRE-514




2-DRE-514 · ST-line 125pk 92kw mHEV M6 Clipper · 28 July 2026 · Zaventem (BE)

Specifications

License Plate Number	2-DRE-514	Fuel Type	Hybrid Gasoline
Manufacturer	FORD	VIN	WF0PXXGCHPPL84295
Model	Focus	Cylinder Capacity	999 ^{cm3}
Model Versions	ST-line 125pk 92kw mHEV M6 Clipper	Transmission Type	Handmatig geschakelde transmissie
		First Admission	02-06-2023
Body Type	5 door hatchback	Odometer	86.981 ^{Km}
Color	Blue	Numer Of Keys	2
Paint Type	Metallic	Interior	Black
Production Year	2023	Number Headrests	5
KW	92		

Images

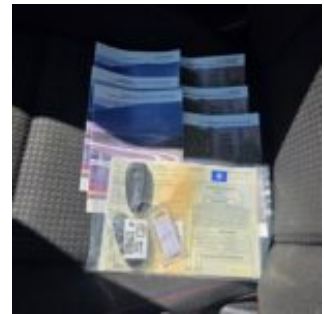

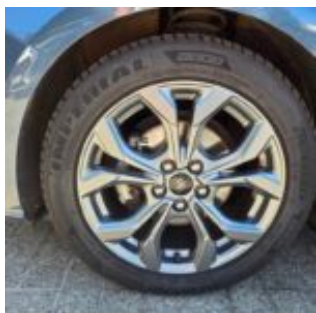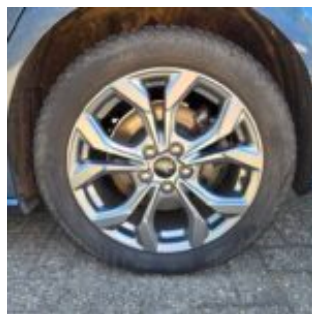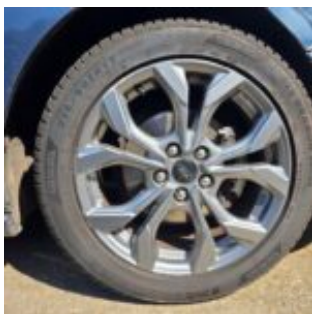

Accessories

ABS

Airbags

Alloy wheels

Audio System

Automatic air conditioning

Bluetooth car kit

Central door locking

Centre armrest

Cruise control

Electric rear windows

Electric windows front

Electrically adjustable exterior mirrors

Front & rear parking sensors

Leather steering wheel

Navigation system

Roller cover / parcel shelf

Seat heating

Steering wheel multifunction

Steeringwheel - Heated

Windscreen - Heated

Condition

Condition exterior

Adequate

Maintenance Remarks

Bandenspanning controleren

Condition interior

Adequate

Previous Repairs

Unknown

Last Maintenance Unknown

Tire Specifications

Tire	Profile	Brand	Width	Aspect Ratio	Radial	Type
Front Left	5 ^{mm}	Imperial	215 ^{mm}	50 ^{mm}	17 ^{inch}	All Season
Rear Left	4 ^{mm}	Goodyear	215 ^{mm}	50 ^{mm}	17 ^{inch}	All Season
Front Right	5 ^{mm}	Imperial	215 ^{mm}	50 ^{mm}	17 ^{inch}	All Season
Rear Right	4 ^{mm}	Goodyear	215 ^{mm}	50 ^{mm}	17 ^{inch}	All Season
Spare Tire Type	Compressor					

Damages



Damage Part
Skirt - Right



Damage Type
Scratch(es)



Repair Type
Spray

Acceptable
No



Damage Part
Frontdoor - Right



Damage Type
Dent(s) & Scratch(es)




Repair Type
Panelbeating & Spray

Acceptable
No



Damage Part
Fender - Front Right

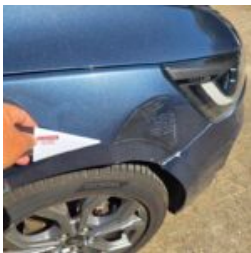

Damage Type
Dent(s) & Scratch(es)



Repair Type
Panelbeating & Spray

Acceptable
No



Damage Part
Bumper - Front





Damage Type
Dent(s) & Scratch(es)



Repair Type
Panelbeating & Spray

Acceptable
No

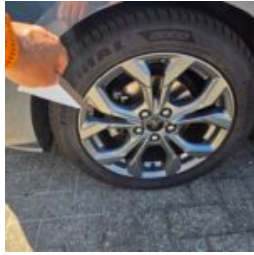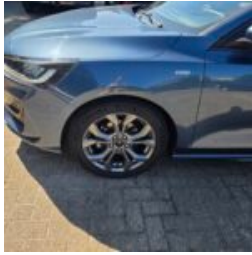

Damage Part	Damage Type	Repair Type	Acceptable
Alloy – Left Front	Damaged	Rim repair	No



Damage Part	Damage Type	Repair Type	Acceptable
Frontdoor – Left	small dents / small scratches	Acceptable	Yes



Damage Part	Damage Type	Repair Type	Acceptable
Bumper – Rear	Scratch(es)	Spray	No



Damage Part	Damage Type	Repair Type	Acceptable
Tailgate	small dents / small scratches	Panelbeating & Spray	No