



Expertise

Protocol number: 46495036
Order No. / Reference: 26587836
Inspection date: 10 Jul 2026

Manufacturer: Opel	Model: Grandland 1.5 D Automatik Business Elegance
VIN: W0VZCYHZ2N6833504	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Grandland 1.5 D Automatik Business Elegance	
Vehicle Identification number	W0VZCYHZ2N6833504
Mileage (Read)	70,585 km
First registration	24 Oct 2022
Number of holders	1
Power / Engine displacement	96 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Topas Blau
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	18,400 km
Last service on / at	10/2025 at 59,075 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GN194983
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AHG 00221		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,000 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	225/55 R18 102V	Summer tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Falken	4mm / 4mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Falken	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 03/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 2 ignition keys, both foldable
- Storage compartments (storage compartment in the instrument panel, driver's side - storage compartment in the center console, front - storage compartment in the front doors, suitable for 1.5-liter beverage bottles - storage compartment in the rear doors, suitable for 1.0-liter beverage bottles - illuminated glove compartment with cooling and heating function - bag hooks, on the side in the luggage compartment - lashing eyes in the luggage compartment)
- Exterior mirrors, electrically adjustable and heated, electrically folding (exterior mirror housing in black)
- Roof design line in chrome
- Diesel particulate filter with SCR and oxidation catalyst
- Electric parking brake
- Electronic Stability Program Plus (ESP Plus)
- Forward Collision Warning (monitors the distance (close, medium, far) to the vehicle ahead; if the vehicle approaches a vehicle ahead or a pedestrian too quickly, a warning tone is sounded and a message appears in the driver information display. - with automatic emergency braking and pedestrian detection - Lane Keeping Assist: warns if the vehicle unintentionally leaves its lane - Traffic Sign Recognition - Driver Drowsiness Detection)
- Interior rearview mirror, automatically dimming
- IntelliLux LED Pixel Matrix Light (Adaptive LED matrix headlights with individual light distribution and the following functions: - City light - Highway light - Country road light - Static cornering light - Turning light - Parking function light - High beam: traffic-dependent dimming taking into account preceding and oncoming road users - Automatic headlight range control - Fog lights)
- LED headlights (LED taillights - LED front turn signals - manual headlight range control - high beam assist)
- Illuminated makeup mirror in sun visor, for driver and front passenger
- Quickheat heating system
- Radio accessories: Digital radio reception DAB+ (Offers a wider selection of radio programs. Digitally broadcast radio stations and traffic information can be received.)
- Rain sensor
- Tire pressure warning
- Wheels: Light alloy 7.5 J x 18 with 5 double spokes in BiColor/Black (with tires 225/55 R 18)
- Wheels: Tire repair kit (with tire sealant and 12-volt compressor (without jack))
- Speed-sensitive power steering
- Seat belts (three-point seat belts in all seats - height-adjustable seat belts, front - belt force limiters, front and rear outer seats - double belt tensioners, front - belt tensioners, rear outer seats - warning tone and light for unfastened seat belts, front and rear)
- Seats: Rear seat backrest split 40:60 and foldable
- Solar Protect heat-insulating glazing (heavily tinted, in the rear)
- Start/Stop System (Reinforced starter motor - High-performance battery - Switch to deactivate the start/stop function)
- 230V equipment (230V socket on the center console, rear - 12V socket in the luggage compartment)
- Driver and passenger side airbags
- Airbag: Front and side airbags
- Airbag: Head airbags, front and rear outer
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Automatic activation of the hazard warning lights (and unlocking of the doors after deployment of the airbag and seatbelt tensioner)
- Hill Start Assist
- On-board computer
- Decorative strips, Erino/Palladium Medium
- Tachometer
- Electronic brake force distribution (EBD)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Luggage compartment cover
- Cruise control with intelligent speed limiter (The intelligent speed limiter, in conjunction with traffic sign recognition, allows for rapid speed adjustment)
- Transmission: 8-speed automatic
- Rear window wiper
- Interior lighting, front and rear (with reading lights front and rear - luggage compartment lighting)
- Child safety lock in the rear doors, manual
- Dual-zone automatic climate control including rear footwell heating (with separate temperature control for driver and front passenger - manual recirculation - automatic air distribution - sun sensor - particle and odor filter)
- Rear headrests (3), height adjustable
- Front headrests, height adjustable
- Leather steering wheel including remote control
- Steering wheel, height and reach adjustable
- Center armrest, sliding, front, including storage compartment and cup holder
- Radio: Multimedia Navi Pro (with 10" color touchscreen display and voice control for audio, telephone and navigation - Navigation: with integrated memory, European road map, 3D map display, dynamic route guidance via map and/or arrow display, GPS module - Display and readout of emails - USB interfaces - High-gloss black shark fin antenna - Bluetooth audio streaming - Hands-free system - Smartphone integration, Apple CarPlay, Android Auto - Radio)
- Reversing camera (without parking pilot, front and rear parking aid, and parking sensors)
- Seats: Ergonomic active seat with AGR seal of approval, driver (length, height and backrest angle manually adjustable - seat tilt electrically adjustable - lumbar support electropneumatically adjustable in height and length - extendable thigh support, manually adjustable - pocket on front seat back - all seats in fabric/premium leather look, black)



- Bumpers and side panels in high-gloss black
- Pre-wiring for ISOFIX child seat mounting system, including top tether attachment points, rear outer (and for ISOFIX child seat mounting system on the front passenger seat)

- Lane departure warning (warning in case of unintentional lane departure from 60 km/h via warning tone and indicator light in the driver information display)
- 12-volt power outlet (in the center console, front)
- Phone: Wireless Charging
- Immobiliser
- Central locking with remote control and interior switches

Extra equipment

- Detachable trailer hitch (trailer stability program)
- Paint finish: Metallic special color
- Forward Collision Warning (monitors the distance (close, medium, far) to the vehicle ahead; if the vehicle approaches a vehicle ahead or a pedestrian too quickly, a warning tone sounds and a message appears in the driver information display. - with automatic emergency braking and pedestrian detection - Lane Keeping Assist: warns if the vehicle unintentionally leaves its lane - Traffic Sign Recognition - Driver Drowsiness Detection - Automatic Speed Assist with Stop&Go function - Automatic Headlights)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Roof	Roof - dent(s) - Smooth repair work
2	Bonnet	Bonnet - Stone chips - Loss in value
3	Wheel / tyres	Tyre - front right side - Broken / torn - Replace
4	Door - front left side	Door - Scratch(es) - Loss in value
5	Door - front right side	Door - Stone chips - Loss in value
6	Front bumper	Front bumper - dent(s) - Smart repair
7	Front bumper	Spoiler - Scratch(es) - Replace
8	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
9	Rear bumper	Rear bumper (Matt und einschlässe) - Paint defect - Repair and paint

Wear and tear

No.	Component group	Description
1	2nd wheel set	Tyres - complete set (Über 4mm) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No.	Repainting
1	Bumper rear, Unprofessionally carried out, Invoice of repair done Non-existent



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Keine Besichtigung des Unterbodens, Begutachtung
Fahrwerk/Achsen/Aggregate nur bedingt möglich, Zusatzkosten können entstehen.
- Der beiliegende Winterradsatz ist kein Bestandteil des
Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

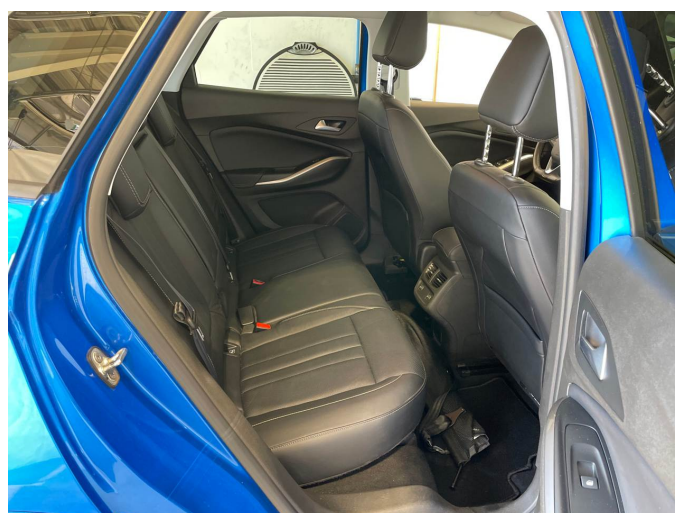


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

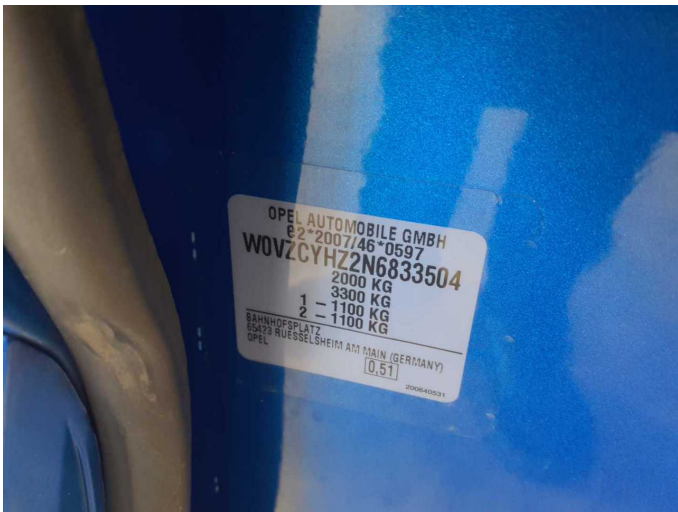


Figure 11: VIN

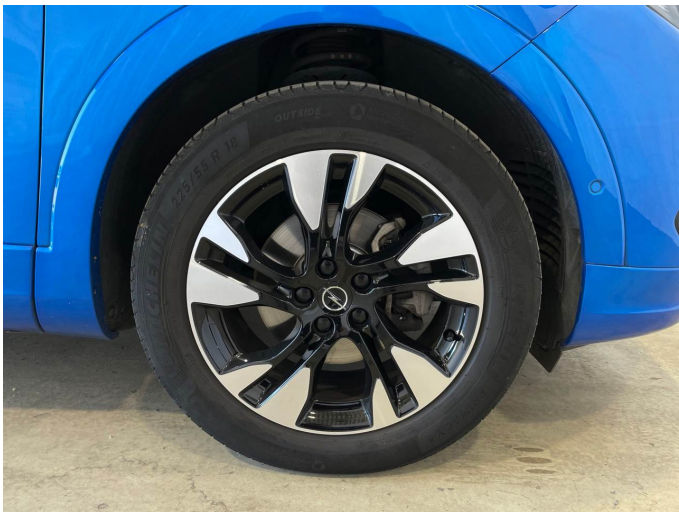


Figure 12: Mounted tyres



Figure 13: Documents

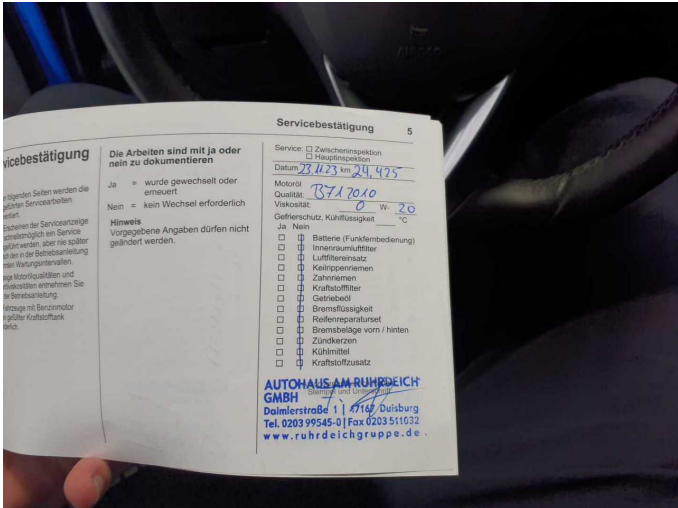


Figure 14: Documents

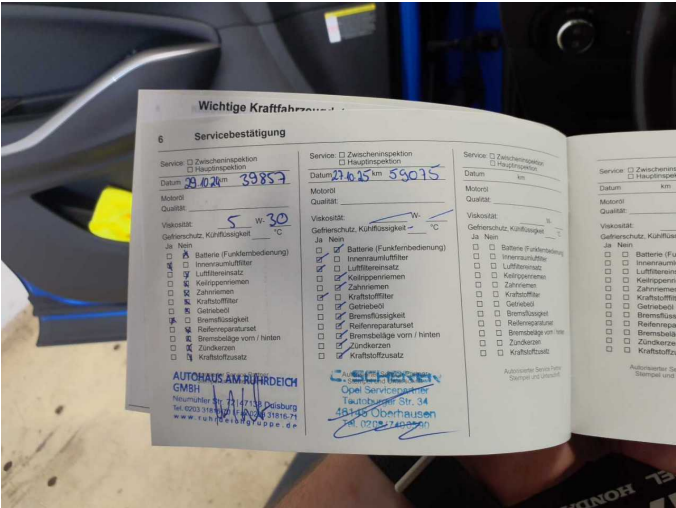


Figure 15: Documents



Figure 16: Additional tyres

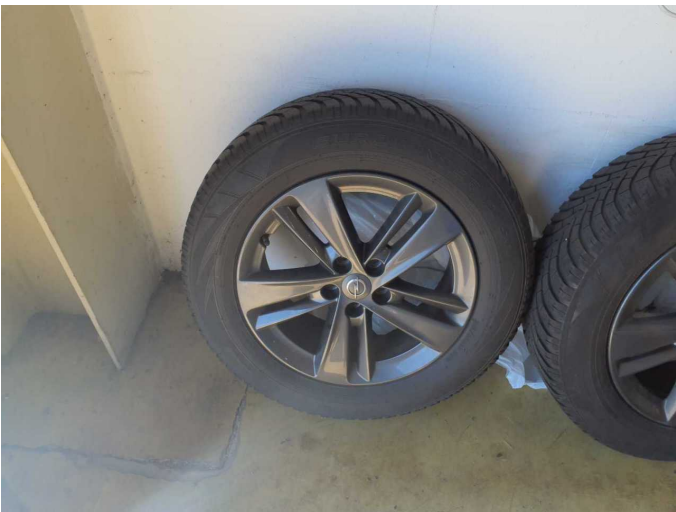


Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

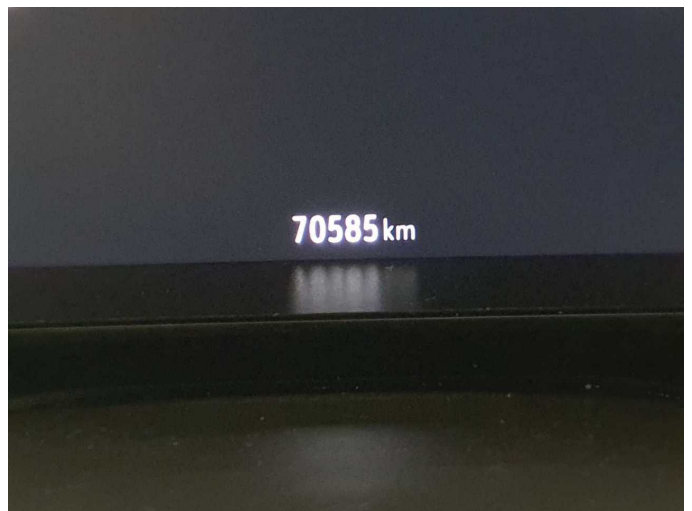


Figure 22: Misc.

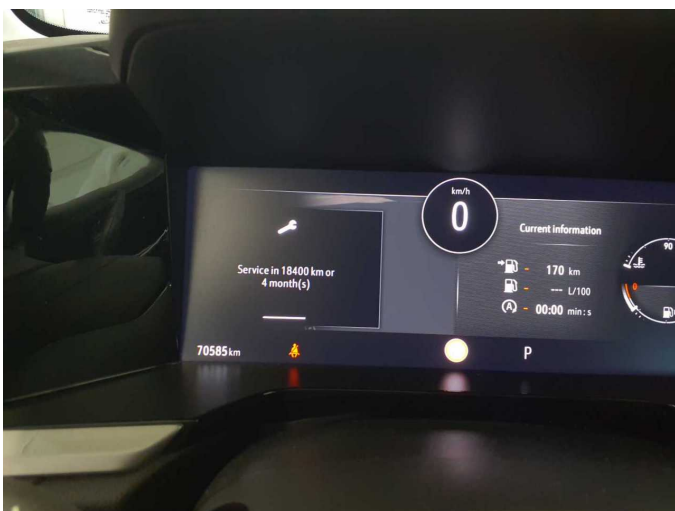


Figure 23: Misc.

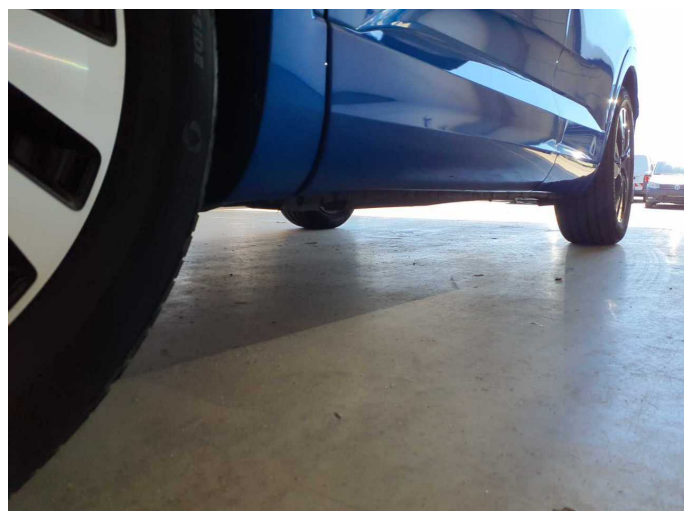


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

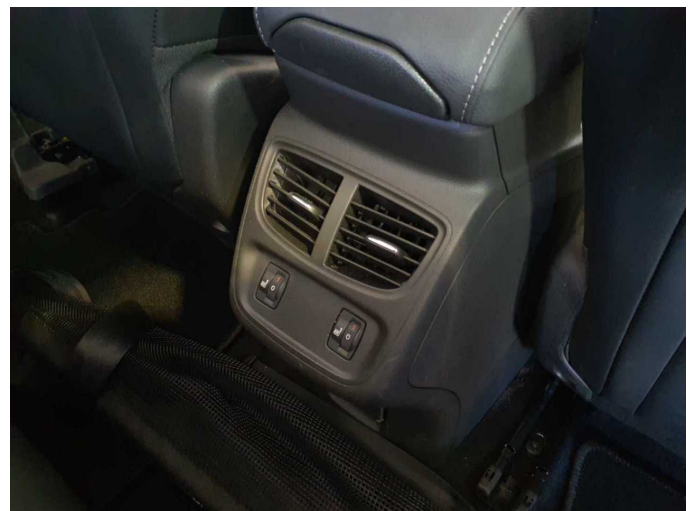


Figure 28: Misc.



Figure 29: Misc.

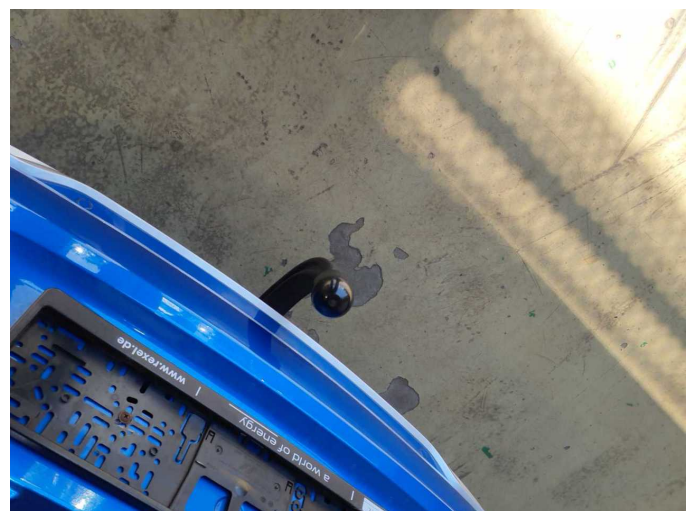


Figure 30: Misc.

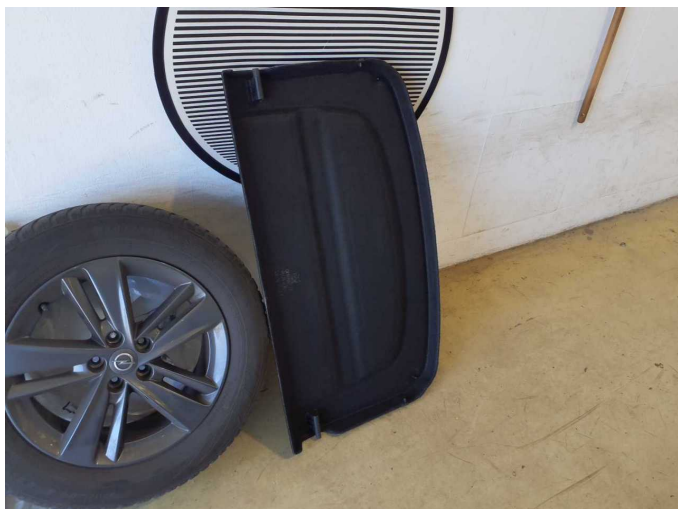



Figure 31: Misc.



Damage 1: Roof: Roof - dent(s) - Smooth repair work




Damage 1: Roof: Roof - dent(s) - Smooth repair work

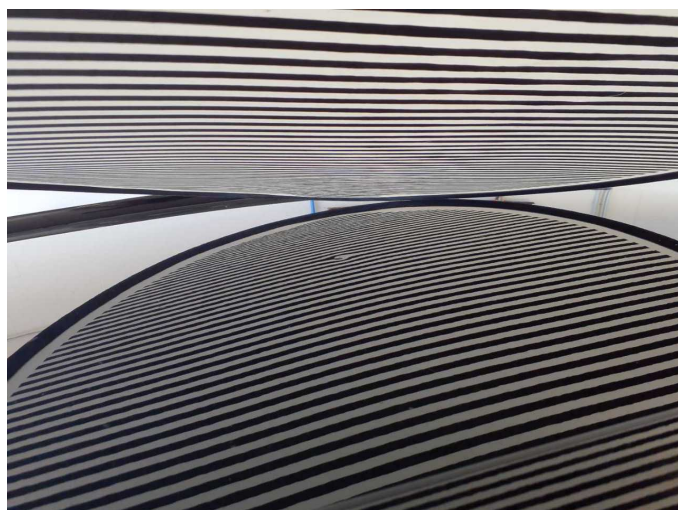

Damage 1: Roof: Roof - dent(s) - Smooth repair work



Damage 2: Bonnet: Bonnet - Stone chips - Loss in value

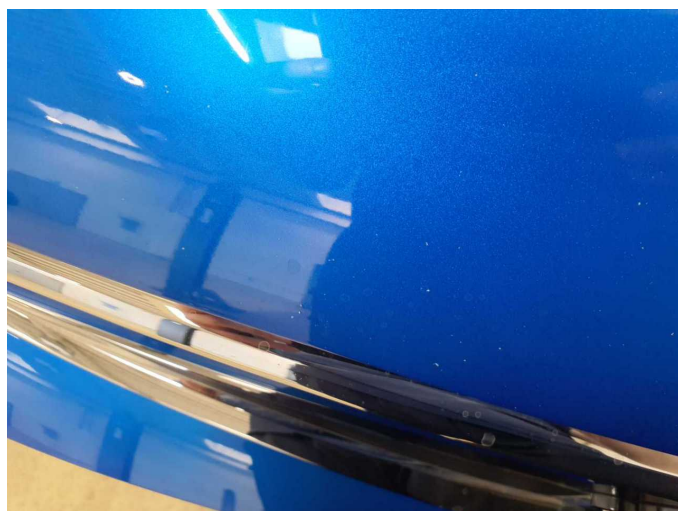

Damage 2: Bonnet: Bonnet - Stone chips - Loss in value



Damage 2: Bonnet: Bonnet - Stone chips - Loss in value




Damage 3: Wheel / tyres: Tyre - front right side - Broken / torn - Replace




Damage 3: Wheel / tyres: Tyre - front right side - Broken / torn - Replace



Damage 3: Wheel / tyres: Tyre - front right side - Broken / torn - Replace

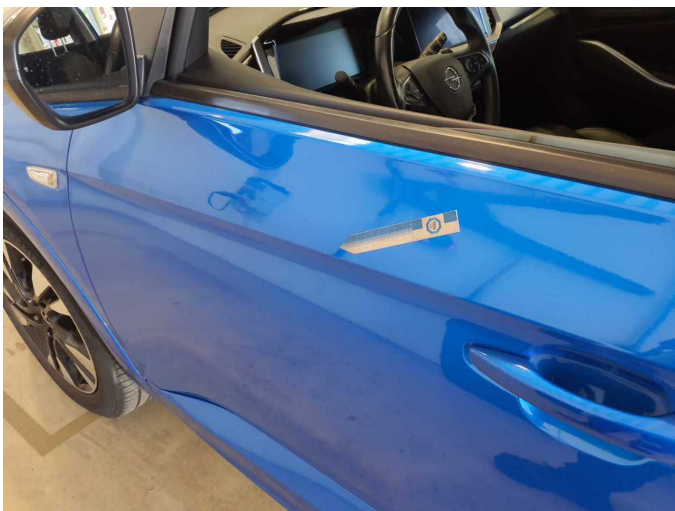


Damage 4: Door - front left side: Door - Scratch(es) - Loss in value

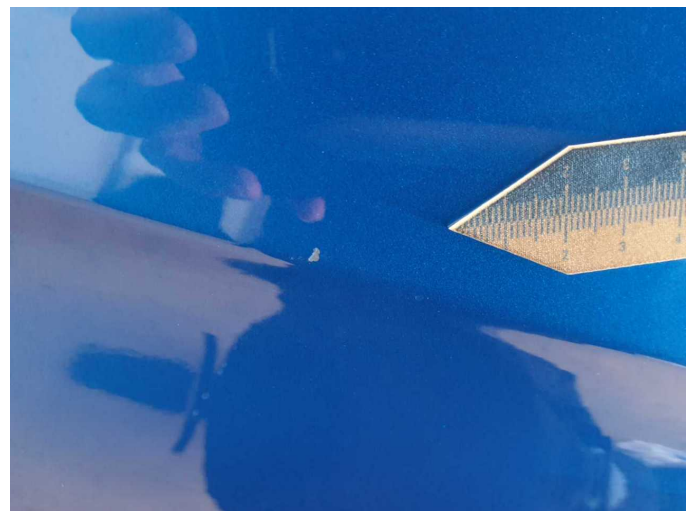


Damage 4: Door - front left side: Door - Scratch(es) - Loss in value



Damage 5: Door - front right side: Door - Stone chips - Loss in value

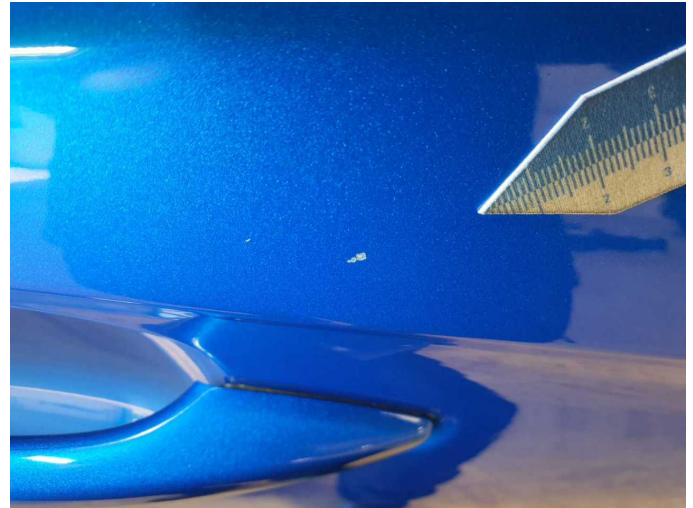


Damage 5: Door - front right side: Door - Stone chips - Loss in value

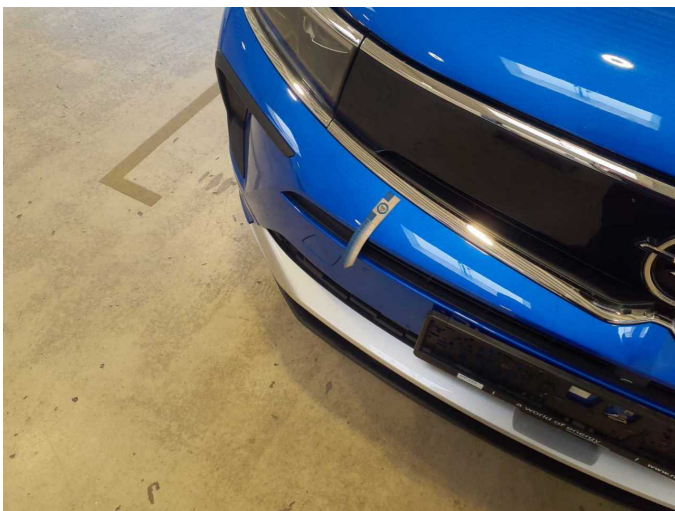

Damage 6: Front bumper: Front bumper - dent(s) - Smart repair



Damage 6: Front bumper: Front bumper - dent(s) - Smart repair

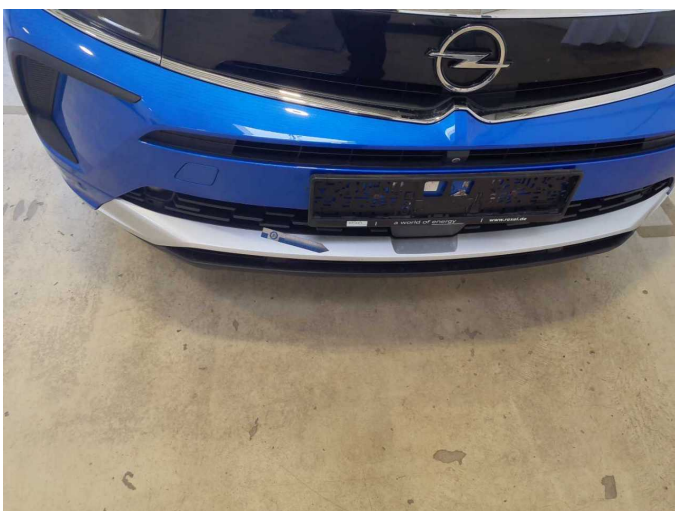


Damage 7: Front bumper: Spoiler - Scratch(es) - Replace




Damage 7: Front bumper: Spoiler - Scratch(es) - Replace




Damage 7: Front bumper: Spoiler - Scratch(es) - Replace

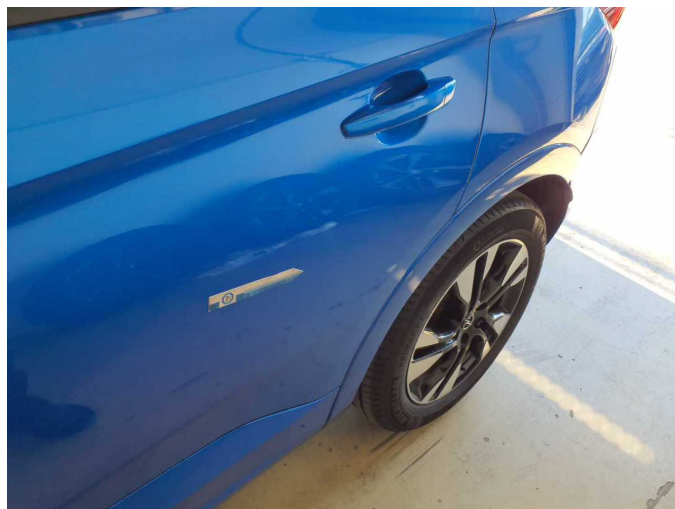


Damage 8: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

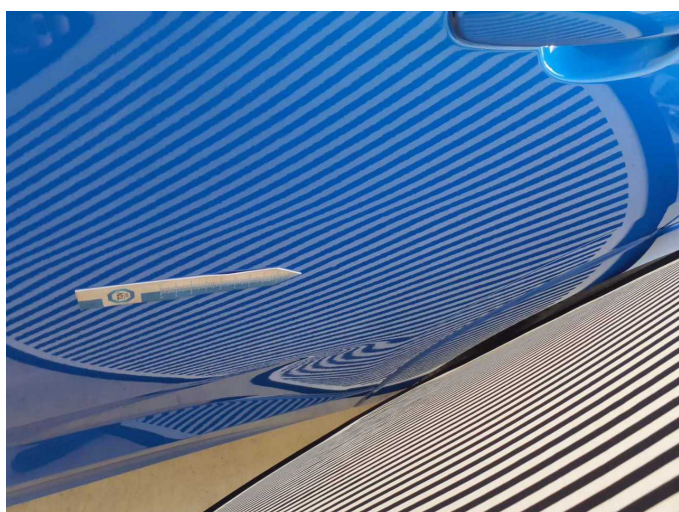


Damage 8: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

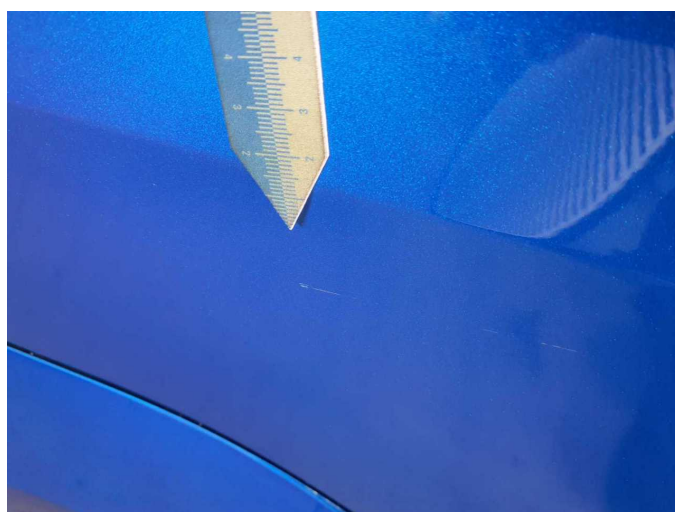


Damage 8: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

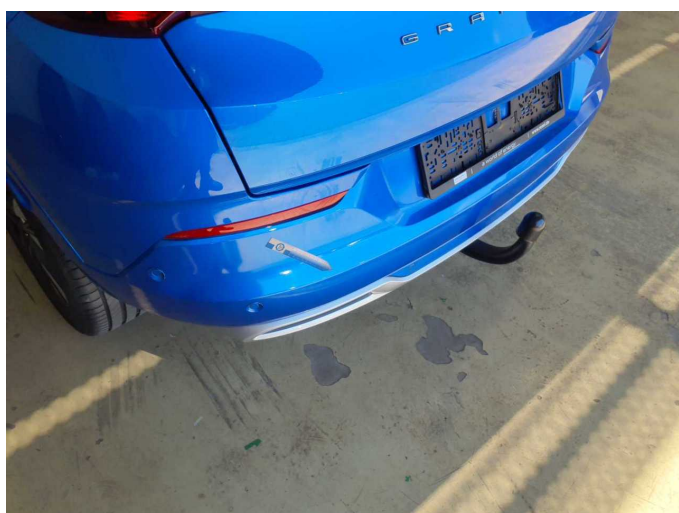

Damage 9: Rear bumper: Rear bumper (Matt und einschüsse) - Paint defect - Repair and paint

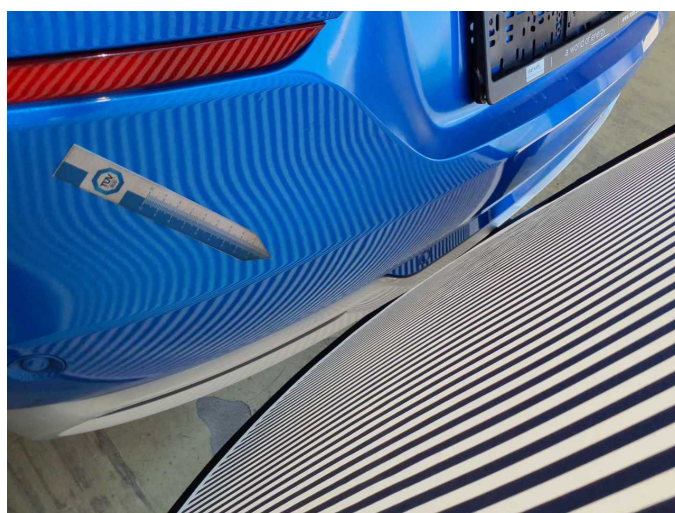

Damage 9: Rear bumper: Rear bumper (Matt und einschüsse) - Paint defect - Repair and paint

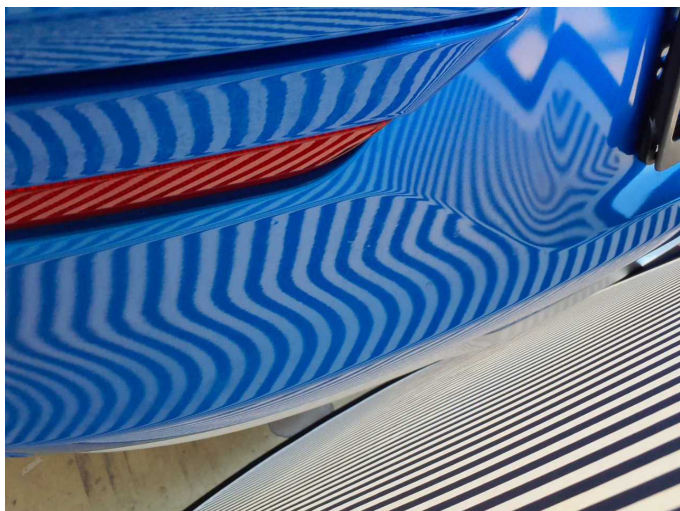

Damage 9: Rear bumper: Rear bumper (Matt und einschüsse) - Paint defect - Repair and paint