



Expertise

Protocol number: 46456371
Order No. / Reference: 26661862
Inspection date: 10 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1N9M0BBXPN033409

Model: EQB 250 Progressive



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz EQB 250 Progressive	
Vehicle Identification number	W1N9M0BBXPN033409
Mileage (Read)	110,154 km
First registration	20 Mar 2023
Number of holders	1
Next periodical technical inspection	05/2028
(Report on hand)	
Power / Engine displacement	111 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Iridiumsilber metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	301 Tag(e)
Last service on / at	05/2026 at 106,472 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ150126
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BFC 00029		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,520 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 103T	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	235/50 R19 103T	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R18 102T	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	215/60 R18 102T	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartment in center console with roller blind
- Airbag: Driver and passenger side
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Active Lane Keeping Assist
- Ambient lighting in 64 colors
- Rear armrest
- Trim strips for the sills and window lines in polished aluminum
- Third brake light in LED technology
- EASY-PACK tailgate
- Electric windows, front and rear
- Velour floor mats in black
- Speed Limit Assistant
- Rear window heated
- Black fabric headliner
- Communication module (LTE) for the use of Mercedes me connect services
- Charging system: Direct current charging system (DC charging)
- LED High Performance Headlights
- Steering wheel: Multifunction sports steering wheel in leather
- Navigation accessories: Extended MBUX functions
- Navigation accessories: Pre-installation for remote and navigation services
- Package: Cargo space
- Package: Seating comfort
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Remote and Charging Services Premium
- Windscreen wipers with rain sensor
- Seats: 4-way lumbar support for driver
- Seats: Rear seat backrests foldable
- TIREFIT with tire inflation compressor
- Immobiliser
- Decorative elements spiral look
- Adaptive Highbeam Assist
- Airbag: Kneebag for driver
- Airbag: Windowbag
- Active Brake Assist
- Acoustic environmental protection
- Anti-lock braking system (ABS)
- Electrically adjustable exterior mirrors
- Roof rails in polished aluminum
- Double cup holder
- DYNAMIC SELECT
- Chassis: Comfort chassis with lowered suspension
- Front and rear aprons with chrome inserts
- Luggage net on driver and passenger seatbacks
- Transmission: Direct drive
- rear window wiper
- Climate: THERMATIC automatic climate control
- Headrests (5)
- Charging cable for wallboxes and public charging stations, 5m, smooth
- Charging system: Alternating current charging system (AC charging) up to 11 kW (3-phase)
- Air vents in silver chrome with outer ring in silver chrome
- Mercedes-Benz emergency call system
- Navigation accessories: Pre-installation for Live Traffic Information
- Navigation: Hard disk navigation
- Package: Light and Visibility Package
- Upholstery: ARTICO leatherette/fabric
- Radio accessories: Digital radio
- Tire pressure monitoring system (TPMS)
- Rear view camera
- Three-point seat belts on all seats
- Seats: Comfort seats
- Cruise control
- High-visibility vest for drivers
- Central locking



Extra equipment

- Exit warning function
- Paint finish: Metallic
- Package: Advanced Plus (Fully digital instrument display, high resolution 10.25" - CENTRAL MEDIA DISPLAY 10.25" - Mirror package: interior and exterior mirrors automatically dimming, exterior mirrors electrically folding, ambient lighting for the exterior mirrors to illuminate the entry area - Parking package with reversing camera - Active Park Assist with PARKTRONIC - THERMOTRONIC automatic climate control - KEYLESS-GO Comfort package: KEYLESS-GO function, EASY-PACK tailgate - Wireless charging system for mobile devices in the front - Advanced sound system - 10 speakers, 225 W, Blind Spot Assist)
- Package: Night for Progressive Exterior (front and rear aprons and side panels with inserts in high-gloss black - exterior mirror housings in high-gloss black, with cosmos black paint they are painted in body color - beltline trim strip and window line trim strip in high-gloss black - roof rails in black - heat-insulating dark tinted glass from the B-pillar - trim strip on the B-pillar in black)
- Phone accessories: Smartphone integration (Smartphone integration merges your mobile phone with the media system via Apple CarPlay and Android Auto. This gives you convenient access to your smartphone's most important applications. You can also use third-party apps like Spotify quickly and easily. Features include: app display, access to current software and data (e.g., for navigation, traffic information, contacts, messaging, telephony, media), and voice control of smartphone functions.)
- Chassis: Comfort chassis (Enjoy high comfort on long motorway journeys, while still being able to tackle tight corners with sporty enthusiasm. The well-balanced comfort chassis offers a convincing mix of ample suspension reserves and very good driving stability. This makes your journey safe and also provides plenty of driving pleasure.)
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC - Active Speed Limit Assist - Extended Automatic Restart on Highways - Route-Based Speed Adaptation with Traffic Jam Definition - Active Steering Assist - Active Emergency Stop Assist with SOS Function - Emergency Lane Radio - Active Brake Assist - Turning and Intersection Function - Traffic Jam Emergency Braking Function - Evasive Steering Assist - Active Lane Keeping Assist - Active Blind Spot Assist - Exit Warning Function - Pedestrian Warning Function)
- Wheels: 48.3 cm (19") alloy wheels, 4-spoke design (aerodynamically optimized, painted black with energy blue decorative elements and polished finish with 235/50 R 19 tires on 7.5 J x 19 ET 53.5)
- Traffic Sign Assistant (networked system consisting of a camera behind the windshield and navigation maps - analyzes the camera images and can recognize stored traffic signs - assesses the currently driven route based on navigation data - displays speed limits, prohibitions and their cancellation in the instrument cluster or media display as well as in the optionally available head-up display - optional and, upon request, additional acoustic warning when the maximum permitted speed is exceeded - can recognize no-entry signs)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Mudguard - right side	Wheel arch - Loose - Un- / install
2	Sill - right side	Sill - Dent / paintcoat damage - Smart repair
3	Body	Body - Glued / labelled - De-glue / neutralise



Wear and tear

No.	Component group	Description
1	Door - front left side	Door - Stone chips - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Interior	Interior - Scratch(es) - No deduction
5	Side panel - rear left side	Sill - dent(s) - No deduction
6	Bonnet	Bonnet - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 13 Jun 2023	1.969,41 €
2	Side right, Provided by user / customer, from 20 Dec 2023	2.006,05 €

Repainting

No.	Repainting
1	Mudguard - left side, Mudguard - right side, Door - rear left side, Door - front left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - left side	165 µm	Mudguard - right side	269 µm
Door - rear left side	170 µm	Door - front left side	190 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

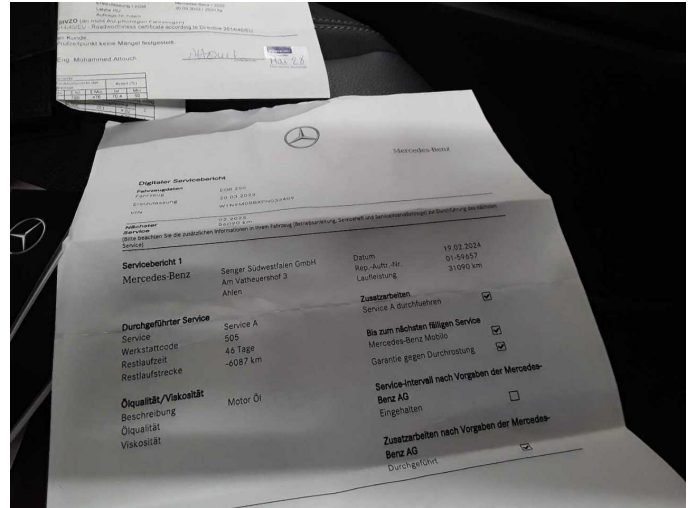


Figure 14: Documents

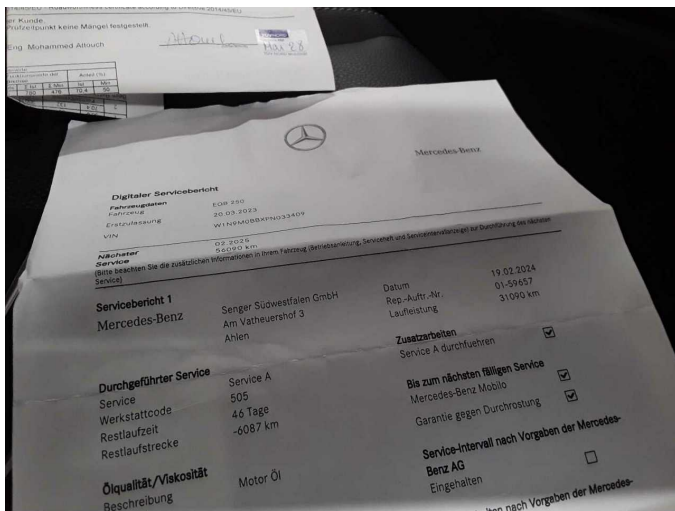


Figure 15: Documents

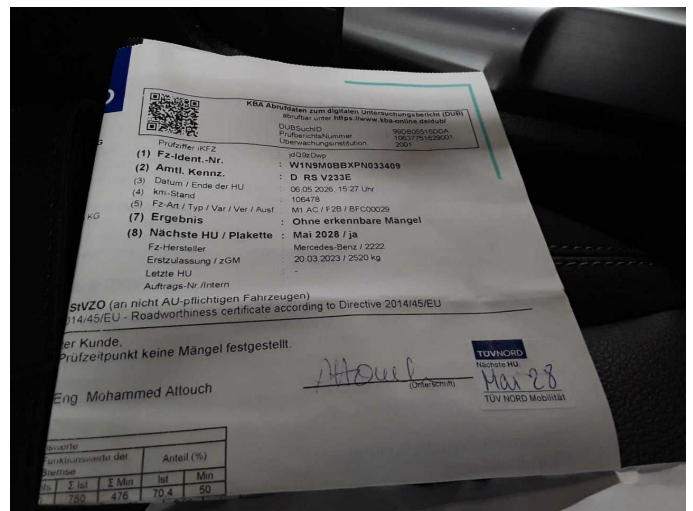


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

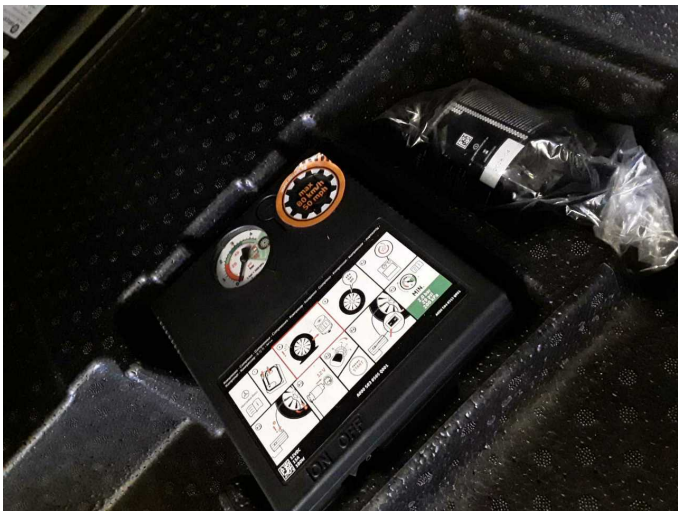


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

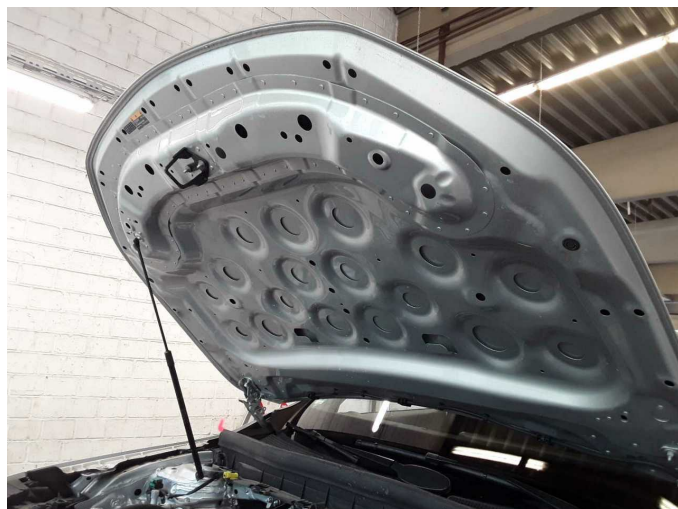


Figure 26: Misc.

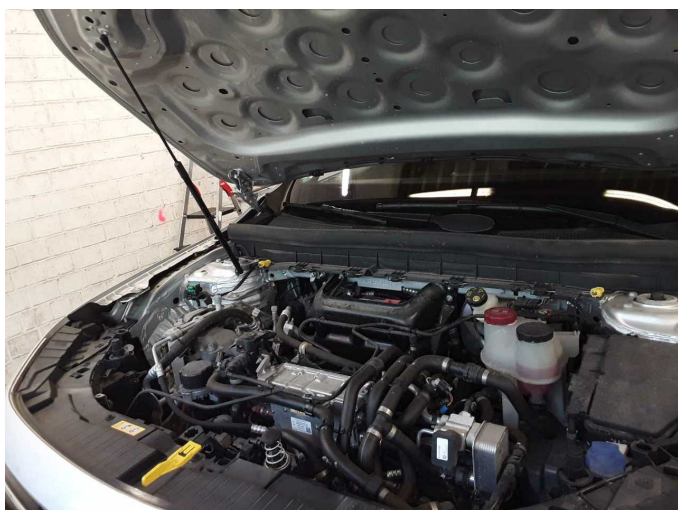


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

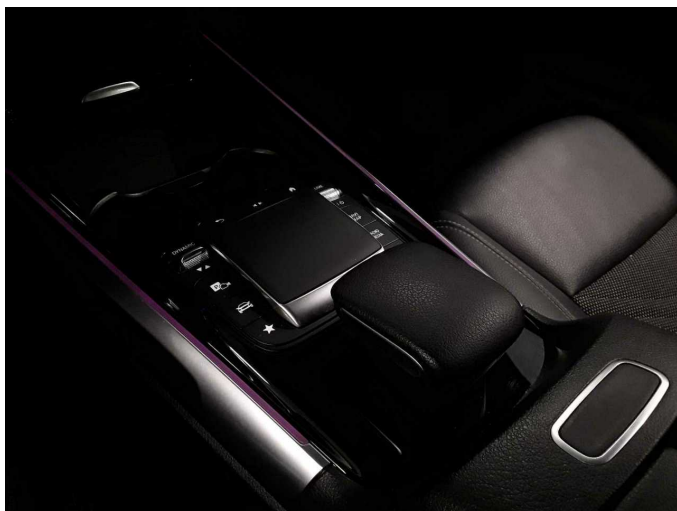


Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.




Damage 1: Mudguard - right side: Wheel arch - Loose - Un- / install



Damage 1: Mudguard - right side: Wheel arch - Loose - Un- / install




Damage 2: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

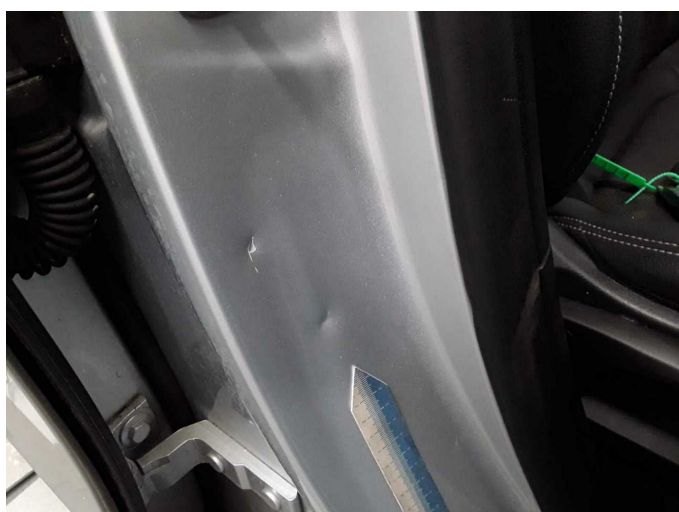

Damage 2: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 3: Body: Body - Glued / labelled - De-glue / neutralise

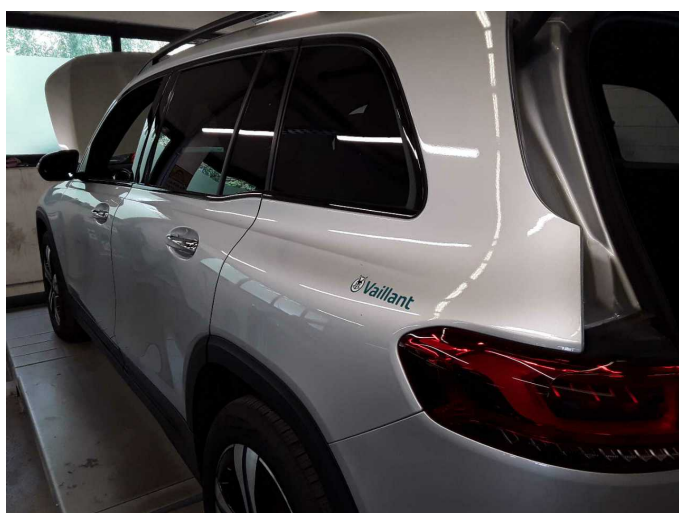

Damage 3: Body: Body - Glued / labelled - De-glue / neutralise



Wear and tear 5: Side panel - rear left side: Sill - dent(s) - No deduction



Wear and tear 5: Side panel - rear left side: Sill - dent(s) - No deduction



Wear and tear 6: Bonnet: Bonnet - dent(s) - No deduction



Wear and tear 6: Bonnet: Bonnet - dent(s) - No deduction



Repainting 1: Mudguard - left side, Mudguard - right side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Mudguard - right side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Mudguard - right side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Mudguard - right side, Door - rear left side, Door - front left side




Repainting 1: Mudguard - left side, Mudguard - right side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Mudguard - right side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - left side, Mudguard - right side, Door - rear left side, Door - front left side

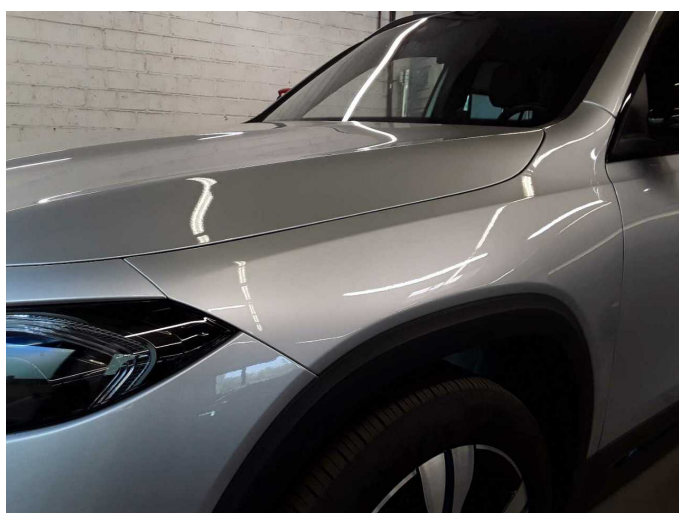

Repainting 1: Mudguard - left side, Mudguard - right side, Door - rear left side, Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N9M0BBXPN033409

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ EQB 250 Progressive

Datum	KM-Stand	Beschreibung
06.05.2026	106.472	HU + AU; Regelwartungsdienst
10.07.2025	81.204	Regelwartungsdienst
24.10.2024	56.696	Regelwartungsdienst
19.02.2024	31.090	Regelwartungsdienst