DEKRA

DEKRA Automotive Solutions

Appraisal Report

Vehicle details

VIN	W0V7H9EN8 P4349495	Registration date	20/06/2024	Exterior Color	Unknown
Brand	OPEL	Licence Plate	KO-VK 817	Odometer	38 847 km
Model	CROSSLAND 1.5 Diesel 81kW Elegance				

Inspection Details

Arrival Date	18/08/2026	Inspection ID	7122514	Inspection date	24/08/2026
Assign Date	18/08/2026	Fleet owner	Leasys Privat Leasing	Inspection loc.	Leasys AKB Kitzingen



Generic equipment

Removable element

Spare wheel kit	✔
Rear parcel shelf	✔

Technical Document

User manual	✔
Warranty booklet	✔
Log books	✔
Spare key	✔
Key	✔
Remote key	✔
Service	✔

DEKRA


DEKRA Automotive Solutions

Appraisal Report

Tyres

Bridgestone 195/60/16 H Summer 5.0 mm

Bridgestone 195/60/16 H Summer 5.0 mm

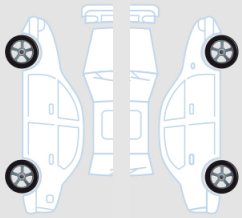

Bridgestone 195/60/16 H Summer 5.0 mm


Bridgestone 195/60/16 H Summer 5.0 mm



Winter kit

Falken 195/60/16 H Winter 6.0 mm

Falken 195/60/16 H Winter 6.0 mm

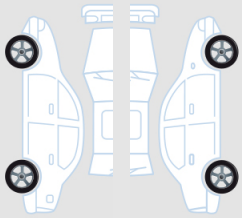

Falken 195/60/16 H Winter 7.0 mm

Falken 195/60/16 H Winter 7.0 mm



Exception / Damage

1



Part	Bumper	Repair Time	-	Part Cost	-
Position	Front	Repair Cost	-	Gross Cost	-
Damages	Worn out	Paint Time	-	Depreciation %	15.00%
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	**-**

2



Part	Bonnet	Repair Time	-	Part Cost	-
Position	-	Repair Cost	-	Gross Cost	-
Damages	Worn out	Paint Time	-	Depreciation %	15.00%
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	**-**

3



Part	Windscreen	Repair Time	1.70	Part Cost	537.96€
Position	Front	Repair Cost	238.00€	Gross Cost	775.96€
Damages	Broken	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Replace	Flat Rate	-	**Net Cost**	**775.96€**

4



Part	Fixing glue kit	Repair Time	-	Part Cost	98.05€
Position	Front	Repair Cost	-	Gross Cost	98.05€
Damages	Broken	Paint Time	-	Depreciation %	15.00%
Severity	-	Paint cost	-	Depreciation	- 14.71
Repair mode	Replace	Flat Rate	-	**Net Cost**	**83.34€**

5



Part	Door	Repair Time	-	Part Cost	-
Position	Front right	Repair Cost	-	Gross Cost	-
Damages	Worn out	Paint Time	-	Depreciation %	15.00%
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	**-**

DEKRA Automotive Solutions

Summary Inspection

Gross Price	874.01€	Depreciation	-14.71€	Net Price	859.30€

Labor cost summary

	Hourly Rate	Time	Gross Price	Depreciation %	Depreciation	Net Price
Bodywork	140.00€	1.70	238.00€	-	-	238.00€
Paintwork	0.00€	0.00	0.00€	-	-	0.00€
Paint preparation	0.00€	0.00	0.00€	-	-	0.00€

Miscellaneous

	Gross Price	Depreciation %	Depreciation	Net Price
Small parts / disposal charge	0.00€	-	-	0.00€
Part Cost	636.01€	2.31 %	-14.71€	621.30€
Flat Rate	0.00€	-	-	0.00€