



Expertise

Protocol number: 46139806
Order No. / Reference: 26521071
Inspection date: 25 Jun 2026

Manufacturer: Volvo

Model: V60 B4 D Plus Dark

VIN: YV1ZWK5V5P2544573



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo V60 B4 D Plus Dark	
Vehicle Identification number	YV1ZWK5V5P2544573
Mileage (Reported)	70,810 km
First registration	22 Jun 2023
Number of holders	1
Next periodical technical inspection	06/2026
(Report not on hand)	
Power / Engine displacement	145 kw / 1,969 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Black Stone
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Anthracite-Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	0 km
Last service on / at	06/2025 at 48,151 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS766828
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BTH 00017		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,290 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/40 R19 96W	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	235/40 R19 96W	Summer tyres on Light alloy	Michelin	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 98V	Winter tyres on Light alloy	Michelin	5mm / 5mm
2)	225/50 R17 98V	Winter tyres on Light alloy	Michelin	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ABS - Anti-lock Braking System
- Driver and passenger side airbags with two-stage deployment system
- Electrically folding exterior mirrors
- Sport exterior mirrors in high-gloss black
- Outdoor temperature display
- Hill Start Assist (HSA)
- fog sensor
- On-board computer with vehicle control functions
- Roof edge spoiler
- Digital services including Google Maps navigation system
- Aluminum door sill plates with Volvo lettering at the front
- Electronic differential lock
- Electric windows front and rear
- Window surround in high-gloss black
- Sport front and rear apron
- Luggage compartment partition net
- Front seat belt height adjustment
- Automatic tailgate (electric)
- Interior and exterior mirrors with automatic dimming function
- ISOFIX anchors for the outer rear seats
- Keyless Start
- Automatic air conditioning
- Front headrests
- Paint finish: Solid
- Stainless steel loading sill protector in the luggage compartment
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel
- Front center armrest with integrated storage compartment and cup holders
- Package: Seat Comfort Package
- Electric parking brake
- Particulate filter: Soot particle filter for diesel engines
- Radio accessories: Smartphone integration Apple CarPlay
- Rain sensor
- Wheels: Tire pressure monitoring system (passive)
- Rear view camera
- Speed-sensitive power steering
- Seat belts
- Safety steering column (adaptive)
- Start/Stop technology
- Power socket
- Phone: Inductive smartphone charging system (Qi standard)
- Preparation for Trailer Stability Assist (TSA)
- WHIPS whiplash protection system
- Front passenger airbag can be deactivated
- Ambient lighting
- Android infotainment system
- Electrically adjustable exterior mirrors
- Heated exterior mirrors and rear window (automatic)
- Attachment system for carrier bags in the luggage compartment
- LED turn signals integrated into the exterior mirrors
- third brake light
- Roof rails in high-gloss black (integrated)
- Digital Instrumentation 2nd Gen.
- Electronic Stability Control (ESC)
- Advanced air purification system with fine dust filtration according to air quality standard PM2.5
- Automatic emergency braking
- Sport front grille
- Transmission: 8-speed automatic transmission
- Hooks in the luggage compartment
- rear window wiper
- Interior lighting
- Intelligent driver information system
- Keyless Drive (electronic access system)
- Child safety lock (electric for the rear doors)
- Headrests of the 2nd row of seats foldable, electrically adjustable
- Charging box under the cargo floor
- Cargo area roller blind
- LED headlights "Thor's Hammer"
- Steering wheel: Three-spoke steering wheel, leather-free
- Rear center armrest (foldable) with cup holders
- Emergency brake lights
- Package: Parking Assistance
- Package: Winter Package
- Parking ticket holder
- Upholstery: Leather/leatherette comfort seats
- Radio accessories: Two USB-C ports on the back of the center console
- Wheel accessories: Tire sealant
- Safety Assistance
- Safety braking system with disc brakes all around (internally ventilated)
- Seats: Rear seats in a 40/60 split or fully foldable with pass-through function
- Fuel filler neck with misfuelling protection
- Textile floor mats
- Lashing eyes in the luggage compartment (foldable)
- Immobiliser
- Central locking system with two remote controls and integrated emergency keys



Extra equipment

- Towbar (semi-electric)
- Windscreen, heater
- Package: Light Package (Plus, Ultimate) (LED fog lights - headlight cleaning system - full LED headlights "Thor's Hammer" Active High Beam with extended high beam, dynamic cornering lights, intelligent high beam assist with adaptive headlight range control and integrated LED daytime running lights)
- Parking camera with 360° surround view (including front, side and rear parking aid with automatic braking intervention (rear))
- Side and rear windows tinted (from the B-pillar back)
- Audio system High Performance Sound Pro 1033
- Package: Driver Assistance Package (Driver Assistance - Adaptive Cruise Control - Emergency Stop Assist (automatic emergency stopping system if warnings are ignored due to the driver's failure to steer, brake, or accelerate, including activation of the hazard warning lights and automatic braking to a standstill) - Pilot Assist (lane guidance assistant with adaptive cruise control up to speeds of 130 km/h) Interior and exterior mirrors with automatic dimming)
- Wheels: 19" 5-triple-spoke alloy wheels, sport design, diamond cut/graphite look (8 J x 19 with 235/40 R19 W tires)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Front bumper	Front bumper - Scratch(es) - Smart repair
2	Wheel / tyres	Alloy rim - front left side - Scratched - Loss in value
3	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
4	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
5	Misc.	Inspection / maintenance - Due - Perform

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

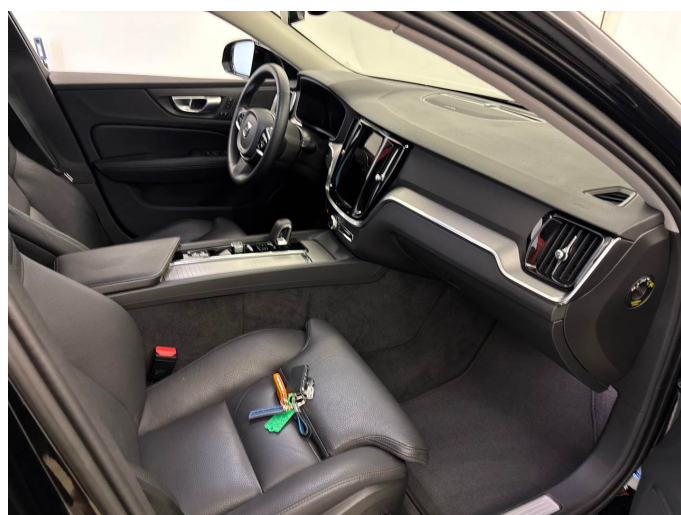


Figure 5: Interior - front

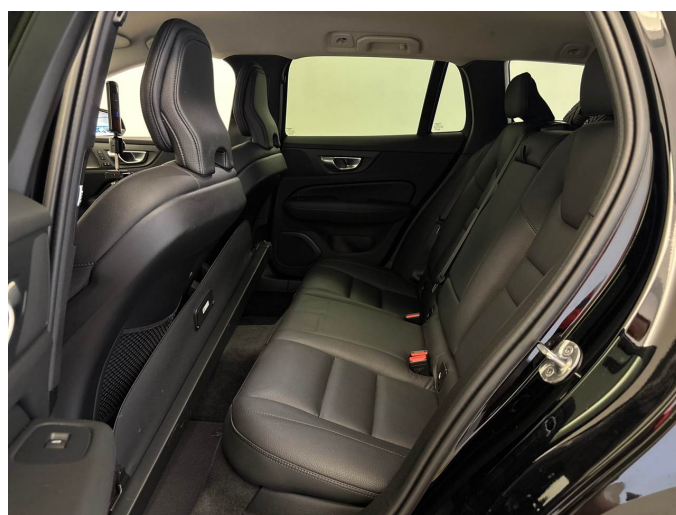


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

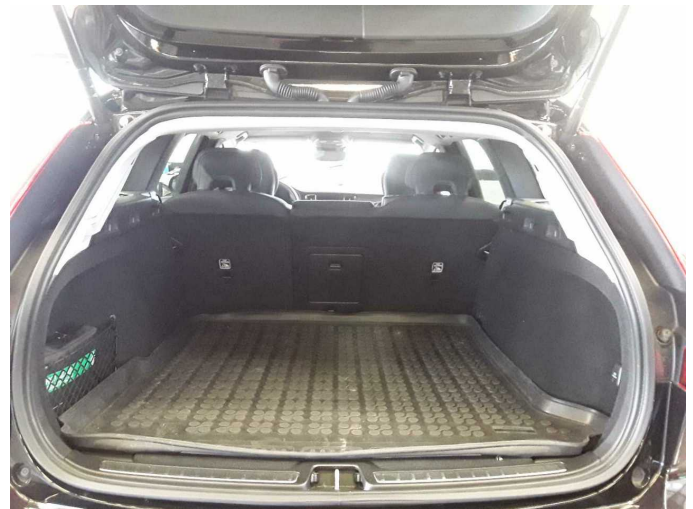


Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

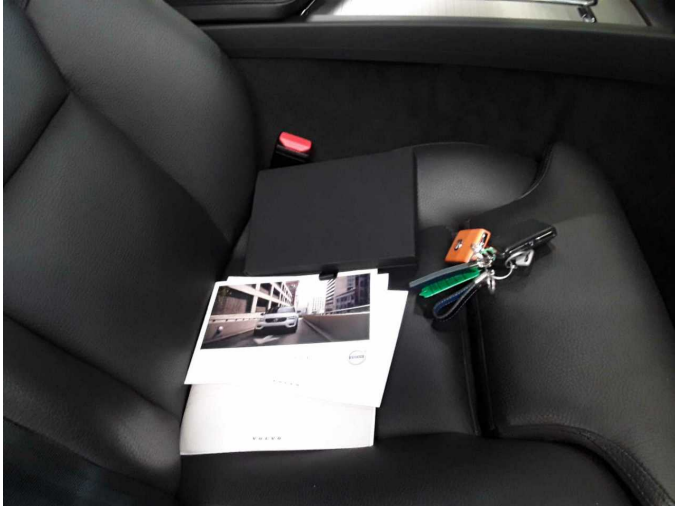


Figure 13: Documents

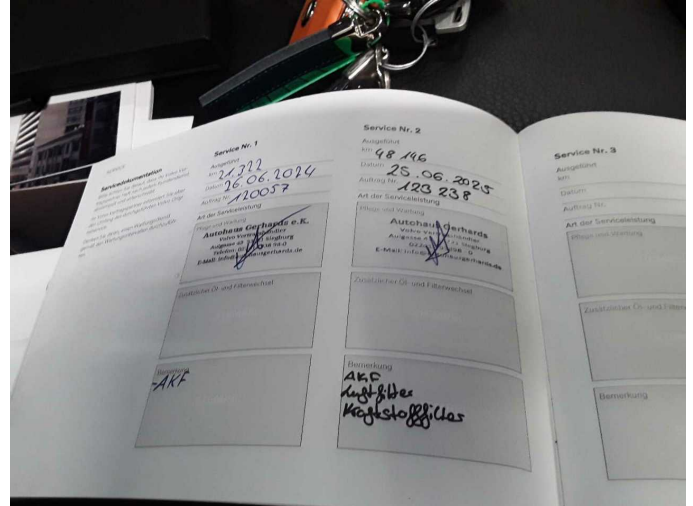


Figure 14: Documents

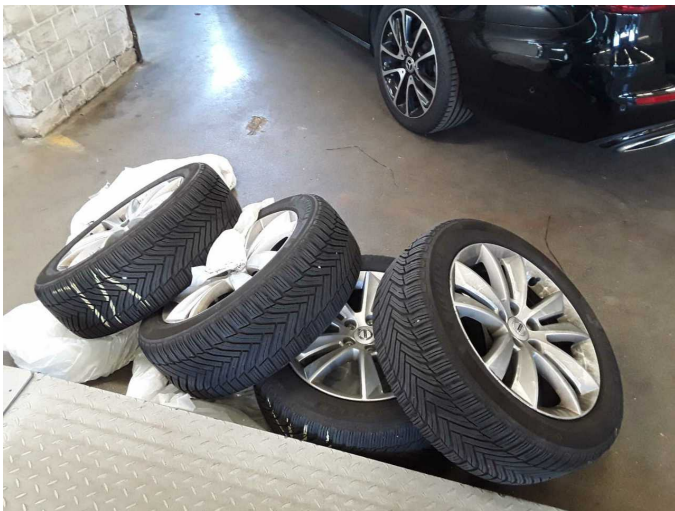


Figure 15: Additional tyres

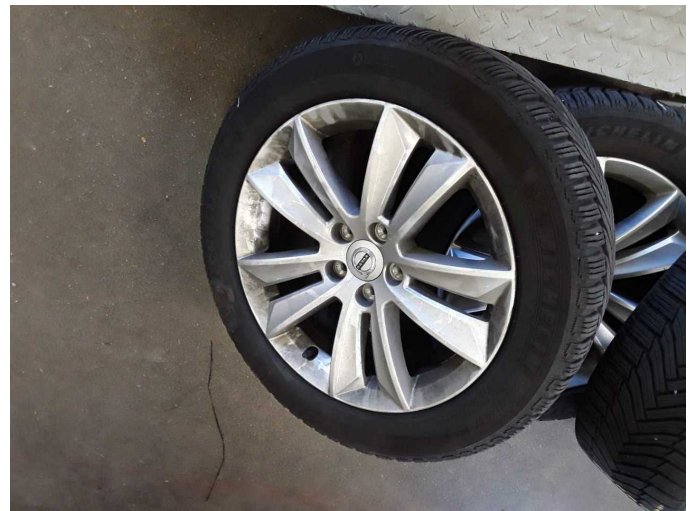


Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.

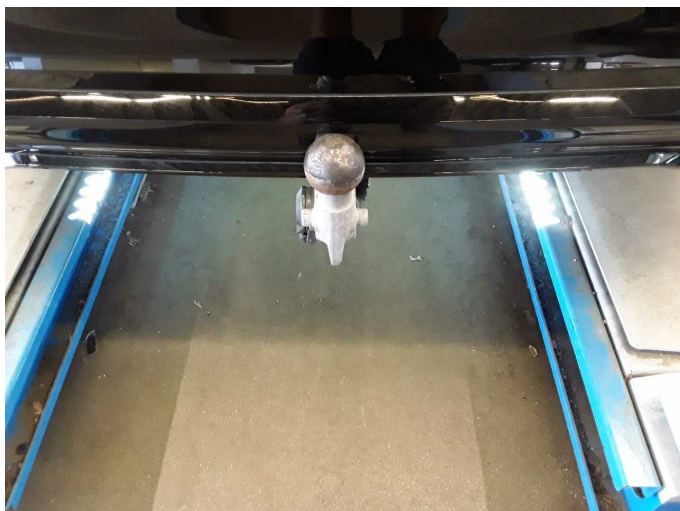


Figure 19: Misc.



Figure 20: Misc.

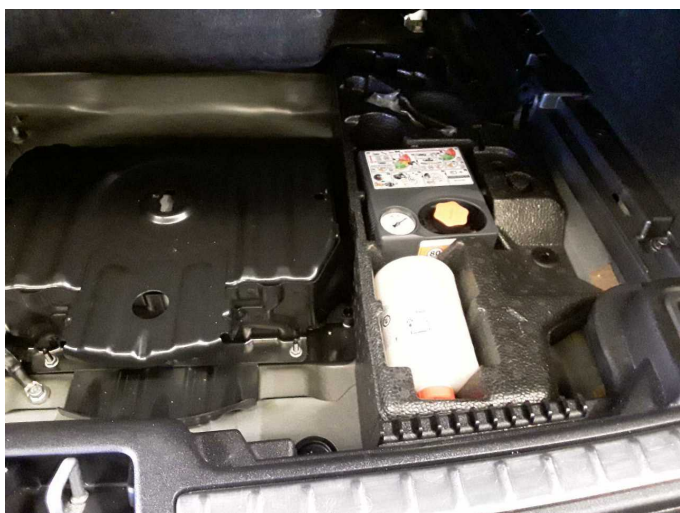


Figure 21: Misc.



Figure 22: Misc.

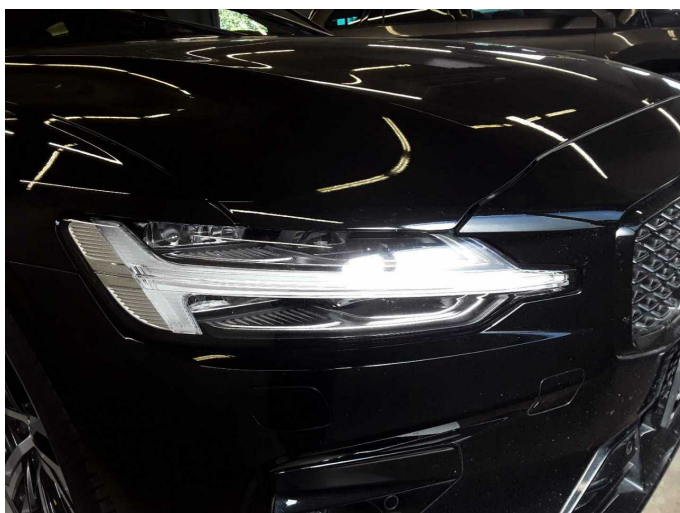


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

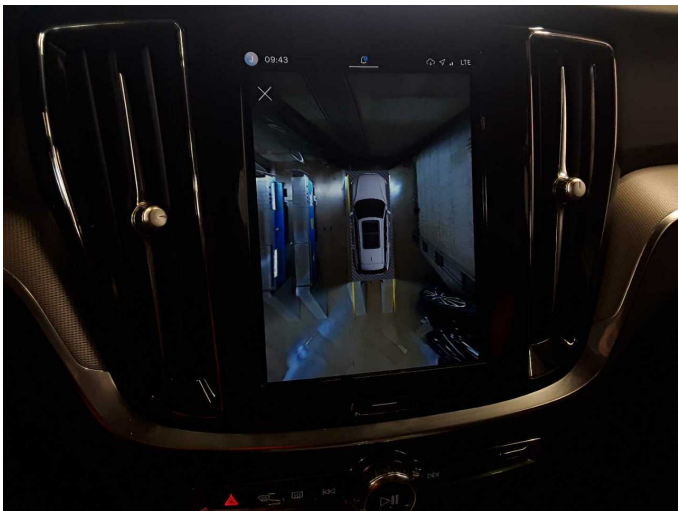


Figure 28: Misc.



Figure 29: Misc.

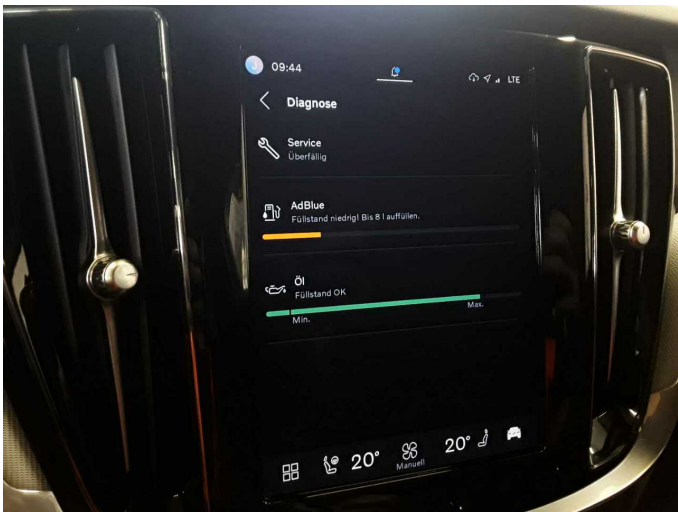


Figure 30: Misc.



Damage 1: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 1: Front bumper: Front bumper - Scratch(es) - Smart repair




Damage 2: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 2: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 3: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value

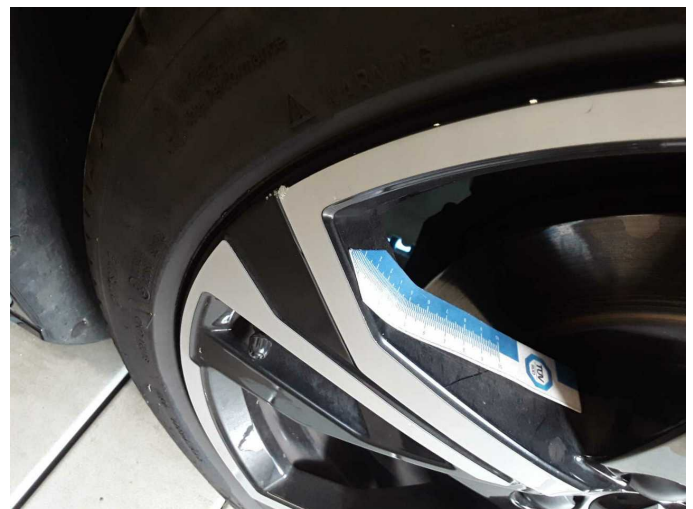


Damage 3: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value




Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value




Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value

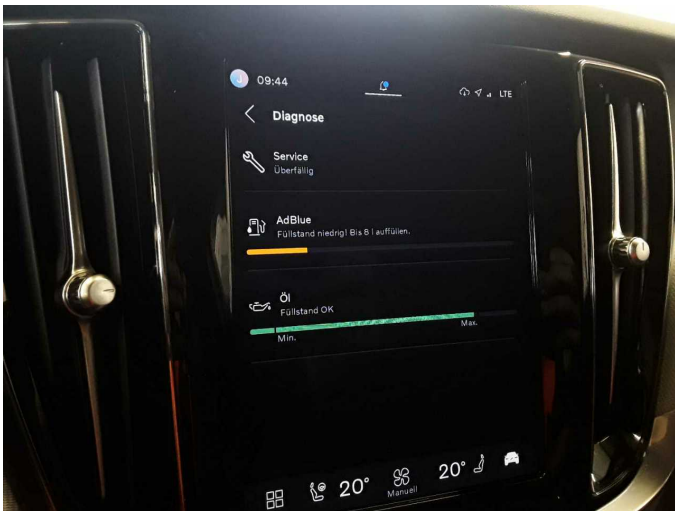

Damage 5: Misc.: Inspection / maintenance - Due - Perform

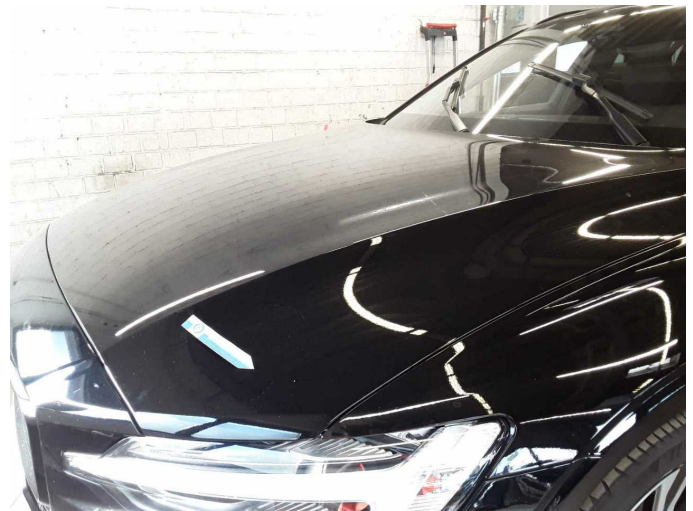


Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction

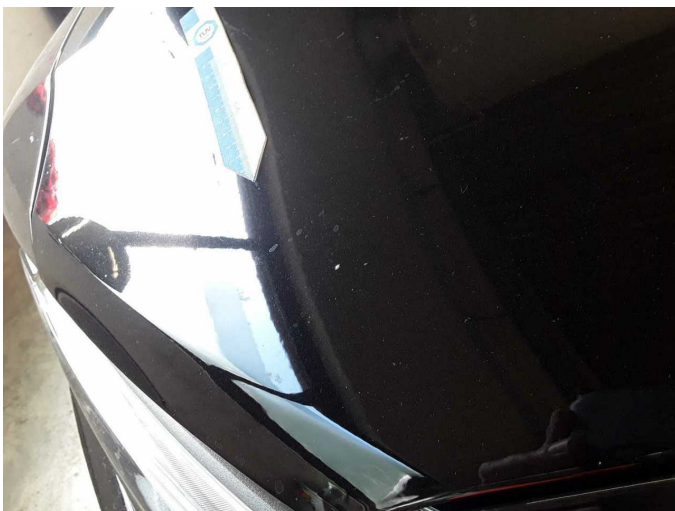

Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Vehicle glazing: Windscreen - Stone chips - No deduction

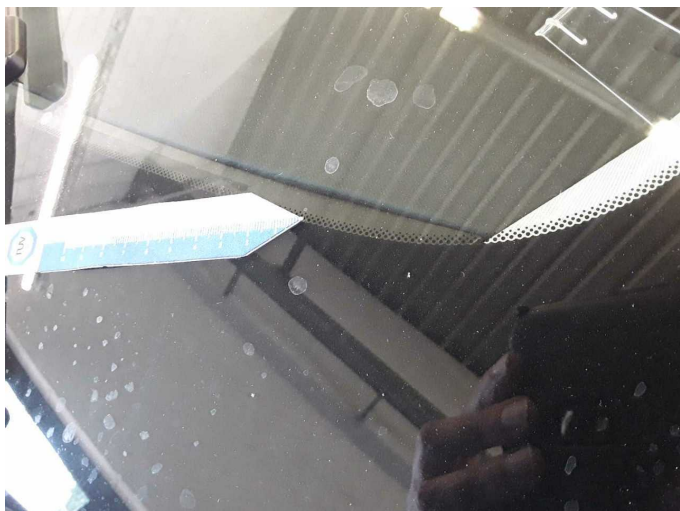

Wear and tear 2: Vehicle glazing: Windscreen - Stone chips - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1ZWK5V5P2544573
Hersteller / Modell: VOLVO VOLVO V60 B4 D Plus Dark

Datum	KM-Stand	Beschreibung
25.06.2025	48.151	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
26.06.2024	21.327	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges