



Expertise

Protocol number: 45489987
Order No. / Reference: 26461692
Inspection date: 15 May 2026

Manufacturer: Mercedes-Benz

Model: E 220 d T 9G-TRONIC Avantgarde

VIN: W1KZH0EB7PB158866



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz E 220 d T 9G-TRONIC Avantgarde	
Vehicle Identification number	W1KZH0EB7PB158866
Mileage (Read)	176,938 km
First registration	6 Jul 2023
Number of holders	1
Next periodical technical inspection	07/2026
(Report not on hand)	
Power / Engine displacement	147 kw / 1,993 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	Rear drive
Type of vehicle	Station wagon
Colour / colour code	OBSIDIANSCHWARZ - METALLICLACK
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	273 Tag(e)
Last service on / at	02/2026 at 174,159 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV698888
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2222 / BEG 00109		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,605 kg	Empty weight	
Dimensions	4996 x 1868 x 1499		

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 97H	Winter tyres on Light alloy	Dunlop	5mm / 5mm
2)	225/55 R17 97H	Winter tyres on Light alloy	Dunlop	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102Y	Summer tyres (Without wheel rim)	Continental	6mm / 6mm
2)	225/55 R18 102Y	Summer tyres (Without wheel rim)	Continental	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ADAPTIVE BRAKE with hill start assist, pre-filling and drying braking in wet conditions
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Premium ambient lighting with 64 colors and 3 color zones
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Attention Assist
- Basic services
- On-board computer
- Diesel particulate filter
- Third brake light
- EASY-PACK cargo cover including EASY-PACK safety net
- Electronic Stability Program (ESP)
- Chassis: Air suspension on the rear axle with level control
- Electric window regulator with comfort operation and anti-pinch protection, 4-way
- Heated rear window with timer
- Interior headliner in nevagrau fabric
- THERMATIC automatic climate control
- Paint finish: Solid
- LED High Performance Headlights
- Steering wheel: Multifunction steering wheel in Nappa leather in a 3-spoke design
- Mercedes-Benz emergency call system
- Center console with on-the-fly storage compartment
- Navigation: Hard disk navigation
- Package: Storage
- Package: Seating comfort
- PRE-SAFE system
- Radio: MBUX multimedia system
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Windscreen wipers with rain sensor
- Seats: i-Size child seat attachment
- Power outlet: 12V socket in the cargo area
- High-visibility vest for drivers
- Green, heat-insulating glass all around
- Decorative elements: aluminum with longitudinal brushing, light finish
- AdBlue tank with a capacity of 23.5 liters
- Airbag for driver and front passenger
- Airbag: Kneebag for driver
- Airbag: Windowbags left/right
- AMG sports pedal assembly made of brushed stainless steel with rubber studs
- Foldable armrest for driver and front passenger
- Left and right exterior mirrors, heated and electrically adjustable, painted in body color
- Brake assist, active
- Tachometer
- DYNAMIC SELECT
- EASY-PACK tailgate
- Chassis: AGILITY CONTROL chassis with selective damping system and lowered suspension
- Velour floor mats
- Transmission: 9-speed automatic, 9G-TRONIC
- rear window wiper
- KEYLESS START
- Headrests 5-way adjustable for driver and front passenger, 4-way adjustable, and 2-way adjustable in the rear.
- Steering column mechanically adjustable in height and length
- Center console piano black finish
- Navigation accessories: Pre-installation for Live Traffic Information
- Package: AVANTGARDE Exterior
- Upholstery: ARTICO leatherette/Norwich fabric
- Radio: Extended MBUX functions
- Radio accessories: Digital radio
- Tire pressure monitoring system
- Remote Services Plus
- Power steering
- Seats: Rear seat backrests foldable, 40/20/40 split
- Touchpad
- Electronic immobilizer
- Central locking



Extra equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Towbar with ESP trailer stabilization (fully electrically foldable and retractable) • Package: Driving Assistance Package (Active Distance Assist DISTRONIC incl. Active Speed Limit Assist, Extended Automatic Restart on Highways, Route-Based Speed Adaptation with Traffic Jam Function (only when selecting Parking Packages), Active Steering Assist incl. Active Emergency Stop Assist with SOS Function, Emergency Lane Radio, Active Brake Assist incl. Turning and Intersection Radio, Traffic Jam Emergency Brake Radio, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist incl. Exit Warning, Pedestrian Warning Radio, PRE-SAFE PLUS) • Package: Mirrors (both exterior mirrors electrically foldable (button in the driver's door control panel) - automatic lowering of the passenger-side mirror glass to parking position when reverse gear is engaged - interior mirror and driver's side exterior mirror automatically dimming continuously - ambient lighting of the exterior mirror to illuminate the entry area) • Sunroof: Panoramic electric sunroof in glass design (with comfort and automatic rain closing, PRE-SAFE closing function, electric sunshade and anti-pinch protection) • Glazing: Heat-insulating dark tinted glass all around from the B-pillar (the use of heat-insulating dark tinted glass for the rear side windows and rear window protects rear passengers from prying eyes and direct sunlight - the dark tint also emphasizes the sportiness of the vehicle) | <ul style="list-style-type: none"> • Paint finish: Metallic • Package: Business (MBUX High-End Package - Connectivity Package Navigation - Traffic Sign Assist - Smartphone Integration (Apple CarPlay and Android Auto) - Preparation for Digital Key Handover - Widescreen Cockpit - Wireless Charging System for Mobile Devices - MBUX Augmented Reality for Navigation - Heated Seats for Driver and Front Passenger - Parking Package with Rearview Camera - Fuel Tank with 66 Liter Capacity (916) (60l for Diesel Plug-in Hybrids).) • Package: Parking package with reversing camera (The parking package with reversing camera makes it easier to find and select parking spaces, as well as to park and exit in parallel and perpendicular parking spaces or garages. The active parking assistant steers the vehicle into parking spaces, including speed control and automatic gear changes.) • Wheels: Complete summer wheel sets fitted at the factory • Wheels: Winter complete set of M+S tires, 4-piece set, 43.2 cm (17") light alloy wheels in 5-twin-spoke design (black painted and polished, 225/55 R 17 on 7.5 J x 17 ET 40) • Seats: Heated seats for driver and front passenger (selectable in three stages - Intelligent and comfortable: The seat heating switches off automatically) • Type designation removed from trunk lid • 17" Leichtmetallräder im 5-Doppelspeichen-Design, Sommer |
|---|---|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Wing mirror - right side	Cap - Scratch(es) - Smart repair
2	Roof	Roof - dent(s) - Smart repair
3	Side panel - rear left side	Side panel - dent(s) - Smart repair
4	Steering system	Steering wheel - Scratch(es) - Smart repair
5	Side panel - rear left side	Sill - Scratch(es) - Smart repair
6	Door - front left side	Door - Scratch(es) - Smart repair
7	Mudguard - right side	Mudguard - right side - Stone chips - Paint
8	Rear bumper	Rear bumper - Scratch(es) - Paint
9	Front bumper	Front bumper - Scratched - Paint
10	Bonnet	Bonnet - Stone chips - Paint

Wear and tear

No.	Component group	Description
1	Body	Underbody panelling - Scratch(es) - No deduction
2	Headlight	Headlight - right side - Stone chips - No deduction
3	Headlight	Headlight - left side - Stone chips - No deduction
4	Door - rear right side	Door - dent(s) - No deduction
5	Vehicle glazing	Rear window - Scratch(es) - No deduction
6	Mudguard - left side	Mudguard - left side - Stone chips - No deduction
7	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

2nd wheel set - Alloy rim set - complete (17 Zoll Sommer Radsatz)

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- 18 Zoll Sommerreifensatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

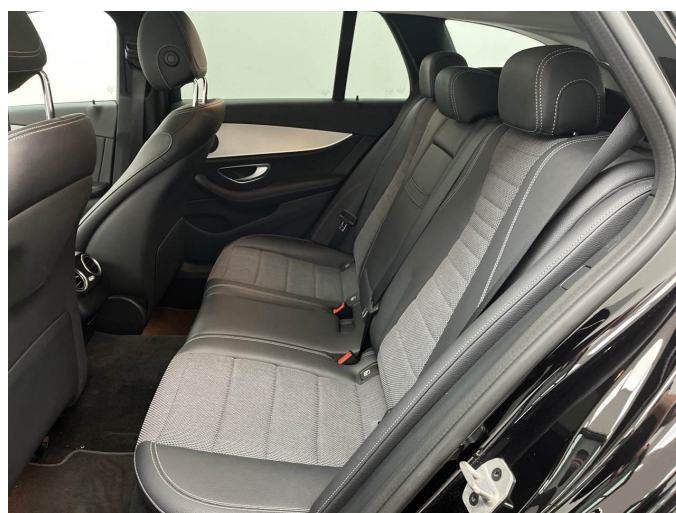


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

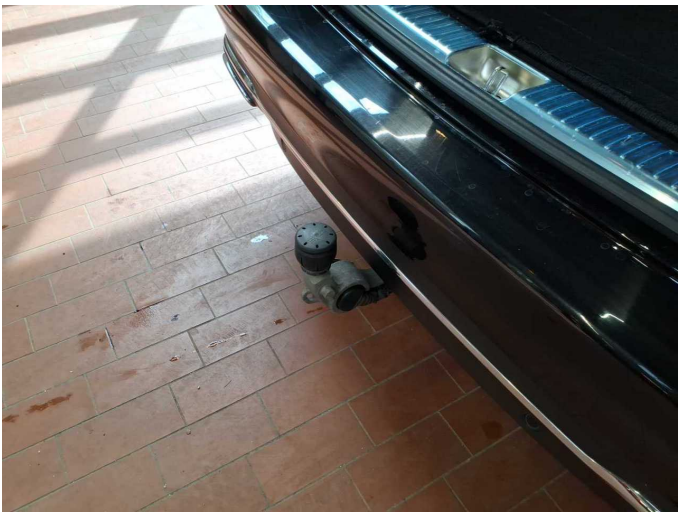


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.




Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair




Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 2: Roof: Roof - dent(s) - Smart repair

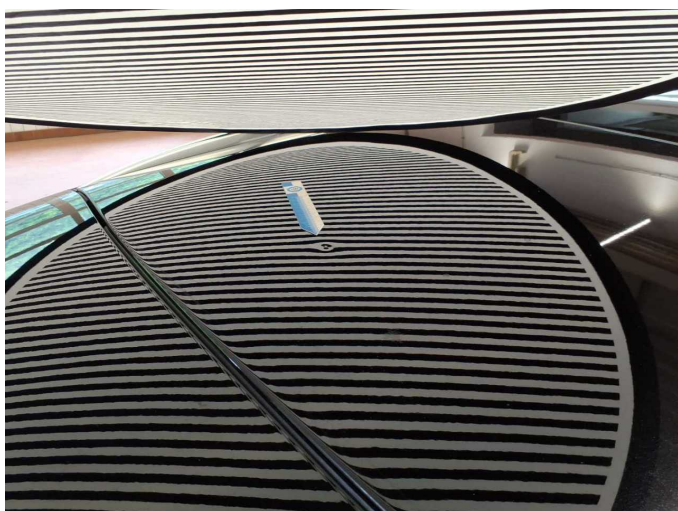


Damage 2: Roof: Roof - dent(s) - Smart repair

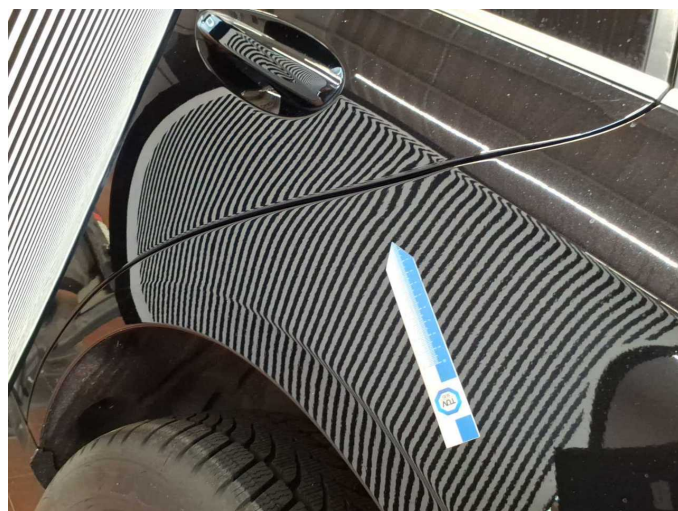

Damage 3: Side panel - rear left side: Side panel - dent(s) - Smart repair



Damage 3: Side panel - rear left side: Side panel - dent(s) - Smart repair

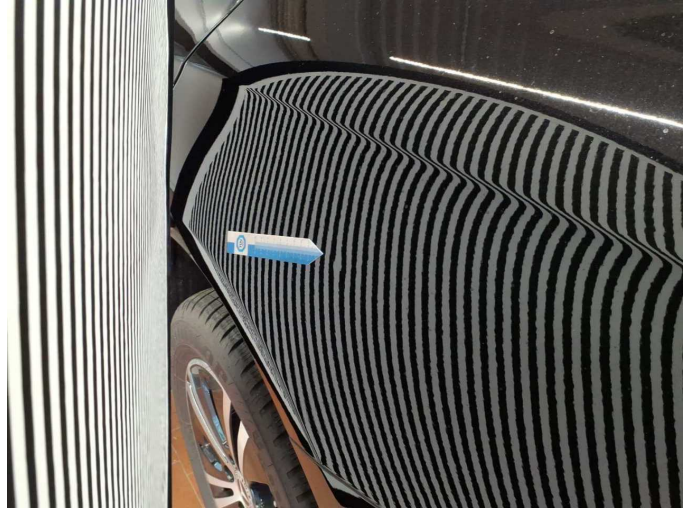

Damage 3: Side panel - rear left side: Side panel - dent(s) - Smart repair




Damage 4: Steering system: Steering wheel - Scratch(es) - Smart repair



Damage 4: Steering system: Steering wheel - Scratch(es) - Smart repair



Damage 5: Side panel - rear left side: Sill - Scratch(es) - Smart repair

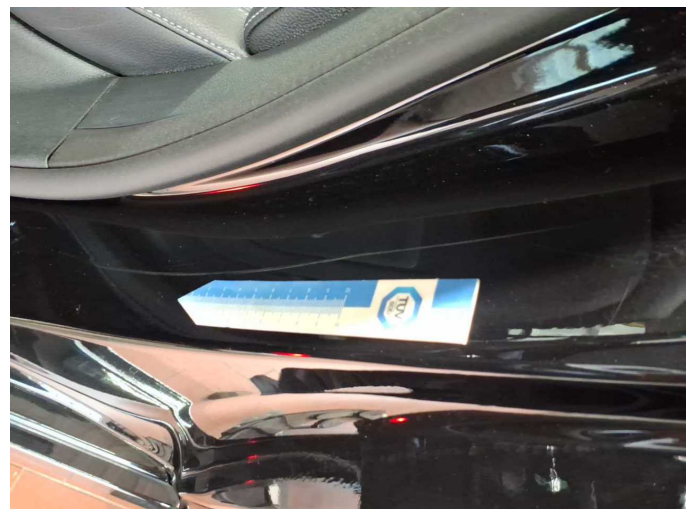

Damage 5: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 6: Door - front left side: Door - Scratch(es) - Smart repair




Damage 6: Door - front left side: Door - Scratch(es) - Smart repair




Damage 6: Door - front left side: Door - Scratch(es) - Smart repair



Damage 7: Mudguard - right side: Mudguard - right side - Stone chips - Paint

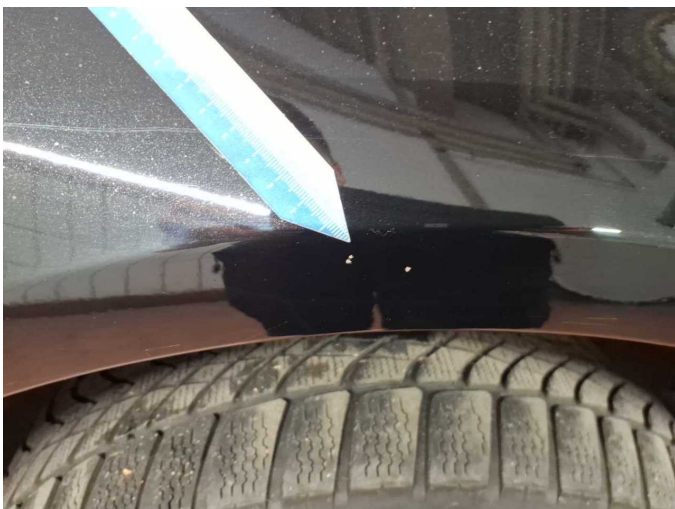


Damage 7: Mudguard - right side: Mudguard - right side - Stone chips - Paint

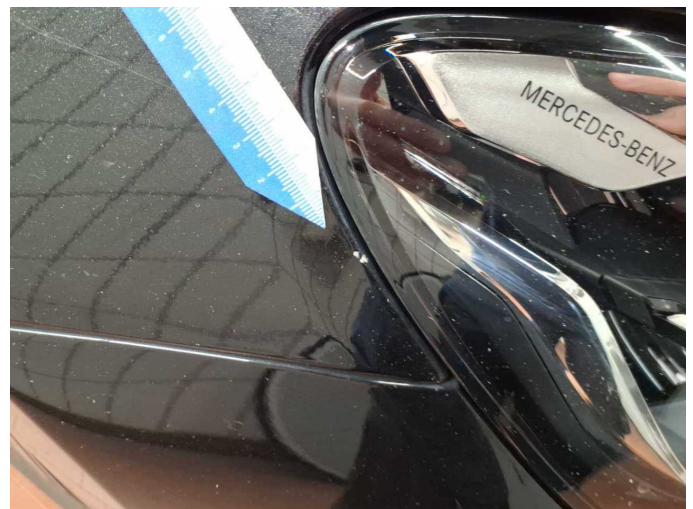

Damage 7: Mudguard - right side: Mudguard - right side - Stone chips - Paint



Damage 7: Mudguard - right side: Mudguard - right side - Stone chips - Paint

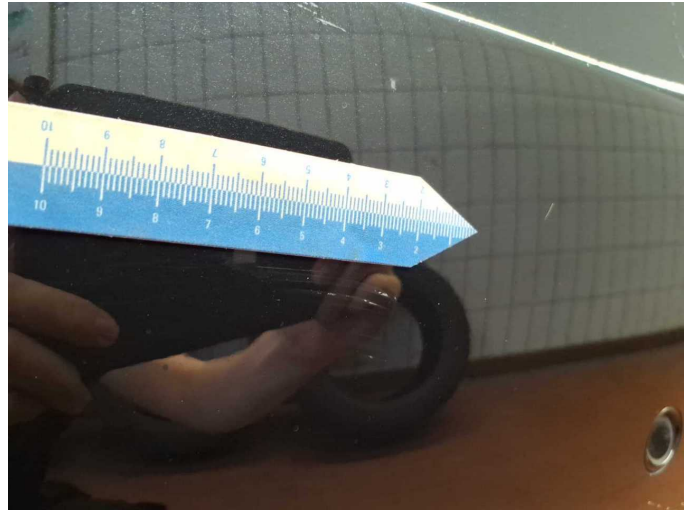

Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint

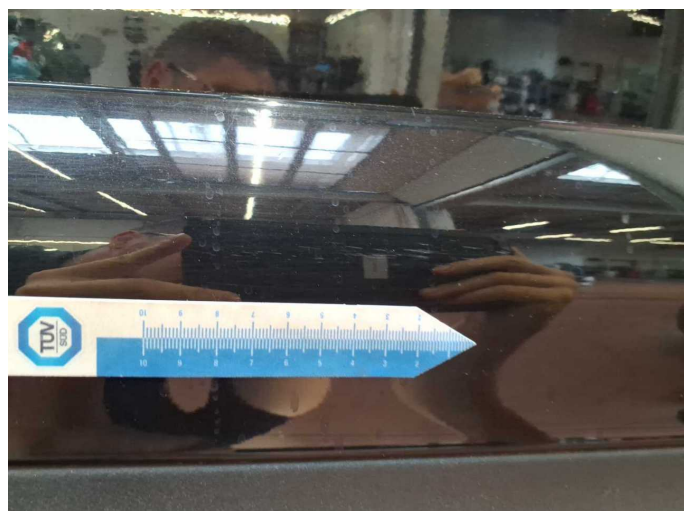


Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint

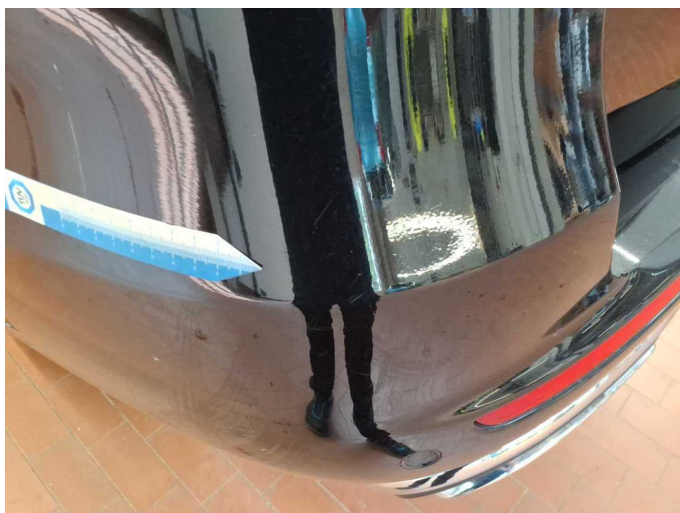


Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint

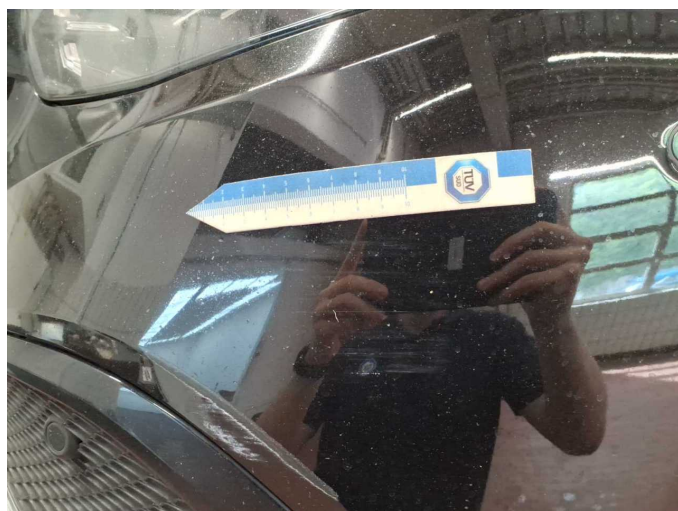

Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 10: Bonnet: Bonnet - Stone chips - Paint



Damage 10: Bonnet: Bonnet - Stone chips - Paint



Damage 10: Bonnet: Bonnet - Stone chips - Paint



Damage 10: Bonnet: Bonnet - Stone chips - Paint




Wear and tear 2: Headlight: Headlight - right side - Stone chips - No deduction



Wear and tear 3: Headlight: Headlight - left side - Stone chips - No deduction



Wear and tear 5: Vehicle glazing: Rear window - Scratch(es) - No deduction

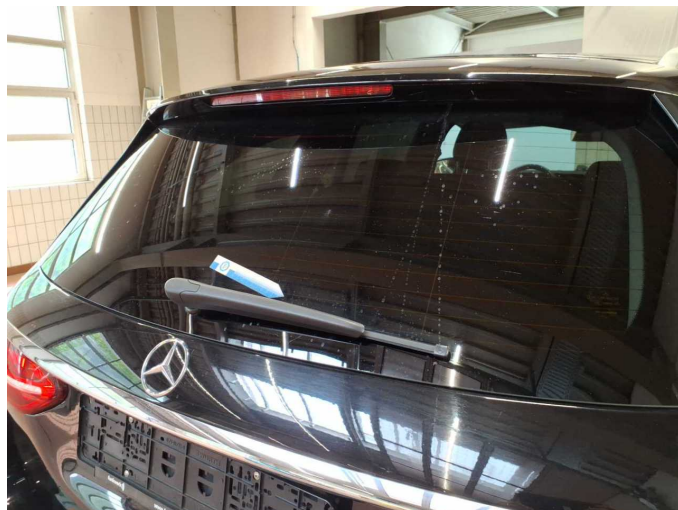

Wear and tear 5: Vehicle glazing: Rear window - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1KZH0EB7PB158866

Hersteller / Modell: MERCEDES-BENZ MB E 220 d T 9G-TRONIC Avantgarde

Datum	KM-Stand	Beschreibung
12.02.2026	174.159	Regelwartungsdienst; Regelwartungsdienst; Regelwartungsdienst
09.10.2025	149.838	Bremsklötze hinten; Regelwartungsdienst
07.10.2025	147.302	Bremsbelagfühler ern; Bremsentest; Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
11.06.2025	127.113	Bremsklötze vorne; Regelwartungsdienst
14.04.2025	112.075	Bremsscheiben hinten
27.01.2025	103.655	Regelwartungsdienst
27.11.2024	93.541	Bremsscheiben vorne
02.09.2024	79.537	Regelwartungsdienst
10.06.2024	64.055	Bremsscheiben+Beläge v+h
09.04.2024	53.782	Regelwartungsdienst
10.01.2024	35.624	Bremsinspektion vo + hi
28.11.2023	27.001	Regelwartungsdienst