



RENAULT CLIO: GD-070-EM

Vinnumber:	VF1RJA00X67890824	Versionname:	RENAULT CLIO Business E-Tech hybride 140 -21N
First Registrationdate:	26/11/2021	Fiscalpower:	VP [5P] bva 6-140CH-5cv (bi-corps)
Expertise Mileage:	150716	Power Kw:	103
Bodytype:	Berline	Body colour:	White
Gearbox:	Automatic	Paint type:	Opaque
Transmission:	Front	Interior colour:	Anthracite
Fueltype:	Hybrid	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Anthracite
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Steel		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Seat cover lining	Lining Other
Steering wheel leather			
Type of climate control	Manual climate control		

Tyres

	195/55/16/91 V			
Summer tyres:	Fr.L.	Goodyear: 80%	Fr.R.	Goodyear: 80%
	Re.L.	Hankook: 60%	Re.R.	Hankook: 80%
Tyre profile depth FL				3.1
Tyre profile depth FR				2.9
Tyre profile depth RL				4.4
Tyre profile depth RR				3.1
Tyre size FL				195/55 R 16 91 V
Tyre size FR				195/55 R 16 91 V
Tyre size RL				195/55 R 16 91 V
Tyre size RR				195/55 R 16 91 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				259
Tyre make FR				259
Tyre make RL				260
Tyre make RR				260

Assistance equipment

Door panel RL, Scratch(es), Replace



Armrest F M, Broken, Replace



Interior, Stain, Cleaning



Dashboard, Tear, Repair/replace (lump sum)



Remote ignition key, Missing, Repair/replace (lump sum)



Tyre FL, Out of tolerance, Replace



Tyre RR, Out of tolerance, Replace



Tyre FR, Out of tolerance, Replace




Wheel cover FR, Broken, Replace



Alloy rim RL bitone/polychrome, Broken, Repair/replace (lump sum)



Outside rear-view mirror housing L, Scratch(es), Polish

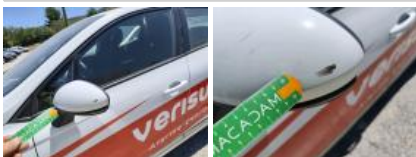

Door FL, Dent(s), Repair and paint (complete)



Outside rear-view mirror housing R, Scratch(es), Acceptable



Tailgate / Boot, Dent(s) and scratch(es), Repair and paint (complete)



Rear light R tailgate, Broken, Replace



Rear bulkhead lining, Scratch(es), Replace



Rear roof pillar covering R, Broken, Replace



Luggage compartment cover, Broken, Replace



Boot lid covering R, Scratch(es), Replace



Bodywork, Not original part, Sticker removal small



Historique Maintenance

Immatriculation: **GD-070-EM** Date de 1ère immatriculation: **26/11/2021**

Modèle: **Renault CLIO Business E-Tech hybride 140 -21N VP [5P] bva 6-140CH-5cv (bi-corps)**

Date	Kilométrage	Fournisseur	Descriptif
22/12/2025	130.498	DEKRA AUTOMOTIVE S.A	CONTRE VISITE CT
04/12/2025	126.756	FLEET SOLUTIONS FRANCE	REPLACEMENT PNEUS ETE
28/11/2025	126.752	DEKRA AUTOMOTIVE S.A	CONTROLE TECHNIQUE
07/10/2025	125.531	GRAND SUD AUTO	PLAQUETTES AV RPLT
	0		REVISION ET CLIM ET AIR ET BOUGIES
	0		PILE DE CLE RPLT
	0		RECYCLAGE
13/03/2025	96.643	FLEET SOLUTIONS FRANCE	REPLACEMENT PNEUS ETE
03/03/2025	92.797	GRAND SUD AUTO	RECYCLAGE
	0		REVISION ET CLIM
	0		LIQUIDE DE FREIN
	0		BALAIS ESSUIE GLACE AV
03/07/2024	70.000	CONTITRADE FRANCE	REPLACEMENT PNEUS 4 SAISONS
02/05/2024	64.960	CONTITRADE FRANCE	REPLACEMENT PNEUS ETE
27/02/2024	61.772	GRAND SUD AUTO	REVISION ET CLIM ET AIR ET BOUGIES
14/06/2023	38.578	NORAUTO SAS (PRODUIT SPE)	REPLACEMENT PNEUS ETE
19/04/2023	34.742	NORAUTO SAS (PRODUIT SPE)	REPARATION DE ROUE
27/03/2023	31.411	GRAND SUD AUTO	BALAIS ESSUIE GLACE AV
	0		REVISION ET CLIM
	0		PLAQUETTES AV RPLT
16/09/2022	12.580	NORAUTO SAS (PRODUIT SPE)	REPLACEMENT PNEUS ETE