



Expertise

Protocol number: 46605159
Order No. / Reference: 26505030
Inspection date: 17 Jul 2026

Manufacturer: Skoda
VIN: TMBJJ9NS5N8053902

Model: Kodiahq 2.0 TDI DSG Clever



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiahq 2.0 TDI DSG Clever	
Vehicle Identification number	TMBJJ9NS5N8053902
Mileage (Read)	129,873 km
First registration	30 May 2022
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Black-Magic Perleffekt
Doors / Seats	5 / 7
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	8,000 km
Last service on / at	11/2025 at 110,940 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ921443
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / ART 02910		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,350 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99V	Summer tyres on Light alloy	Falken	4mm / 4mm
2)	235/50 R19 99V	Summer tyres on Light alloy	Hankook	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Continental	4mm / 4mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 12V socket in the center console and in the trunk
- Storage compartments behind the wheel arches in the trunk
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically folding exterior mirrors including interior and driver's side mirrors with automatic dimming
- Hill start assist
- Care Connect: Proactive services (10-year term)
- Roof rails, black
- Anti-theft alarm system
- Tachometer
- Easy Start (start-stop button)
- Electric tailgate operation with comfort opening
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor
- High Beam Assist (Light Assist)
- front and rear floor mats
- Closed storage compartment on the driver's side
- Tinted windows
- Isofix anchorage on the outer rear seats including top tether
- Boot cover, roll-up and removable
- Paint finish: Solid
- LED matrix headlights and dynamic high beam assist (Light Assist)
- Steering wheel: Leather steering wheel with multifunction buttons including paddle shifters.
- Reading lights at the front of the headliner
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Multi-collision brake
- Package: Family
- Front and rear parking sensors
- Wheel arch cover
- Radio accessories: 8 speakers
- Radio accessories: SmartLink
- Tire pressure monitoring
- Wheels: RunFlat tires with Seal technology
- Heated windshield washer nozzles, front
- Headlights washer / wiper system
- Kodiaq seat belts
- Seats: Adjustable lumbar support in the front seats
- Skoda Care Connect
- Sun visor on driver and passenger side with illuminated vanity mirror
- Tablet holder in the rear
- Front door sill trims
- Variable fastening concept in the trunk
- Immobiliser
- Storage compartment on the left wheel arch
- front aero windshield wipers
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Traction control (ASR)
- Traveller Plus Assistance System (DSG)
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hydraulic brake assist (HBA)
- Grey headliner
- CLEVER decorative inlay
- Diesel particulate filter
- Third brake light
- eCall
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear
- Front radar assistant including city emergency braking function with pedestrian detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Illuminated glove compartment
- Kessy - keyless entry and start-stop system
- Climatronic air conditioning (2-zone)
- Front and rear headrests are height-adjustable.
- LED ambient lighting
- LED taillights in crystal glass look & LED license plate lights
- Steering wheel: Sport leather steering wheel with multifunction buttons including paddle shifters.
- Rear center armrest with cup holders and pass-through option
- Multifunction display in the instrument cluster, color
- Fog lights with integrated LED daytime running lights
- Parking assist
- Upholstery: Cloth
- Radio: Amundsen infotainment system (Clever)
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink
- Wheels: 19" Aronia AERO Platinum alloy wheels
- Rear seat backrest split 60:40, foldable, longitudinally adjustable, backrest angle adjustable
- Electromechanical power steering
- Seats: Heated front and outer rear seats
- Seats: Height-adjustable front seats
- Skoda Infotainment Online
- Sunshade roller blind for the rear side windows
- Sunset
- Telephone: Convenient hands-free telephone system including phone box
- Lashing eyes in the trunk
- Central locking with remote control



Extra equipment

- Swiveling trailer hitch (with electric release, including trailer stabilization)
- Climatronic air conditioning (3-zone) (fully automatic, separately adjustable for driver, front passenger and rear seats)
- Proactive occupant protection including rear side airbags
- Seats: 3rd row of seats (7-seater), cargo cover in the trunk
- Seats: Folding tables on the front seatbacks
- Phone: USB charging port (Type-C) on the interior mirror
- 360° surround view camera (area view) including reversing camera
- Roof rails, anodized (including chrome trim strips on the side windows)
- Paint finish: Metallic / Pearl effect
- Package: Business Columbus (Clever) (Columbus dynamic radio navigation system - Capacitive 9.2" color display - Digital instrument cluster (virtual cockpit) - 230 V socket and USB port (Type-C) - Acoustic glazing in the front doors - Luggage net partition - Infotainment Online (3-year subscription))
- Windscreen, wirelessly heated

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Equipment	Tirefit filler - Expired - Replace
3	Side panel - rear right side	Side panel - Scratch(es) - Smart repair
4	Wheel / tyres	Tyre - rear right side (Flanke,nicht fahrbereit) - Damaged - Replace
5	Rear bumper	Rear bumper - Scratched - Paint
6	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint
7	Door - front right side	Door - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Interior	Interior - Soiled - No deduction
3	2nd wheel set	1 tyre - Damaged - No deduction
4	Door - rear left side	Door - Scratch(es) - No deduction
5	Side panel - rear left side	Side panel - Scratch(es) - No deduction
6	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side - left, Provided by user / customer, from 6 Sept 2022	583,92 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation

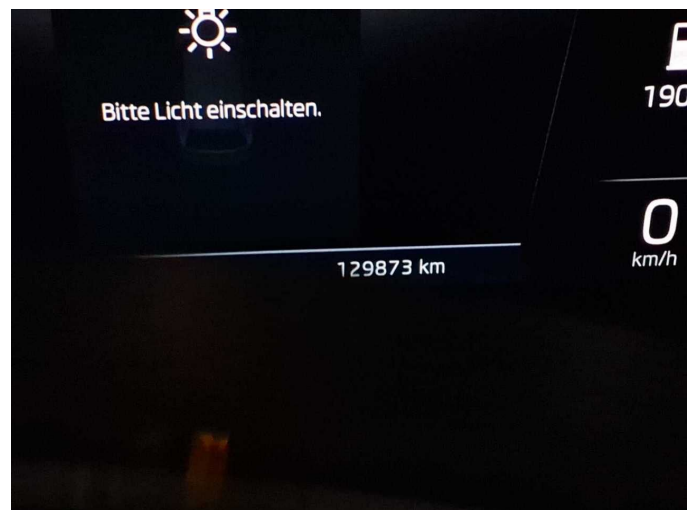


Figure 16: Misc.

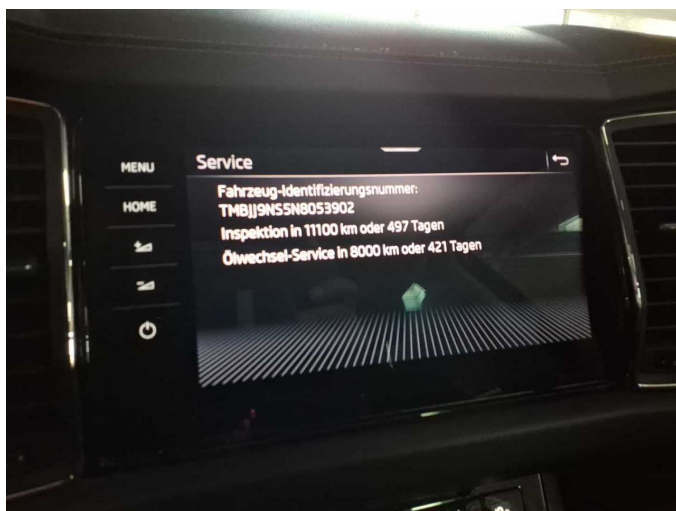


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

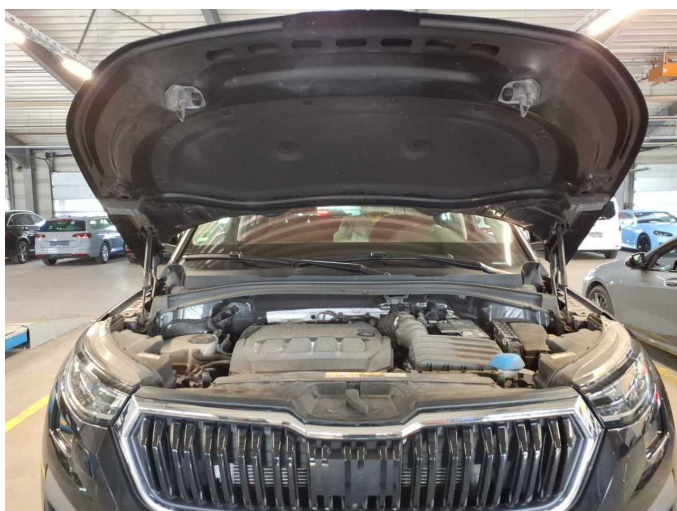


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

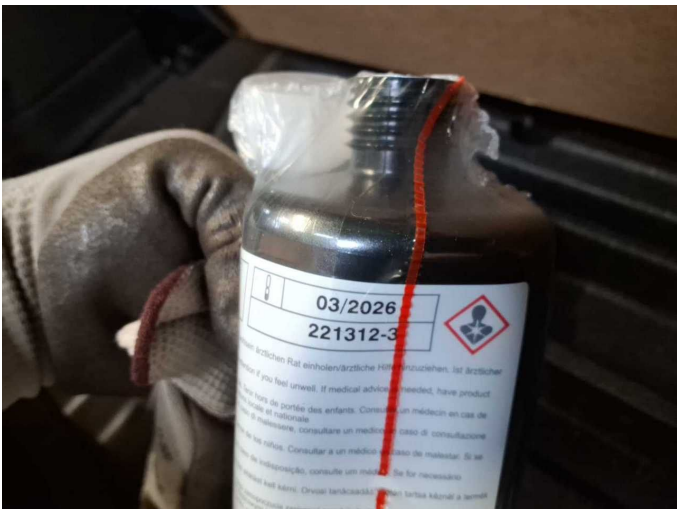

Damage 2: Equipment: Tirefit filler - Expired - Replace



Damage 3: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 4: Wheel / tyres: Tyre - rear right side (Flanke, nicht fahrbereit) - Damaged - Replace



Damage 4: Wheel / tyres: Tyre - rear right side (Flanke, nicht fahrbereit) - Damaged - Replace




Damage 5: Rear bumper: Rear bumper - Scratched - Paint




Damage 5: Rear bumper: Rear bumper - Scratched - Paint



Damage 5: Rear bumper: Rear bumper - Scratched - Paint

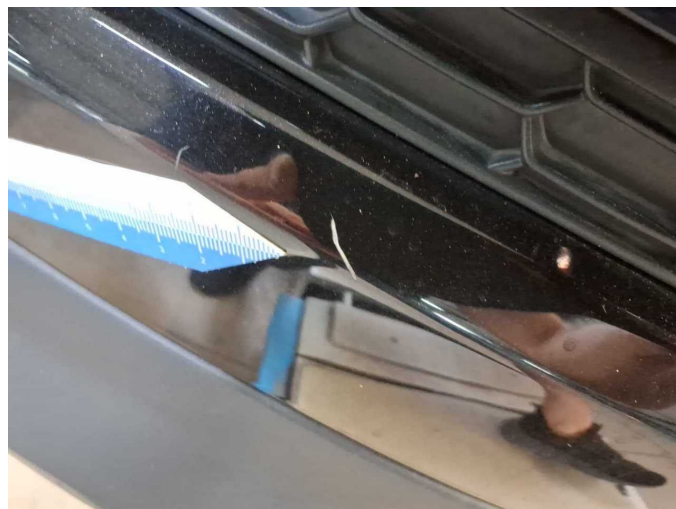

Damage 5: Rear bumper: Rear bumper - Scratched - Paint

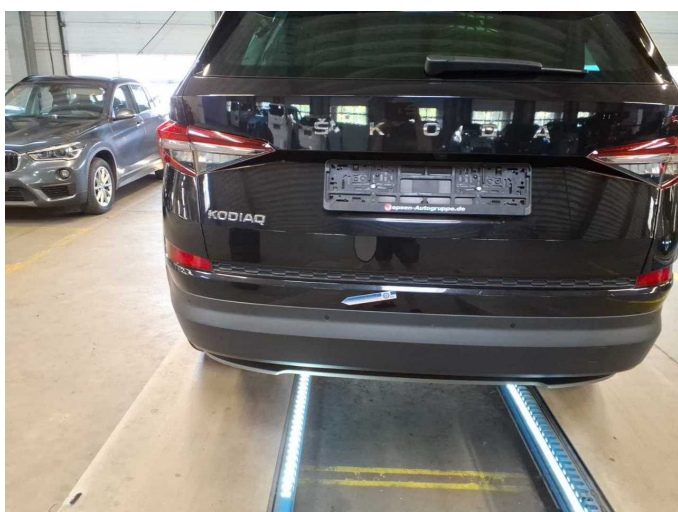

Damage 5: Rear bumper: Rear bumper - Scratched - Paint



Damage 5: Rear bumper: Rear bumper - Scratched - Paint



Damage 5: Rear bumper: Rear bumper - Scratched - Paint



Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint




Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint




Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint




Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

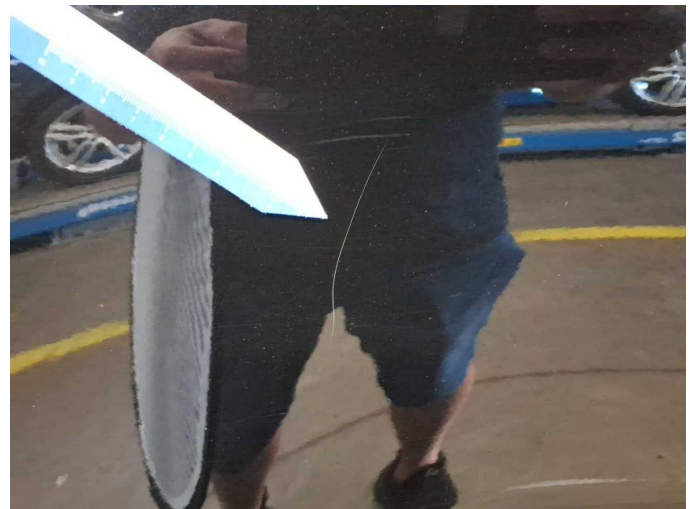

Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

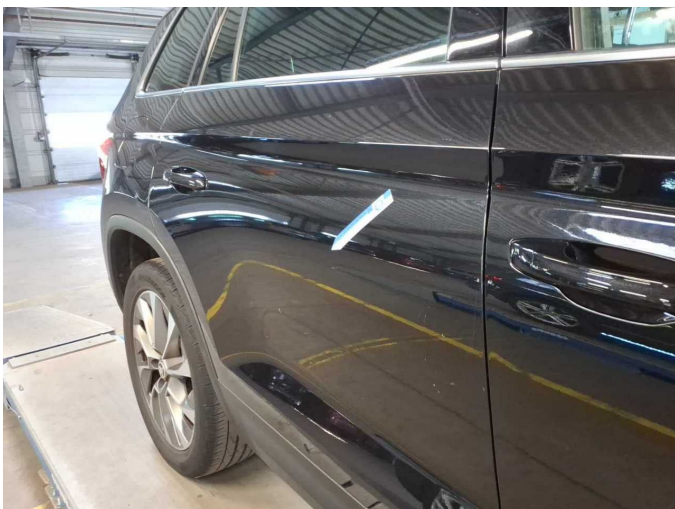

Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

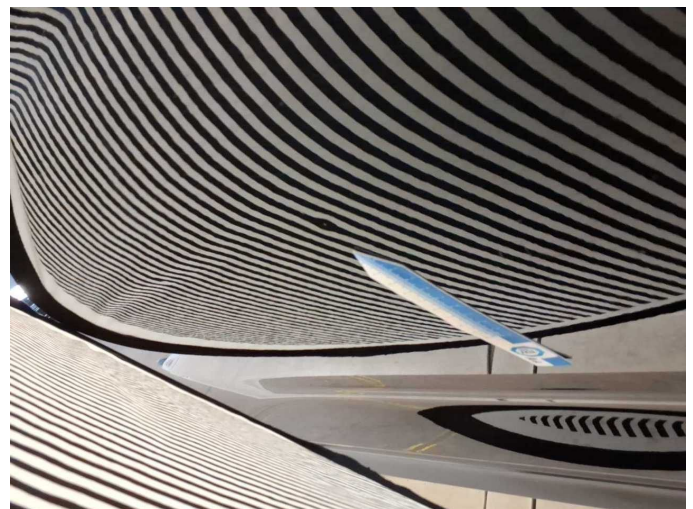

Damage 6: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 7: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 7: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 7: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 7: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 7: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Wear and tear 3: 2nd wheel set: 1 tyre - Damaged - No deduction



Wear and tear 3: 2nd wheel set: 1 tyre - Damaged - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJJ9NS5N8053902
Hersteller / Modell: SKODA SKODA Kodiaq 2.0 TDI DSG Clever

Datum	KM-Stand	Beschreibung
18.02.2026	118.777	Reparatur Sonstiges; Systemtest/Eigendiagnose
26.11.2025	110.940	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
10.09.2025	104.039	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Systemtest/Eigendiagnose
21.05.2025	93.616	AU
20.01.2025	83.074	Batterie ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
19.03.2024	55.417	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
07.02.2024	52.514	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Wartung Sonstiges
24.05.2023	27.108	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges