



Expertise

Protocol number: 46467035
Order No. / Reference: 26535100
Inspection date: 9 Jul 2026

Manufacturer: Volvo	Model: V90 T6 Recharge AWD Geartronic Inscription Expression
VIN: YV1PWH1VDN1182977	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo V90 T6 Recharge AWD Geartronic Inscription Expression	
Vehicle Identification number	YV1PWH1VDN1182977
Mileage (Read)	103,275 km
First registration	28 Jun 2022
Number of holders	1
Power / Engine displacement	186 kw / 1,969 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Onyx Schwarz-Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black-Anthracite
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	9 Tag(e)
Last service on / at	07/2025 at 78,336 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ550365
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	9101 / BSB 00014		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,610 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100W	Summer tyres on Light alloy	Michelin	3mm / 3mm
2)	245/45 R18 100W	Summer tyres on Light alloy	Michelin	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100V	Winter tyres on Light alloy	Dunlop	6mm / 6mm
2)	245/45 R18 100V	Winter tyres on Light alloy	Dunlop	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 04/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- ABS - Anti-lock Braking System (with EBV)
- Airbag, passenger airbag can be deactivated
- Aluminum loading sill protector in the luggage compartment
- Attachment system for carrier bags in the luggage compartment
- Automatic climate control (with separate temperature control for driver and front passenger and additional air vents for the rear seats)
- Automatic emergency braking (emergency braking mechanism after the deployment of the airbags or seatbelt pretensioners to prevent secondary accidents)
- Automatic tailgate (electric)
- Cargo area roller blind (electric)
- Charging box under the cargo floor
- Child safety lock (manual, rear doors)
- Chrome applications in the front bumper
- Chrome window surround
- CleanZone air quality system (with activated carbon filter, automatic recirculation and pre-ventilation of the interior when the vehicle is unlocked)
- Digital instrumentation 2nd generation (Full graphic 12.3" driver display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Driver and front passenger airbags with two-stage deployment system (driver's side knee airbag - side airbags for driver and front passenger and head/shoulder airbags (IC) for all occupants)
- Driver Awareness (Blind Spot Information System (BLIS), blind spot assist including lane change warning for rapidly approaching vehicles including steering intervention if warning signals are ignored - Cross Traffic Alert (CTA) - cross traffic warning with braking intervention - warning of vehicles, cyclists and pedestrians approaching from the side - rear impact mitigation, preventive protection in case of impending rear collisions by rapid illumination of the hazard warning lights, braking of the vehicle and tightening of the seat belts)
- Electrically adjustable exterior mirrors
- Electrically folding exterior mirrors
- Electronic differential lock
- Electronic Stability Control (ESC)
- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated at speeds below 10 km/h)
- Exterior mirror caps in car color
- First aid kit and warning triangle
- Fuel filler neck with misfuelling protection
- Glazing: Acoustic glazing for the side windows (UV and burglar-resistant laminated glass panes)
- Heated exterior mirrors and rear window (automatic)
- High-gloss black louvers in the center console
- Illuminated makeup mirror for driver and front passenger
- Immobiliser
- Intelligent driver information system (delays incoming calls or vehicle information in dangerous situations)
- Acoustic Vehicle Alerting System (AVAS) (acoustic pedestrian/cyclist protection through artificially generated driving noises in the speed range up to 20 km/h)
- Active safety belts with belt tensioners
- Aluminum door sill plates with Recharge lettering at the front and rear
- Aluminum roof rails (integrated)
- Android infotainment system (9" touchscreen (22.9 cm diagonal) - Google Services (includes Google Maps with navigation, Google Assistant, Google Play Store and unlimited data for the first 4 years) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - 2 USB ports (compatible with Apple iPod/iPhone/iPad)
- Brake energy recuperation
- Central locking with two remote controls and integrated emergency key (including automatic locking of the doors while driving (can be deactivated) - comfort opening/closing of the side windows and, if applicable, sunroof via remote control)
- Charging cable Schuko/Type 2 (Mode 2), 7 m length, single-phase, 10 A (for connection to a standard 230-volt household socket)
- Chrome applications on the rear of the vehicle
- Chrome trim strip in the door sill area with Recharge lettering
- Condensation sensor (for automatic activation of the defroster function)
- Drive Mode (driving mode settings for engine, transmission, steering, brakes and suspension)
- Driver Alert - Attention Warning
- Driver Assistance (Adaptive Cruise Control - Emergency Stop Assist (automatic emergency stop system if warnings are ignored due to the driver's failure to steer, brake and accelerate, including activation of the hazard warning lights and automatic braking to a standstill) - Pilot Assist (lane guidance assistant with adaptive cruise control up to speeds of 130 km/h))
- Electric parking brake
- Electric windows front and rear (with auto-down and auto-up function)
- Front center armrest including cup holder
- Front grille in waterfall design in chrome
- Front seat belt height adjustment
- Front seat heating
- Headrests (5)
- Hill Start Assist (HSA)
- Inlays: Checkered aluminum inlay
- Interior lighting (headliner - front and rear reading lights - individually dimmable - front footwell - glove compartment - luggage compartment)
- ISOFIX anchors for the outer rear seats
- Keyless Drive (electronic access system) (with sensor-controlled tailgate, illuminated door handles and puddle lights)
- Lashing eyes in the luggage compartment (foldable)



- Interior and exterior mirrors with automatic dimming function
- LED headlights "Thor's Hammer" (with high beam assist and integrated LED daytime running lights)
- LED turn signals integrated into the exterior mirrors
- On-board computer with vehicle control functions
- Outdoor temperature display
- Radio accessories: Two USB-C ports on the back of the center console
- Radio accessory: Roof antenna (fin)
- Safety Assistance (Automatic emergency braking system with vehicle, cyclist and pedestrian detection including intersection and emergency braking assistant - Connected Safety - Distance warning (only in conjunction with head-up display) - Driver Alert - Attention warning - Variable speed limiter - Cruise control - Lane Keeping Aid (LKA) - Active lane keeping assist - Oncoming Lane Mitigation - Ready to Drive notification - Road Edge Detection - Road Sign Information (RSI) - Traffic sign recognition)
- Seats: Rear seat backrests can be folded down in a 40/60 split or completely.
- Start/Stop technology
- Steering wheel: Multifunction buttons on the steering wheel
- Textile floor mats (front and rear)
- third brake light
- Transmission: 8-speed Geartronic (automatic transmission)
- Upholstery: Leather/leatherette comfort seats (including rear center armrest)
- Warning tone/indicator when seat belts are not fastened (for all seats)
- Wheels: 18" 10-spoke alloy wheels, diamond cut/high-gloss black (8 J x 18 with 245/45 R18 tires)
- Wheels: Tire pressure monitoring system (passive) (with tire-specific pressure loss warning)
- WHIPS whiplash protection system (including immersion protection on all seats and energy-absorbing front seat cushions)
- Luggage compartment lid release via remote control or from the driver's seat
- Luggage compartment partition net
- Parking ticket holder
- Pollen filter
- Power outlet: 12-volt connection in the luggage compartment
- Radio accessories: Subwoofer
- Radio: Audio system High Performance Sound (330 watts of power - 10 speakers)
- Rain sensor including automatic light function
- Rear headrests foldable, electrically
- Rear parking assist with automatic braking intervention (rear)
- rear window wiper
- Roof edge spoiler
- Run-off Road Protection (preventive protection system in case of unintentional leaving the road or impending rollovers, including door unlocking)
- Safety braking system with disc brakes all around (internally ventilated) (automatic brake system pre-tensioning, brake assist and automatic hold function)
- Safety steering column (adaptive)
- Seats: Driver and front passenger seats height adjustable (electrically) (including manual tilt adjustment for the driver's seat)
- Seats: Lumbar support (2-way, electrically adjustable) for driver and front passenger seats
- Speed-sensitive power steering
- Steering wheel adjustable for height and reach
- Steering wheel heating
- Trailer Stability Assist (TSA) - Preparation for trailer stability control
- Volvo On Call (alerting the Volvo On Call service center at the touch of a button, as well as additional convenience services via the smartphone app, such as locking and unlocking the vehicle, direct start of pre-conditioning of the interior and retrieval of the high-voltage battery charge status)
- Wheel accessories: Tire sealant (with 12-volt compressor (maximum speed 80 km/h))

Extra equipment

- Towbar (semi-electric)
- Package: Parking Assistance (front and rear parking aid - reversing camera)
- Paint finish: Metallic paint
- Side and rear windows tinted (from the B-pillar back)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - Loss in value
3	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
4	Mudguard - left side	Mudguard - left side - Scratch(es) - Paint
5	Wheel / tyres	Alloy rim - front left side - Scratched - Replace
6	Rear bumper	Rear bumper - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Side panel - rear left side	Side panel - dent(s) - No deduction
2	Door - front right side	Door - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - charging cable (Mode 2)

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

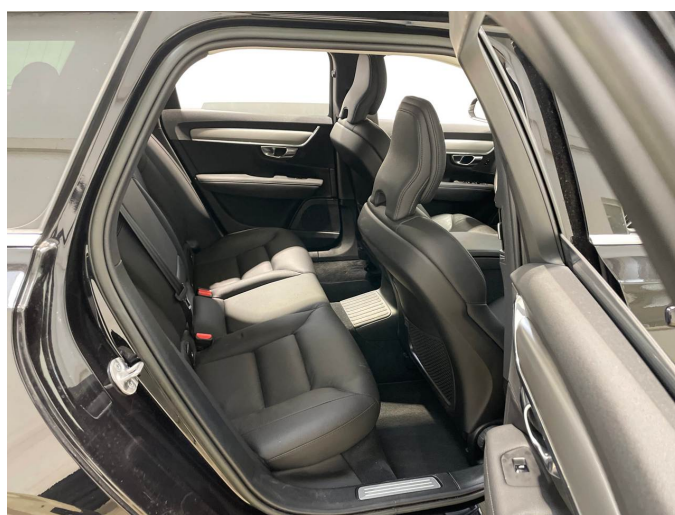


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

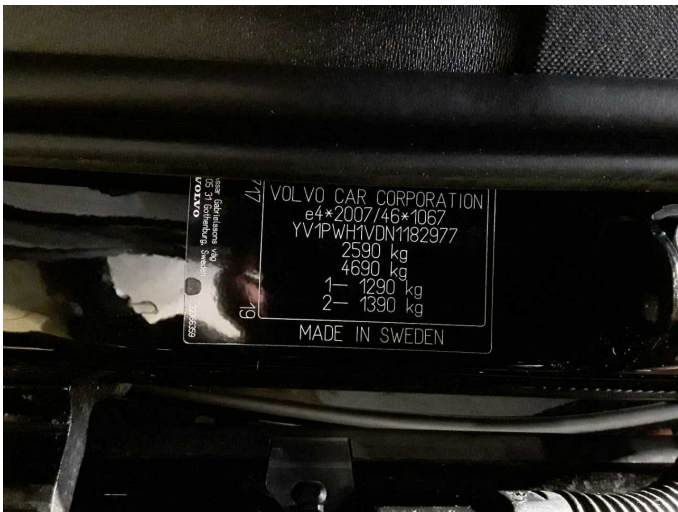


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

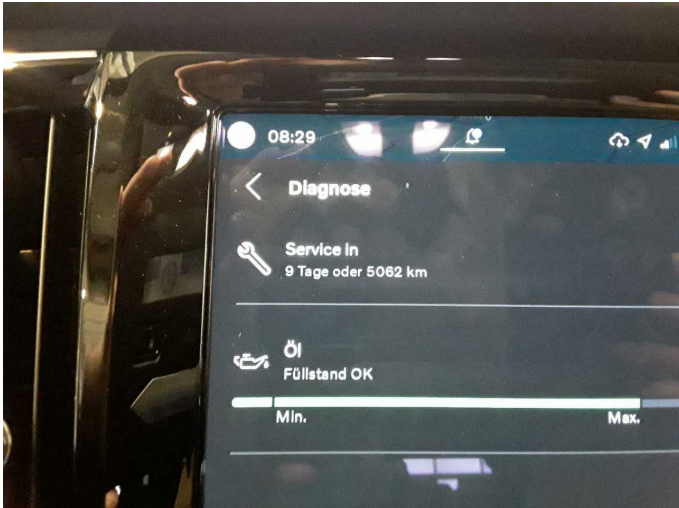


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

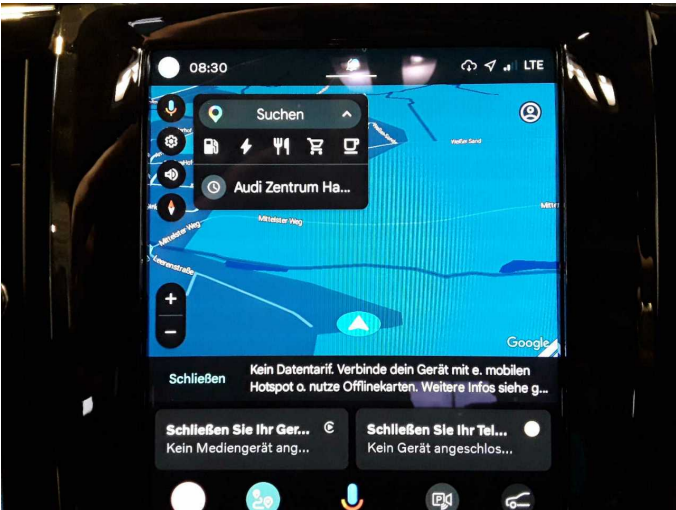


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

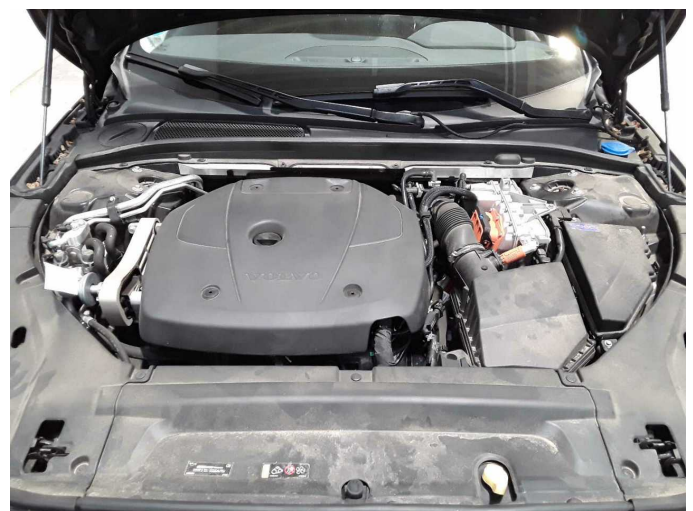


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 2: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 4: Mudguard - left side: Mudguard - left side - Scratch(es) - Paint

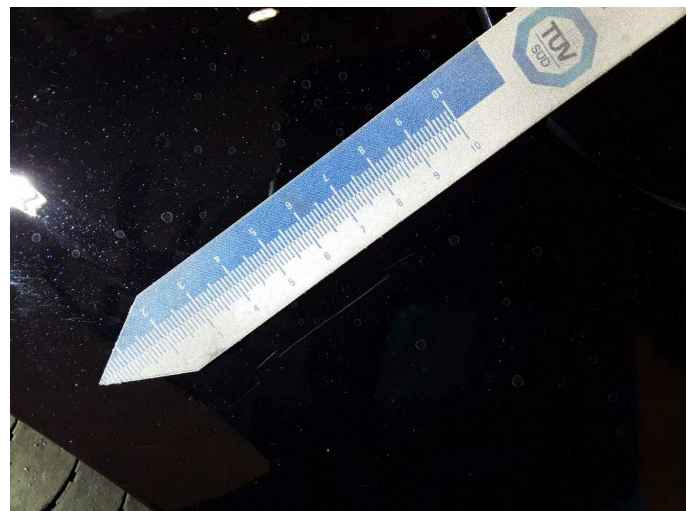

Damage 4: Mudguard - left side: Mudguard - left side - Scratch(es) - Paint



Damage 5: Wheel / tyres: Alloy rim - front left side - Scratched - Replace

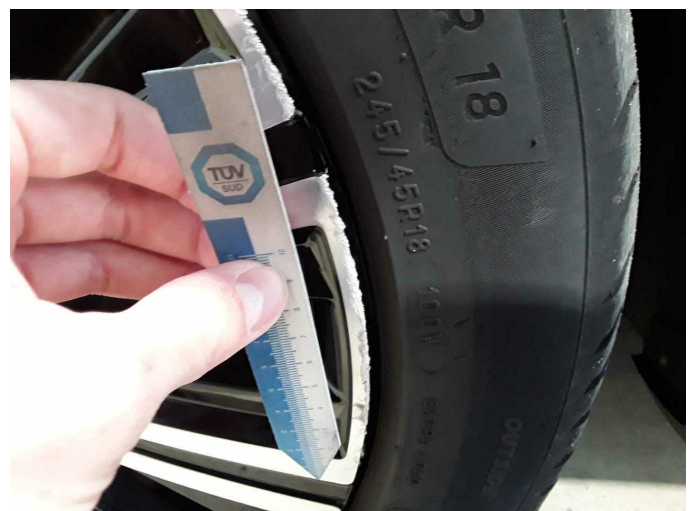

Damage 5: Wheel / tyres: Alloy rim - front left side - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front left side - Scratched - Replace



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1PWH1VDN1182977

Hersteller / Modell: VOLVO VOLVO V90 T6 Recharge AWD Geartronic Inscription
Expression

Datum	KM-Stand	Beschreibung
05.12.2025	85.379	Systemtest/Eigendiagnose
21.07.2025	78.336	AU; Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
06.08.2024	57.768	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges; Zündkerzen ern
07.07.2023	28.671	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges