



Expertise

Protocol number: 46619533
Order No. / Reference: 26678040
Inspection date: 15 Jul 2026

Manufacturer: Volvo

Model: XC60 T6 AWD Recharge Geartronic Inscription

VIN: LYVUZH1VDNB038295



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC60 T6 AWD Recharge Geartronic Inscription	
Vehicle Identification number	LYVUZH1VDNB038295
Mileage (Read)	79,087 km
First registration	10 May 2022
Number of holders	1
Fuel type	Hybr.B/E ext.aufl
Engine displacement / Cylinder	1,969 ccm / 4
Power	186 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Onyx Schwarz-Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Anthracite-Black
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	40 Tag(e)
Last service on / at	09/2025 at 66,205 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF857579
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	9101 / BRS 00014		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,660 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/45 R20 105V	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	255/45 R20 105V	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105H	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	235/55 R19 105H	Winter tyres on Light alloy	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ABS - Anti-lock Braking System (with EBV)
- Airbag, side airbags for driver and front passenger and head/shoulder airbags (iC) for all occupants
- Android infotainment system (9" touchscreen (22.9 cm diagonal) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - 2 USB-C ports (compatible with Apple iPod/iPhone/iPad))
- Automatic emergency braking (emergency braking mechanism after the deployment of the airbags or seatbelt pretensioners to prevent secondary accidents)
- Central locking with two remote controls and integrated emergency keys (automatic locking of doors while driving (can be deactivated) - comfort opening/closing of side windows and, if applicable, sunroof via remote control - panic function integrated into the remote control)
- Charging cable Schuko/Type 2 (Mode 2) (7 m length, 1-phase, 10A (for connection to a standard 230-volt household socket))
- Chrome window surround
- CleanZone air quality system with activated carbon filter (automatic recirculation and pre-ventilation of the interior when the vehicle is unlocked)
- Drive Mode (driving mode settings for engine, transmission, steering, brakes and suspension: Hybrid, Pure, AWD, Off Road, Power)
- Driver and passenger side airbags with two-stage deployment system
- Electrically folding exterior mirrors
- Electronic differential lock
- First aid kit and warning triangle
- Front center armrest with integrated storage compartment and cup holders
- Glazing: Colored glazing
- Google Services with navigation (navigation via Google Maps, Google Assistant, Google Play Store and unlimited data (includes data for map updates, app downloads and streaming services) for the first 4 years)
- Headrests (5) front and rear
- Hill Start Assist (HSA)
- Illuminated makeup mirror for driver and front passenger
- Immobilizer (deactivation of the high-voltage battery in the event of a collision)
- Intelligent driver information system (delays incoming calls or vehicle information in dangerous situations)
- ISOFIX mounting for the outer rear seats
- Keyless Drive (electronic access system) with sensor-controlled tailgate, illuminated door handles and puddle lights
- Lashing eyes in the luggage compartment (foldable)
- LED headlights "Thor's Hammer" with high beam assist and integrated LED daytime running lights
- LED turn signals integrated into the exterior mirrors
- Outdoor temperature display
- 12-volt connection at the front
- 12-volt socket in the luggage compartment
- Acoustic Vehicle Alerting System (AVAS) (Acoustic pedestrian/cyclist protection through artificially generated driving noises in the speed range up to 20 km/h)
- Airbag, driver's knee airbag
- All-wheel drive (AWD) (depending on the driving mode)
- Aluminum door sill plates with Recharge lettering, front
- Aluminum roof rails (integrated)
- Ambient lighting (Extended interior lighting with: - Ambient lighting front and rear - Exit lights front and rear - Work light on the tailgate - Illuminated door pockets and door openers front and rear - Rear footwell lighting - Rear reading lights)
- Automatic climate control with separate temperature control for driver and front passenger (and additional air vents for the 2nd row of seats (integrated in the B-pillar))
- Automatic tailgate (electric)
- Cargo area roller blind
- Charging box under the cargo floor
- Child safety lock (rear doors)
- Chrome applications in the front bumper
- Chrome applications on the rear of the vehicle
- Chrome trim strip in the door sill area with Recharge lettering
- Dashboard in leather look with contrasting stitching
- Digital instrumentation 2nd generation (Full graphic 12.3" driver display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Electric parking brake
- Electric windows front and rear (with auto-down and auto-up function)
- Electrically adjustable and heated exterior mirrors
- Electronic Stability Control (ESC)
- Fog sensor for automatic activation of the defroster function
- Front grille in waterfall design in chrome
- Gearshift lever made of Swedish crystal glass by Orrefors
- Heated rear window
- Hill Descent Control (HDC)
- Interior and exterior mirrors automatically dimming
- Interior lighting (headliner, front reading lights, front ambient lighting, front footwell, storage compartment behind center console, glove compartment and luggage compartment)
- Luggage compartment partition net
- On-board computer (with vehicle control functions)
- Package: Winter Package (front seat heating - steering wheel heating)
- Phone: Inductive smartphone charging system (Wirelessly charges smartphones that support the Qi standard on a charging pad)
- Radio accessories: Digital radio reception (DAB+)
- Radio accessories: Subwoofer
- Rain sensor



- Panoramic glass sliding sunroof with lifting function (electric) (with integrated, continuously adjustable sunshade)
- Passenger side airbag can be deactivated
- Preparation for Trailer Stability Assist (TSA)
- Radio accessories: Two USB-C ports on the back of the center console
- Radio: Audio system High Performance Sound (330 watts of power - 10 speakers)
- Rear headrests foldable (electrically)
- Rear parking assist with automatic braking intervention (rear)
- Run-off Road Protection (preventive protection system in case of unintentional leaving the road or impending rollovers including pre-activation of the seat belt tensioners, deactivation of the battery and door unlocking)
- Safety Assistance (Automatic emergency braking system with detection of vehicles, cyclists, pedestrians and large animals including intersection braking assistant and emergency braking assistant - Connected Safety - Driver Alert - Attention warning - Variable speed limiter - Cruise control - Lane Keeping Aid (LKA) - Active lane keeping assistant - Oncoming Lane Mitigation - Ready to Drive notification - Road Edge Detection - Road Sign Information (RSI) - Traffic sign recognition)
- Seat belts (active seat belts with belt tensioners, pre-activation of the belt tensioners - belt height adjustment at the front - warning tone / indicator when seat belts are not fastened (for all seats))
- Seats: Driver's seat electrically adjustable (with memory function for driver's seat and exterior mirror settings (stored in the remote control))
- Start/Stop technology
- Third brake light (emergency brake lights (brake lights flash rapidly in case of heavy deceleration; hazard warning lights are automatically activated at speeds below 10 km/h))
- Rear center armrest (foldable) (with cup holders)
- Rear seats in a 40/60 split or completely foldable with pass-through function
- Roof edge spoiler
- Safety braking system with disc brakes all around (internally ventilated) (automatic brake system pre-tensioning, brake assist and automatic hold function)
- Seats: Adjustable (electric) leg rest for driver and front passenger seats
- Seats: Driver and front passenger seats height adjustable (electrically) (including manual tilt adjustment for the driver's seat)
- Seats: Lumbar support (4-way electrically adjustable) for driver and front passenger seats
- Speed-sensitive power steering
- Stainless steel loading sill protector in the luggage compartment
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel
- Tire pressure monitoring system (with tire-specific pressure loss warning)
- Transmission: 8-speed Geartronic automatic transmission
- Upholstery: Leather/leatherette comfort seats (including rear center armrest)
- Volvo On Call (alerting the Volvo On Call service center at the touch of a button, as well as additional convenience services via the smartphone app, such as locking and unlocking the vehicle, direct start of pre-conditioning of the interior and retrieval of the high-voltage battery charge status)
- Wheels: Tire sealant (Incl. 12-volt compressor, maximum speed 80 km/h)
- Whiplash Protection System (WHIPS) (including immersion protection on all seats and energy-absorbing front seat cushions)



Extra equipment

- Towbar (semi-electric)
- Chassis: Adaptive air suspension with Four-C technology (Continuously Controlled Chassis Concept) with adjustable modes Comfort, Eco, Dynamic, Off Road including automatic leveling and entry/rear lowering (4/5 cm)
- Head-up display: Graphic projection of driving information onto the windshield
- Package: Light Package (Headlight cleaning system - Full LED headlights "Thor's Hammer" Active High Beam with extended high beam, dynamic cornering lights, intelligent high beam assistant with adaptive headlight range control and integrated LED daytime running lights)
- Radio: Audio system High Performance Sound Pro by Harman/Kardon (600 watts of power - 14 speakers - Fresh Air - Subwoofer - Dirac Unison - Sound optimization)
- Wheels: 20" alloy wheels, 5-Y-spoke design, diamond cut/graphite look (tires 255/45 R20 with rims 8 x 20")
- Auxiliary heater with timer (fuel-operated)
- Glazing: Side and rear windows tinted (from the B-pillar back)
- Driver Assistance (Adaptive Cruise Control - Emergency Stop Assist (automatic emergency stop system if warnings are ignored due to the driver's failure to steer, brake and accelerate, including activation of the hazard warning lights and automatic braking to a standstill and emergency call via Volvo On Call) - Pilot Assist (lane guidance assistant up to speeds of 130 km/h))
- Paint finish: Metallic paint
- Package: Parking Assistance Package (front and rear parking aid - reversing camera)
- Package: Seat Comfort Package (Electrically adjustable passenger seat - memory function for passenger seat)
- Package: Xenium Package (High Performance Sound Pro audio system by Harman/Kardon - 600 watts of power - 14 speakers - Fresh Air Subwoofer - Dirac Unison sound optimization; Advanced air quality system with fine dust filtration according to PM2.5 air quality standard)
- Seats: Child seats (2-stage) integrated into the outer rear seats

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Door - front left side	Door edge - Scratch(es) - Smart repair
3	Trim / covers	Door trim - rear right side - Scratch(es) - Smart repair
4	Sill - right side	Sill - Scratch(es) - Smart repair
5	Side panel - rear left side	Sill - Scratch(es) - Smart repair
6	Side panel - rear right side	Sill - Scratch(es) - Smart repair
7	Seat - rear	Seat upholstery - 3 seater bench (Druckstelle Reifen und verschmutzt; Mehrkosten möglich) - Smart repair
8	Front bumper	Grille - Scratch(es) - Replace
9	Wheel / tyres	Alloy rim - rear left side - Scratched - Replace
10	Wheel / tyres	Alloy rim - front right side - Scratched - Replace
11	Vehicle glazing	Windscreen - Stone chips - Replace



Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - No deduction
2	Door - rear left side	Door - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Log book (+ Unterlagen)

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

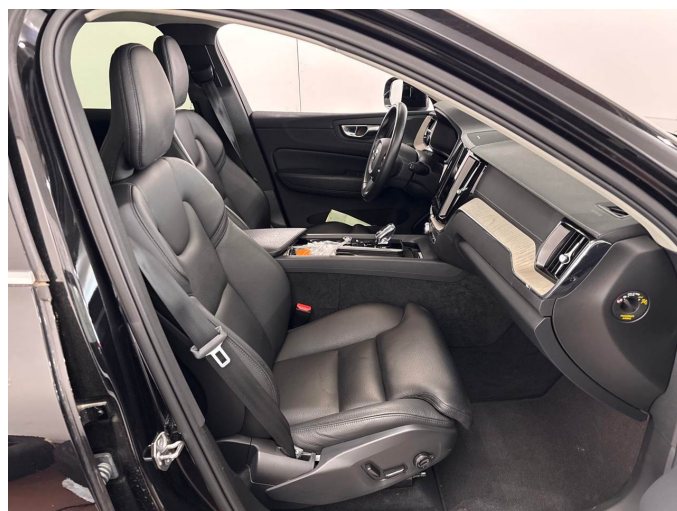


Figure 5: Interior - front

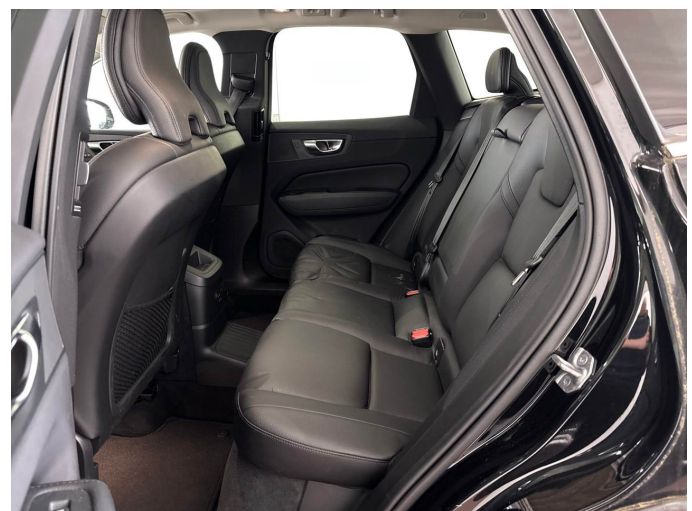


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

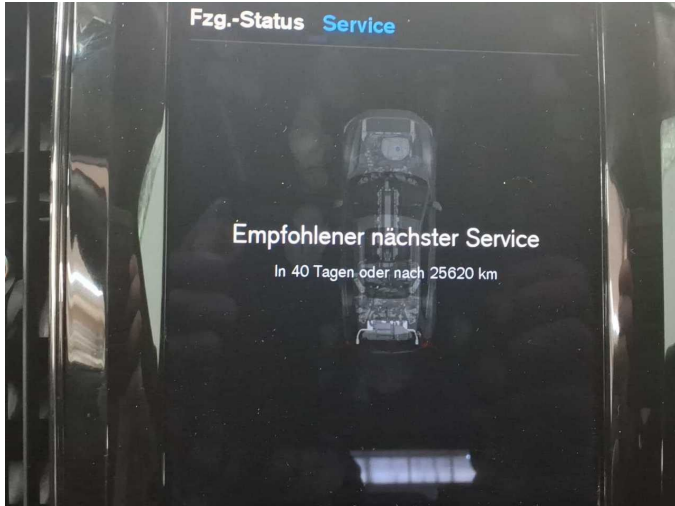


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation

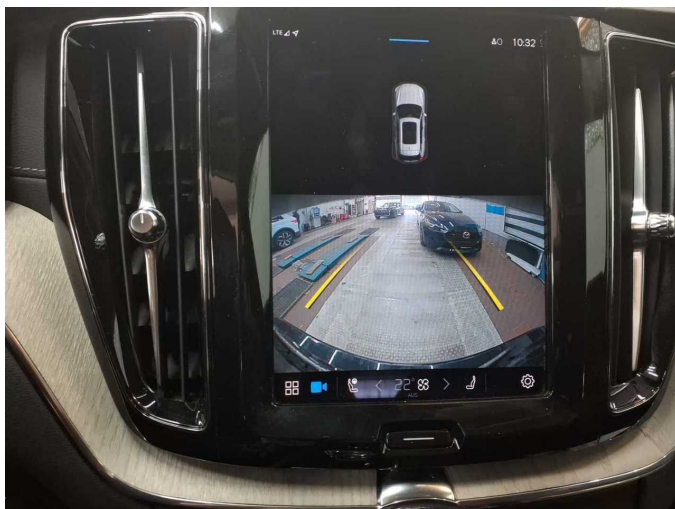


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 3: Trim / covers: Door trim - rear right side - Scratch(es) - Smart repair




Damage 3: Trim / covers: Door trim - rear right side - Scratch(es) - Smart repair




Damage 4: Sill - right side: Sill - Scratch(es) - Smart repair




Damage 4: Sill - right side: Sill - Scratch(es) - Smart repair

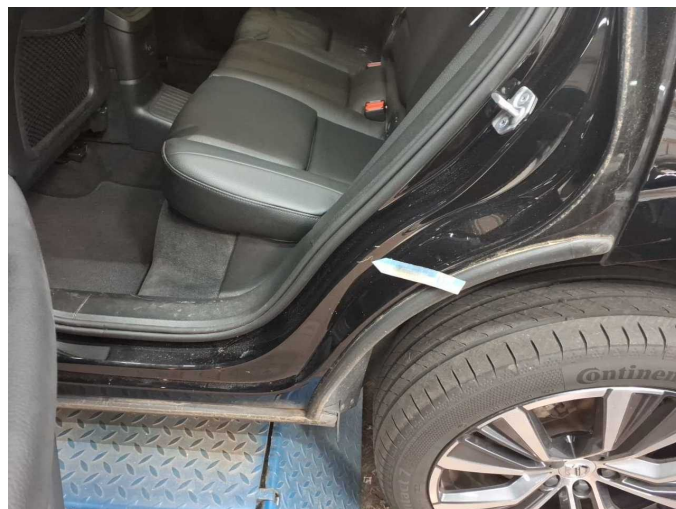

Damage 5: Side panel - rear left side: Sill - Scratch(es) - Smart repair

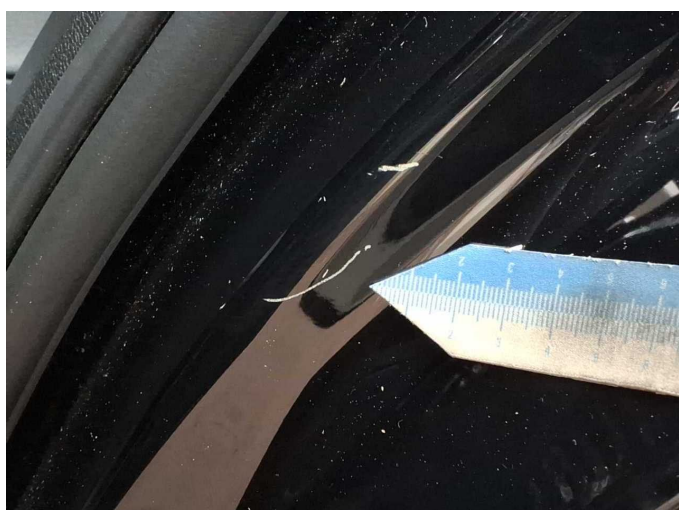


Damage 5: Side panel - rear left side: Sill - Scratch(es) - Smart repair

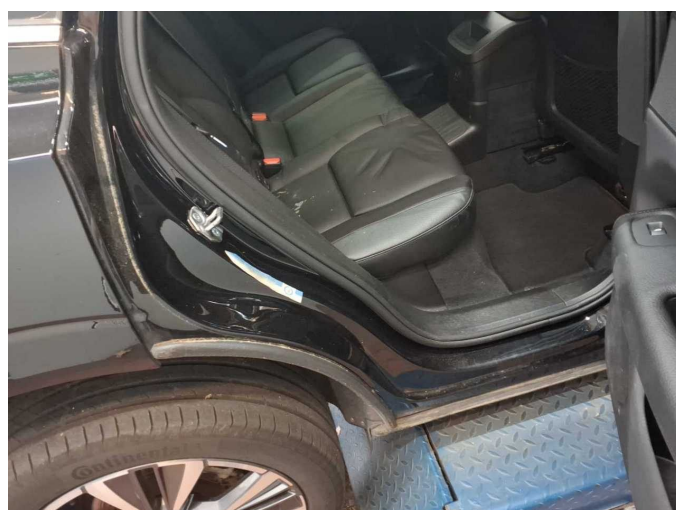

Damage 6: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 6: Side panel - rear right side: Sill - Scratch(es) - Smart repair

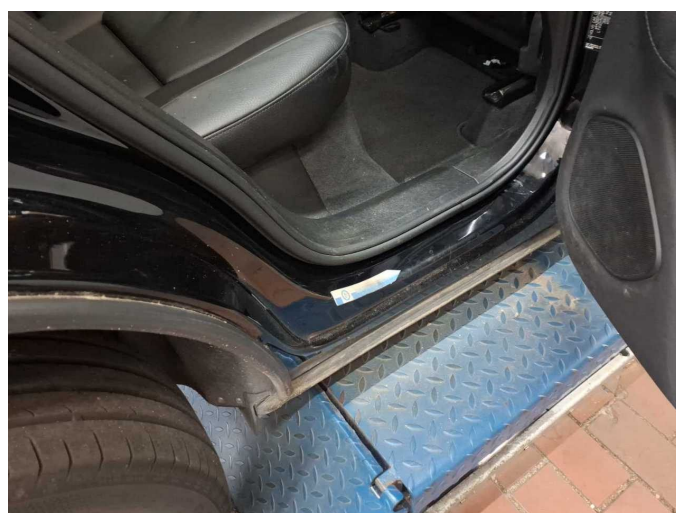

Damage 6: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 6: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 7: Seat - rear: Seat upholstery - 3 seater bench (Druckstelle Reifen und verschmutzt; Mehrkosten möglich) - Smart repair




Damage 7: Seat - rear: Seat upholstery - 3 seater bench (Druckstelle Reifen und verschmutzt; Mehrkosten möglich) - Smart repair




Damage 7: Seat - rear: Seat upholstery - 3 seater bench (Druckstelle Reifen und verschmutzt; Mehrkosten möglich) - Smart repair



Damage 7: Seat - rear: Seat upholstery - 3 seater bench (Druckstelle Reifen und verschmutzt; Mehrkosten möglich) - Smart repair

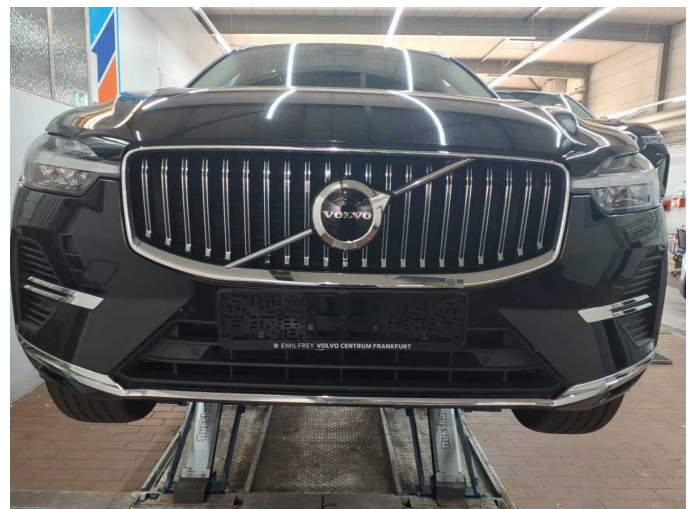

Damage 8: Front bumper: Grille - Scratch(es) - Replace

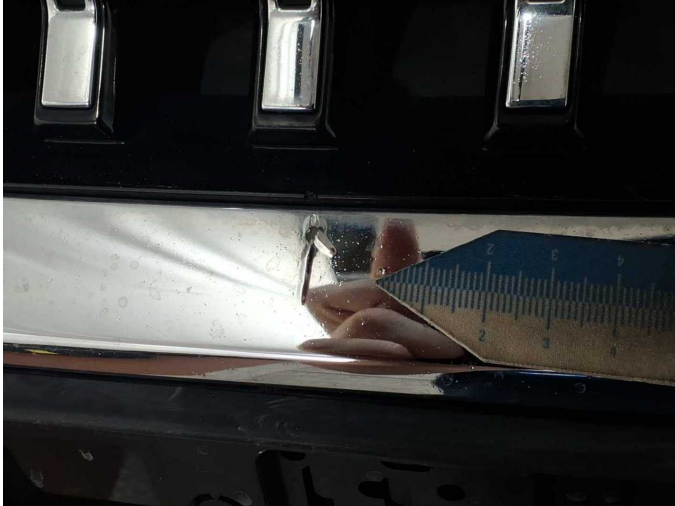

Damage 8: Front bumper: Grille - Scratch(es) - Replace




Damage 9: Wheel / tyres: Alloy rim - rear left side - Scratched - Replace



Damage 9: Wheel / tyres: Alloy rim - rear left side - Scratched - Replace



Damage 9: Wheel / tyres: Alloy rim - rear left side - Scratched - Replace

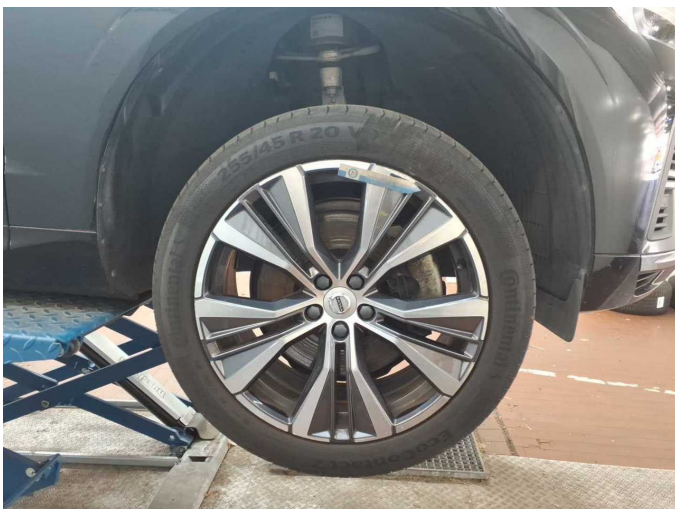

Damage 10: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 10: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 10: Wheel / tyres: Alloy rim - front right side - Scratched - Replace




Damage 11: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 11: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 11: Vehicle glazing: Windscreen - Stone chips - Replace

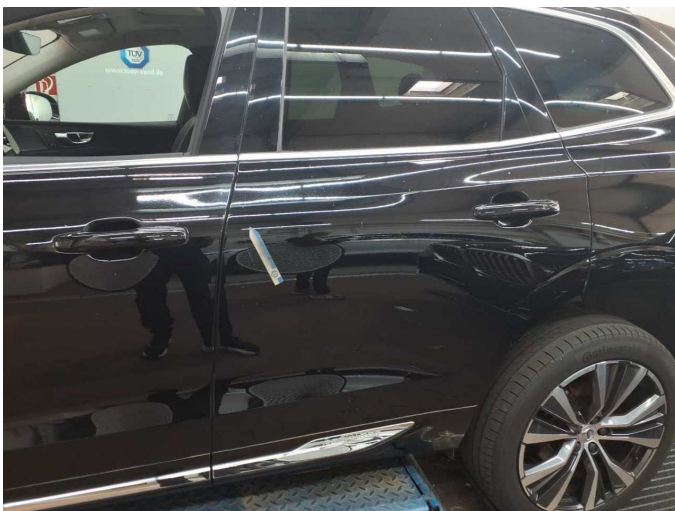

Wear and tear 2: Door - rear left side: Door - Scratch(es) - No deduction



Wear and tear 2: Door - rear left side: Door - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: LYVUZH1VDNB038295

Hersteller / Modell: VOLVO VOLVO XC60 T6 AWD Recharge Geartronic Inscription

Datum	KM-Stand	Beschreibung
02.09.2025	66.205	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges; Zündkerzen ern
22.05.2025	66.205	AU
09.07.2024	45.800	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.05.2023	21.093	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges