


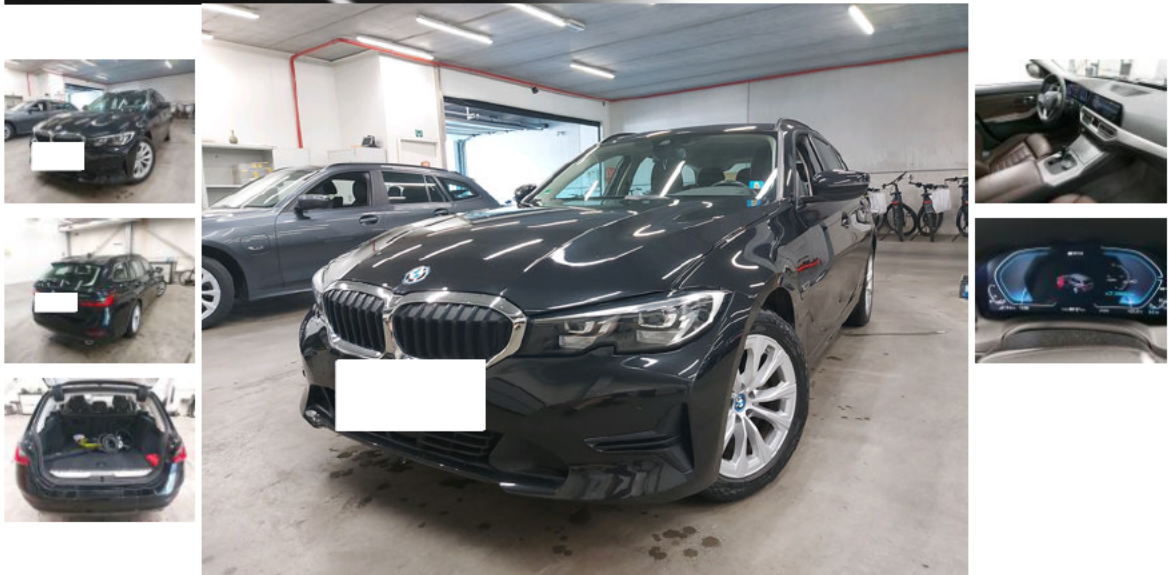

BMW 3 Touring:

Vinnumber:	WBA6N91000FM29499	Versionname:	
First Registrationdate:	4/01/2022	Fiscalpower:	
Expertise Mileage:	88187	Power Kw:	
Bodytype:		Body colour	Black
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:		Parking lot	1431
Fueltype:	Hybrid Petrol		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Seats F heated		Type of Tow bar	No Tow bar
Radio multimedia			
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Tyres

	225/50/17/92 H			
Winter tyres:	Fr.L.	Uniroyal: 5 mm	Fr.R.	Uniroyal: 5 mm
	Re.L.	Uniroyal: 5 mm	Re.R.	Uniroyal: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				225/50 R 17 92 H
Tyre size FR				225/50 R 17 92 H
Tyre size RL				225/50 R 17 92 H
Tyre size RR				225/50 R 17 92 H
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				265
Tyre make FR				265
Tyre make RL				265
Tyre make RR				265

Assistance equipment

Number of charging cables (normal)	1		
Number of charging cables (rapid charge)	1		
Total cost ex VAT			2390,03
Backrest cover FR, Scratch(es), Smart repair			116,69



Bonnet, Chemical polution, Polish

0,00



Bumper F, Broken, Replace and paint

976,52



Bumper moulding F, Broken, Replace and paint

104,09



Door RL, Dent(s), Acceptable

0,00



Door FL, Scratch(es), Acceptable

0,00



Bumper R, Dent(s) and scratch(es), Replace and paint

1059,70




Alloy rim FR, Scratch(es), Repair and paint (complete)

133,03



Wing FR, Scratch(es), Acceptable

0,00

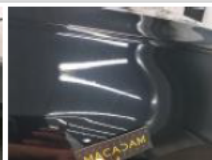

Door RR, Scratch(es), Acceptable

0,00



Wing RR, Dent(s), Acceptable

0,00



Roof, Dent(s), Acceptable	0,00
---------------------------	------

