



PEUGEOT PARTNER: FS-780-ED

Vinnumber:	VR3EFYHYCLJ770946	Versionname:	PEUGEOT PARTNER BHDI 100 S&S 100 S&S 1000KG STD ASPHALT VU [4P] bvm 5-102CH-5cv (fourgonnettesimple cabine)
First Registrationdate:	21/08/2020	Fiscalpower:	75
Expertise Mileage:	219216	Power Kw:	White
Bodytype:	Transporter	Body colour:	White
Gearbox:	MAN 5 VIT	Paint type:	Opaque
Transmission:	Front	Interior colour:	Anthracite
Fueltype:	Diesel	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Anthracite
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	2		
Number head rests:	2		
Type of rims (mounted):	Steel		
Category:	Light Commercial Vehicle		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Rear parking sensors	
Windows electric F		Sliding door right-side	
Cruise Control		Rear view camera	
Steering wheel multifunctional		Seat cover lining	Lining Other
Type of climate control	Manual climate control		

Tyres

205/60/16/96 H				
Summer tyres:	Fr.L.	Hankook: 45%	Fr.R.	Hankook: 60%
	Re.L.	Hankook: 30%	Re.R.	Hankook: 45%
Tyre profile depth FL				5.2
Tyre profile depth FR				4.4
Tyre profile depth RL				6.1
Tyre profile depth RR				5.2
Tyre size FL				205/60 R 16 96 H
Tyre size FR				205/60 R 16 96 H
Tyre size RL				205/60 R 16 96 H
Tyre size RR				205/60 R 16 96 H
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				260
Tyre make FR				260
Tyre make RL				260
Tyre make RR				260

Assistance equipment

Spare wheel	Yes	Jack	Yes
Remote ignition key, Missing, Repair/replace (lump sum)			



Gear shift lever cover, Tear, Replace



Centre console, Scratch(es), Replace



Seat cover FR, Stain, Cleaning



Seat cover FL, Stain, Cleaning



Floor mat F, Tear, Replace




Steering wheel, Scratch(es), Repair/replace (lump sum)



Steel rim RL, Deformed / Strained, Acceptable




Steel rim FL, Not original part, Acceptable

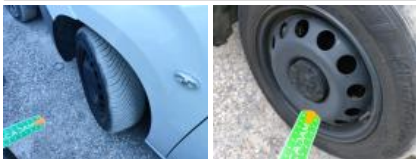

Steel rim FR, Deformed / Strained, Acceptable



Wing trim RL, Scratch(es), Replace

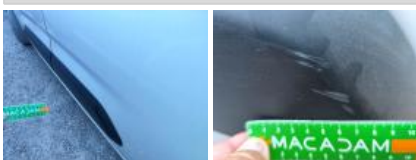

Bumper F, Scratch(es), Acceptable



Bumper F, Unclassped, Dismount/Mount



Bumper corner RR, Scratch(es), Acceptable



Bumper R, Scratch(es), Acceptable



Bumper corner RL, Scratch(es), Acceptable



Boot door lining L, Broken, Replace



Bodywork, Not original part, Sticker removal small



Historique Maintenance

Immatriculation: **FS-780-ED** Date de 1ère immatriculation: **21/08/2020**

Modèle: **Peugeot PARTNER BHDi 100 S&S 100 S&S 1000KG STD ASPHALT VU [4P] bvm 5-102CH-5cv (fourgonnettesimple cabine)**

Date	Kilométrage	Fournisseur	Descriptif
05/08/2024	202.524	CONTROLE TECHNIQUE VELAUXIEN	CONTROLE TECHNIQUE
03/05/2024	188.745	GARAGE BROSSET SARL	REVISION ET CLIM ET AIR ET CARBURANT
	0		LIQUIDE DE FREIN
	0		PLAQUETTES AV RPLT
14/12/2023	171.137	GARAGE BROSSET SARL	TELECHARGEMENT CALCULATEUR
	0		DIAG
	0		FAP RPLT
	0		ESSAI
22/08/2023	156.970	STELLANTIS &YOU FRANCE SAS	FILTRE CLIM RPLT
	0		RECYCLAGE
	0		DIVERS ECHAPPEMENT
	0		DIVERS CLIM
	0		REVISION
	0		FILTRE A AIR RPLT
	0		REVISION
09/12/2022	118.495	STELLANTIS &YOU FRANCE SAS	DIVERS SUSPENSION
	0		DISQUES PLAQUETTES AV RPLT
	0		DISQUES PLAQUETTES AR RPLT
	0		RECYCLAGE
03/11/2022	115.546	STELLANTIS &YOU FRANCE SAS	REVISION
	0		BALAIS ESSUIE GLACE AV
	0		COMMODO CLIGNOTANTS PHARES RPLT
	0		RECYCLAGE
14/04/2022	81.862	STELLANTIS &YOU FRANCE SAS	FILTRE A AIR RPLT
	0		REVISION
	0		FILTRE CLIM RPLT
	0		RECYCLAGE
	0		PLAQUETTES AV RPLT
	0		REVISION
26/08/2021	41.836	STELLANTIS &YOU FRANCE SAS	FILTRE CLIM RPLT
	0		RECYCLAGE
	0		REVISION

Historique Maintenance

Immatriculation: **FS-780-ED**

Date de 1ère immatriculation: **21/08/2020**

Modèle: **Peugeot PARTNER BHDl 100 S&S 100 S&S 1000KG STD ASPHALT VU [4P] bvm 5-102CH-5cv
(fourgonnettesimple cabine)**

Date	Kilométrage	Fournisseur	Descriptif
	0		FILTRE A AIR RPLT
	0		REVISION