



Expertise

Protocol number: 46923268
Order No. / Reference: 26747088
Inspection date: 6 Aug 2026

Manufacturer: Mercedes-Benz

Model: C 220 d 4Matic T 9G-TRONIC AMG Line

VIN: W1KAH0FB2PF101043



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz C 220 d 4Matic T 9G-TRONIC AMG Line	
Vehicle Identification number	W1KAH0FB2PF101043
Mileage (Read)	165,325 km
First registration	15 Mar 2023
Number of holders	1
Next periodical technical inspection	06/2028
(Report on hand)	
Fuel type	Hybrid Diesel / E
Engine displacement / Cylinder	1,993 ccm / 4
Power	147 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	SCHWARZ - UNILACK
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	178 Tag(e)
Last service on / at	12/2025 at 144,838 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS689007
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BBU 00203		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,410 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95V	Winter tyres on Light alloy	Pirelli	4mm / 4mm
2)	225/45 R18 95V	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/40 R19 93Y	Summer tyres on Light alloy	Goodyear	6mm / 6mm
2)	255/35 R19 96Y	Summer tyres on Light alloy	Bridgestone	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Center airbag
- Airbag: Windowbag for driver and front passenger
- Ambient lighting with 64 light colors
- AMG sports pedal assembly made of brushed stainless steel with rubber studs
- Brake assist, active
- Diesel particulate filter
- DYNAMIC SELECT
- ECO start/stop function
- Electric windows (4-way)
- Transmission: 9-speed automatic, 9G-TRONIC
- Heated rear window
- Instrument panel and door sills in ARTICO man-made leather in black nappa look
- Mechanical child safety lock for the rear doors
- Front headrests
- Cargo area cover including EASY-PACK safety net
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Package: Interior lighting package
- Radio: Extended MBUX functions
- Radio accessories: Digital radio (DAB)
- Radio accessories: Central display
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- Lane Keeping Assist, active
- High-visibility vest for drivers
- Central locking with remote control
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- 4MATIC all-wheel drive
- AMG floor mats
- Basic services
- Brake system with larger brake discs on the front axle
- black roof rails
- Double cup holder at the front
- EASY-PACK tailgate
- Electronic Stability Program (ESP)
- Speed Limit Assistant
- rear window wiper
- Interior headliner fabric crystal grey
- ISOFIX child seat attachment with top tether in the rear
- KEYLESS-GO start function
- Rear headrests (3)
- Paint finish: Solid
- LED High Performance Headlights
- Mercedes-Benz emergency call system
- Package: Storage
- Upholstery: ARTICO leatherette/MICROCUT microfiber
- Radio: MBUX
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Remote Services Plus
- Seats: Rear seat backrests foldable
- Cruise control
- Electronic immobilizer
- Decorative elements, metal structure



Extra equipment

- Airbag: Side airbags in the rear
- Black fabric headliner
- Fuel tank with larger capacity
- Center console metal structure
- Package: Advanced Infotainment Package (MBUX Navigation Premium (hard drive navigation, pre-installation for Live Traffic Information), Traffic Sign Assist, Smartphone Integration (connects the mobile phone wirelessly to the multimedia system via Apple CarPlay and Android Auto), Wireless charging system for mobile devices in the front, Driver display - 31.2 cm (12.3") color LCD display, Central display - 30.2 cm (11.9") touch display with LCD technology)
- Package: Advanced Parking Package (12 ultrasonic sensors - 360° camera - Active Parking Assist with PARKTRONIC: detects free parking spaces, assisted parking, visual and acoustic warning, display of camera and ultrasonic data in the media display - Cross traffic warning: can provide visual and acoustic warnings when reversing out of a parking space and, if necessary, automatically initiate emergency braking - Reverse maneuvering brake: can trigger a braking process - Drive-away assist)
- Package: High-End Business DB3
- Package: High-End Light Package (DIGITAL LIGHT with projection function: -HD system with projection module -DIGITAL LIGHT projection functions: projection function for lines, symbols, animations -ULTRA RANGE high beam with a range of more than 600 m -Topography compensation -Curving light with roundabout and intersection function -Active curve light with predictive control -Extended fog light, city light, country road light, motorway light, motorway high beam and bad weather light)
- Package: Mirror package (both exterior mirrors electrically folding (button in the driver's door control panel) - interior mirror and exterior mirror on the driver's side automatically dimming continuously - ambient lighting of the exterior mirror to illuminate the entry area with projection of the Mercedes-Benz logo)
- Upholstery: ARTICO man-made leather
- Radio accessories: Advanced sound system (with 9 speakers and 225 watts system power)
- Seats: Comfort seats
- Seats: Multi-contour seats for driver and front passenger (driver and front passenger seats fully electrically adjustable via the switches in the door control panel - Electro-pneumatic 4-way lumbar support - Massage via 8 inflatable air chambers in the lower seat back and side bolsters as well as 7 zones - Deep tissue massage via 4 vibration elements in the seat cushion (driver's side only) - 6 massage programs for the driver, 4 massage programs for the front passenger)
- High-visibility vests for drivers and passengers (one for each seat)
- Heat-insulating dark tinted glass
- Chassis: Chassis with adaptive damping adjustment
- THERMATIC automatic climate control with 2 climate zones (control via the central display or the climate control unit in the center console; sensor system for detecting, for example, indoor/outdoor temperature, sunlight, humidity, and dew point; automatic recirculation (only in conjunction with navigation system); ventilation system consisting of: 3 center vents and 2 side vents; fine dust activated carbon filter for filtering dust, soot, and pollen; dew point sensor; residual heat function for efficient use of engine waste heat)
- Package: Advanced Light Package (DIGITAL LIGHT: -HD system with projection module (more than 1.3 million pixels per headlight) and MULTIBEAM LED background module -Adaptive Highbeam Assist Plus -ULTRA RANGE high beam with a range of more than 600 m -Topography compensation -Cornering light with roundabout and intersection function -Active curve light with predictive control -Extended fog light, city light, country road light, motorway light, motorway high beam and bad weather light)
- Package: Advanced Park Package D2P
- Package: Driving Assistance Package Plus (Active Distance Assist DISTRONIC, Active Speed Limit Assist, Extended Automatic Restart on Highways, Route-Based Speed Adaptation with Traffic Jam End Function, Active Traffic Jam Assist, Active Steering Assist, Active Lane Change Assist, Active Emergency Stop Assist, Emergency Lane Function, Active Brake Assist with Vehicle, Bicycle and Pedestrian Detection; Intersection Function, Turn Function, Traffic Jam End Emergency Braking Function, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, PRE-SAFE Impulse Side)
- Package: Luggage compartment comfort (electrically folding rear seat backrests via switches on the right and left in the control panel in the load compartment - electric opening and closing of the load compartment roller blind - 12V socket on the left in the control panel in the load compartment - reversible mat, with a rubberized, non-slip side and a soft velour side)
- Upholstery: ARTICO black leatherette
- Wheels: 48.3 cm (19") AMG multi-spoke light-alloy wheels (painted black with high-sheen rim flange, front axle 225/40 R 19 on 7.5 J x 19 ET 40, rear axle 255/35 R 19 on 8.5 J x 19 ET 58, 1)
- Auxiliary heating
- Telephone accessories: Wireless charging system for mobile devices (wireless charging according to Qi standard for compatible mobile phones - fast connection setup between multimedia system and mobile phone via Near Field Communication (NFC) for identification of the mobile device - storage compartment for wireless charging is located in the storage compartment at the front of the center console)
- Heat and noise insulating acoustic glass (for windshield and front doors)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Carpet - front left side - Damaged - Replace
2	Door - front left side	Door - Dent / paintcoat damage - Smooth repair work
3	2nd wheel set	1 tyre (VR platt) - Replace
4	Seat - rear	Seat upholstery - 2nd row (Druckstellen) - Damaged - Loss in value
5	Sill - left side	Sill - dent(s) - Repair and paint
6	Rear bumper	Rear bumper - Scratched - Paint
7	Front bumper	Front bumper - Scratched - Paint
8	Side panel - rear left side	Sill - dent(s) - Repair and paint
9	Bonnet	Bonnet - Stone chips - Paint
10	2nd wheel set	3 alloy rims (VL VR HR) - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Side panel - rear left side	Side panel - Scratched - No deduction
2	Boot lid / rear door	Trim - standard - lower - Scratched - No deduction
3	Door - front left side	Door edge - Scratched - No deduction
4	Wheel / tyres	Wheel rims - complete set - Scratched - No deduction
5	Roof	Roof - dent(s) - No deduction
6	Side panel - rear left side	Elbow - dent(s) - No deduction
7	Door - rear right side	Door - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Additional tyres



Figure 19: Additional tyres



Figure 20: Navigation



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

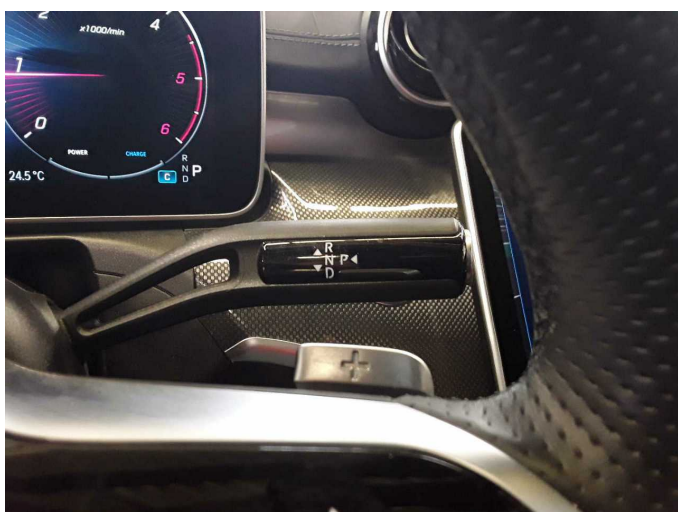


Figure 27: Misc.

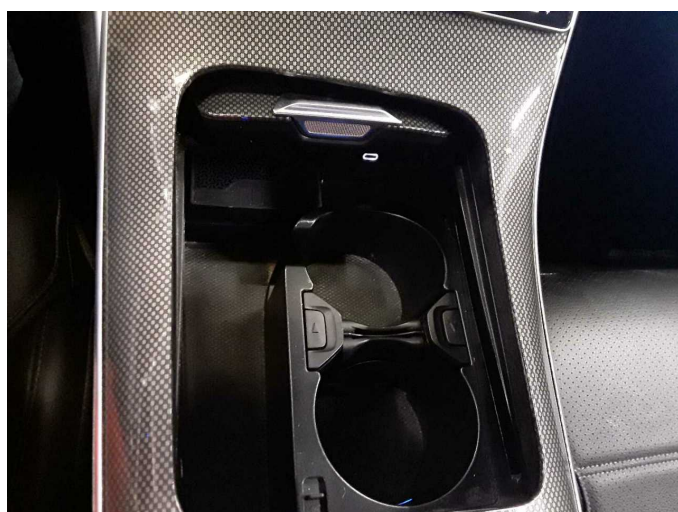


Figure 28: Misc.

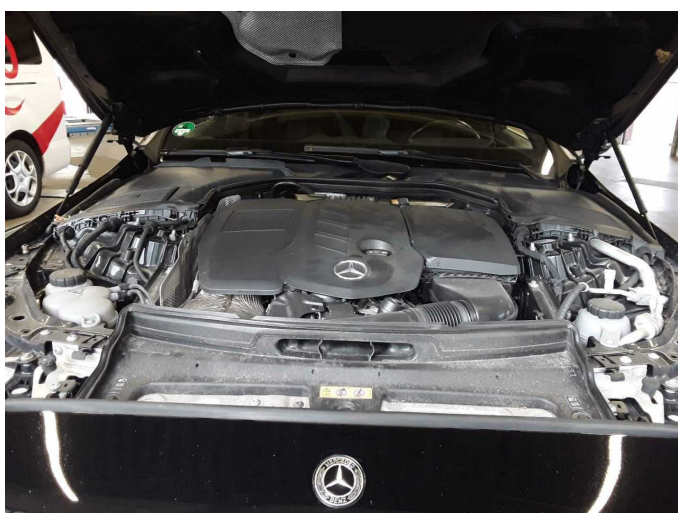


Figure 29: Misc.

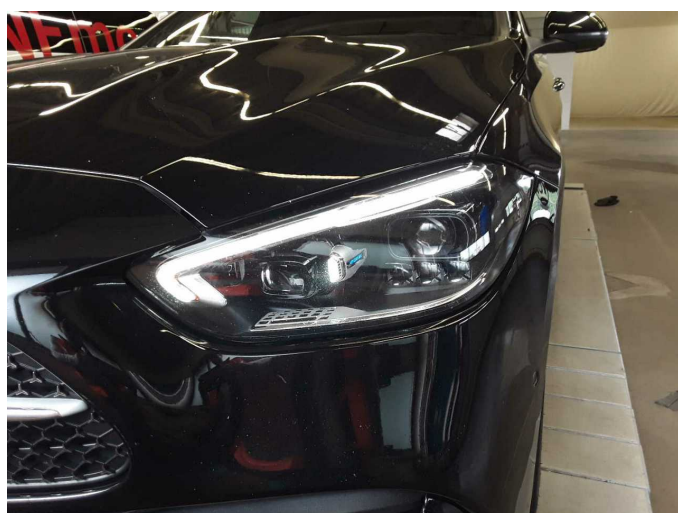


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.




Figure 37: Misc.




Damage 1: Trim / covers: Carpet - front left side - Damaged - Replace



Damage 1: Trim / covers: Carpet - front left side - Damaged - Replace

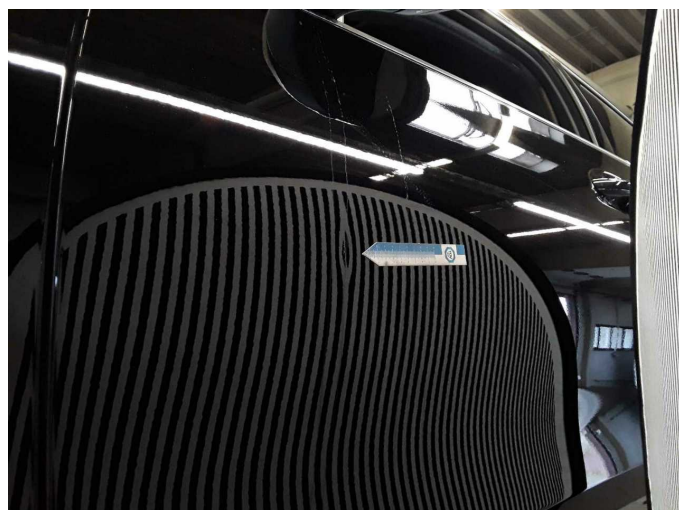

Damage 2: Door - front left side: Door - Dent / paintcoat damage - Smooth repair work

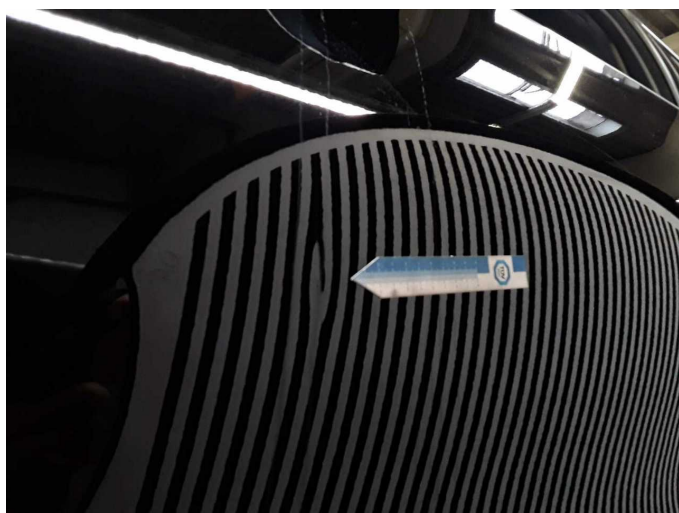

Damage 2: Door - front left side: Door - Dent / paintcoat damage - Smooth repair work



Damage 3: 2nd wheel set: 1 tyre (VR platt) - Replace




Damage 3: 2nd wheel set: 1 tyre (VR platt) - Replace




Damage 4: Seat - rear: Seat upholstery - 2nd row (Druckstellen) - Damaged - Loss in value



Damage 4: Seat - rear: Seat upholstery - 2nd row (Druckstellen) - Damaged - Loss in value

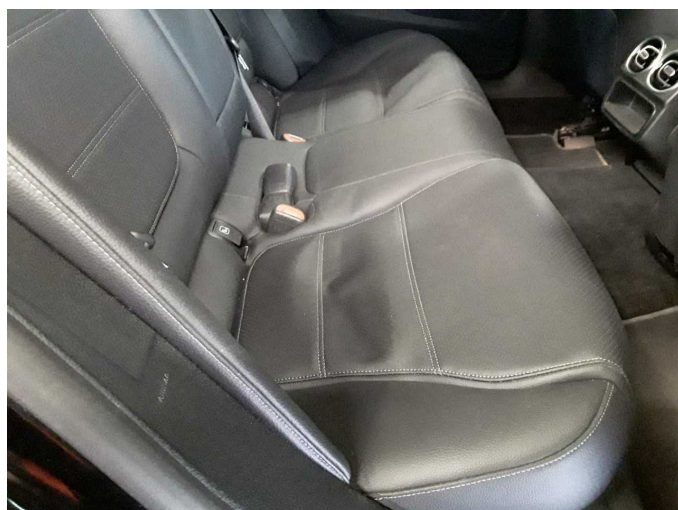


Damage 4: Seat - rear: Seat upholstery - 2nd row (Druckstellen) - Damaged - Loss in value

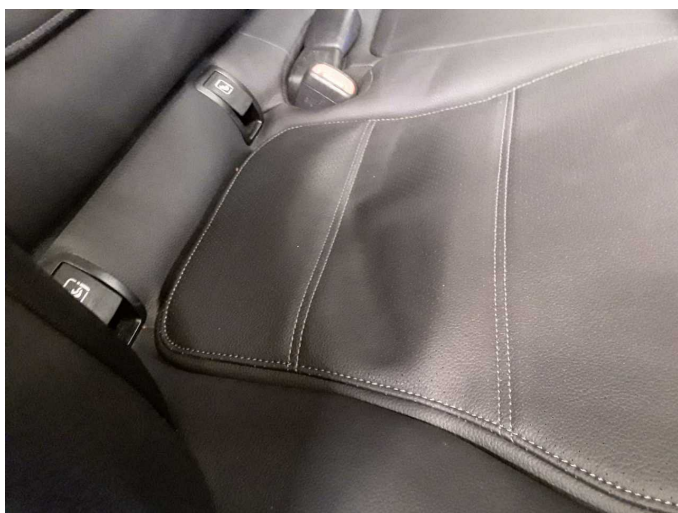

Damage 4: Seat - rear: Seat upholstery - 2nd row (Druckstellen) - Damaged - Loss in value



Damage 5: Sill - left side: Sill - dent(s) - Repair and paint

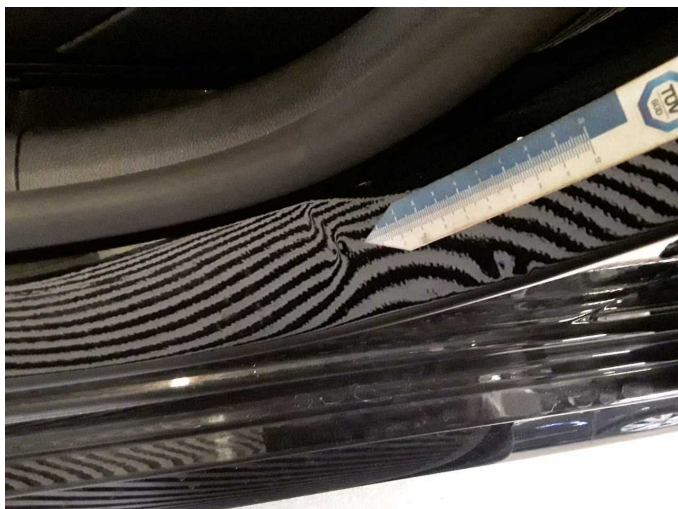

Damage 5: Sill - left side: Sill - dent(s) - Repair and paint



Damage 5: Sill - left side: Sill - dent(s) - Repair and paint



Damage 5: Sill - left side: Sill - dent(s) - Repair and paint



Damage 6: Rear bumper: Rear bumper - Scratched - Paint




Damage 6: Rear bumper: Rear bumper - Scratched - Paint



Damage 6: Rear bumper: Rear bumper - Scratched - Paint



Damage 6: Rear bumper: Rear bumper - Scratched - Paint

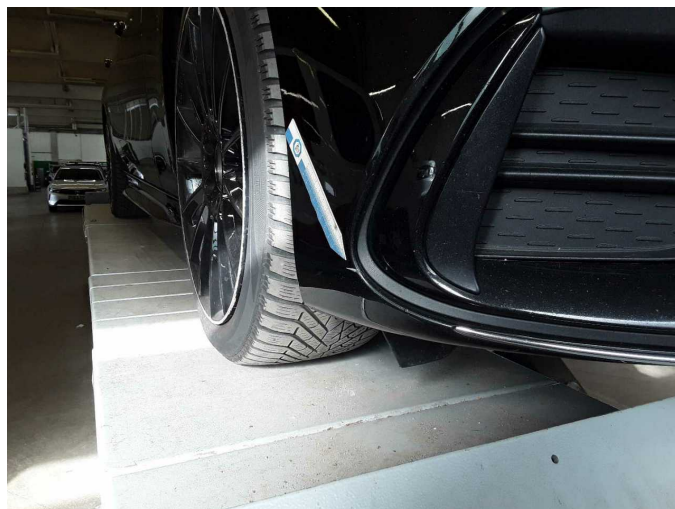

Damage 7: Front bumper: Front bumper - Scratched - Paint



Damage 7: Front bumper: Front bumper - Scratched - Paint



Damage 7: Front bumper: Front bumper - Scratched - Paint




Damage 7: Front bumper: Front bumper - Scratched - Paint



Damage 7: Front bumper: Front bumper - Scratched - Paint




Damage 7: Front bumper: Front bumper - Scratched - Paint

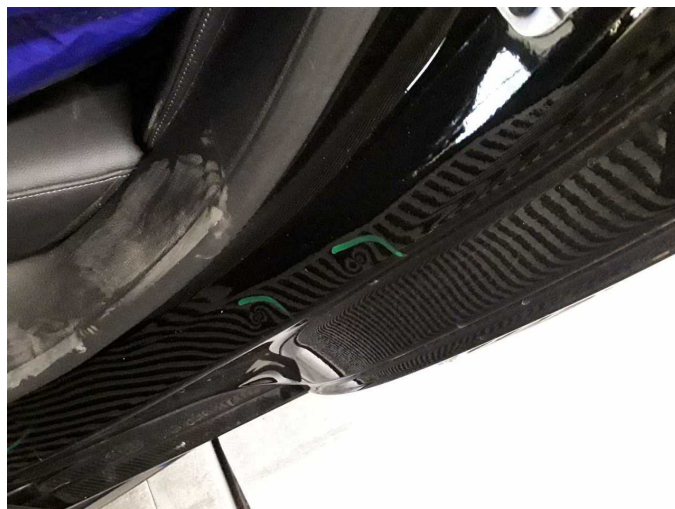


Damage 8: Side panel - rear left side: Sill - dent(s) - Repair and paint




Damage 8: Side panel - rear left side: Sill - dent(s) - Repair and paint

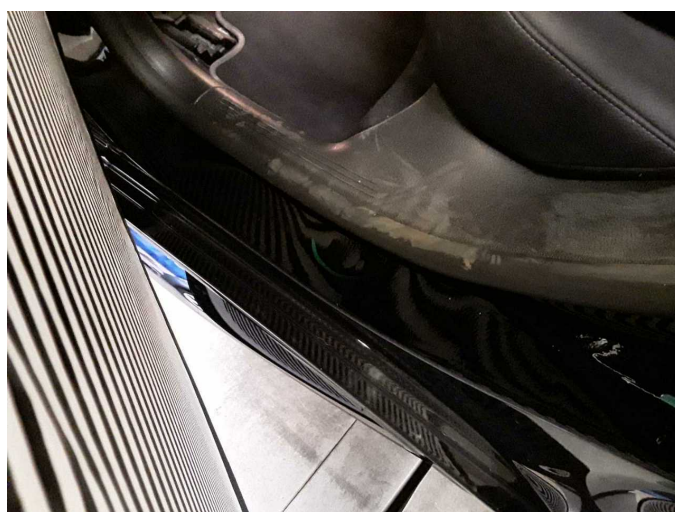


Damage 8: Side panel - rear left side: Sill - dent(s) - Repair and paint

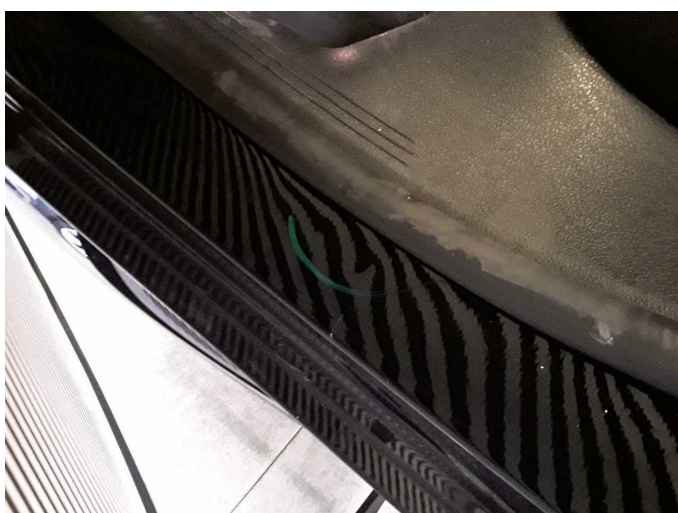

Damage 8: Side panel - rear left side: Sill - dent(s) - Repair and paint

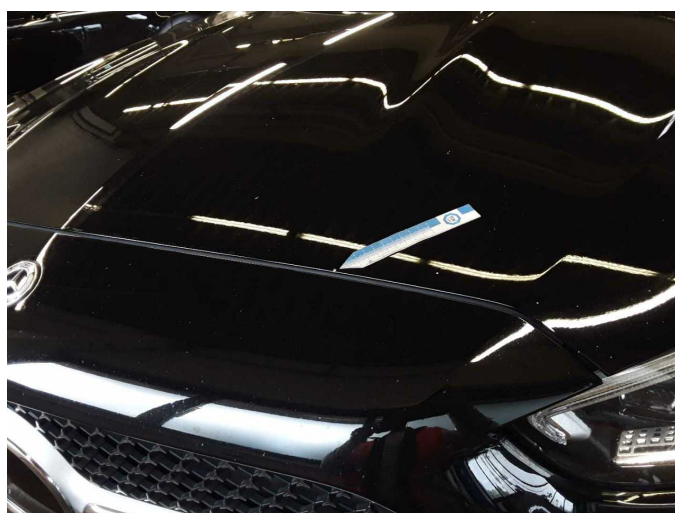


Damage 9: Bonnet: Bonnet - Stone chips - Paint

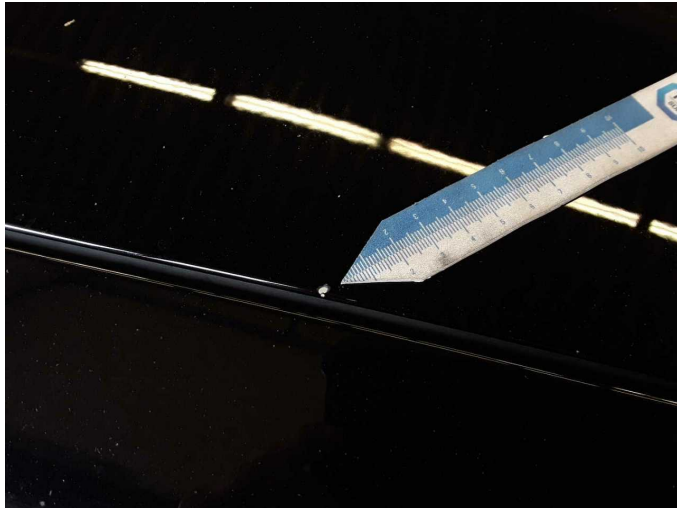


Damage 9: Bonnet: Bonnet - Stone chips - Paint



Damage 9: Bonnet: Bonnet - Stone chips - Paint

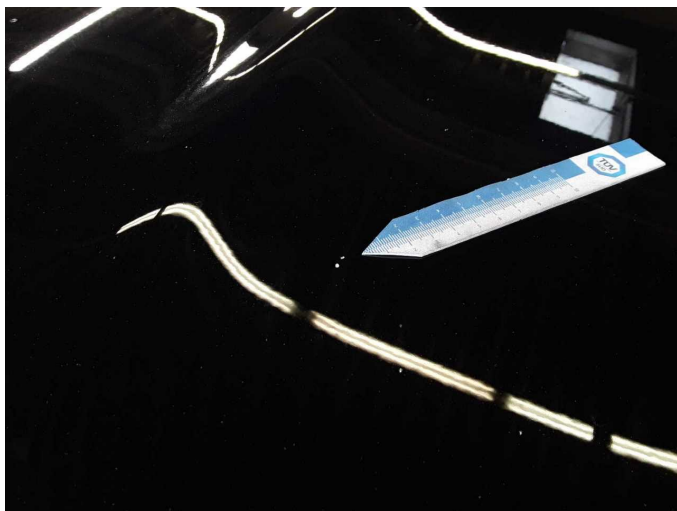

Damage 9: Bonnet: Bonnet - Stone chips - Paint

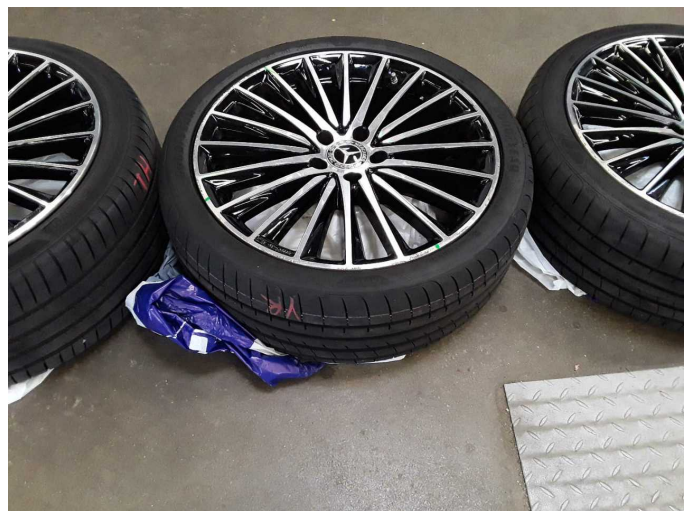

Damage 10: 2nd wheel set: 3 alloy rims (VL VR HR) - Scratched - Replace



Damage 10: 2nd wheel set: 3 alloy rims (VL VR HR) - Scratched - Replace



Damage 10: 2nd wheel set: 3 alloy rims (VL VR HR) - Scratched - Replace




Damage 10: 2nd wheel set: 3 alloy rims (VL VR HR) - Scratched - Replace




Damage 10: 2nd wheel set: 3 alloy rims (VL VR HR) - Scratched - Replace



Damage 10: 2nd wheel set: 3 alloy rims (VL VR HR) - Scratched - Replace

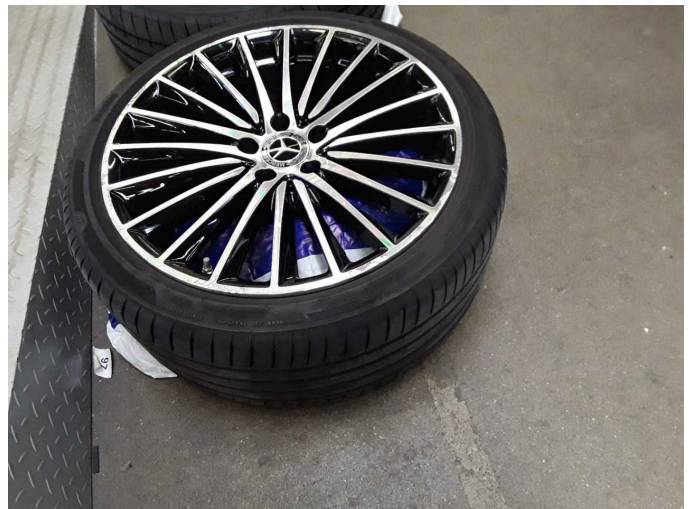


Damage 10: 2nd wheel set: 3 alloy rims (VL VR HR) - Scratched - Replace

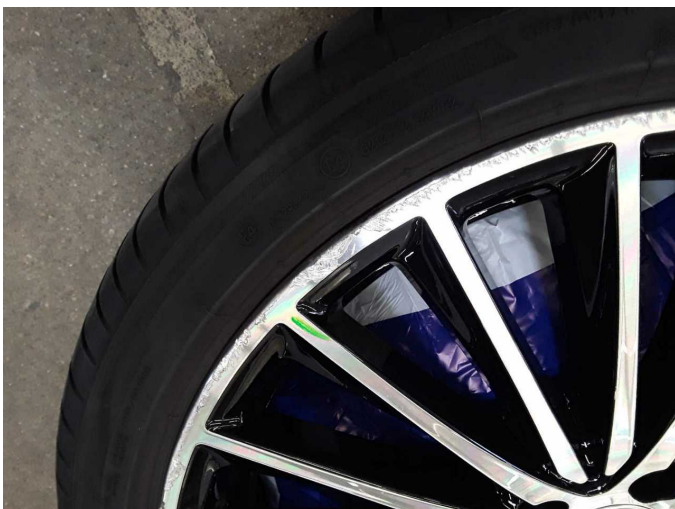

Damage 10: 2nd wheel set: 3 alloy rims (VL VR HR) - Scratched - Replace




Wear and tear 1: Side panel - rear left side: Side panel - Scratched - No deduction

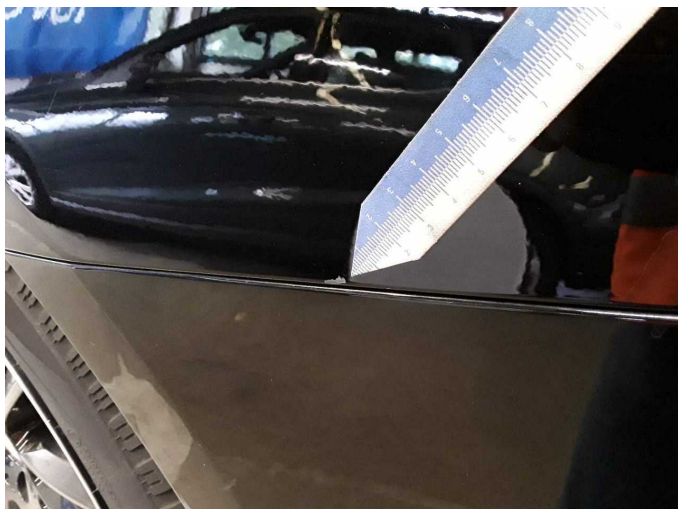

Wear and tear 1: Side panel - rear left side: Side panel - Scratched - No deduction



Wear and tear 2: Boot lid / rear door: Trim - standard - lower - Scratched - No deduction

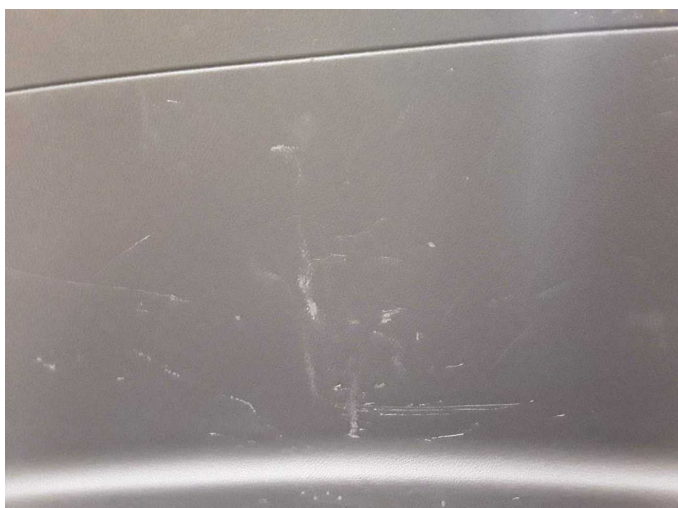

Wear and tear 2: Boot lid / rear door: Trim - standard - lower - Scratched - No deduction



Wear and tear 3: Door - front left side: Door edge - Scratched - No deduction



Wear and tear 3: Door - front left side: Door edge - Scratched - No deduction



Wear and tear 4: Wheel / tyres: Wheel rims - complete set - Scratched - No deduction



Wear and tear 4: Wheel / tyres: Wheel rims - complete set - Scratched - No deduction



Wear and tear 4: Wheel / tyres: Wheel rims - complete set - Scratched - No deduction




Wear and tear 4: Wheel / tyres: Wheel rims - complete set - Scratched - No deduction



Wear and tear 4: Wheel / tyres: Wheel rims - complete set - Scratched - No deduction



Wear and tear 4: Wheel / tyres: Wheel rims - complete set - Scratched - No deduction

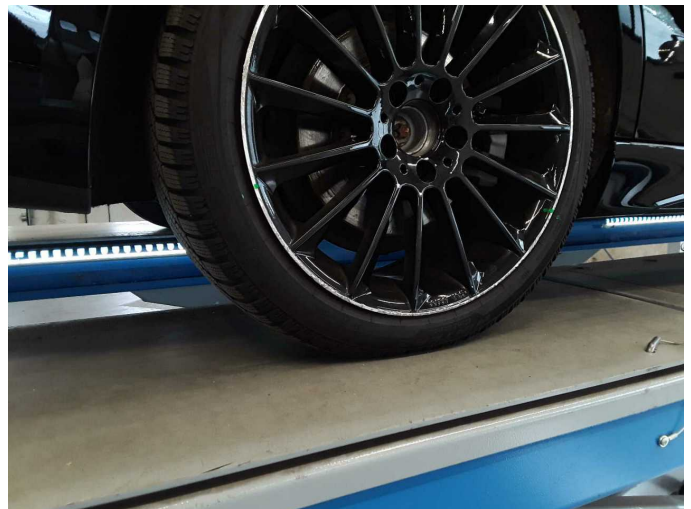

Wear and tear 4: Wheel / tyres: Wheel rims - complete set - Scratched - No deduction



Wear and tear 4: Wheel / tyres: Wheel rims - complete set - Scratched - No deduction



Wear and tear 4: Wheel / tyres: Wheel rims - complete set - Scratched - No deduction



Wear and tear 4: Wheel / tyres: Wheel rims - complete set - Scratched - No deduction




Wear and tear 4: Wheel / tyres: Wheel rims - complete set - Scratched - No deduction




Wear and tear 4: Wheel / tyres: Wheel rims - complete set - Scratched - No deduction




Wear and tear 5: Roof: Roof - dent(s) - No deduction

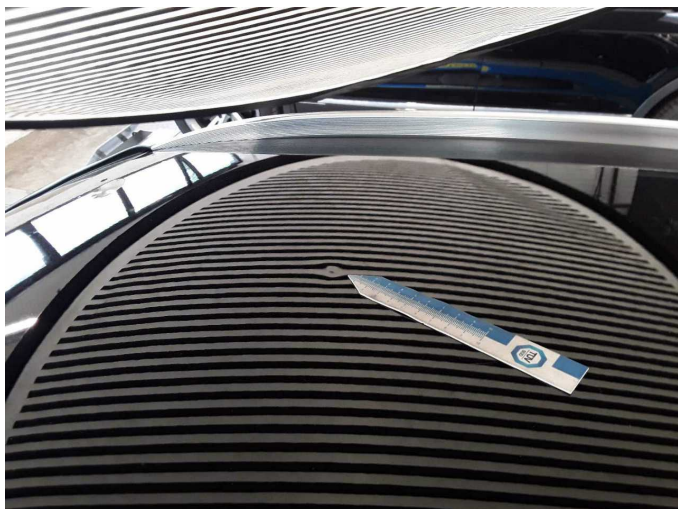


Wear and tear 5: Roof: Roof - dent(s) - No deduction

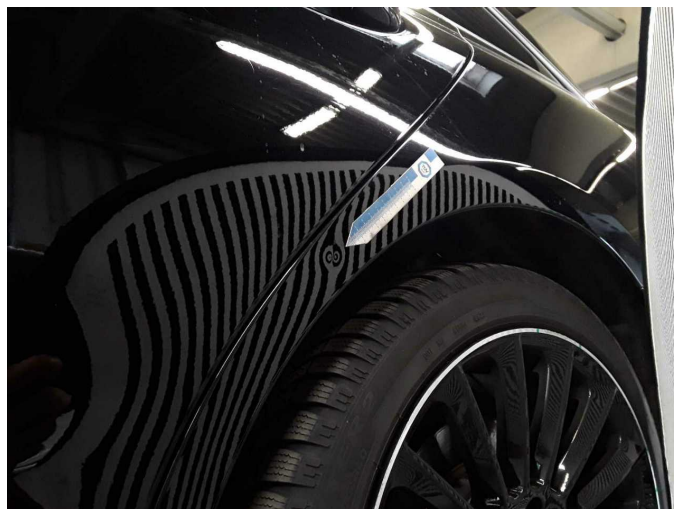

Wear and tear 6: Side panel - rear left side: Elbow - dent(s) - No deduction

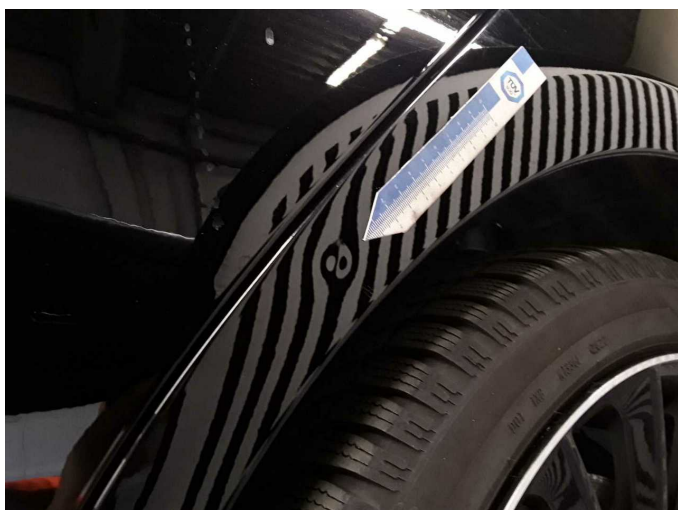

Wear and tear 6: Side panel - rear left side: Elbow - dent(s) - No deduction

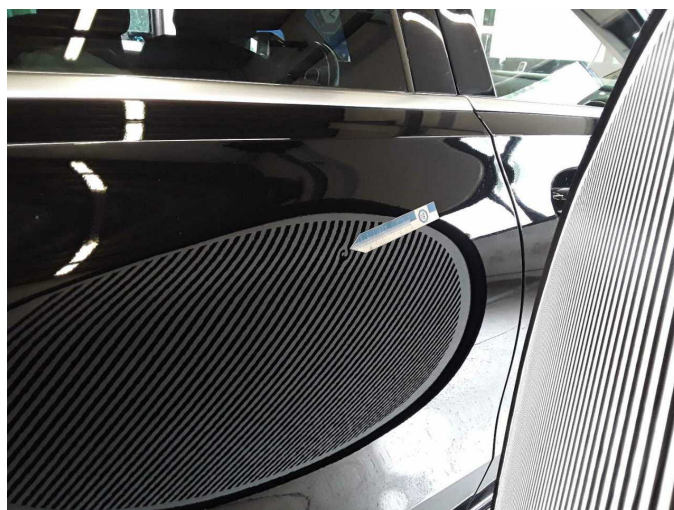

Wear and tear 7: Door - rear right side: Door - dent(s) - No deduction



Wear and tear 7: Door - rear right side: Door - dent(s) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1KAH0FB2PF101043

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ C 220 d 4Matic T 9G-
TRONIC AMG Line

Datum	KM-Stand	Beschreibung
08.07.2026	164.648	Reparatur Sonstiges
29.06.2026	164.644	AU
09.12.2025	144.838	Systemtest/Eigendiagnose
08.12.2025	144.838	Regelwartungsdienst
05.08.2025	127.473	Bremsinspektion vo + hi
24.03.2025	116.242	Regelwartungsdienst
17.09.2024	90.595	Regelwartungsdienst
11.04.2024	64.855	Bremsklötze vorne; Regelwartungsdienst
22.09.2023	30.177	Regelwartungsdienst