

Condition Report / Loss of Value Assessment II



Process

Your order dated

Venue of inspection

Date of inspection

Reference numbers

Vehicle information

Registration no.		Vehicle ident. no.	WAUZZZF27SN034532
Type of vehicle	Motor car - Estate	Color / finish	Silver / metallic
Manufacturer	Audi	Next main inspection	12/2027
Type / sales designation	A6 Avant 45 TDI quattro advanced	Kilometres read	28,878 km
First registration date	2025-03-19	Emissions class	Euro 6
Gearbox / no. of gears	automatic / 7	Seats / doors	5 / 5
Axles / driven	2 / 2	No. of owners	unknown
Engine	Hybrid / Diesel / electric	Displacement / kW	2,967 ccm / 180 KW
Continuous power		Maximum power	
Charging plug		Battery capacity	

Vehicle information was communicated by the client and verified and supplemented on the vehicle.

Fitted wheels:					
Position	Type of tyre	Type of rim	Manufacturer	Dimensions	Thread depth
front left	summer tyre	alloy wheel	Continental	245/45R19 102Y	4 mm
front right	summer tyre	alloy wheel	Continental	245/45R19 102Y	4 mm
rear right	summer tyre	alloy wheel	Kumho	245/45R19 102Y	7 mm
rear left	summer tyre	alloy wheel	Continental	245/45R19 102Y	7 mm
Type of spare tyre: Tire Fit					

Common / Condition	
✓ Vehicle is in running order	✗ Underbody check conducted
✗ Vehicle is registered	✓ Main key included (no: 1)
✗ Battery is functioning	Secondary key is stored centrally
✗ Service manual included	
✗ Test drive performed.	
First service not yet due. Remaining mileage 1200 Kilometers.	

Legende : ✓ Yes ✗ No ○ not verifiable ⊗ not included

Repaired previous damage	The previous damage was professionally and correctly rectified	Declaration
Door front right damaged	yes	
Sidewall rear right damaged	yes	

Remarks
Batterie Tiefentladen

Equipment according to VIN query

Standard equipment

airbag passenger side deactivatable	airbag driver side/passenger side
antilock braking system (ABS)	Audi connect (web-based services)
Audi connect (Emergency and Assistance System)	Audi Drive Select
exterior mirror aspherical, left	exterior mirror aspherical, right
turn signal lights LED in exterior mirror integrated	roof rails anodised
parking aid plus front, sideways and rear, acoustic and optical with environment view	scuff rails with aluminium insert
Electronic Stability Control (ESP)	driver assistance system: brake assistant (Audi pre sense front)
driver assistance system: passenger protection system (Audi pre sense basic)	driver assistance system: lane-departure warning
driver assistance system: traffic sign detection	rear seat system (3 seats)
windshield heat protection glazing	cargo space lid electrically operated (open+close)
transmission 7-speed - dual-clutch transmission S-tronic	Shine package
liftgate opening automatic	interior equipment decorative trim inserts fine paint
Isofix mounts for child seat	instrument cluster digital (virtual cockpit plus)
head airbag system (Sideguard)	steering column (steering wheel) mech. height/longitudinal adjustment
Light-alloy rims	Mild-hybrid 180 kW (engine 3,0 liter - 180 kW V6 24V TDI)
Mild-Hybrid-Technologie	center armrest front
model refinement	multi-media Interface MMI basic plus / MMI radio plus
multi-media Interface MMI Navigation	non-smoking package
progressive steering	radio reception digital (DAB)
tire repair kit	tire pressure indicator
diesel particulate filter	rear seat backrest split/folding (40:20:40)
windshield washer jets heated	rail system in cargo space
SCR system (AdBlue technology)	start/stop system
daytime running lights LED	jack
immobilizer (electronic)	heat protection glazing (sideways / rear)

Special features

Storage package	cargo space partition (net)
beverage holder rear	ambient lighting
trailer coupling (pivoting ball head)	Audi Application Store and Smartphone Interface
control elements glass look, incl. extended aluminium look	Business package
Assistance package Tour	driver assistance system: high-beam assistant
driver assistance system: adaptive cruise control system (Adaptive Cruise Control) with automatic distance control	driver assistance system: emergency assistant with automatic emergency call
driver assistance system: predictive efficiency assistant	driver assistance system: collision avoidance assistant
driver assistance system: cornering assistant left	driver assistance system: adaptive drive assistant
exterior mirror electrically adjustable, heated + folding, with automatic dimming and Memory	exterior mirror with automatic curb-view tilting, right
adaptive windshield wiper, heated	Bluetooth hands-free system with voice recognition (Audi Phone Box)

Special features

comfort automatic air-conditioning 4-zone	seat heating front
interior mirror with automatic dimming	roof liner cloth, black
driver assistance system: park assist	driver assistance system: lane change assistant (Side Assist) incl. Audi pre sense rear
driver assistance system: egress alert	driver assistance system: intersection assistant rear end
suspension with shock absorber control (Magnetic Ride)	urea tank (SCR) 24 liter
Isofix mounts for child seat at passenger seat	comfort key with sensor controlled liftgate release incl. (open+close)
fuel tank: 73 liter	steering wheel (sport/leather - 3-spokes) with multiple function and shift function
light alloy rims 8,5x19 (5-arm dynamic design, Platinum gray)	Matrix LED headlights
rear lights LED with dynamic flasher	headlight washer system (headlight washer system)
metallic paintwork	styling package black plus
exterior mirror black	reversing camera
sidebag front and rear	sender for garage door opener (integrated)
seat covers/upholstery: leather / mono.pur 550 combination	seats front electrically adjustable (left with Memory)
lumbar support front, electrically adjustable	sound system DSP / Audi sound system
glazing rear darkened (privacy tinting) and door glasses front acoustic glass	

Condition / damage

rear

bumper rear panel -painted-, deformed, replace (Image 17, Image 18)

tyre, rims, wheel caps

LM wheel front left, scratched, depreciation (Image 21, Image 22)

LM wheel rear left, scratched, depreciation (Image 19, Image 20)

other


vehicle Battery, functioning, replace

Inspection conditions

The inspection involved an appraisal of the exterior on the full assembled vehicle which took into account the inspection conditions at the time. No assurance of properties can be given of non-inspected areas or areas that cannot be fully inspected.

This document has an appendix with photo documentation with 22 photos.

Photo appendix

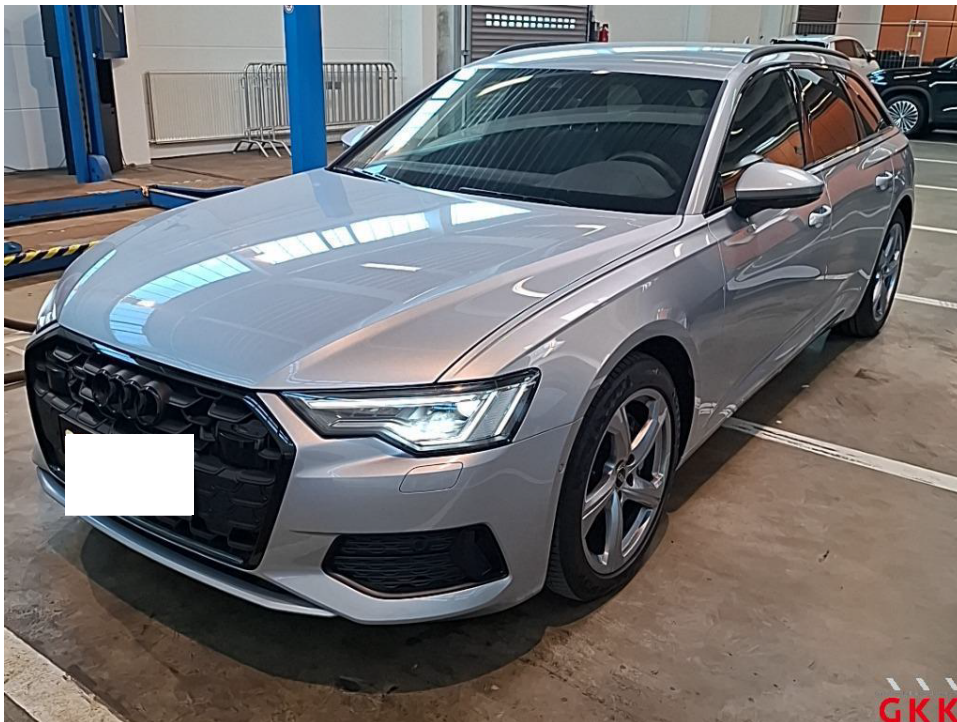

Picture 1



Picture 2

Photo appendix




Picture 3




Picture 4

Photo appendix

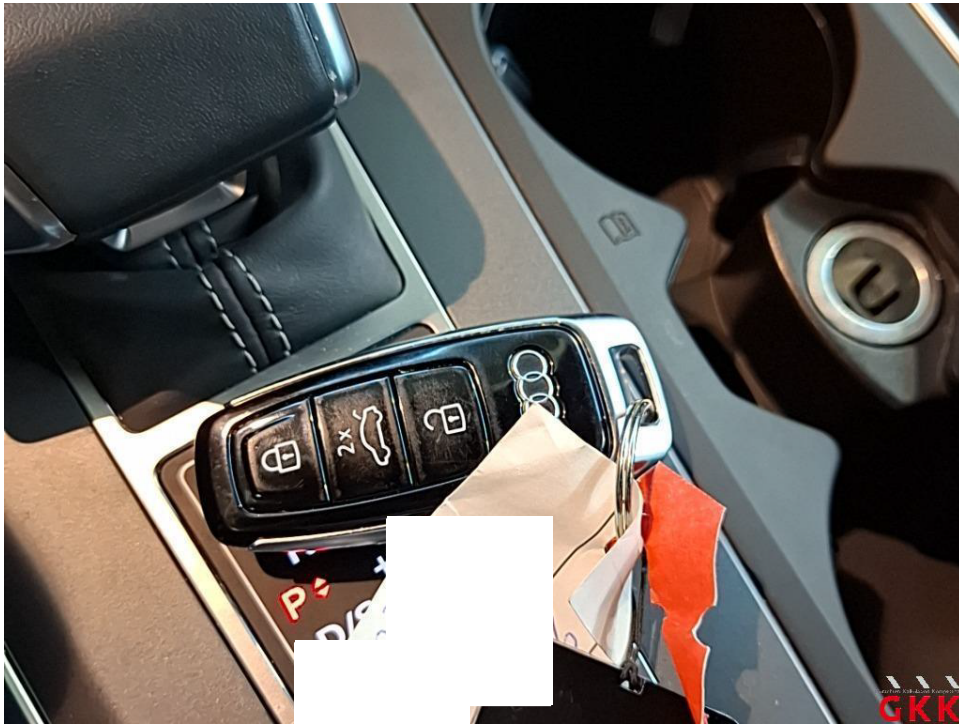

Picture 5

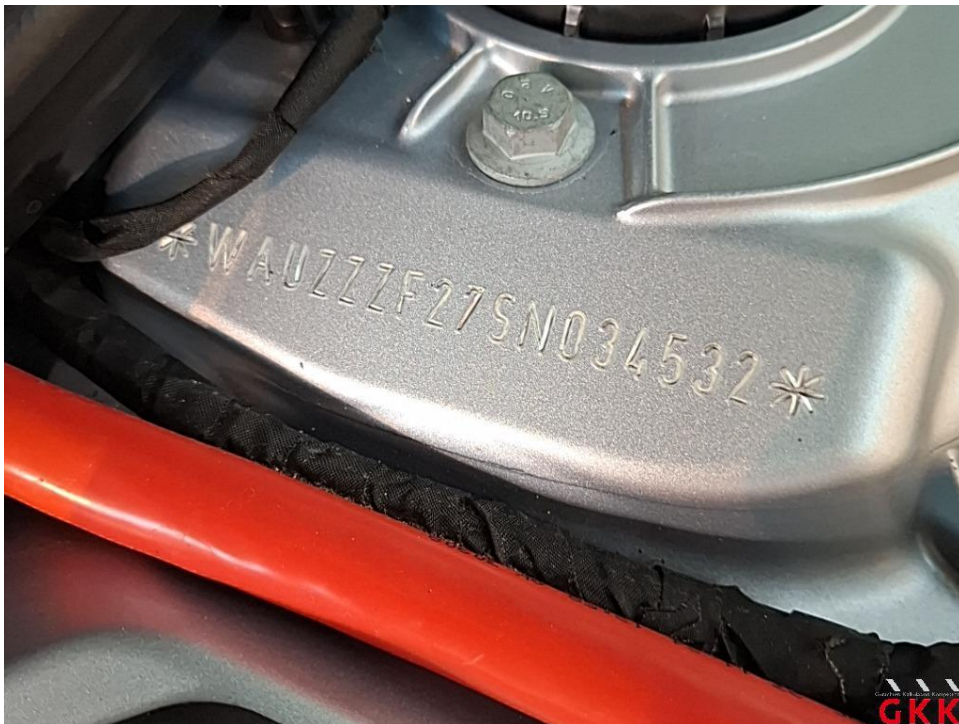


Picture 6

Photo appendix



Picture 7

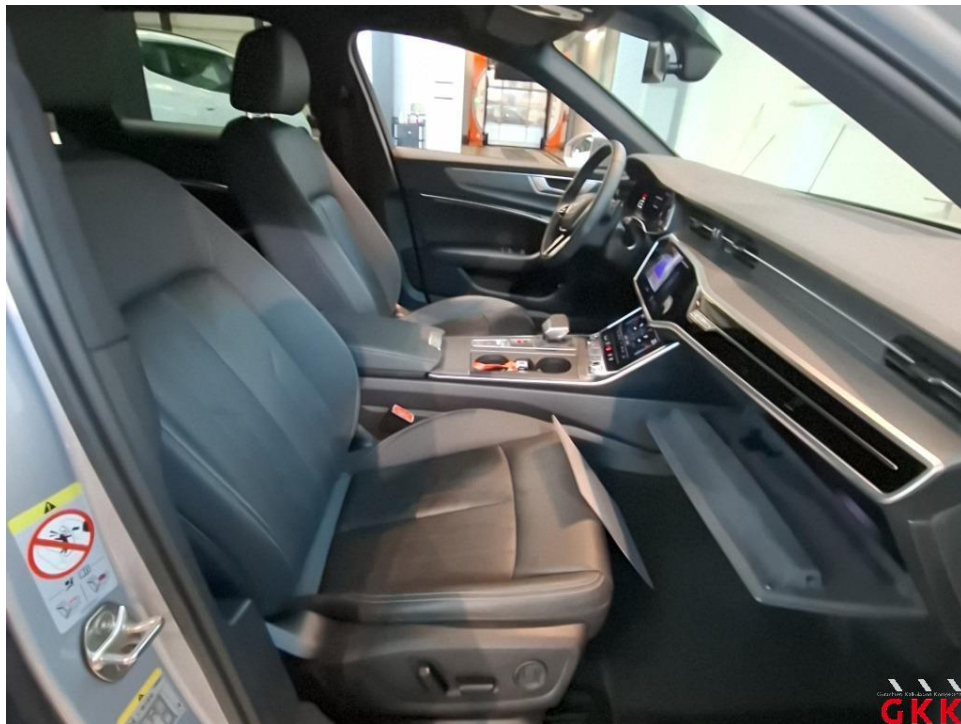

Picture 8

Photo appendix



Picture 9



Picture 10

Photo appendix



Picture 11



Picture 12

Photo appendix




Picture 13



Picture 14

Photo appendix

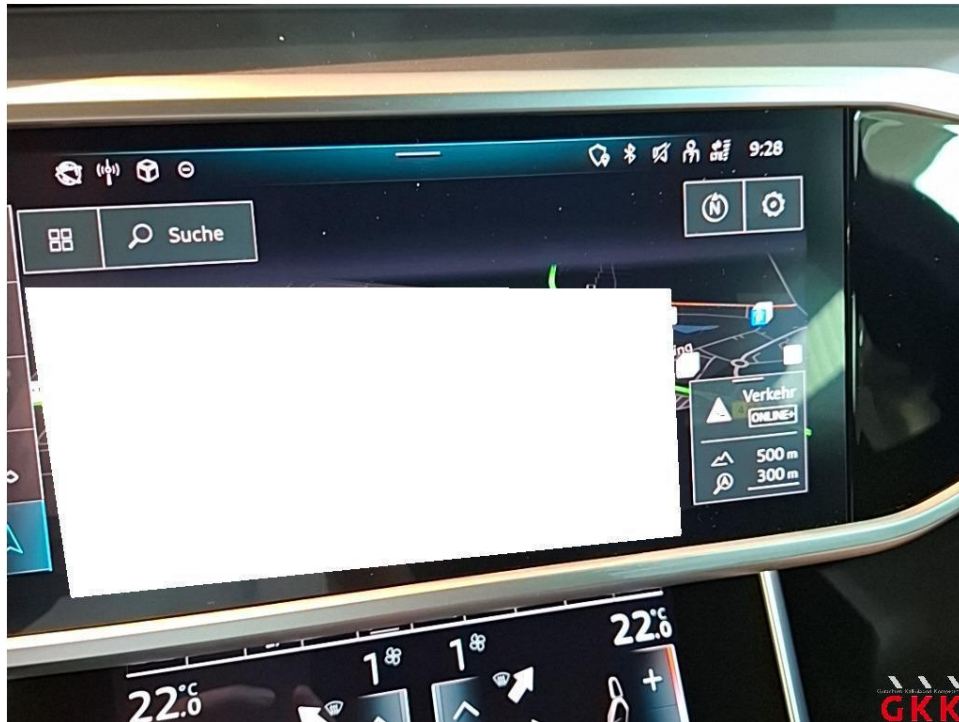

Picture 15



Picture 16

Photo appendix



Picture 17 bumper rear, panel -painted-, deformed, replace



Picture 18 bumper rear, panel -painted-, deformed, replace

Photo appendix



Picture 19 LM wheel, rear left, scratched, depreciation



Picture 20 LM wheel, rear left, scratched, depreciation

Photo appendix



Picture 21 LM wheel, front left, scratched, depreciation



Picture 22 LM wheel, front left, scratched, depreciation