



Expertise

Protocol number: 46376510
Order No. / Reference: 26652553
Inspection date: 6 Jul 2026

Manufacturer: Ford

Model: Puma 1.0 EcoBoost Hybrid ST-LINE DESIGN

VIN: WF02XXERK2NL40911



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Puma 1.0 EcoBoost Hybrid ST-LINE DESIGN	
Vehicle Identification number	WF02XXERK2NL40911
Mileage (Read)	141,529 km
First registration	10 May 2022
Number of holders	1
Power / Engine displacement	92 kw / 999 ccm
Fuel type / Cylinder	Hybrid Petrol / E / 3
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Magnetic-Grau (Metallic)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	72 %
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH415167
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8566 / BSO 00077		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,760 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Winter tyres on Light alloy	Michelin	2mm / 2mm
2)	215/55 R17 94V	Winter tyres on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98W	Summer tyres (Without wheel rim)	Goodyear	2mm / 2mm
2)	215/55 R17 98W	Summer tyres (Without wheel rim)	Goodyear	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Ambient lighting at the front
- Electrically adjustable exterior mirrors (painted in body color - with integrated turn signals)
- Tires: 7 J x 17 alloy wheels (4) in 5-spoke design, black, diamond-turned (with 215/55 R17 tires)
- third brake light
- Fabric headliner
- Digital instrument panel 12.3 inch (31.2 cm screen diagonal)
- Chassis: Sport-tuned chassis
- Electric windows front and rear
- Ford EcoCoach (shows the efficiency of current driving behavior)
- FordPower start function (keyless start)
- Luggage compartment lighting
- Cruise control system (with speed limiter)
- Grab handles for driver and passenger side
- Heated rear window
- Interior lighting front and rear with LED technology (map reading lights at the front)
- ISOFIX mounts including top tether attachment points on the outer seats of the 2nd row.
- Clothes hook at the back
- air conditioning, manual
- Rear headrests (3) height adjustable
- LED taillights
- Steering wheel: ST-Line steering wheel, 3-spoke design, Sensico in leather look
- MyKey key system (individually programmable second key)
- Ford navigation system including Ford SYNC 3 with AppLink and 8" touchscreen (AppLink (Android Auto and Apple CarPlay) - Digital radio reception DAB/DAB+ (Digital Audio Broadcasting) - 6 speakers - Steering wheel controls - Bluetooth hands-free system and audio streaming - 2 USB ports - Voice control for audio and telephone - SMS text-to-speech function - Road map for Europe)
- Selective driving mode switch (5 driving modes to choose from: Normal, Sport, Eco, Slippery and Unpaved Road)
- Seats: Driver's seat height adjustable (with lumbar support)
- Sun visors including illuminated makeup mirrors, on driver and passenger side
- Variable radiator air intake
- Immobiliser
- Anti-lock braking system (ABS) (with electronic brake force distribution (EBD))
- Passenger airbag deactivation
- Tires: Tire repair kit (maximum speed 80 km/h when used)
- Body styling kit (side skirts painted in body color, with black high-gloss insert - front and rear bumpers, ST-Line design)
- Tachometer
- Electronic Stability Program (ESP) (with hill start assist, traction control and emergency brake assist)
- Ford Easy Fuel (comfortable fuel filler cap and misfuelling protection)
- Ford MegaBox
- FordPass Connect (including eCall, Live Traffic information)
- Transmission: 6-speed manual transmission
- Illuminated glove compartment
- Rear window wiper/washer system
- Intelligent Protection System (IPS) (front airbag for driver and front passenger - front and rear head and shoulder airbags - side airbag for driver and front passenger - seat belt tensioners and force limiters for front and outer rear seats - seat belt warning system for front and second-row seats)
- Front headrests are height-adjustable
- LED fog lights (including static cornering lights)
- Steering column, adjustable in height and reach
- Front center console with integrated armrest (2 cup holders - 12-volt socket)
- Otto particulate filter
- Pollen and dust filter
- Upholstery: Cloth
- Tire Pressure Monitoring System (TPMS)
- Headlights with LED daytime running lights and LED low beam headlights
- Headlight assistant with day/night sensor
- Power steering (electro-mechanical, speed-dependent (EPAS - Electric Power Assisted Steering))
- Seats: Rear seat backrest, foldable, 60:40 split
- Seats: Front sports seats with integrated headrests
- Start-stop system
- Carpet floor mats in the front
- Lashing eyes in the luggage compartment
- Central locking with remote control



Extra equipment

- Package: Comfort (Air conditioning with automatic temperature control - Windscreen wipers with rain sensor (sensitivity adjustable) - Interior mirror, automatically dimming - Inductive charging station for mobile devices (according to Qi standard, compatibility depends on the device) - Rear parking pilot system)
- Package: Winter (Heated windscreen - Heated leather steering wheel - Individually and variably heated front seats)
- Paint finish: Desert Island Blue Metallic
- Radio: Ford SYNC 3 Light with AppLink (Android Auto and Apple CarPlay - 8" touchscreen (20.3 cm screen diagonal) - Digital radio reception DAB/DAB+ - 6 speakers - Steering wheel controls - Bluetooth hands-free system and audio streaming - 2 USB ports - Voice control via phone - SMS text-to-speech function)
- Rear parking pilot system
- Driver information system with on-board computer - color
- Electric front and rear windows with quick-down function including all-around closing function (including exterior mirrors painted in body color, electrically adjustable, heated, with integrated turn signals, electrically folding and with ambient lighting)
- Package: Safety Package (Lane Assist incl. Lane Keeping Assist - High Beam Assist - Intelligent Speed Limiter with Speed Limit Display - Driver Alert - Emergency Brake Light, Pulsating Brake Lights During Heavy Braking - Pre-Collision Assist incl. Forward Alert with Pedestrian & Cyclist Detection - Post-Collision Assist - Traffic Sign Recognition System)
- Side windows from the 2nd row of seats and rear window, dark tinted.

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Misc.	Main inspection - No evidence - No deduction
3	Equipment	Tirefit filler - Expired - Replace
4	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
5	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
6	Wheel / tyres	Alloy rim - rear right side - Corrosion - Loss in value

Wear and tear

No.	Component group	Description
1	2nd wheel set	2 tyres (Über 2mm) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterreifensatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

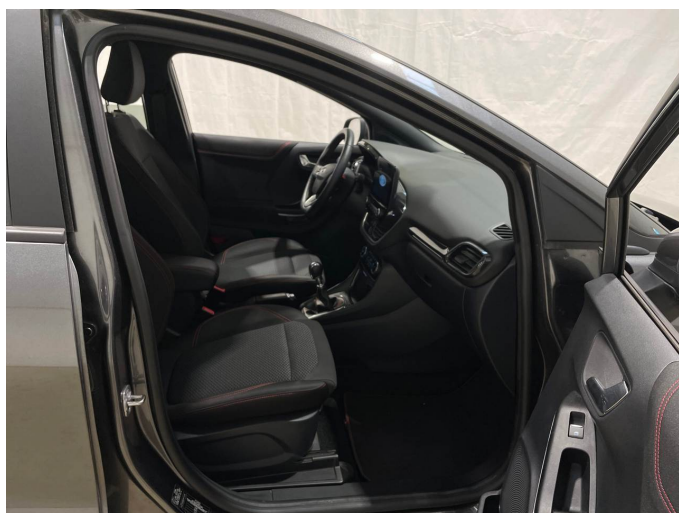


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument panel



Figure 8: Interior 360° view



Figure 9: Cargo area



Figure 10: VIN



Figure 11: Mounted tyres



Figure 12: Documents



Figure 13: Documents

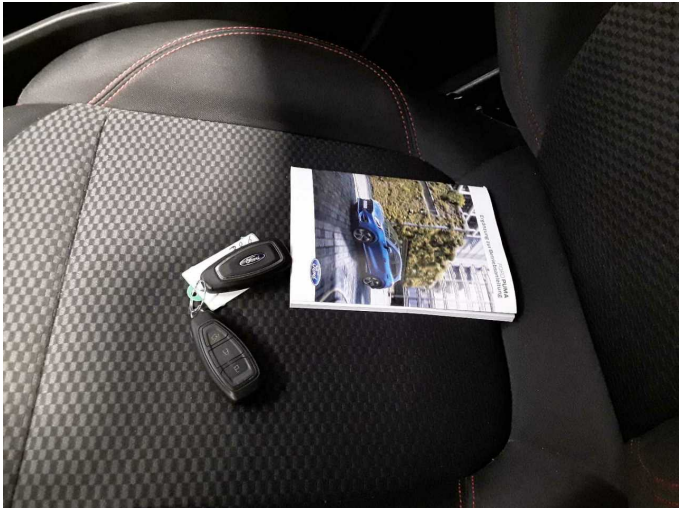


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

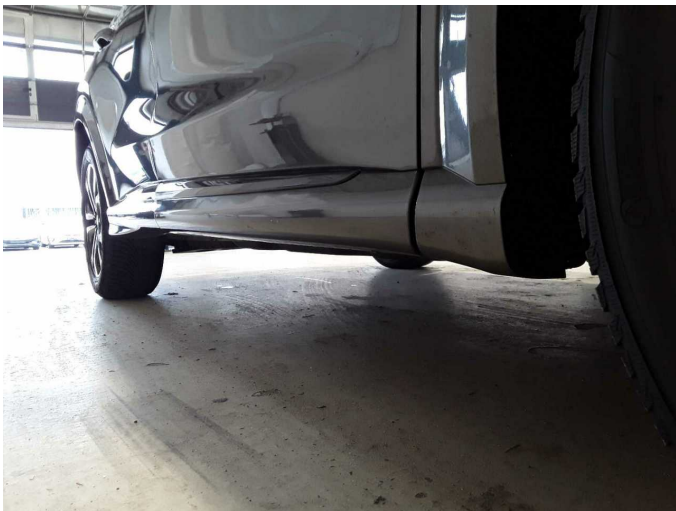


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Damage 3: Equipment: Tirefit filler - Expired - Replace



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value




Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value




Damage 5: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value

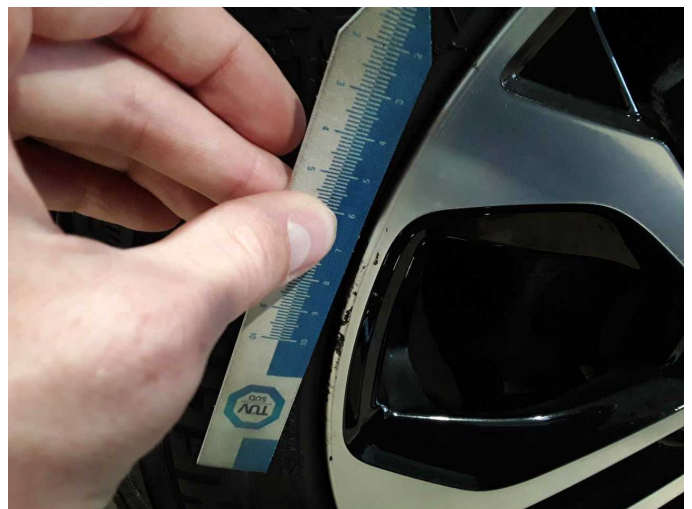

Damage 5: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 6: Wheel / tyres: Alloy rim - rear right side - Corrosion - Loss in value

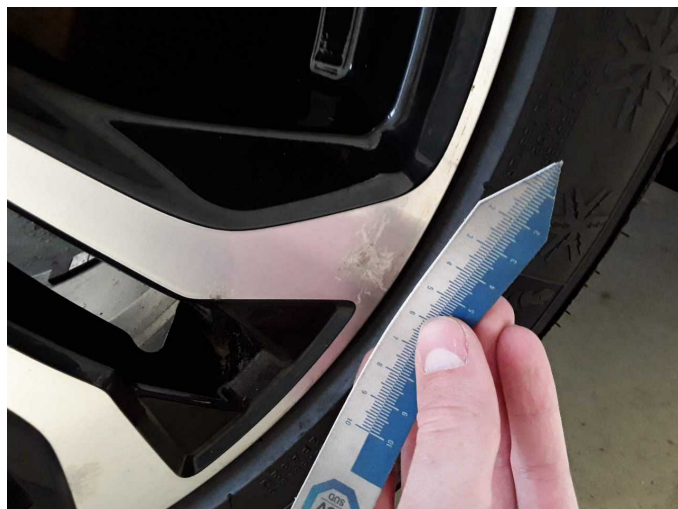

Damage 6: Wheel / tyres: Alloy rim - rear right side - Corrosion - Loss in value



Damage 6: Wheel / tyres: Alloy rim - rear right side - Corrosion - Loss in value