



Expertise

Protocol number: 46918517
Order No. / Reference: 26676167
Inspection date: 6 Aug 2026

Manufacturer: Volkswagen

Model: Tiguan Allspace 2.0 TDI SCR 4Motion DSG R-Line

VIN: WVGZZZ5N9PM067720



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Tiguan Allspace 2.0 TDI SCR 4Motion DSG R-Line	
Vehicle Identification number	WVGZZZ5N9PM067720
Mileage (Read)	113,442 km
First registration	24 Apr 2023
Number of holders	1
Next periodical technical inspection	07/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	147 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Deep Black Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	4,900 km
Last service on / at	07/2026 at 112,610 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS434078
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CLE 03432		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,380 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/45 R19 100V	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	255/45 R19 100V	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 100H	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	235/55 R18 100H	Winter tyres on Light alloy	Continental	8mm / 8mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Equipment

- Klimaautomatik

|



Standard equipment

- Storage compartments in the overhead console
- Airbag, head airbag system including front side airbags
- Airbag: Side airbags for the outer seats of the 2nd row.
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto
- Electrically adjustable and heated exterior mirrors
- Hill descent control
- Chrome applications on mirror adjustment switches, window regulator switches, door pull handles
- Decorative inlays "Carbon Grey"
- Display: Digital Cockpit Pro, multicolor, various selectable info profiles
- Electronic parking brake including auto-hold function
- Driving assistant "Travel Assist" and lane keeping assistant "Lane Assist"
- Electric windows front and rear
- Pedestrian detection
- Luggage compartment lighting
- Transmission: 7-speed DSG
- Rear window heated
- Rear window wiper with intermittent function
- Interior mirror automatically dimming
- LED license plate lighting
- Rear headrests (3)
- LED matrix headlights - IQ.LIGHT
- Steering wheel: Multifunction sports steering wheel in leather, heated, with paddle shifters
- Illuminated makeup mirrors in the sun visors
- Fatigue detection
- Emergency braking assistant "Front Assist"
- Package: Winter
- Proactive occupant protection system in conjunction with "Front Assist"
- Rain sensor
- Wheels: AirStop tires 255/45 R 19, optimized for low rolling resistance
- Gearshift knob in leather
- electromechanical power steering
- Seats: Front passenger seat backrest folds down completely
- Seats: Top comfort seats in the front
- Seats: Front seats with height adjustment
- 12-volt socket
- Bumpers in body color, in "R-Line" styling
- Textile floor mats front and rear
- Prepared for later activation: Navigation function "Discover Media" incl. "Streaming & Internet"
- Central locking without safe locking, with remote control and 2 remote keys
- Airbag for driver and front passenger including knee airbag on the driver's side
- Permanent 4MOTION all-wheel drive
- Adaptive Cruise Control (ACC) "stop & go" with speed limiter
- Exterior mirror housings painted silver
- third brake light
- Chrome trim on the side windows
- Silver anodized roof rails
- Diesel particulate filter
- Parking assistance
- Front door sill trims in aluminum, with "R-Line" logo
- Electronic Stability Program with counter-steering support
- Automatic headlight control, with daytime running lights
- Driving profile selection
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage compartment floor height adjustable in 2 stages
- Tailgate with electric opening and closing, adjustable opening angle
- Rear spoiler in R-style
- ISOFIX mounting points, also for i-Size child car seats
- Air conditioning system "Air Care Climatronic"
- Front headrests
- LED headlights with bad weather light and cornering light
- Reading lights: 2 front and 2 rear
- Light in the front footwell
- front center armrest
- Non-smoking version
- Emergency call service
- Stainless steel pedals
- Radio
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- Wheels: Tire Mobility Set omitted
- Wheels: Light alloy (4) "Valencia" 8.5 J x 19, Volkswagen R
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Lumbar support in the front
- Seats: Heated front seats
- Start-stop system with brake energy recuperation
- Power outlet: 2 USB-C ports on the front
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear



Extra equipment

- Anti-theft alarm system with safe locking (anti-theft alarm system with interior monitoring, backup horn and tow-away protection, central locking with safe locking, remote control and 2 remote folding keys)
- Package: Business Premium incl. Navigation (DSG) (2 USB-C ports in the front, 1 USB-C charging port on the rear center console - Head-up display - Leather multifunction steering wheel, heated, with shift paddles - Automatically heated windshield washer nozzles in the front - Voice control - "Comfort" telephone interface with inductive charging function - Heated front seats)
- Package: Leather package "Vienna", Volkswagen R, incl. front seats with memory function (electrically adjustable, folding, heated exterior mirrors with memory function and ambient lighting - electrically adjustable lumbar support in front - leather seat covers - electrically adjustable front seats with memory function; with comfort entry on the driver's side - front seats with active climate control)
- Windows: Rear side windows and rear window tinted
- Surround view "Area View" (incl. reversing camera "Rear View")
- Paint finish: Metallic in combination with R-Line "Black Style"
- Paint finish: Pearl effect
- Navigation system "Discover Pro" incl. "Streaming & Internet" (8 speakers - App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Digital radio reception DAB+ - Navigation system "Discover Pro" incl. "Streaming & Internet" - Radio - Voice control - Traffic sign recognition)
- Package: Driver assistance package "Plus" without "Side Assist" and proactive occupant protection system (Driving assistant "Travel Assist", lane keeping assistant "Lane Assist" and "Emergency Assist" - parking steering assistant "Park Assist" incl. parking aid - traffic sign recognition)
- Radio accessories: "Harman Kardon" sound system (8+1 speakers - 480 watts total power - digital 16-channel amplifier - subwoofer)
- Keyless locking and starting system "Keyless Access" with safe locking mechanism

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Valve (Reifen HR) - Missing - Replace
2	Door - front right side	Door - dent(s) - Smooth repair work
3	Side panel - rear left side	Sill - dent(s) - Smooth repair work
4	Rear bumper	Rear bumper - Scratched - Smart repair
5	Side panel - rear right side	Side panel - Dent / paintcoat damage - Smart repair
6	Door - rear right side	Door - dent(s) - Smooth repair work
7	Side panel - rear right side	Side panel - Scratch(es) - Paint
8	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Scratched - No deduction
2	Wing mirror - right side	Mirror housing - Abrasion - No deduction
3	Boot lid / rear door	Trim - standard - lower - Scratched - No deduction
4	Trim / covers	Cargo area - lining - right side - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

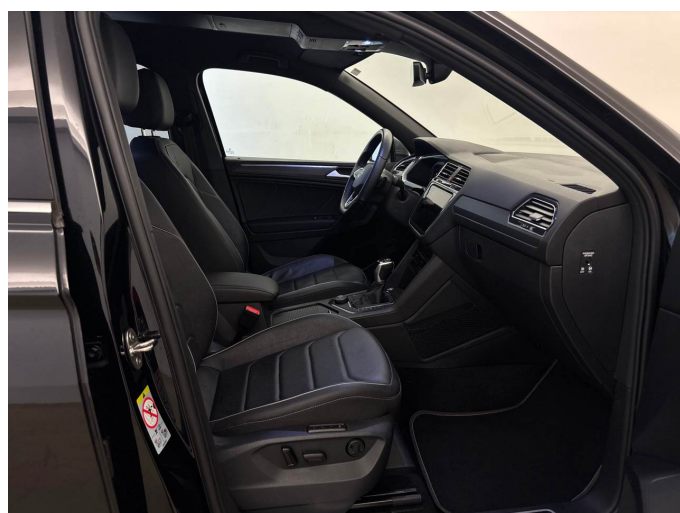


Figure 5: Interior - front

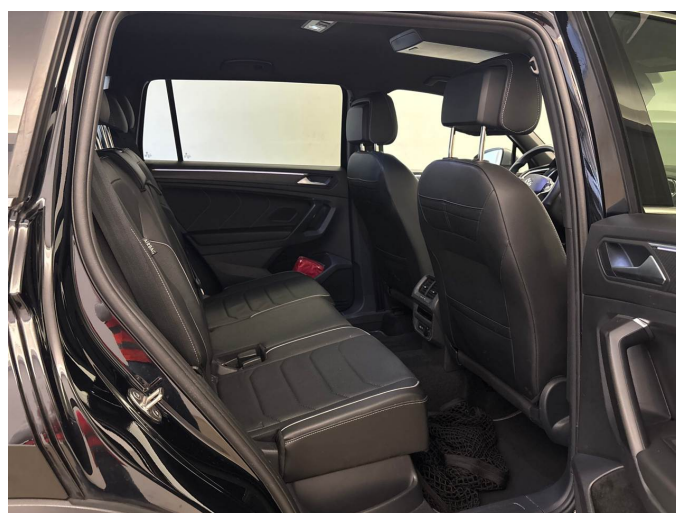


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

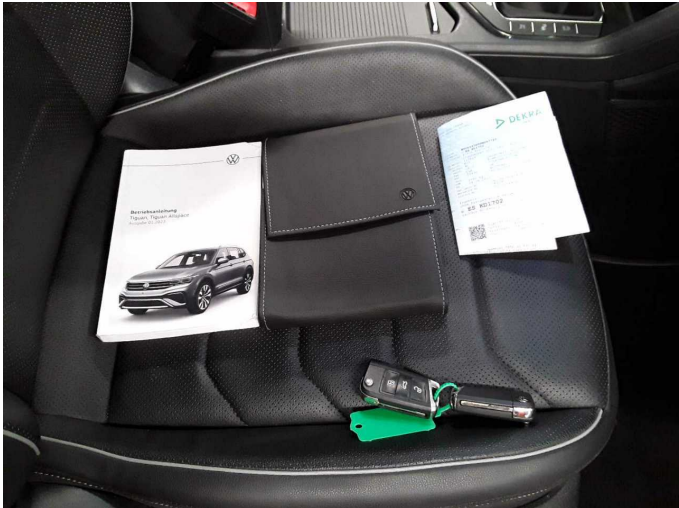


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Additional tyres

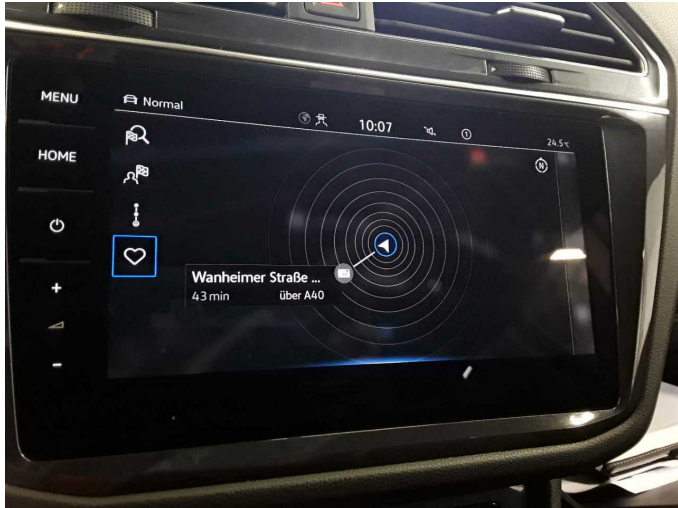


Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.

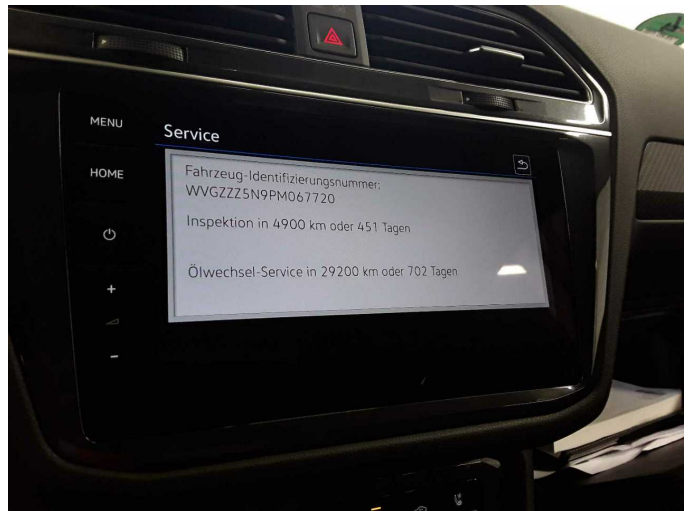


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

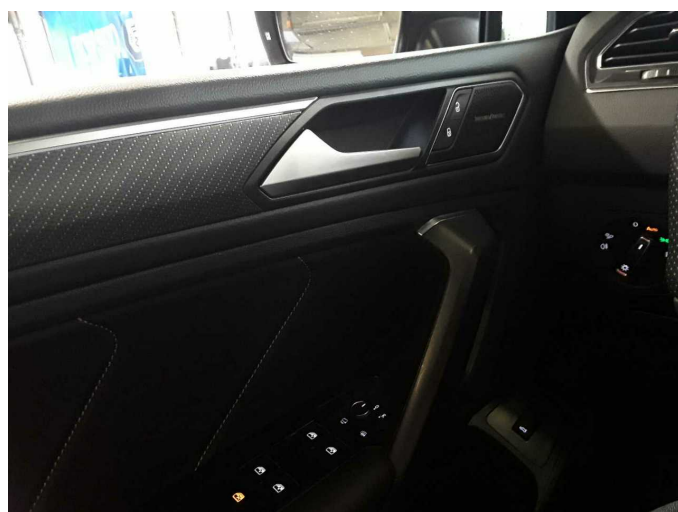


Figure 28: Misc.

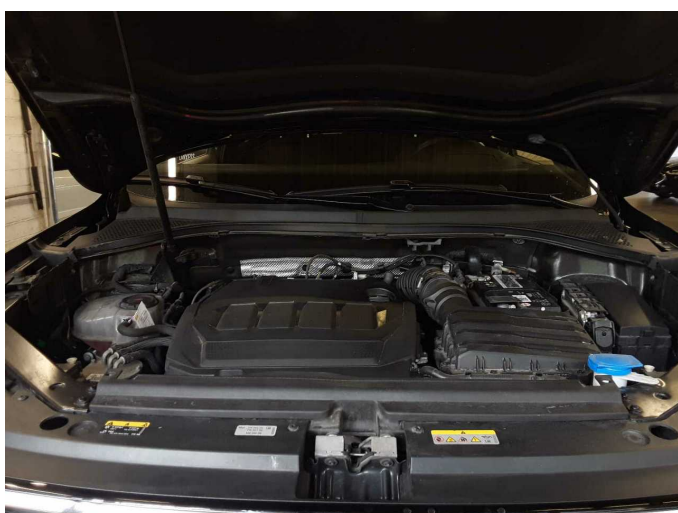


Figure 29: Misc.

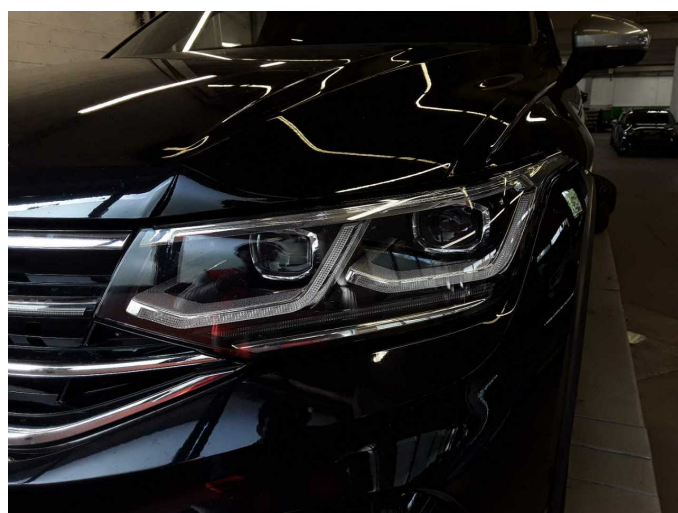


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.



Figure 39: Misc.



Damage 1: Wheel / tyres: Valve (Reifen HR) - Missing - Replace




Damage 1: Wheel / tyres: Valve (Reifen HR) - Missing - Replace




Damage 2: Door - front right side: Door - dent(s) - Smooth repair work




Damage 2: Door - front right side: Door - dent(s) - Smooth repair work

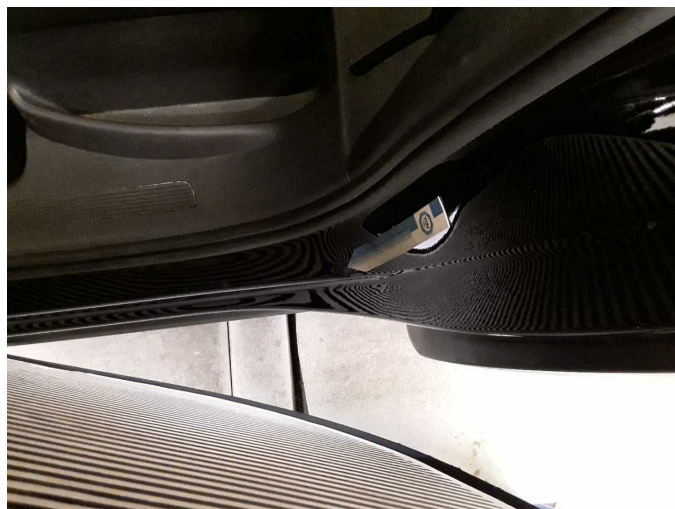

Damage 3: Side panel - rear left side: Sill - dent(s) - Smooth repair work

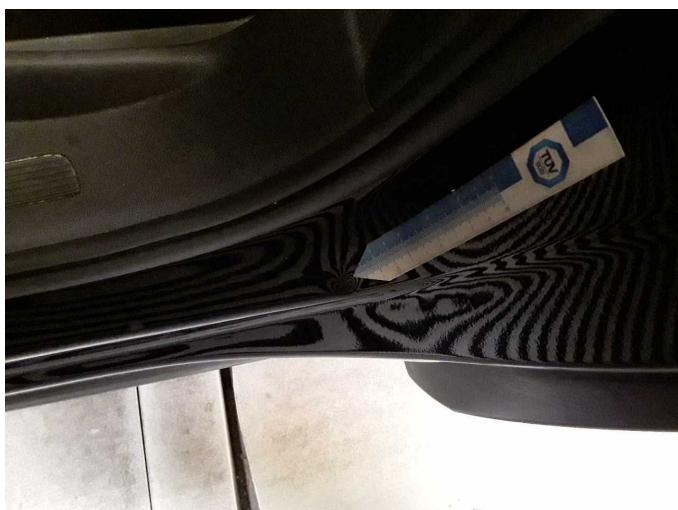

Damage 3: Side panel - rear left side: Sill - dent(s) - Smooth repair work

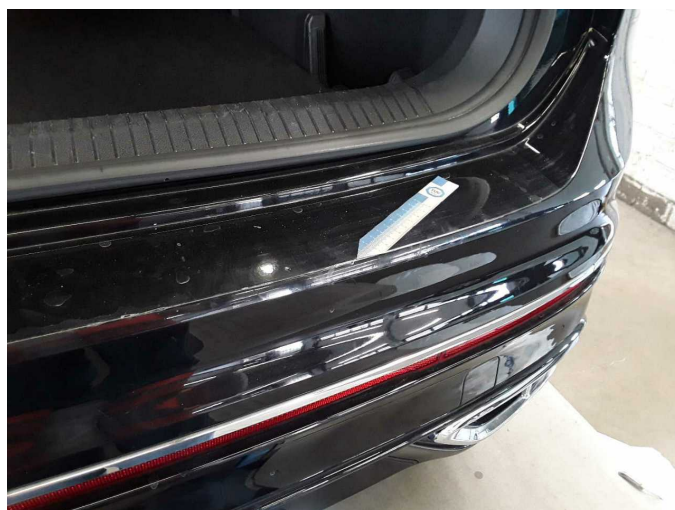

Damage 4: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 4: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 4: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 4: Rear bumper: Rear bumper - Scratched - Smart repair




Damage 5: Side panel - rear right side: Side panel - Dent / paintcoat damage - Smart repair



Damage 5: Side panel - rear right side: Side panel - Dent / paintcoat damage - Smart repair



Damage 6: Door - rear right side: Door - dent(s) - Smooth repair work

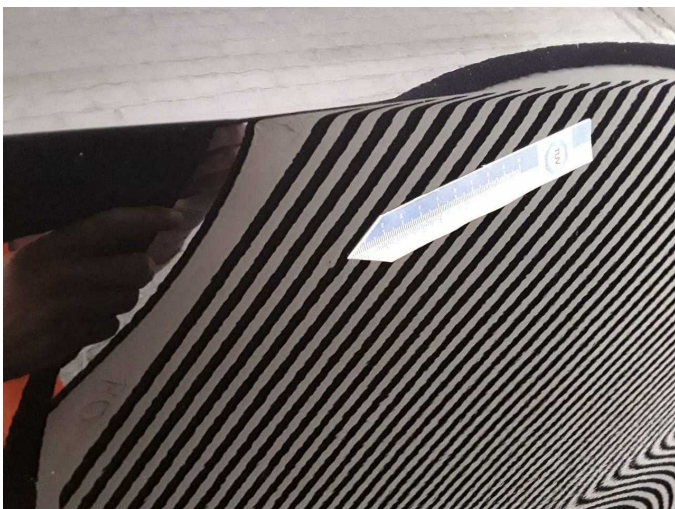

Damage 6: Door - rear right side: Door - dent(s) - Smooth repair work



Damage 6: Door - rear right side: Door - dent(s) - Smooth repair work



Damage 6: Door - rear right side: Door - dent(s) - Smooth repair work




Damage 7: Side panel - rear right side: Side panel - Scratch(es) - Paint




Damage 7: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 8: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

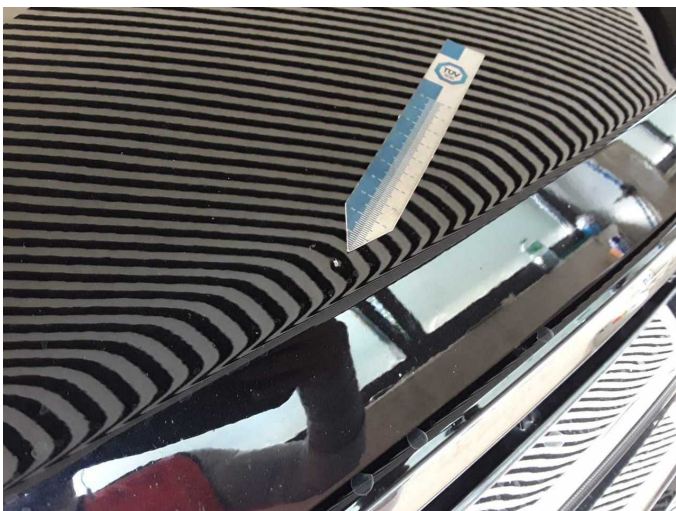

Damage 8: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

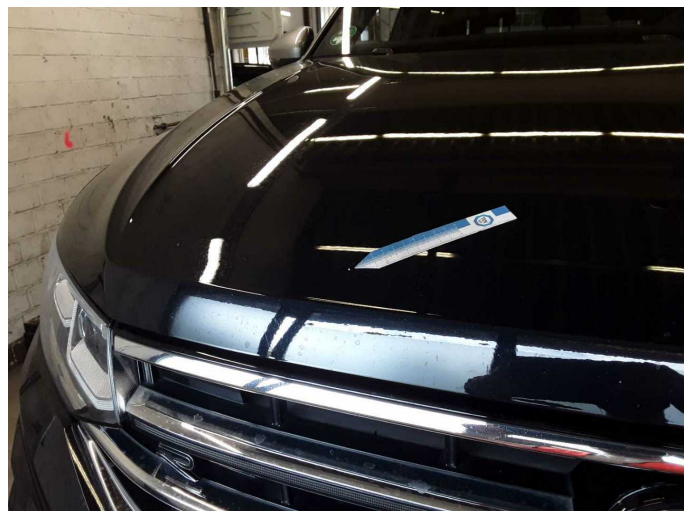

Damage 8: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 8: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Wear and tear 1: Front bumper: Front bumper - Scratched - No deduction



Wear and tear 1: Front bumper: Front bumper - Scratched - No deduction




Wear and tear 2: Wing mirror - right side: Mirror housing - Abrasion - No deduction



Wear and tear 2: Wing mirror - right side: Mirror housing - Abrasion - No deduction



Wear and tear 3: Boot lid / rear door: Trim - standard - lower - Scratched - No deduction

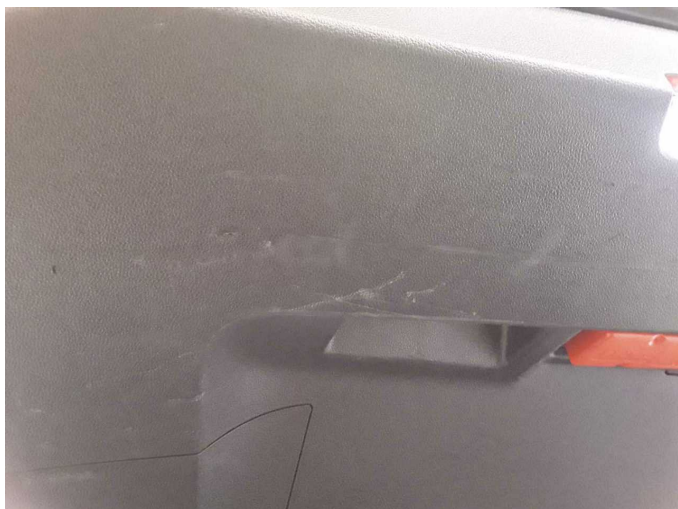

Wear and tear 3: Boot lid / rear door: Trim - standard - lower - Scratched
- No deduction



Wear and tear 3: Boot lid / rear door: Trim - standard - lower - Scratched
- No deduction



Wear and tear 3: Boot lid / rear door: Trim - standard - lower - Scratched
- No deduction



Wear and tear 4: Trim / covers: Cargo area - lining - right side -
Scratched - No deduction



Wear and tear 4: Trim / covers: Cargo area - lining - right side -
Scratched - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5N9PM067720

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Tiguan Allspace 2.0 TDI SCR
4Motion DSG R-Line

Datum	KM-Stand	Beschreibung
10.07.2026	112.610	AU; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
17.02.2026	96.932	Reparatur Sonstiges; Systemtest/Eigendiagnose
14.01.2026	94.584	Reparatur Sonstiges; Reparatur Sonstiges; Systemtest/Eigendiagnose
31.10.2025	88.248	Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Systemtest/ Eigendiagnose
31.07.2025	80.808	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
13.01.2025	57.521	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
22.03.2024	29.711	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges