



BMW IX1: GN-986-ZZ

Vinnumber:	WBY61EF0305W94129	Versionname:	BMW IX1 xDrive30 VP [5P] bva 1-313CH-9cv (SUV)
First Registrationdate:	19/05/2023	Fiscalpower:	
Expertise Mileage:	43355	Power Kw:	230
Bodytype:	SUV	Body colour:	Dark Grey
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Electric	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		
Last service correctly filled in:	Yes		

Options

Number of keys total	2	Radio	
Number keys remote	2	Central consol F	
GPS big screen color		Headlights Xenon/LED/Laser	
Windows electric F		Front parking sensors	
Windows electric R		Rear parking sensors	
Cruise Control		Rear view camera	
Steering wheel multifunctional		Seat cover lining	Lining Other
Steering wheel leather			
Type of climate control	Autom climate control		


Tyres

	205/65/17/100 Y			
Summer tyres:	Fr.L.	Vredestein: 60%	Fr.R.	Vredestein: 90%
	Re.L.	Vredestein: 45%	Re.R.	Vredestein: 55%
Tyre profile depth FL	4.3			
Tyre profile depth FR	2.0			
Tyre profile depth RL	5.1			
Tyre profile depth RR	4.5			
Tyre size FL	205/65 R 17 100 Y			
Tyre size FR	205/65 R 17 100 Y			
Tyre size RL	205/65 R 17 100 Y			
Tyre size RR	205/65 R 17 100 Y			
Tyre type FL	Summer			
Tyre type FR	Summer			
Tyre type RL	Summer			
Tyre type RR	Summer			
Tyre make FL	2480			
Tyre make FR	2480			
Tyre make RL	2480			
Tyre make RR	2480			

Assistance equipment

Interior, Dirty, Chemical cleaning



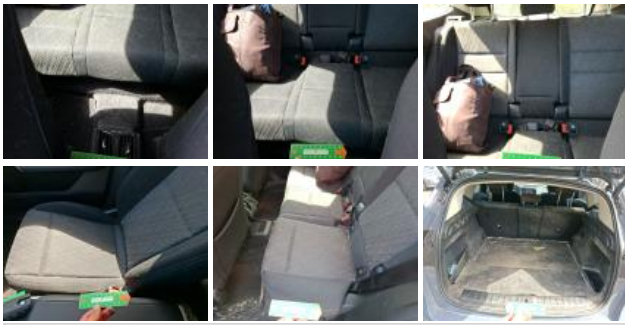

Tyre FR, Out of tolerance, Replace



Alloy rim FR, Scratch(es), Repair/replace (lump sum)



Alloy rim RR, Scratch(es), Repair/replace (lump sum)



Alloy rim RL, Scratch(es), Repair/replace (lump sum)



Alloy rim FL, Scratch(es), Repair/replace (lump sum)



Door RL, Dent(s) and scratch(es), Repair and paint (complete)



Roof pillar L, Dent(s), Repair and paint (complete)



Wing trim RL, Scratch(es), Replace



Bumper F, Scratch(es), Paint



Bumper grille, Broken, Replace



Bumper moulding FL, Broken, Replace



Headlight L, Scratch(es), Polish



Windscreen, Stone chip(s), Replace



Windscreen glue kit, Required to install glazing, Repair/replace (lump sum)



Outside rear-view mirror housing R, Broken, Replace and paint



Side repeater R, Broken, Replace



Outside rear-view mirror base R, Broken, Replace



Side repeater R, Missing, Replace



Luggage compartment cover, Missing, Replace



Bumper moulding RL, Broken, Replace



Bumper moulding RR, Broken, Replace



Roof, Dent(s), Repair and paint (complete)



Historique Maintenance

Immatriculation: **GN-986-ZZ** Date de 1ère immatriculation: **19/05/2023**
Modèle: **BMW IX1 xDrive30 VP [5P] bva 1-313CH-9cv (SUV)**

Date	Kilométrage	Fournisseur	Descriptif
23/05/2025	31.454	NDBM1	DIAG
	0		LIQUIDE DE FREIN
	0		SERVICE CONTROLE VH BMW MINI
	0		FILTRE CLIM RPLT