



Peugeot 5008:

Vinnumber:	VF3MCYHZMMS148104	Versionname:	
First Registrationdate:	4/06/2021	Fiscalpower:	
Expertise Mileage:	162051	Power Kw:	
Bodytype:		Body colour	Black
Gearbox:	MAN 6 VIT	Type of rims (mounted)	Aluminium
Transmission:		Parking lot	3205
Fueltype:	Diesel		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Sun Roof electric	
Cruise Control		Luggage cover	
Steering wheel multifunctional		Front parking sensors	
Seats F heated		Rear parking sensors	
Radio multimedia		Type of Tow bar	Tow bar removable
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining semi-artificial leather		
Type of climate control	Autom climate control		
Type of GPS storage	HD		

Limited Technical Inspection

Tyres

225/55/18/102 Y				
Summer tyres:	Fr.L.	Vredestein: 5 mm	Fr.R.	Vredestein: 5 mm
	Re.L.	Vredestein: 5 mm	Re.R.	Vredestein: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				225/55 R 18 102 Y
Tyre size FR				225/55 R 18 102 Y
Tyre size RL				225/55 R 18 102 Y
Tyre size RR				225/55 R 18 102 Y
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				2480
Tyre make FR				2480
Tyre make RL				2480
Tyre make RR				2480

Assistance equipment

Spare wheel	No	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	1442,09
Registration document, Damaged, Acceptable	0,00



Interior, Damaged, Acceptable

0,00



Bonnet, Dent(s), Paintless dent repair

95,47



Bumper F, Scratch(es), Acceptable

0,00




Bumper moulding F, Scratch(es), Acceptable

0,00




Door FL, Dent(s), Paintless dent repair

95,47

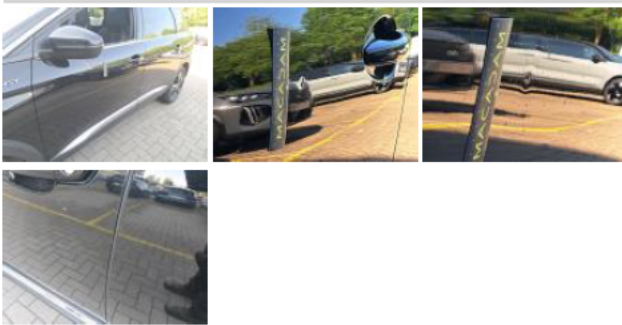


Alloy rim RL polished, Scratch(es), Repair and paint (complete)



204,21

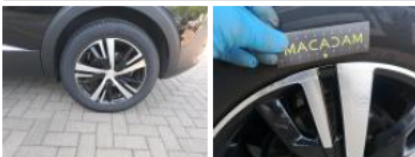

Alloy rim FL polished, Scratch(es), Repair and paint (complete)

204,21

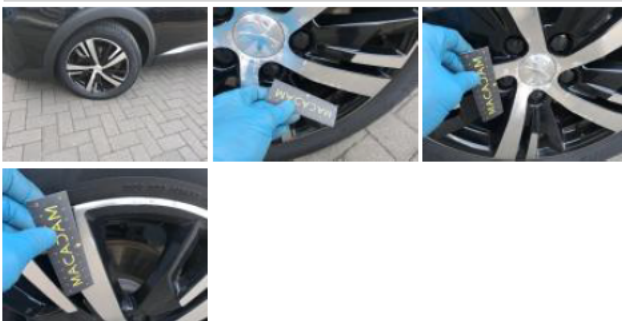

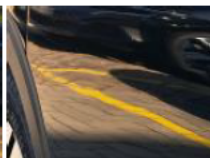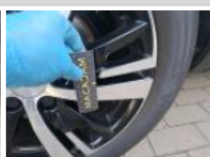Spare wheel, Missing, Replace	271,72
	
Bumper R, Scratch(es), Acceptable	0,00
 	
Wing RR, Dent(s) and scratch(es), Acceptable	0,00
  	
Door RR, Dent(s) and scratch(es), Repair and paint (complete)	475,54
      	
Alloy rim FR polished, Scratch(es), Acceptable	0,00
 	
Alloy rim RR polished, Scratch(es), Acceptable	0,00
 	
Step R, Scratch(es), Acceptable	0,00
 	
Roof pillar R, Dent(s), Paintless dent repair	95,47
 	