



Expertise

Protocol number: 46090920
Order No. / Reference: 26469373
Inspection date: 22 Jun 2026

Manufacturer: Audi

Model: Q3 35 TDI S tronic S line

VIN: WAUZZZF35P1071358



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi Q3 35 TDI S tronic S line	
Vehicle Identification number	WAUZZZF35P1071358
Mileage (Read)	171,667 km
First registration	11 Jan 2023
Number of holders	1
Next periodical technical inspection	03/2028
(Report on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Mythossschwarz Metallic (Y9T)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	28,800 km
Last service on / at	05/2026 at 170,456 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP950503
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0588 / BOY 05302		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,155 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 100Y	Summer tyres on Light alloy	Bridgestone	4mm / 4mm
2)	235/55 R18 100Y	Summer tyres on Light alloy	Bridgestone	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Hankook	5mm / 5mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Hankook	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger (with front passenger airbag deactivation)
- Anti-lock braking system (ABS)
- Audi connect Emergency Call & Service (includes the following services: - Legal emergency call - Audi connect emergency call. In the event of a serious accident, an emergency call is automatically triggered. - Online breakdown call. In the event of a breakdown, the customer can trigger the online breakdown call via the service call button in the overhead module. - Audi Damage Service. If the vehicle sensors detect a minor accident without airbag deployment and/or seatbelt tensioning, the customer is automatically informed via the Audi Damage Service. - Audi service appointment online.)
- Audi pre sense front (within system limits, uses a front radar to detect the area in front of the vehicle and warns the driver with visual and acoustic signals to indicate a potential hazard caused by vehicles ahead, whether moving or stationary. Pedestrian and cyclist detection registers, within system limits, when a pedestrian or cyclist is moving on or crossing the road. The system then warns the driver with an acoustic and visual signal.)
- Hill start assist (after prolonged use of the foot brake while stationary, the built-up brake pressure is maintained for a short moment after releasing the foot brake; this automatic braking intervention makes it easier for you to start comfortably on inclines)
- Digital instrument cluster - fully digital instrument cluster in 10.25 inches (speed, time, mileage, outside temperature, fuel warning with remaining range, shift indicator (for manual and automatic transmissions in manual mode), current radio station or music track, radio and media lists, classic-style display; if available: telephone menu (in conjunction with multifunction steering wheel), trip computer with short- and long-term memory, fuel-saving tips for more economical driving including break recommendations)
- front and rear floor mats
- Legal emergency call (complies with the legal requirements of the pan-European emergency call system. The emergency call is triggered either manually or automatically in the event of a serious accident and establishes a voice connection with a local emergency services control center in the respective national language. In addition, vehicle-related data is collected and also sent to the local emergency services control center.)
- rear window wiper
- ISOFIX and Top Tether child seat attachments for the outer rear seats (standard mounting for the convenient attachment of i-Size and ISOFIX child seats - including an additional attachment point (Top Tether). Recommended child seats are available from your Audi dealer.)
- Headrests (5) front and rear
- LED headlights (low beam, high beam, daytime running lights and position lights in LED technology - turn signals in incandescent bulb technology)
- Airbag: Front side airbags and head airbag system (front side airbags integrated into the seatbacks; with additional head airbag system; deploys in front of the side window area and thus helps to protect front and outer rear passengers in the event of a side impact)
- Audi connect Remote & Control (The services of Audi connect Remote & Control connect the vehicle to your smartphone. The myAudi app allows you to remotely access the vehicle, view its last parking position and current vehicle status. - Parking position - Vehicle status and driving data - Remote locking and unlocking - Remote control of the auxiliary heater - Push notifications for the anti-theft alarm system)
- Audi pre sense basic (within the system's limits, it initiates preventive safety measures for the occupants by networking and coordinating different vehicle systems. In unstable driving conditions, the front seat belts are electrically tightened. Depending on the situation, the windows close. The hazard warning lights are activated to warn following traffic.)
- Electrically adjustable and heated exterior mirrors (with integrated LED turn signals, including heated windshield washer nozzles)
- third brake light
- black roof rails
- Decorative inlays Micrometallic silver
- Diesel particulate filter (DPF)
- Door sill trims with aluminum inlay (front, illuminated, with S lettering)
- Electromechanical parking brake (includes parking brake function when stationary, starting aid by automatic release when starting off and emergency braking function while driving via all four wheels)
- Electronic Stability Control (ESC)
- Chassis: Sport chassis (sporty chassis with firmer spring and damper settings)
- Electric windows front and rear
- Adjustable speed limiter (allows individual limiting of the maximum speed from 30 km/h, e.g., within built-up areas. When the set limit is reached, the vehicle's speed is smoothly reduced. Operation is via a separate steering column lever. The set maximum speed is displayed in the driver information system. The limit can be overridden at any time by using kick-down.)
- Transmission: S tronic 7-speed
- Heated rear window
- Electrically operated child safety lock
- Manual air conditioning (cools or heats the vehicle interior - air distribution and fan manually adjustable - manual recirculation mode - particle filter - dust and odor separating cabin air filter, which ensures a lower burden of dust particles, odors and allergens in the vehicle interior)
- Paint finish: Solid



- Light/rain sensor (for controlling the automatic headlight switching, the windshield wipers and the coming home/leaving home function)
- Wheel: Light alloy wheels in 5-V-spoke (S-design) (7 J × 18 with tires 235/55 R 18)
- Wheel: Tire repair kit (12V compressor and tire sealant, maximum speed 80 km/h)
- Rear seat plus (rear seat back foldable in a 40:20:40 ratio - rear seat bench adjustable lengthwise - rear seat backrest adjustable in tilt)
- Electromechanical power steering (with speed-dependent steering assistance)
- Seat covers in Argument fabric (seat center panel in Argument fabric - inner and outer seat side bolsters, headrests, front center armrest (if ordered) in solid black fabric)
- Seats: Standard front seats (with manual adjustment of seat height, seat longitudinal position, backrest angle, headrest height and seat belt height)
- Lane Change Warning (The system uses two radar sensors to measure the distance and speed difference of vehicles approaching from behind. If a hazard is detected, the system warns the driver of this potential danger when changing lanes by displaying a warning in the respective side mirror. In conjunction with Parking Aid Plus or Parking Assistant including Rear Cross Traffic Alert, the system assists the driver when reversing out of perpendicular parking spaces.)
- Telephone: Bluetooth interface (The smartphone can be connected to the vehicle via Bluetooth to play music through the vehicle or to make phone calls. Depending on the smartphone model, emails and SMS messages can also be displayed in the MMI via Bluetooth.)
- Electronic immobilizer (integrated into the engine control unit, automatic activation via vehicle key)
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction controls (height and reach of the steering wheel are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with 6 multifunction buttons.)
- Wheel: Tire pressure monitoring system (visual and audible warning in case of pressure loss in one or more wheels)
- Radio: MMI Radio plus (digital instrument cluster 10.25 inch - 10.1" color display incl. MMI touch - AM/FM radio reception - DAB+ - USB interface with charging function - Bluetooth interface - hands-free calling and audio streaming - voice control for telephony, media - 6 passive speakers, 4 front, 2 rear, 80 watts - Audi connect emergency call & service with Audi connect remote & control - speed-dependent volume adjustment - accent area in the instrument panel and triangular trim panels of the front doors in black glass look)
- Lane Departure Warning (within system limits, helps prevent unintentional lane departures. If the system is activated and ready, and the driver has not used the turn signal, the Lane Departure Warning helps prevent crossing detected lane markings by making corrective steering interventions. Additional steering wheel vibration can be set at the driver's request. Operating range from approximately 60 to a maximum of 250 km/h)
- Start-stop system with recuperation (helps reduce fuel consumption and CO2 emissions by switching off the engine during stationary phases, e.g. at traffic lights. For a restart, the starting process is initiated as soon as the clutch is depressed (manual transmission) or the foot brake is released (S tronic). Can be deactivated at any time via a switch).
- Glazing: Windscreen in heat-insulating and acoustic glazing (heat-insulating glass)
- Central locking (with remote control)



Extra equipment

- Airbag: Rear side airbags
- Parking aid plus (supports the driver with acoustic signals and a display in the MMI when parking and maneuvering. The parking aid is activated by engaging reverse gear or via a button in the center console, or automatically when the distance to a detected object is less than 90 cm. Automatic activation can be switched on and off.)
- Deletion of model designation and performance/technology lettering
- Cruise control (maintains the individually set speed between 20 and 250 km/h, provided the engine power allows. It is operated via a separate steering column stalk. The set speed is displayed on the screen. The system does not react to vehicles ahead with adaptive cruise control.)
- Paint finish: Mythos Black Metallic
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction plus (The steering wheel impresses with its high-quality look and aluminum trim and feels good in the hand. Height and reach of the steering wheel are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with 12 multifunction buttons.)
- Ambient Lighting Package (front and rear roof module, including reading lights - illuminated glove compartment - right-side trunk lighting - illuminated vanity mirrors for driver and front passenger - entry lights on the underside of the front doors - front/rear door handles - ambient fabric lighting in the front/rear doors - front/rear footwell lighting - illuminated front cupholders - side ambient lighting of the front center console - illuminated storage compartment under the instrument panel)
- Wheel: Winter alloy wheels in 5-arm Secare (6.5 J x 17 with winter tires 215/65 R17)
- Reversing camera (Within the system's limits, the reversing camera captures the area behind the vehicle and displays it on the MMI screen using dynamic display elements. The system allows a choice between perpendicular parking mode and trailer mode (in conjunction with a factory-installed trailer hitch). Depending on the selected mode, the calculated driving lane or a guide line for coupling a trailer is displayed. The reversing camera is discreetly integrated into the tailgate handle.)
- Glazing: Sun protection glazing, tinted (rear window, rear door and side windows tinted)
- Anti-theft alarm system (The anti-theft alarm system monitors the doors, front hatch, and trunk lid. The deadbolt, linked to the door locks, prevents opening via the interior door handle once the vehicle has been locked with the key. The anti-theft alarm system also offers: switchable ultrasonic interior monitoring, a theft warning via a tilt sensor, and a battery-powered horn to prevent tampering.)
- Chassis: Comfort chassis (Comfortably tuned chassis - front with a McPherson strut axle with lower wishbones, subframe and stabilizer - rear with a four-link rear axle with separate spring and damper arrangement, subframe and stabilizer)
- 2-zone automatic climate control (electronically regulates air temperature, volume and distribution - separate temperature distribution for driver and front passenger side - sun position-dependent control - automatic recirculation control via air quality sensor - dust and odor separating allergen filter - air vents in the rear center console - separate defroster button for faster defrosting of the front and side windows)
- Front center armrest (adjustable in tilt, movable in length)
- Storage and luggage compartment package (flexible transport of items and comfort while traveling, consisting of: - storage net on the back of the front seats - storage compartment under the passenger seat - luggage compartment light (LED) in the tailgate for lighting the trunk - luggage compartment net - 12-volt socket in the trunk tray in the left side panel)
- Business package (MMI Navigation plus - 3-spoke leather steering wheel with multifunction plus - Audi virtual cockpit plus - Audi phone box - Audi connect Navigation & Infotainment plus - Cruise control)
- Panoramic glass roof (two-part glass roof - electric operation for tilting and opening the front glass element - tinted glass insert - including an electrically operated, lightproof sunshade - comfort opening/closing from the outside via the remote key - ensures a pleasant, light-flooded interior and an improved interior climate through efficient ventilation - an integrated wind deflector reduces wind noise when the roof is open)
- Seats: 4-way lumbar support (electrically adjustable, horizontally and vertically)
- Front seat heating (heats seat and backrest center section for standard seats, otherwise seat and backrest center section as well as seat side bolsters - individually adjustable in 3 stages for driver and front passenger via direct selection button on the climate control unit)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Door - rear right side	Brightware - lower - Scratch(es) - Loss in value
2	Trim / covers	Door trim - rear right side - Deformed - Loss in value
3	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
4	Side panel - rear left side	Side panel - Deformed - Repair and paint

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Door - rear right side	Door - dent(s) - No deduction
5	Rear bumper	Rear bumper - Scratch(es) - No deduction
6	Door - front left side	Door - dent(s) - No deduction
7	Body	Body - Scratch(es) - No deduction
8	Front bumper	Spoiler (Links) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Accident damages

No. Accident

- 1 Rear, Side - left
- 2 Front, Side right

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Das Fahrzeug weist der Laufzeit entsprechende Gebrauchsspuren auf.

- Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

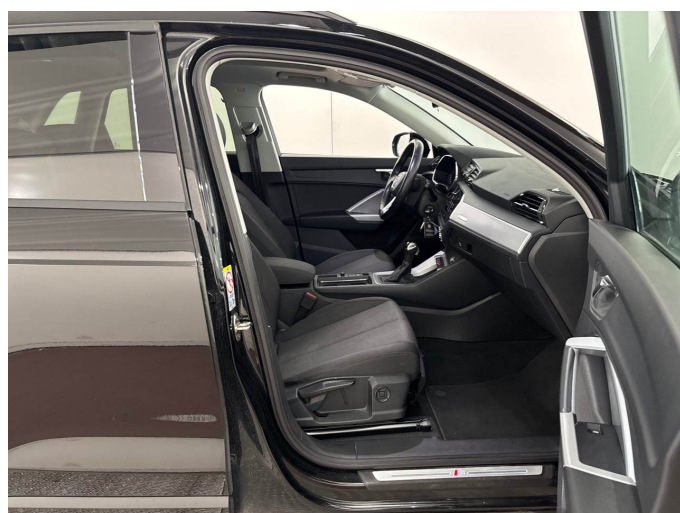


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

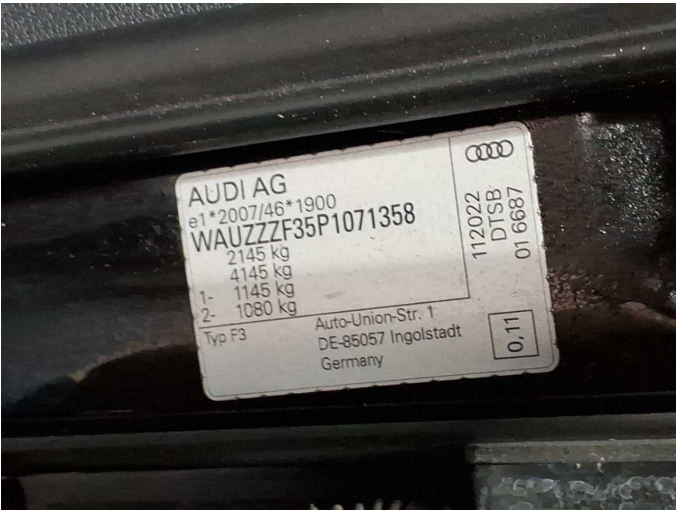


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

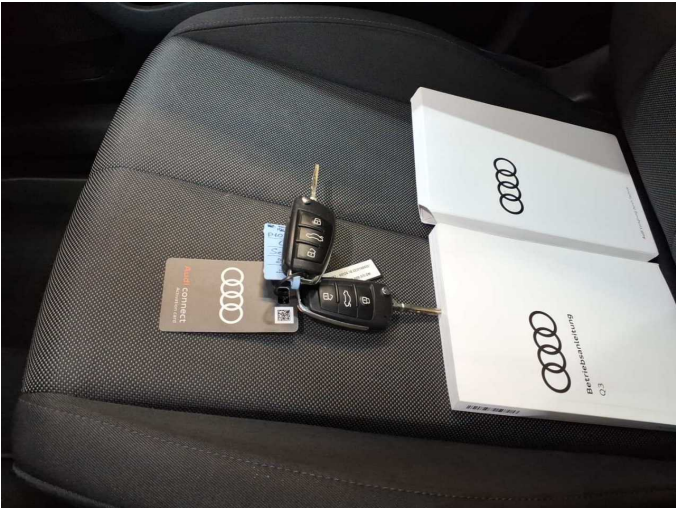


Figure 15: Documents



Figure 16: Additional tyres

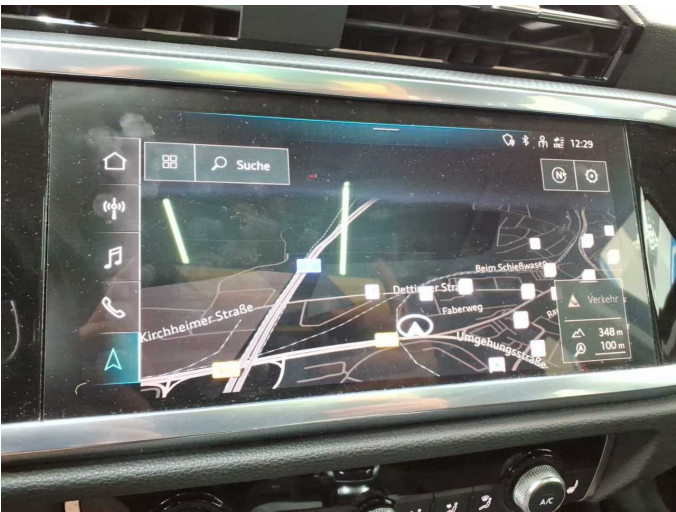


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

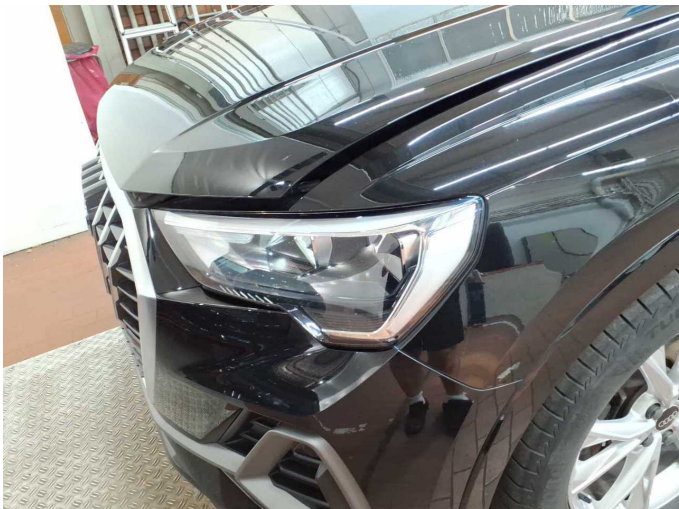


Figure 24: Misc.

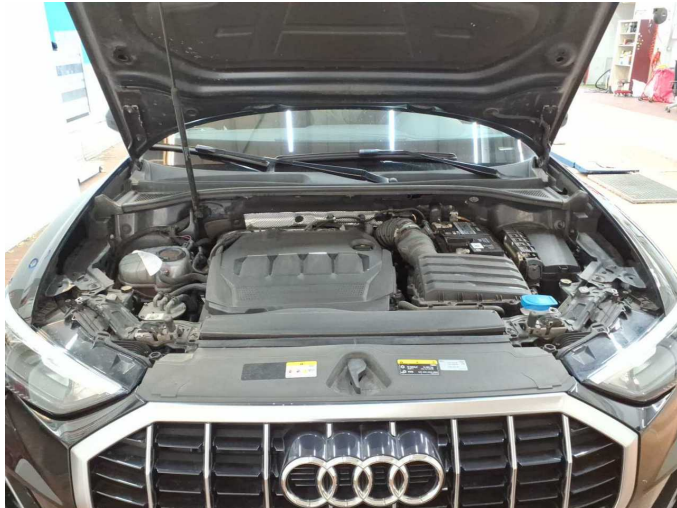


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

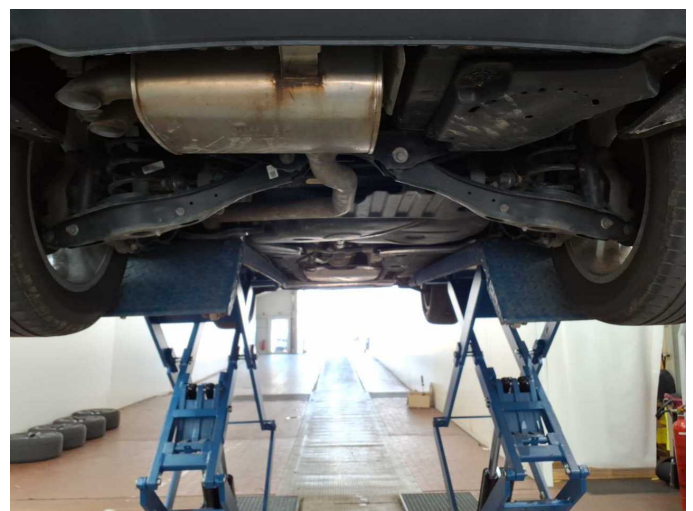


Figure 30: Misc.



Damage 1: Door - rear right side: Brightware - lower - Scratch(es) - Loss in value



Damage 1: Door - rear right side: Brightware - lower - Scratch(es) - Loss in value



Damage 2: Trim / covers: Door trim - rear right side - Deformed - Loss in value



Damage 2: Trim / covers: Door trim - rear right side - Deformed - Loss in value



Damage 3: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value




Damage 3: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value




Damage 3: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 4: Side panel - rear left side: Side panel - Deformed - Repair and paint

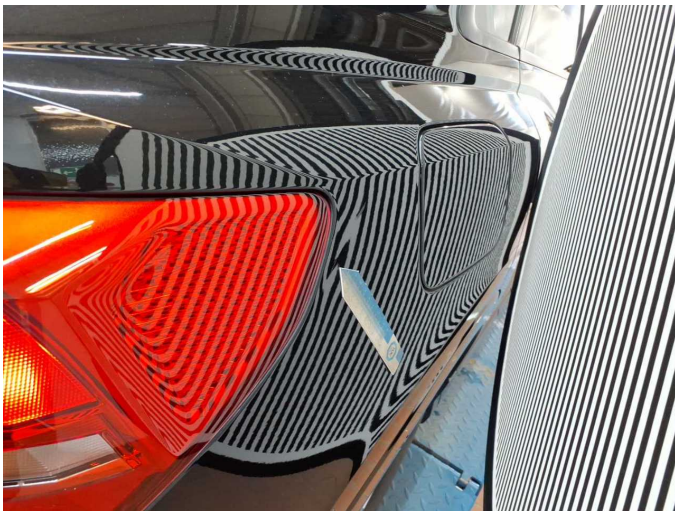

Damage 4: Side panel - rear left side: Side panel - Deformed - Repair and paint

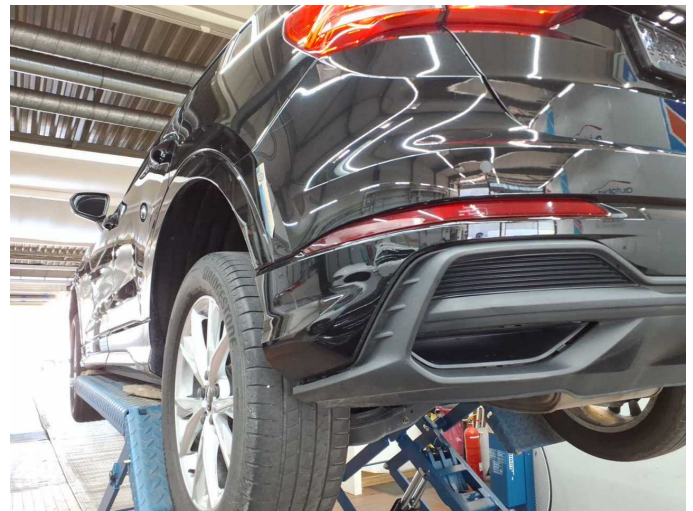

Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left




Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left

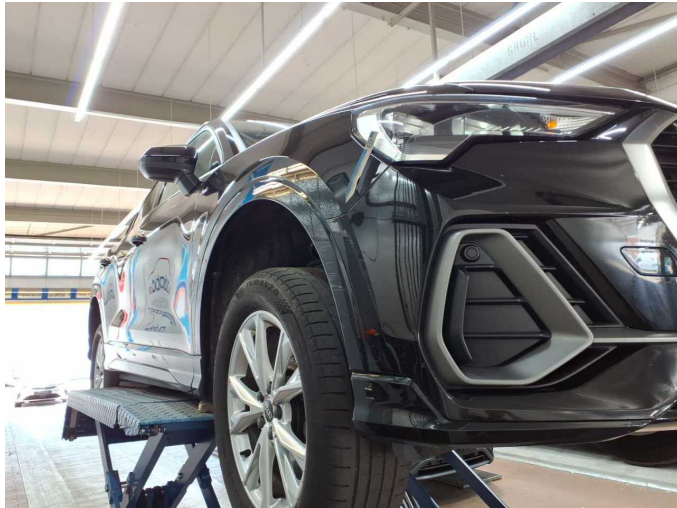


Accident 2: Front, Side right




Accident 2: Front, Side right



Accident 2: Front, Side right

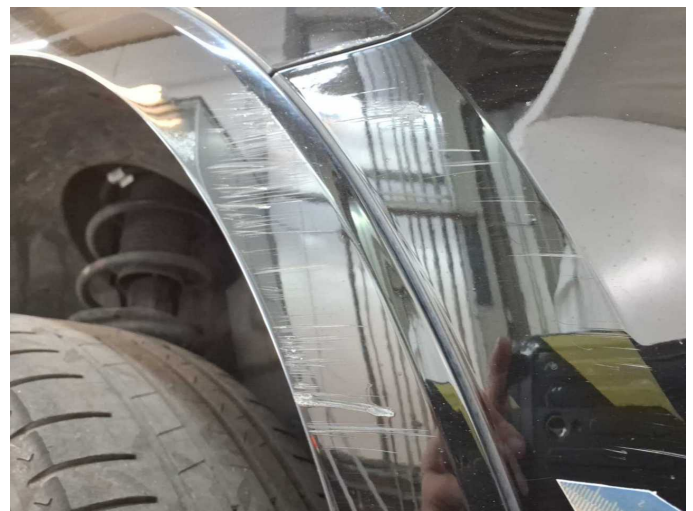

Accident 2: Front, Side right

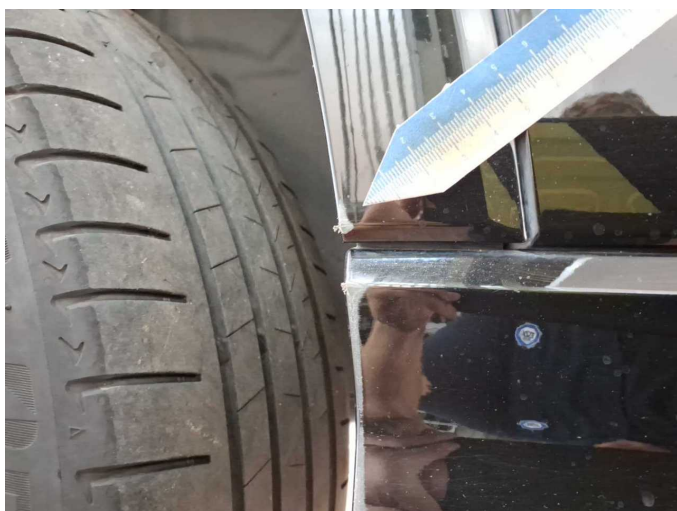

Accident 2: Front, Side right



Accident 2: Front, Side right



Accident 2: Front, Side right



Accident 2: Front, Side right



Accident 2: Front, Side right



Accident 2: Front, Side right



Accident 2: Front, Side right



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF35P1071358
Hersteller / Modell: AUDI AUDI Q3 35 TDI S tronic S line

Datum	KM-Stand	Beschreibung
13.05.2026	170.456	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
20.04.2026	163.716	AU
29.10.2025	142.930	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.10.2025	136.856	Reparatur Sonstiges; Systemtest/Eigendiagnose; Wasserpumpe ern
10.09.2025	135.770	Bremsklötze hinten; Bremsscheiben + Klötze v
23.07.2025	115.211	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
30.09.2024	89.788	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
24.05.2024	72.569	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten
27.02.2024	59.776	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.08.2023	28.942	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges