



Expertise

Protocol number: 46257661
Order No. / Reference: 26605529
Inspection date: 29 Jun 2026

Manufacturer: Volkswagen
VIN: WVGZZCD1PW115200

Model: Golf 2.0 TDI SCR DSG Life



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Golf 2.0 TDI SCR DSG Life	
Vehicle Identification number	WVGZZCD1PW115200
Mileage (Read)	79,263 km
First registration	25 Nov 2022
Number of holders	1
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Grey Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Dark grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	8,200 km
Last service on / at	03/2025 at 57,384 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM713922
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CNX 01444		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,950 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91V	Summer tyres on Light alloy	Nexen	4mm / 4mm
2)	205/55 R16 91V	Summer tyres on Light alloy	Continental	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91H	Winter tyres on Light alloy	Bridgestone	4mm / 4mm
2)	205/55 R16 91H	Winter tyres on Light alloy	Bridgestone	3mm / 3mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 2 USB-C ports on the front
- Turning brake function and evasive steering support (When making left turns, the Golf with the turning assistant automatically brakes to a standstill (with a simultaneous acoustic and visual warning) should a vehicle approach in the lane to be crossed. Depending on the speed of both vehicles, the turning assistant can, within the system limits, prevent the accident or mitigate its consequences.)
- Electrically adjustable and heated exterior mirrors with memory function and passenger-side mirror lowering function.
- Vehicle tool kit
- Car2X (Using the WLANp ITS G5 standard, all Car2X-enabled vehicles and traffic systems such as traffic lights can transmit data at high speed without using the mobile network. This works over a distance of around 800 meters - enough to warn of an invisible traffic jam.)
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Electronic parking brake including auto-hold function
- Automatic headlight control, with LED daytime running lights (as well as welcome and farewell lights)
- Electric windows, front and rear
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage compartment cover
- Rear window heated
- Rear window wiper with intermittent function
- ISOFIX mounting points (for child seats on the outer rear seats and on the front passenger seat, i-Size compatible)
- Rear headrests (3 pieces)
- LED reading lights at the front (2) and 2 at the rear
- LED headlights
- Dynamic headlight range control
- Illuminated makeup mirrors in the sun visors
- Fatigue detection (detects signs of possible driver fatigue based on characteristic steering behavior, time of day and driving duration and issues a visual and audible warning)
- Emergency call service (no registration required, service is activated upon delivery)
- Radio "Composition" (touchscreen with 21 cm screen diagonal - 4+1 speakers - output power 4 x 20 watts - FM radio reception - dual tuner with phase diversity for the best possible radio reception - Radio Data System (RDS) - MP3 playback - USB-C interface with Apple compatibility - DAB+ digital radio reception - telephone interface (hands-free system, Bluetooth audio))
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Keyless start system without safe locking
- Seat belts: Three-point automatic seat belt for the middle rear seat
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Comfort seats in the front
- 2 USB charging ports on the rear of the center console
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Airbags: Front and rear head airbags, front side airbags, center airbag
- Ambient lighting, 10 colors
- App-Connect (selected smartphone apps can be displayed and operated on the touchscreen of the radio or navigation system - MirrorLink, Android Auto, Apple CarPlay)
- Exterior mirror housings and door handles in body color
- Third brake light
- Headliner in Storm Grey
- Decorative inlays "Nature Cross Brushed" (for instrument panel and front door trim)
- Diesel particulate filter and SCR catalyst
- Digital Cockpit Pro, multicolor (various info profiles selectable)
- Electronic differential lock XDS
- Electronic stability program and electromechanical brake booster (Anti-lock braking system with brake assist - Electronic brake force distribution - Traction control - Electronic differential lock - Engine drag torque control - Trailer stabilization)
- Pedestrian protection measures expanded
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- Rear spoiler
- "Climatronic" air conditioning system (with active combination filter)
- Front headrests (safety-optimized)
- LED taillights
- Steering wheel: Multifunction leather steering wheel with paddle shifters
- Front center armrest adjustable in height and length
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection (detects critical distance situations to other vehicles and helps to shorten the stopping distance - warns the driver visually and audibly in dangerous situations as well as with a preventive braking jolt with pedestrian and cyclist detection - also reacts to pedestrians and cyclists)
- Tire pressure monitoring system (passive)
- Wheels: Alloy wheels (4) "Norfolk" 7 J x 16 (tires 205/55 R 16)
- Rear bench seat undivided, backrest asymmetrically split and foldable with center armrest
- Electromechanical power steering (speed-dependent control)
- Seat belts: Three-point automatic seat belts for the outer rear seats
- Seat covers in fabric (seat center panels of the front seats and the outer rear seats in fabric)
- Seats: Front seats are height-adjustable
- Start-stop system (with brake energy recuperation)
- Bumpers in body color
- Illuminated door handle recesses



- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- 12-volt power outlet in the luggage compartment
- Telephone interface with inductive charging function
- Ambient lighting with logo projection
- Prepared for "We Connect" and "We Connect Plus"
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear

- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened seat belts front and rear
- Central locking without safe locking, with remote control and 2 remote folding keys

Extra equipment

- Paint finish: Metallic
- Package: Light and Sight Package incl. High Beam Control "Light Assist" (High Beam Control "Light Assist" - Automatically Dimming Interior Mirror - Multifunction Camera - Rain Sensor)
- Rear View reversing camera

- Package: "Business Premium" package including "Discover Media" navigation system (DSG) (6+1 speakers, App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto, Adaptive Cruise Control (ACC) stop & go with speed limiter, Travel, Lane Assist and Emergency Assist, Multifunction camera, Heated leather multifunction steering wheel with paddle shifters, Discover Media navigation system including streaming & internet, Heated windshield washer nozzles, Voice control, Comfort telephone interface, Textile floor mats front/rear, Heated front seats)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wing mirror - right side	Cap - Scratch(es) - Smart repair
2	Door - rear right side	Door handle - outside - Scratch(es) - Smart repair
3	Roof	Roof rail - left side - Scratch(es) - Smart repair
4	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
5	Side panel - rear right side	Side panel - Scratch(es) - Smart repair
6	Rear bumper	Rear bumper - Scratch(es) - Smart repair
7	Roof	Roof - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
2	2nd wheel set	2 tyres (Über 4mm) - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction
4	Bonnet	Bonnet - Dent / paintcoat damage - No deduction
5	2nd wheel set	2 tyres (Kein Teil der Ausstattung) - does not meet manufacturer specifications - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Die zusätzlichen Winterräder sind kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

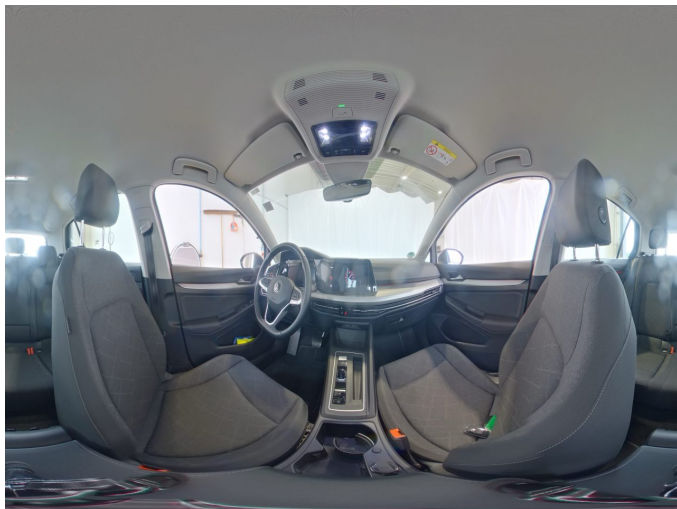


Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

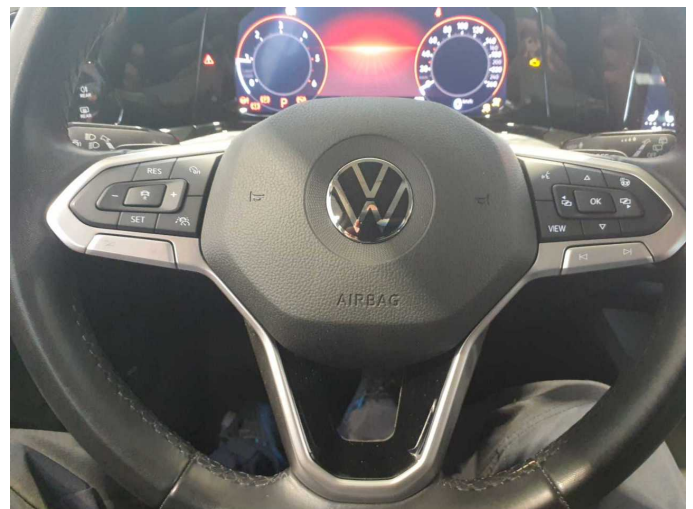


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

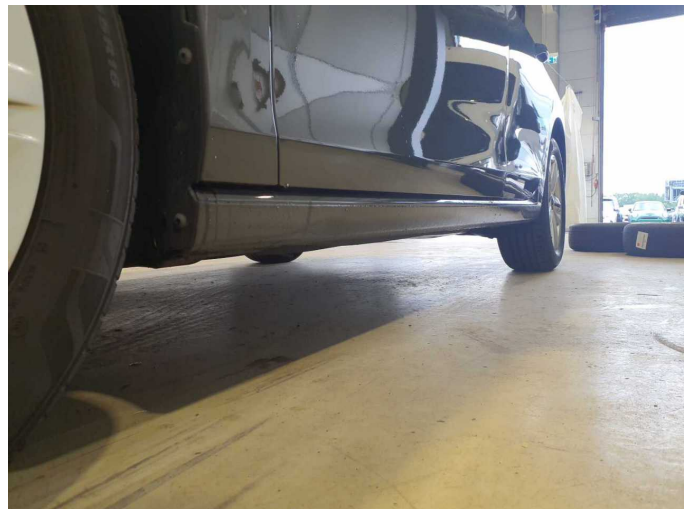


Figure 22: Misc.

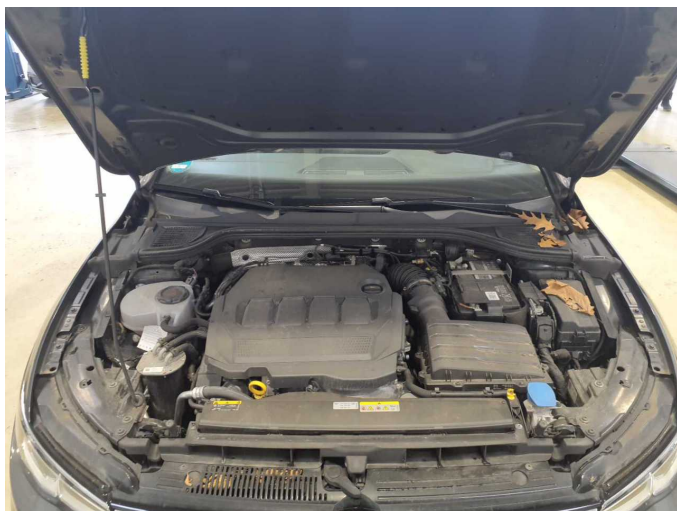


Figure 23: Misc.

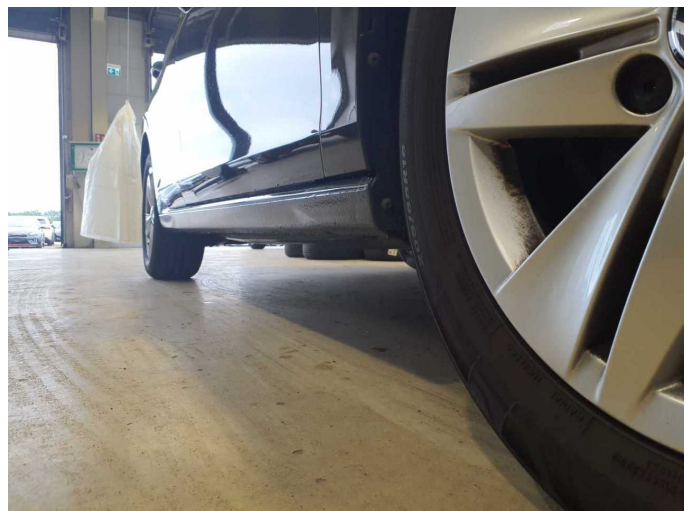


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 2: Door - rear right side: Door handle - outside - Scratch(es) - Smart repair




Damage 2: Door - rear right side: Door handle - outside - Scratch(es) - Smart repair



Damage 3: Roof: Roof rail - left side - Scratch(es) - Smart repair




Damage 3: Roof: Roof rail - left side - Scratch(es) - Smart repair

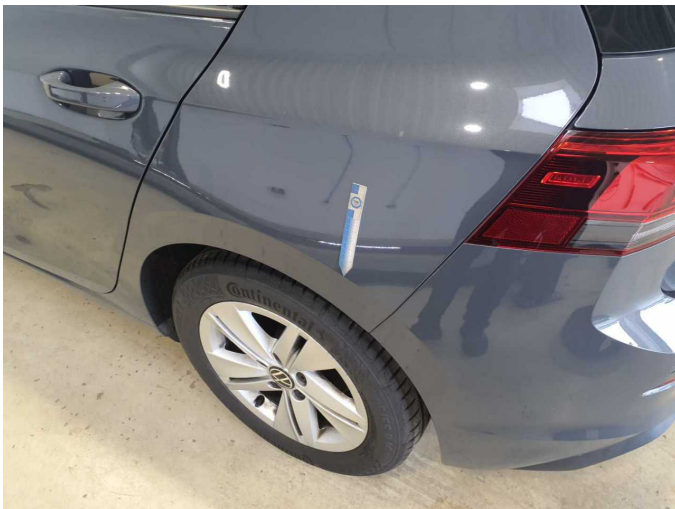


Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

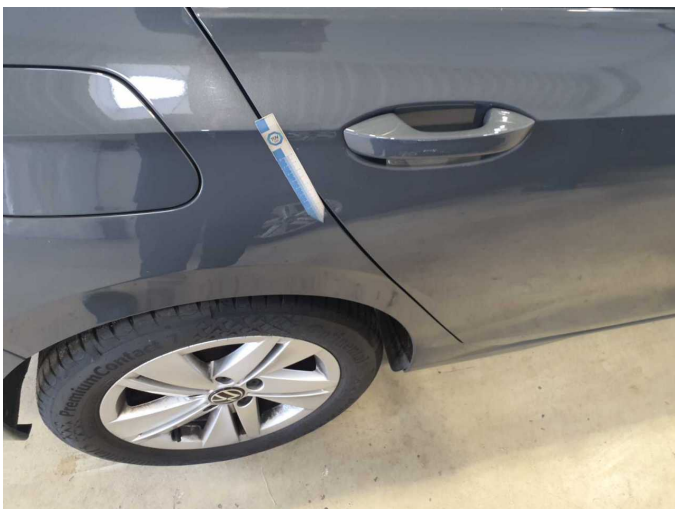

Damage 5: Side panel - rear right side: Side panel - Scratch(es) - Smart repair

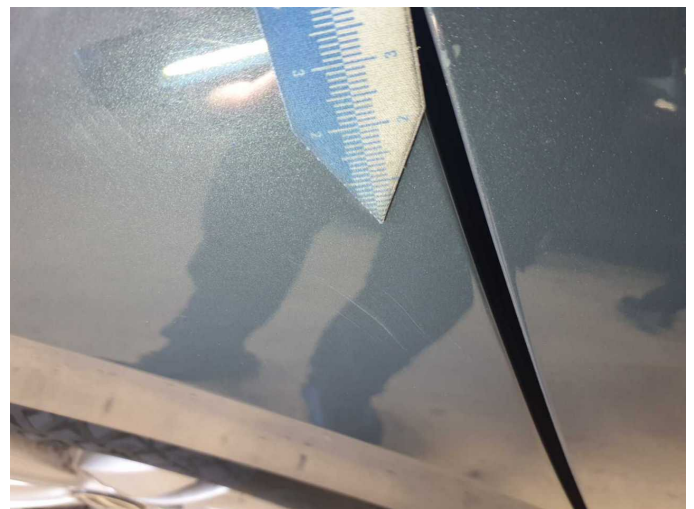

Damage 5: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 5: Side panel - rear right side: Side panel - Scratch(es) - Smart repair




Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair

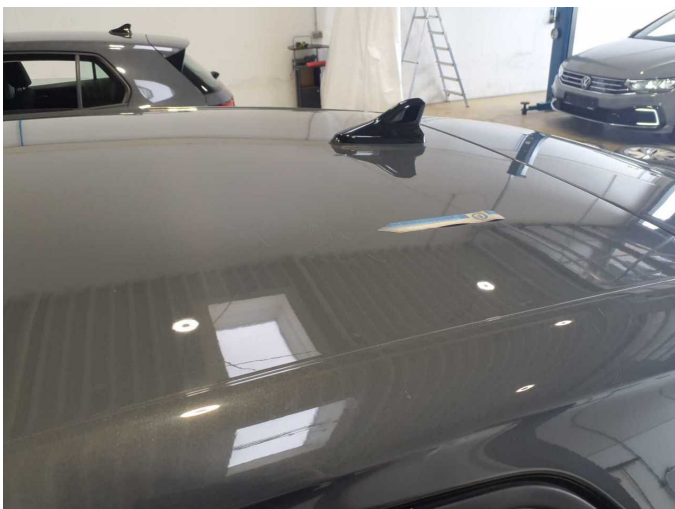

Damage 7: Roof: Roof - Scratch(es) - Paint



Damage 7: Roof: Roof - Scratch(es) - Paint



Damage 7: Roof: Roof - Scratch(es) - Paint



Wear and tear 5: 2nd wheel set: 2 tyres (Kein Teil der Ausstattung) - does not meet manufacturer specifications - No deduction



Wear and tear 5: 2nd wheel set: 2 tyres (Kein Teil der Ausstattung) - does not meet manufacturer specifications - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZCD1PW115200

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Golf 2.0 TDI SCR DSG Life

Datum	KM-Stand	Beschreibung
21.11.2025	69.907	AU
13.03.2025	57.384	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
09.12.2023	29.295	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges